MARYLAND DEPARTMENT OF TRANSPORTATION

STATE HIGHWAY ADMINISTRATION

Impervious Restoration and Coordinated Total Maximum Daily Load Implementation Plan

October 8, 2016 | Revised: October 9, 2018 | Revised October 9, 2019







MARYLAND DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

Larry Hogan
Governor
Boyd K. Rutherford
Lt. Governor
Pete K. Rahn
Secretary
Gregory Slater
Administrator

October 9, 2018

Mr. Stewart Comstock
Sediment, Stormwater and Dam Safety Program
Water and Science Administration
Maryland Department of the Environment
1800 Washington Boulevard, Suite 440
Baltimore, MD 21230

Dear Mr. Comstock:

The Maryland Department of Transportation State Highway Administration (MDOT SHA) is pleased to submit this Interim Review Draft of the MDOT SHA *Impervious Restoration and Coordinated TMDL Implementation Plan* (Implementation Plan) addressing conditions under the MDOT SHA NPDES MS4 permit (11-DP-3313 MD 0068276) which took effect on October 9, 2015.

The initial version of this Implementation Plan was submitted to MDE on October 8, 2016. Subsequently, there were several updates that were indicated by a revised footer date. Because the October 8, 2016 version has now been completely revised with the attached version, all pages in this Interim Review Draft are dated October 9, 2018.

This Interim Review Draft addresses MDE comments on the MDOT SHA MS4 annual reports for FY16 and FY17, and the initial October 8, 2016 Implementation Plan submittal. Please note that Part II of the plan is not included in the enclosed Interim Review Draft. Rather, Part II will be included once MDOT SHA receives MDE decision on the 6/29/2018 *MDOT SHA Final Impervious Baseline Assessment*. At that point the revised Implementation Plan will be finalized and submitted to MDE as the latest Implementation Plan.

If you have any questions or need additional information regarding this delivery, please contact Mr. Travis Vance at 410-545-8623 (or via email at tvance@sha.state.md.us) or me at 410-545-8407 (or via email at kcoffman@sha.state.md.us).

Sincerely,

Karen Coffman, Chief
MDOT SHA OED Water Programs Division

Enclosure

Cc: Mr. Brian Cooper, MDE WSA SSDSP
Ms. Sonal Ram, Director, MDOT SHA OED
Mr. Kevin P. Wilsey, Deputy Director, MDOT SHA OED
Mr. Travis Vance, MDOT SHA OED WPD

TABLE OF CONTENTS

Table of Contents i
List of Tables vi
List of Figures x

I. Program Introduction 1-1
A. Purpose 1-1
B. Scope 1-2
C. Background 1-2
C.1. Surface Water Quality Standards 1-2
C.2. Chesapeake Bay TMDL Requirements 1-2
C.3. Local Watershed TMDL Requirements 1-3
D. MDOT SHA MS4 Permit Requirements 1-8
E. Project Implementation Methodologies 1-10
E.1. Regulatory Guidance and Permitting 1-10
E.2. Urban Sector Focus 1-12
E.3. Watershed Focus 1-12
E.4. Partnerships 1-13
E.5. Redevelopment Credit 1-13
E.6. Existing Grass Channel Inventory 1-13
E.7. Nutrient Credit Trading Program 1-14
E.8. Research 1-15
E.9. Program Funding 1-15
F. Restoration Practice Descriptions 1-15
F.1. Design, Inspection & Maintenance Standards 1-15
F.2. Alternative Practices 1-16
F.3. Categories of Practices 1-16
F.4. Structural Stormwater Controls 1-17
F.5. Land Use Changes 1-21
F.6. Environmental Restoration 1-23
F.7. Source Controls 1-26

II. Impervious Restoration Plan & Chesapeake Bay TDML Compliance 2-1
A. Urbanization and Impervious Surface Restoration 2-1
B. Impervious Area Assessment 2-3
B.1. Impervious Surface Inventory 2-3
B.2. Baseline Runoff Treatment Assessment 2-4
C. Impervious Restoration Plan 2-6
C.1. MEP Treatment Standard 2-6
C.2. Restoration Treatment Strategy 2-6
C.3. Restoration Viewer 2-7
D. Schedule and Funding 2-10
E. Comprehensive List of Restoration Practices 2-11

III. Coordinated TMDL Implementation Plan 3-1
A. Water Quality Standards and Designated Uses 3-1
B. Watershed Assessment Coordination 3-3
C. Visual Inspections Targeting MDOT SHA ROW and Restoration Site Searches 3-5
C.1. Visual Inspections 3-5
C.2. Site Searches 3-5
D. Benchmarks and Detailed Costs 3-10
E. Pollution Reduction Strategies 3-11
E.1. MDOT SHA TMDL Responsibilities 3-11

E.2. Nutrient and Sediment Implementation Plan..... 3-25
E.2.a. Nutrient and Sediment TMDLs with MDOT SHA Responsibility..... 3-25
E.2.b. Nutrient and Sediment Sources. 3-27
E.2.c. MDOT SHA Nutrient and Sediment Reduction Strategies 3-27
E.3. Polychlorinated Biphenyls (PCBs) Implementation Plan..... 3-32
E.3.a. PCB TMDLs Affecting MDOT SHA 3-32
E.3.b. PCB Sources 3-33
E.3.c. Proposed No-Action for Certain Watersheds3-34
E.3.d. PCB Reduction Strategies 3-35
E.4. Trash Implementation Plan 3-37
E.4.a. Trash TMDLs Affecting MDOT SHA..... 3-37
E.4.b. Trash Sources and Loading Rates..... 3-38
E.4.c. Baseline Trash Reduction..... 3-39
E.4.d. Enhanced Trash Reduction..... 3-39
E.5. Bacteria Implementation Plan 3-42
E.5.a. Bacteria TMDLs Affecting MDOT SHA..... 3-42
E.5.b. Bacteria Sources 3-42
E.5.c. Bacteria Reduction Strategies..... 3-44

IV. MDOT SHA Watershed TMDL Implementation Plans..... 4-1
A. Anacostia River Watershed..... 4-1
A.1. Watershed Description 4-1
A.2. MDOT SHA TMDLs within Anacostia Watershed..... 4-1
A.3. MDOT SHA Visual Inventory of ROW 4-1
A.4. Summary of County Assessment Review 4-4
A.5. MDOT SHA Pollution Reduction Strategies 4-6
B. Antietam Creek Watershed.....4-11
B.1. Watershed Description.....4-11
B.2. MDOT SHA TMDLs in Antietam Creek Watershed...4-11
B.3. MDOT SHA Visual Inventory of ROW..... 4-11
B.4. Summary of County Assessment Review 4-14
B.5. MDOT SHA Pollutant Reduction Strategies 4-15
C. Back River Watershed.....4-19
C.1. Watershed Description.....4-19
C.2. MDOT SHA TMDLs within Back River Watershed....4-19
C.3. MDOT SHA Visual Inventory of ROW..... 4-19
C.4. County Assessment Review Summary 4-22
C.5. MDOT SHA Pollutant Reduction Strategies 4-24
D. Baltimore Harbor Watershed 4-27
D.1. Watershed Description.....4-27
D.2. MDOT SHA TMDLs within Baltimore Harbor Watershed 4-27
D.3. MDOT SHA Visual Inventory of ROW..... 4-27
D.4. Summary of County Assessment Review 4-30
D.5. MDOT SHA Pollutant Reduction Strategies 4-32
E. Bush River Segmentshed.....4-36
E.1. Segmentshed Description 4-36
E.2. MDOT SHA TMDLs within Bush River Segmentshed 4-36
E.3. MDOT SHA Visual Inventory of ROW..... 4-36
E.4. Summary of County Assessment Review 4-39
E.5. MDOT SHA Pollutant Reduction Strategies 4-43
F. Bynum Run Watershed 4-46
F.1. Watershed Description.....4-46

F.2. MDOT SHA TMDLs within Bynum Run Watershed...4-46
F.3. MDOT SHA Visual Inventory of ROW 4-46
F.4. Summary of County Assessment Review 4-49
F.5. MDOT SHA Pollutant Reduction Strategies 4-51
G. Cabin John Creek Watershed 4-54
G.1. Watershed Description 4-54
G.2. MDOT SHA TMDLs within Cabin John Creek Watershed 4-54
G.3. MDOT SHA Visual Inventory of ROW 4-54
G.4. Summary of County Assessment Review 4-57
G.5. MDOT SHA Pollutant Reduction Strategies 4-58
H. Catoctin Creek Watershed 4-61
H.1. Watershed Description 4-61
H.2. MDOT SHA TMDLs in Catoctin Creek Watershed ... 4-61
H.3. MDOT SHA Visual Inventory of ROW 4-61
H.4. Summary of County Assessment Review 4-64
H.5. MDOT SHA Pollutant Reduction Strategies 4-65
I. Conococheague Creek Watershed..... 4-69
I.1. Watershed Description 4-69
I.2. MDOT SHA TMDLs within Conococheague Creek .. 4-69
I.3. MDOT SHA Visual Inventory of ROW 4-69
I.4. Summary of County Assessment Review 4-72
I.5. MDOT SHA Pollutant Reduction Strategies 4-72
J. Double Pipe Creek Watershed 4-76
J.1. Watershed Description 4-76
J.2. MDOT SHA TMDLs within Double Pipe Creek..... 4-76
J.3. MDOT SHA Visual Inventory of ROW 4-76
J.4. Summary of County Assessment Review 4-79
J.5. MDOT SHA Pollutant Reduction Strategies 4-80
K. Gunpowder River & Bird River Subsegments.....4-84
K.1. Subsegments Description 4-84
K.2. MDOT SHA TMDLs in Gunpowder River & Bird River Subsegments.....4-84
K.3. MDOT SHA Visual Inventory of ROW..... 4-84
K.4. Summary of County Assessment Review 4-87
K.5. MDOT SHA Pollutant Reduction Strategies.....4-91
L. Gwynns Falls Watershed.....4-94
L.1. Watershed Description.....4-94
L.2. MDOT SHA TMDLs in Gwynns Falls Watershed.....4-94
L.3. MDOT SHA Visual Inventory of ROW..... 4-94
L.4. Summary of County Assessment Review 4-97
L.5. MDOT SHA Pollutant Reduction Strategies 4-99
M. Jones Falls Watershed 4-102
M.1. Watershed Description.....4-102
M 2. MDOT SHA TMDLs within Jones Falls Watershed 4-102
M.3. MDOT SHA Visual Inventory of ROW..... 4-102
M.4. Summary of County Assessment Review 4-105
M.5. MDOT SHA Pollutant Reduction Strategies 4-107
N. Liberty Reservoir Watershed 4-111
N.1. Watershed Description.....4-111
N.2. MDOT SHA TMDLs in Liberty Reservoir Watershed 4-111
N.3. MDOT SHA Visual Inventory of ROW..... 4-111
N.4. Summary of County Assessment Review 4-114
N.5. MDOT SHA Pollutant Reduction Strategies 4-117
O. Little Patuxent River Watershed 4-120
O.1. Watershed Description.....4-120

O.2. MDOT SHA TMDLs within Little Patuxent River Watershed 4-120
O.3. MDOT SHA Visual Inventory of ROW 4-120
O.4. Summary of County Assessment Review 4-123
O.5. MDOT SHA Pollutant Reduction Strategies 4-126
P. Loch Raven Reservoir Watershed 4-129
P.1. Watershed Description 4-129
P.2. MDOT SHA TMDLs within Loch Raven Reservoir Watershed 4-129
P.3. MDOT SHA Visual Inventory of ROW 4-129
P.4. Summary of County Assessment Review 4-132
P.5. MDOT SHA Pollutant Reduction Strategies 4-134
Q. Lower Gunpowder Falls Watershed 4-136
Q.1. Watershed Description 4-136
Q.2. MDOT SHA TMDLs within Lower Gunpowder Falls Watershed 4-136
Q.3. MDOT SHA Visual Inventory of ROW 4-138
Q.4. Summary of County Assessment Review 4-139
Q.5. MDOT SHA Pollutant Reduction Strategies 4-148
R. Lower Monocacy River Watershed 4-151
R.1. Watershed Description 4-151
R.2. MDOT SHA TMDLs within Lower Monocacy River Watershed 4-151
R.3. MDOT SHA Visual Inventory of ROW 4-151
R.4. Summary of County Assessment Review 4-154
R.5. MDOT SHA Pollutant Reduction Strategies 4-155
S. Patapsco River Lower North Branch Watershed 4-160
S.1. Watershed Description 4-160
S.2. MDOT SHA TMDLs within Patapsco River Lower North Branch Watershed 4-160
S.3. MDOT SHA Visual Inventory of ROW 4-160
S.4. Summary of County Assessment Review 4-163
S.5. MDOT SHA Pollutant Reduction Strategies 4-165
T. Patuxent River Segmentsheds 4-169
T.1. Segmentsheds Description 4-169
T.2. MDOT SHA TMDLs within Patuxent Tidal Fresh Segmentshed 4-170
T.3. MDOT SHA Visual Inventory of ROW 4-173
T.4. Summary of County Assessment Review 4-175
T.5. MDOT SHA Pollutant Reduction Strategies 4-188
U. Patuxent River Upper Watershed 4-191
U.1. Watershed Description 4-191
U.2. MDOT SHA TMDLs within Patuxent River Upper Watershed 4-191
U.3. MDOT SHA Visual Inventory of ROW 4-191
U.4. Summary of County Assessment Review 4-194
U.5. MDOT SHA Pollutant Reduction Strategies 4-195
V. Potomac River Montgomery County Watershed 4-199
V.1. Watershed Description 4-199
V.2. MDOT SHA TMDLs within Potomac River Montgomery County Watershed 4-199
V.3. MDOT SHA Visual Inventory of ROW 4-199
V.4. Summary of County Assessment Review 4-202
V.5. MDOT SHA Pollutant Reduction Strategies 4-203
W. Potomac River Upper Tidal Watershed 4-206
W.1. Watershed Description 4-206

W.2. MDOT SHA TMDLs within Potomac River Upper Tidal Watershed 4-206
W.3. Summary of County Assessment Review 4-208
W.4. MDOT SHA Visual Inventory of ROW 4-210
W.5. MDOT SHA Pollutant Reduction Strategies 4-212
X. Rock Creek Watershed 4-215
X.1. Watershed Description 4-215
X.2. MDOT SHA TMDLs in Rock Creek Watershed 4-215
X.3. MDOT SHA Visual Inventory of ROW 4-215
X.4. Summary of County Assessment Review 4-218
X.5. MDOT SHA Pollutant Reduction Strategies 4-219
Y. Seneca Creek Watershed 4-222
Y.1. Watershed Description 4-222
Y.2. MDOT SHA TMDLs in Seneca Creek Watershed .. 4-222
Y.3. MDOT SHA Visual Inventory of ROW 4-222
Y.4. Summary of County Assessment Review 4-225
Y.5. MDOT SHA Pollutant Reduction Strategies 4-226
Z. South River Watershed 4-229
Z.1. Watershed Description 4-229
Z 2. MDOT SHA TMDLs within South River Watershed 4-229
Z.3. MDOT SHA Visual Inventory of ROW 4-229
Z.4. Summary of County Assessment Review 4-232
Z.5. MDOT SHA Pollutant Reduction Strategies 4-234
AA. Swan Creek Watershed 4-237
AA.1. Watershed Description 4-237
AA.2. MDOT SHA TMDLs within Swan Creek Watershed 4-237
AA.3. MDOT SHA Visual Inventory of ROW 4-237
AA.4. Summary of County Assessment Review 4-240
AA.5. MDOT SHA Pollutant Reduction Strategies 4-242
AB. Upper Monocacy River Watershed 4-245
AB.1. Watershed Description 4-245
AB.2. MDOT SHA TMDLs within Upper Monocacy River Watershed 4-245
AB.3. MDOT SHA Visual Inventory of ROW 4-245
AB.4. Summary of County Assessment Review 4-248
AB.5. MDOT SHA Pollutant Reduction Strategies 4-250

Abbreviations A-1
References R-1

LIST OF TABLES

1-1 Maryland 8-Digit Watersheds with TMDLs and MDOT SHA Responsibility 1-5
2-1 Impervious Baseline Dates by County 2-3
2-1 a Percentage of Impervious Treatment by Fiscal Year & Funding Allocation, 2011-2021 2-10
2-2 a Fiscal Years 2010 - 2019 Capital Impervious Restoration Practices Constructed 2-11
2-2b Annual Operations and Redevelopment Impervious Restoration Practices… 2-116
2-2c Fiscal Year 2020 Capital Impervious Restoration Practices Planned 2-116
2-2d Fiscal Year 2021 Capital Impervious Restoration Planned 2-119
2-2e Planned 2020-2021 Annual Operations and Redevelopment Impervious Restoration Practices… 2-119
2-2f Total Planned Credit 2-120
3-1 Designated Uses in Maryland 3-1
3-2 MDOT SHA Nutrient, Sediment, PCB, Trash, and Bacteria Modeling Results 3-19
3-3 Nutrient and Sediment Sources from Various References 3-27
3-4 PCB Sources in Each TMDL 3-34
3-5 Summary of Anacostia River Watershed Baseline Loads and TMDL for MDOT SHA 3-38
3-6 Summary of PATMH Tidal Bay Segment Baseline Loads and TMDL for MDOT SHA 3-38
3-7 Anacostia River Baseline / Enhanced / Initiated Practices 3-39
3-8 PATMH Baseline / Enhanced / Initiated Practices 3-40
3-9 Summary of Trash Load Reduction Credits from BASMAA (2012) 3-40
3-10 Bacteria Sources 3-43
4-1 Montgomery County Preferred Trash Reduction Strategies and Efficiencies 4-5
4-2 Prince George's County Superfund Sites 4-6
4-3 Anacostia River NE Branch Restoration PCB BMP Implementation 4-7
4-4 Anacostia River NW Branch Restoration PCB BMP Implementation 4-7
4-5 Anacostia River Tidal Branch Restoration PCB BMP Implementation 4-8
4-6a Anacostia River Watershed Montgomery County Trash & Debris Activities Implementation 4-8
4-6 b Anacostia River Watershed Prince George's County Trash & Debris Activities Implementation 4-9
4-7 Anacostia River Restoration BMP Cost 4-9
4-8 Suggested BMPs in the Antietam Creek Watershed 4-14
4-9 Antietam Creek Restoration Phosphorus BMP Implementation 4-16
4-10 Antietam Creek Restoration Sediment BMP Implementation 4-16
4-11 Antietam Creek Restoration BMP Cost 4-17

4-12 Potential Stream Restoration Sites in Back River Watershed 4-24
4-13 Back River Restoration PCB BMP Implementation 4-25
4-14 Back River Restoration BMP Cost 4-25
4-15 Anne Arundel County Identified Priority Areas for Treatment 4-31
4-16 Baltimore Harbor Embayment Restoration PCB BMP Implementation 4-32
4-17 Bear Creek Restoration PCB BMP Implementation 4-33
4-18 Curtis Creek/Bay Restoration PCB BMP Implementation 4-33
4-19 Baltimore Harbor - Furnace Creek Restoration Bacteria BMP Implementation 4-33
4-20 Baltimore Harbor - Marley Creek Restoration Bacteria BMP Implementation 4-34
4-21 Baltimore Harbor Restoration BMP Cost 4-34
4-22 County Identified Priority Areas for Treatment in the Bush River Segmentshed 4-41
4-23 County Suggested BMPs for the Bush River Segmentshed 4-42
4-24 Bush River Segmentshed Restoration PCB BMP Implementation 4-44
4-25 Bush River Segmentshed Restoration BMP Cost 4-44
4-26 Declaration Run Priority Restoration Stream Restoration Projects 4-50
4-27 Declaration Run Priority Restoration Structural Projects 4-51
4-28 Declaration Run Priority Restoration Non-Structural Projects 4-51
4-29 Bynum Run Restoration Sediment BMP Implementation 4-52
4-30 Bynum Run Restoration BMP Cost 4-52
4-31 Cabin John Creek Restoration Sediment BMP Implementation 4-58
4-32 Cabin John Creek Restoration BMP Cost 4-59
4-33 Catoctin Creek Restoration Phosphorus BMP Implementation. 4-66
4-34 Catoctin Creek Restoration Sediment BMP Implementation. 4-67
4-35 Catoctin Creek Restoration BMP Cost 4-67
4-36 Conococheague Creek Restoration Sediment BMP Implementation 4-73
4-37 Conococheague Creek Restoration BMP Cost 4-74
4-38 Double Pipe Creek Restoration Phosphorus BMP Implementation 4-81
4-39 Double Pipe Creek Restoration Sediment BMP Implementation 4-81
4-40 Double Pipe Creek Restoration BMP Cost 4-82
4-41 County Identified Priority Areas for Treatment in the Bird River Watershed 4-88
4-42 County Identified Priority Areas for Protection in the Bird River Watershed 4-89
4-43 County Suggested BMPs for the Bird River Watershed 4-90
4-44 County Suggested BMPs for Subwatersheds within the Bird River Watershed 4-91
4-45 Bird River PCB BMP Implementation 4-92
4-46 Bird River Restoration BMP Cost 4-92

4-47 County Identified Potential Stream Restoration Sites in Gwynns Falls Watershed 4-98
4-48 Gwynns Falls Restoration Sediment BMP Implementation ... 4-99
4-49 Patapsco-Gwynns Falls Trash & Debris Activities Implementation 4-100
4-50 Gwynns Falls Restoration BMP Cost 4-100
4-51 County Identified Potential Stream Restoration Sites in Jones Falls Watershed 4-106
4-52 Jones Falls Restoration Sediment BMP Implementation..... 4-107
4-53 Lake Roland Restoration PCB BMP Implementation 4-108
4-54 Patapsco-Jones Falls Trash & Debris Activities Implementation 4-108
4-55 Jones Falls Restoration BMP Cost 4-109
4-56 Potential Stream Restoration Sites in Liberty Reservoir, Baltimore County..... 4-115
4-57 Liberty Reservoir Restoration Phosphorus and Sediment BMP Implementation 4-118
4-58 Liberty Reservoir Restoration BMP Cost 4-118
4-59 Anne Arundel County High Priority Stream Restoration Projects in Little Patuxent Watershed..... 4-125
4-60 Little Patuxent River Restoration Sediment BMP Implementation 4-127
4-61 Little Patuxent River Restoration BMP Cost..... 4-127
4-62 Potential Stream Restoration Sites in Loch Raven Reservoir Watershed..... 4-133
4-63 Loch Raven Reservoir Restoration Bacteria BMP Implementation 4-134
4-64 Loch Raven Reservoir Restoration BMP Cost 4-134
4-65 County Identified Priority Areas for Restoration and Protection within the Lower Gunpowder Falls Watershed - Rural (Area Q) 4-143
4-66 County Suggested BMPs for Subwatersheds within the Lower Gunpowder Falls Watershed - Rural (Area Q).....4-144
4-67 County Identified Priority Areas for Restoration and Protection within the Lower Gunpowder Falls Watershed - Urban (Area N) 4-147
4-68 County Suggested BMPs for Subwatersheds within the Lower Gunpowder Falls Watershed - Urban (Area N)..... 4-148
4-69 Lower Gunpowder Falls Sediment BMP Implementation 4-149
4-70 Lower Gunpowder Falls Restoration BMP Cost 4-149
4-71 Lower Monocacy River Restoration Phosphorus BMP Implementation.....4-156
4-72 Lower Monocacy River Restoration Sediment BMP Implementation.....4-157
4-73 Lower Monocacy River Restoration Phosphorus BMP Cost 4-157
4-74 Lower Monocacy River Restoration Sediment BMP Cost....4-158
4-75 Number of Projects by Type Developed for Concept Plans in Howard County's Portion of the Patapsco River Lower North Branch Watershed.....4-164
4-76 Patapsco River Lower North Branch Restoration Bacteria BMP Implementation.....4-166
4-77 Patapsco River Lower North Branch Restoration Sediment BMP Implementation.....4-166
4-78 Patapsco River Lower North Branch Restoration BMP Cost 4-167

4-79 Howard County Suggested BMPs within the Howard County Portions of the PAXTF 4-180
4-80 PAXTF PCB BMP Implementation 4-189
4-81 PAXTF Restoration BMP Cost 4-189
4-82 Patuxent River Upper Restoration Bacteria BMP Implementation 4-196
4-83 Patuxent River Upper Restoration Sediment BMP Implementation 4-197
4-84 Patuxent River Upper Restoration BMP Cost 4-197
4-85 Potomac River Montgomery County Restoration Sediment BMP Implementation 4-204
4-86 Potomac River Montgomery County Restoration BMP Cost 4-204
4-87 Potomac River Upper Tidal PCB BMP Implementation 4-213
4-88 Potomac River Upper Tidal Restoration BMP Cost 4-213
4-89 Rock Creek Restoration Phosphorus BMP Implementation 4-219
4-90 Rock Creek Restoration Sediment BMP Implementation 4-220
4-91 Rock Creek Restoration BMP Cost 4-220
4-92 Seneca Creek Restoration Sediment BMP Implementation 4-227
4-93 Seneca Creek Restoration BMP Cost 4-227
4-94 South River Restoration Sediment BMP Implementation 4-234
4-95 South River Restoration BMP Cost 4-235
4-96 County Identified Fish Blockages / Removal Opportunities in the Swan Creek Watershed 4-241
4-97 Swan Creek Restoration Sediment BMP Implementation 4-243
4-98 Swan Creek Restoration BMP Cost 4-243
4-99 Upper Monocacy Stream Corridor Assessment Survey Restoration Site Recommendations 4-249
4-100 Upper Monocacy River Restoration Phosphorus BMP Implementation 4-251
4-101 Upper Monocacy River Restoration Sediment BMP Implementation 4-251
4-102 Upper Monocacy River Restoration BMP Cost 4-252

LIST OF FIGURES

1-1 MDOT SHA MS4 Phase I Permit Coverage Area 1-1
1-2 Chesapeake Bay Watershed 1-3
1-3 Watersheds with MDOT SHA TMDL Wasteload Reduction Requirements 1-4
1-4 Existing Grass Channel along Median of I-70 in Baltimore County 1-14
1-5 Proposed Maryland Trading Regions 1-15
1-6 Grass Swale Example along MD 220 in Washington County 1-17
1-7 Bioswale during construction along MD 214 in Prince George's County 1-18
1-8 Submerged Gravel Wetland in Silver Spring, Montgomery County, MD 1-19
1-9 Surface Sand Filter along MD 355 in Montgomery County .. 1-19
1-10 Bioretention Facility at MD 139 in Baltimore County 1-20
1-11 Infiltration Trench along US 113 in Worcester County 1-21
1-12 Wet Pond along US 113 in Worcester County 1-21
1-13 Before and After Image of a Concrete Ditch Lining Removal along I-70 in Washington County 1-22
1-14 MDOT SHA Tree Planting Site at Perring Parkway and I-695 in Baltimore County 1-23
1-15 MDOT SHA Tree Planting Site along US 15 in Frederick County 1-23
1-16 MDOT SHA Stream Restoration Project at MD 139 Before, During, and After Construction 1-24
1-17 Example Step Pool System at Avalon State Park after Construction 1-24
1-18 MD 210 Outfall Before and After Stabilization in Anne Arundel County 1-25
1-19 Typical MDOT SHA Mechanical Street Sweeper 1-26
1-20 Inlet Catch Basin Cleaning Before and After 1-26
1-21 Example of Streams with and without Cattle Fencing 1-29
1-22 Pet Waste Disposal Station at the I-70 Eastbound Rest Area and Welcome Center 1-30
1-23 Outfall Trash Sock 1-30
2-1 Effects of Imperviousness on Runoff and Infiltration 2-1
2-2 MDOT SHA Typical Impervious Surfaces 2-1
2-3 GIS Analysis of Impervious Accounting Categories 2-5
2-4 Cumulative Restoration Plan by FY with Practice Menu 2-8
2-5 Percent of Restoration Treatment Accomplished by Practice Type 2-9
3-1 Maryland 8-digit Watershed Example 3-3
3-2 Chesapeake Bay 92 Segments 3-4
3-3 Example 1.5-Mile Grid System for Anacostia River Watershed 3-7
3-4 Anacostia River Grid Site Search Detail 3-7
3-5 Example Field Investigation Summary Map 3-8
3-6 Example Wasteload Allocation and Reduction Requirement 3-11

3-7A Watersheds with MDOT SHA Phosphorus TMDLs 3-13
3-7B Watersheds with MDOT SHA Sediment TMDLs 3-14
3-7C Watersheds with MDOT SHA Polychlorinated Biphenyl (PCB) TMDLs 3-15
3-7D Watersheds with MDOT SHA Trash TMDLs 3-16
3-7E Watersheds with MDOT SHA Bacteria TMDLs 3-17
3-8 Phosphorus WLA Reductions by Watershed with BMP Menu 3-29
3-9 Sediment WLA Reductions by Watershed with BMP Menu 3-30
3-10 Trash TMDL Baseline and WLAs 3-37
4-1 Anacostia River Watershed 4-3
4-2 Anacostia Site Search Grids 4-4
4-3 MDOT SHA Restoration Strategies within the Anacostia River Watershed 4-10
4-4 Antietam Creek Watershed 4-12
4-5 Antietam Creek Site Search Grids 4-13
4-6 MDOT SHA Restoration Strategies within the Antietam Creek Watershed 4-18
4-7 Back River Watershed 4-21
4-8 Back River Site Search Grids 4-22
4-9 MDOT SHA Restoration Strategies within the Back River Watershed 4-26
4-10 Baltimore Harbor Watershed 4-29
4-11 Baltimore Harbor Site Search Grids 4-30
4-12 MDOT SHA Restoration Strategies within the Baltimore Harbor Watershed 4-35
4-13 Bush River Segmentshed 4-38
4-14 Bush River Segmentshed Site Search Grids 4-39
4-15 MDOT SHA Restoration Strategies within the Bush River Segmentshed 4-45
4-16 Bynum Run Watershed 4-48
4-17 Bynum Run Site Search Grids 4-49
4-18 MDOT SHA Restoration Strategies within the Bynum Run Watershed 4-53
4-19 Cabin John Creek Watershed 4-56
4-20 Cabin John Creek Site Search Grids 4-57
4-21 MDOT SHA Restoration Strategies within the Cabin John Creek Watershed 4-60
4-22 Catoctin Creek Watershed 4-63
4-23 Catoctin Creek Site Search Grids 4-64
4-24 MDOT SHA Restoration Strategies within the Catoctin Creek Watershed 4-68
4-25 Conococheague Creek Watershed 4-71
4-26 Conococheague Creek Site Search Grids 4-72
4-27 MDOT SHA Restoration Strategies within the Conococheague Creek Watershed 4-75
4-28 Double Pipe Creek Watershed 4-78
4-29 Double Pipe Creek Site Search Grids 4-79
4-30 MDOT SHA Restoration Strategies within the Double Pipe Creek Watershed 4-83

4-31 Gunpowder River & Bird River Subsegments of Gunpowder River Oligohaline Segmentshed 4-86
4-32 Gunpowder River & Bird River Subsegments Site Search Grids 4-87
4-33 MDOT SHA Restoration Strategies within the Gunpowder River & Bird River Subsegments 4-93
4-34 Gwynns Falls Watershed 4-96
4-35 Gwynns Falls Site Search Grids 4-97
4-36 MDOT SHA Restoration Strategies within the Gwynns Falls Watershed 4-101
4-37 Jones Falls Watershed 4-104
4-38 Jones Falls Site Search Grids 4-105
4-39 MDOT SHA Restoration Strategies within the Jones Falls Watershed 4-110
4-40 Liberty Reservoir Watershed 4-113
4-41 Liberty Reservoir Site Search Grids 4-114
4-42 MDOT SHA Restoration Strategies within the Liberty Reservoir Watershed 4-119
4-43 Little Patuxent River Watershed 4-122
4-44 Little Patuxent River Site Search Grids 4-123
4-45 MDOT SHA Restoration Strategies within the Little Patuxent River Watershed 4-128
4-46 Loch Raven Reservoir Watershed 4-131
4-47 Loch Raven Reservoir Site Search Grids 4-132
4-48 MDOT SHA Restoration Strategies within the Loch Raven Reservoir Watershed 4-135
4-49 Lower Gunpowder Falls Watershed 4-137
4-50 Lower Gunpowder Falls Site Search Grids 4-139
4-51 MDOT SHA Restoration Strategies within the Lower Gunpowder Falls Watershed 4-150
4-52 Lower Monocacy River Watershed 4-153
4-53 Lower Monocacy River Site Search Grids 4-154
4-54 MDOT SHA Restoration Strategies within the Lower Monocacy River Watershed 4-159
4-55 Patapsco River Lower North Branch Watershed 4-162
4-56 Patapsco River Lower North Branch Site Search Grids 4-163
4-57 MDOT SHA Restoration Strategies within the Patapsco River Lower North Branch Watershed 4-168
4-58 PAXMH, PAXOH, and PAXTF Segmentsheds 4-171
4-59 PAXTF Segmentshed 4-172
4-60 PAXMH, PAXOH, and PAXTF Segmentsheds Site Search Grids 4-174
4-61 MDOT SHA Programmed Restoration Strategies within the PAXTF Segmentshed 4-190
4-62 Patuxent River Upper Watershed 4-193
4-63 Patuxent River Upper Site Search Grids 4-194
4-64 MDOT SHA Restoration Strategies within the Patuxent River Upper Watershed 4-198
4-65 Potomac River Montgomery County Watershed 4-201
4-66 Potomac River Montgomery County Site Search Grids 4-202
4-67 MDOT SHA Restoration Strategies within the Potomac River Montgomery County Watershed 4-205
4-68 Potomac River Upper Tidal Watershed 4-207

4-69 Potomac River Upper Tidal Site Search Grids 4-211
4-70 MDOT SHA Programmed Restoration Strategies within the Potomac River Upper Tidal Watershed 4-214
4-71 Rock Creek Watershed 4-217
4-72 Rock Creek Site Search Grids 4-218
4-73 MDOT SHA Restoration Strategies within the Rock Creek Watershed 4-221
4-74 Seneca Creek Watershed 4-224
4-75 Seneca Creek Site Search Grids 4-225
4-76 MDOT SHA Restoration Strategies within the Seneca Creek Watershed 4-228
4-77 South River Watershed 4-231
4-78 South River Site Search Grids 4-232
4-79 MDOT SHA Programmed Restoration Strategies within the South River Watershed 4-236
4-80 Swan Creek Watershed 4-239
4-81 Swan Creek Site Search Grids 4-240
4-82 MDOT SHA Restoration Strategies within the Swan Creek Watershed 4-244
4-83 Upper Monocacy River Watershed 4-247
4-84 Upper Monocacy River Site Search Grids 4-248
4-85 MDOT SHA Restoration Strategies within the Upper Monocacy River Watershed 4-253

THIS PAGE INTENTIONALLY LEFT BLANK


MARYLAND DEPARTMENT OF TRANSPORTATION

STATE HIGHWAY ADMINISTRATION

Part I
Program Introduction





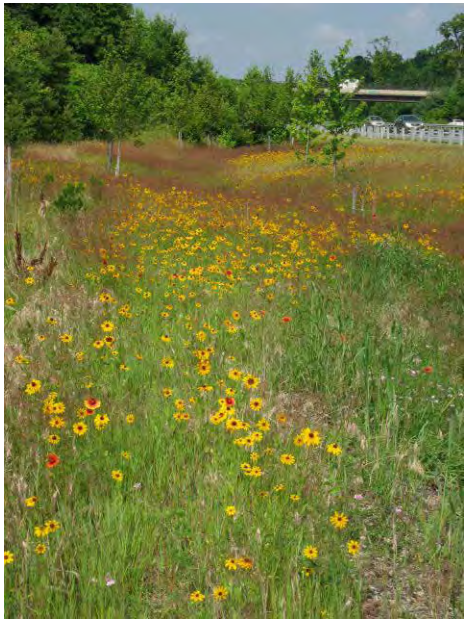

I. PROGRAM INTRODUCTION

A. PURPOSE

The Maryland Department of the Environment (MDE) issues discharge permits under the National Pollutant Discharge Elimination System (NPDES) to regulate urban stormwater runoff and minimize pollutant discharges to streams, rivers, and the Chesapeake Bay. The Municipal Separate Storm Sewer System (MS4) Permit (MS4 Permit) is a discharge permit that is issued to jurisdictions of large to medium population densities that own and operate storm drain systems. The Maryland Department of Transportation State Highway Administration (MDOT SHA) is required to reduce pollutants to the maximum extent practicable (MEP) as a condition of the agency's MS4 Permit (11-DP-3313 MD0068276) that was issued on October 9, 2015.

This Implementation Plan is a required document under the MS4 Permit to establish MDOT SHA's commitment to ensure that pollutants in surface runoff draining from MDOT SHA roads and through our storm drain conveyances are minimized to meet targeted thresholds. Plans such as these play a significant role for Maryland's Chesapeake Bay Restoration program. This Implementation Plan is divided into four parts:

- **Part I, Program Introduction** provides an overview and introduction to the MDOT SHA MS4 Permit, water quality standards, Chesapeake Bay clean-up, project implementation methodologies, and brief descriptions of best management practices (BMPs);
- **Part II, Impervious Restoration and Chesapeake Bay TMDL Compliance** details the strategy, assessment, costs, and schedule to meet a 20 percent impervious surface restoration goal set in the MS4 Permit as a compliance measure to meet the Chesapeake Bay pollution "diet" or total maximum daily load (TMDL);
- **Part III, Coordinated TMDL Implementation Plan** discusses the TMDL development process in Maryland, MDOT SHA TMDL responsibilities and pollutant reductions, modeling results, and methods implemented by MDOT SHA to meet TMDL allocations; and
- **Part IV, MDOT SHA Watershed TMDL Implementation Plans** provides watershed-level detail of the Implementation Plan including summaries of county watershed assessments, visual assessments of MDOT SHA right-of-way, proposed BMPs, costs, and schedules for pollution reduction strategies in each impaired watershed that is addressed by an Environmental Protection Agency (EPA)-approved TMDL document.



Figure 1-1: MDOT SHA MS4 Phase I Permit Coverage Area

B. SCOPE

The MDOT SHA MS4 Permit regulates stormwater discharges from storm drain systems owned or operated by MDOT SHA in Anne Arundel, Baltimore, Carroll, Cecil, Charles, Frederick, Harford, Howard, Montgomery, Prince George's, and Washington counties and the City of Salisbury. **Figure 1-1** is a map of the MDOT SHA MS4 Permit coverage area. While Baltimore City is an MS4 jurisdiction within the State of Maryland, MDOT SHA does not own right-of-way, roadways, storm drain systems, or stormwater management (SWM) facilities within the city limits; therefore, Baltimore City is not included in the MDOT SHA MS4 Permit coverage area.

MDOT SHA also owns and maintains many maintenance shops and facilities that are regulated by the Maryland General Permit for Discharges from Stormwater Associated with Industrial Activities (12-SW) (MDE, 2014a). Activities and practices to comply with the 20 percent impervious restoration requirements for 12-SW industrial properties owned by MDOT SHA are included in implementation activities under the MS4 Permit. Therefore, MDOT SHA 12-SW maintenance shops and facilities located within the MDOT SHA MS4 coverage area are included in this Implementation Plan. Other 12-SW requirements are addressed and reported separately.

C. BACKGROUND

C.1. Surface Water Quality Standards

The Federal Water Pollution Control Act, commonly known as the Clean Water Act (CWA), requires the State to develop water quality standards (WQSs) for Maryland waters, to monitor water quality conditions relative to these standards, and to identify and document water bodies that do not meet WQSs. Results are reported every other year in MDE's Integrated Report (IR) of Surface Water Quality, which is submitted to the EPA (MDE, 2018). The IR includes water quality assessments and lists of impaired waterbodies (formally known as the "303(d) List").

TMDLs are a tool for implementing State WQSs, and they are based on the relationship between pollution sources and in-stream water quality conditions. A TMDL establishes the maximum amount of an impairing substance or stressor that a water body can assimilate and still meet WQSs. The TMDL allocates that load among several pollutant contributors. Contributors can include point sources, such as sewage treatment plants or regulated municipal storm sewers, and non-point sources such as runoff from agricultural land. The EPA approves TMDLs.

C.2. Chesapeake Bay TMDL Requirements

The Chesapeake Bay is a national treasure constituting the largest estuary in the United States and one of the largest and most biologically productive estuaries in the world. The Bay has a 64,000 square mile watershed (See **Figure 1-2**) that includes Maryland, Virginia, Pennsylvania, Delaware, West Virginia, New York, and the District of Columbia (DC). Pollution from surface stormwater runoff and other sources that discharge to the Bay has become a serious threat to the ecologic health of the Bay and prevents the attainment of State WQSs for dissolved oxygen (DO), water clarity, and chlorophyll. The pollutants that are largely responsible for impairing the Bay are sediment and the nutrients nitrogen and phosphorus.

In 2010, the EPA developed a nutrient and sediment pollution "diet" or TMDL for the Bay in coordination with the watershed States and DC. As a partner in this effort, MDE played a key role in the development of the Bay TMDL and the Maryland Watershed Implementation Plans (WIPs).

The TMDL and WIPs address impairments for tidal segments of the Bay by setting thresholds or allocations for nitrogen, phosphorus, and sediment. These allocations are split between several pollutant sources (also referred to as sectors) including agriculture, urban stormwater, septic, wastewater, and others.

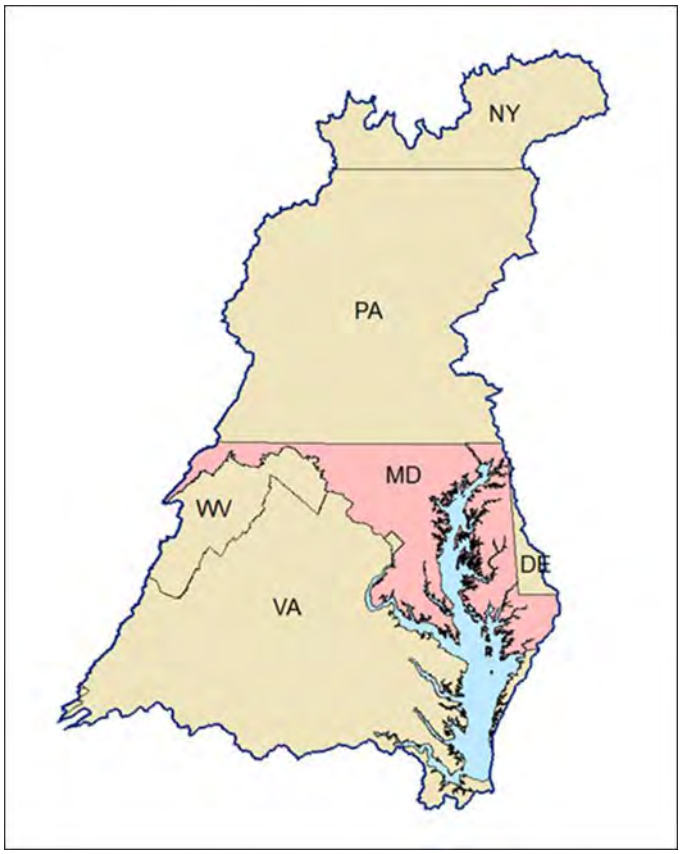


Figure 1-2: Chesapeake Bay Watershed

MDOT SHA is included within the urban stormwater sector, and Bay requirements for this sector are tied to the MS4 Permit through impervious restoration requirements, which are discussed below in **Section D, MS4 Permit Requirements** and in **Part II.A Urbanization and Impervious Surface Restoration** of this Plan.

EPA has instituted accountability measures to ensure clean-up commitments are met by each State, including short and long-term benchmarks, a tracking and accountability system for activities, and federal contingency actions that can be employed if necessary to promote progress. The Bay TMDL is designed to ensure that all pollution control measures needed to fully restore the Bay and its tidal rivers are in place by 2025, with at least 60 percent of the actions completed by 2017.

C.3. Local Watershed TMDL Requirements

In addition to the Bay TMDL, TMDLs are also developed for tidal and non-tidal waterways throughout Maryland. These 'local' TMDLs are also based on State WQSs, and approved by EPA. TMDLs are enforced through NPDES discharge permits, including MS4 permits. Because MDOT SHA is an MS4 permittee and designated a point source discharger, MDOT SHA is required to meet local wasteload allocations (WLAs) for EPA approved TMDLs. **Figure 1-3** and **Table 1-1** on the following pages display and list the current TMDLs for MDOT SHA compliance. The pollutants covered by these TMDLs include nutrients, sediment, bacteria, polychlorinated biphenyls (PCBs), and trash. MDOT SHA plans to meet local TMDLs are provided in **Part III, Coordinated TMDL Implementation Plan** and **Part IV, MDOT SHA Watershed TMDL Implementation Plans**.

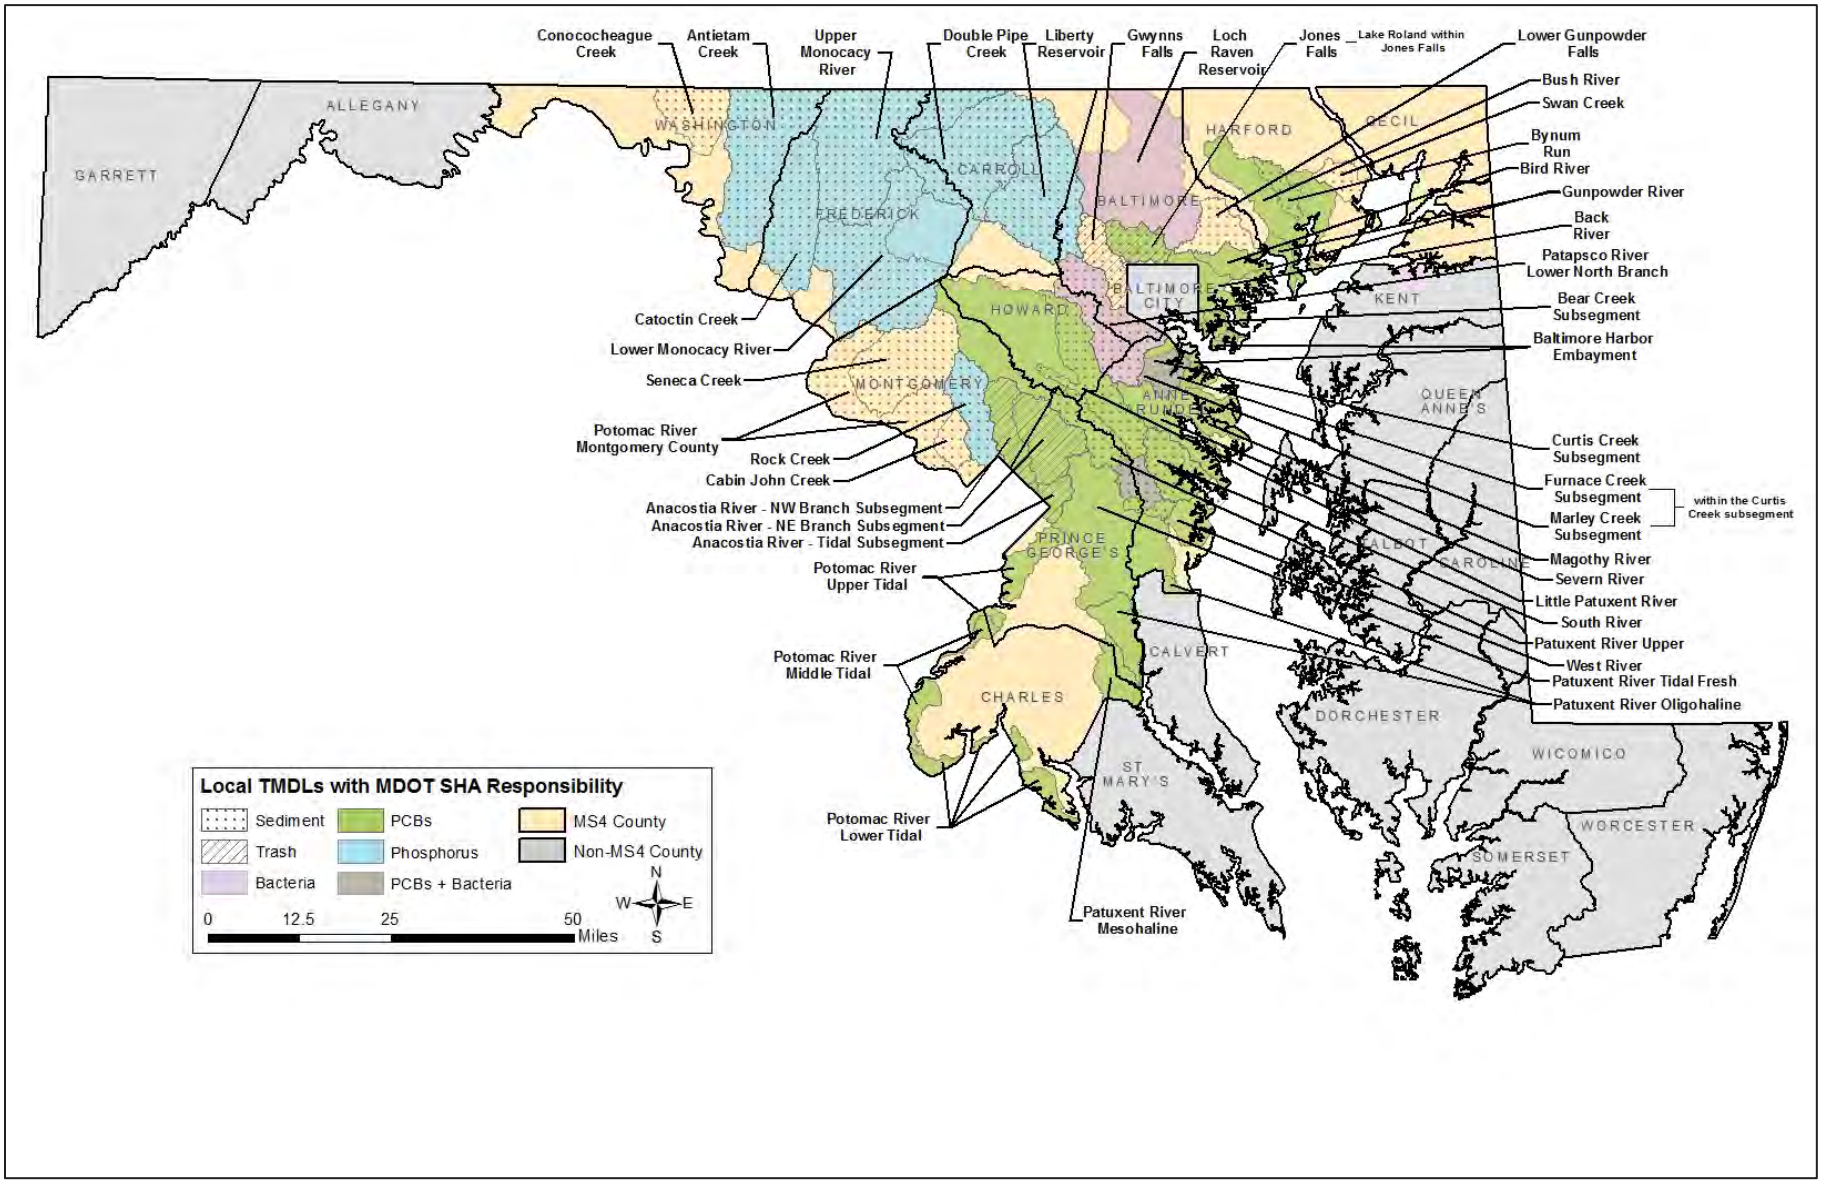


Figure 1-3: Watersheds with MDOT SHA TMDL Wasteload Reduction Requirements

Table 1-1: Maryland 8-Digit Watersheds with TMDLs and MDOT SHA Responsibility						
Watershed Name	**MD Basin Code/ Assessment Unit ID**	**Pollutant**				
		Bacteria	**PCBs**	**Phosphorus**	**Sediment**	**Trash**
Anacostia River	02140205		✓			✓
Antietam Creek	02140502			✓	✓	
Back River Oligohaline Tidal	MD-BACOH		✓			
Baltimore Harbor	02130903					
• **Baltimore Harbor**	02130903 - EMBAYMENT		✓			
• **Bear Creek Subwatershed**	02130903 MD-PATMH-BEAR-CREEK		✓			
• **Curtis Creek/Bay Subwatershed**	02130903 MD-PATMH-CURTIS_BAY_CREEK		✓			
• **Furnace Creek Subwatershed**	02130903 MD-PATMH-FURNACE_CREEK	✓				
• **Marley Creek Subwatershed**	02130903 MD-PATMH-MARLEY_CREEK	✓				
Bush River Oligohaline Segmentshed	MD-BSHOH-02130701		✓			
Bynum Run	02130704				✓	
Cabin John Creek	02140207				✓	
Catoctin Creek	02140305			✓	✓	
Conococheague Creek	02140504				✓	
Double Pipe Creek	02140304			✓	✓	

Table 1-1: Maryland 8-Digit Watersheds with TMDLs and MDOT SHA Responsibility						
Watershed Name	**MD Basin Code/ Assessment Unit ID**	**Pollutant**				
		Bacteria	**PCBs**	**Phosphorus**	**Sediment**	**Trash**
Gunpowder River Oligohaline Segmentshed	02130801, 02130803					
• **Gunpowder River**	02130801 MD-GUNOH		✓			
• **Bird River**	02130803 MD-GUNOH		✓			
Gwynns Falls	02130905				✓	✓
Jones Falls	02130904				✓	✓
• **Lake Roland Subwatershed**	MD-02130904-Lake_Roland		✓			
Liberty Reservoir	02130907			✓	✓	
Little Patuxent River	02131105				✓	
Loch Raven Reservoir	02130805	✓				
Lower Gunpowder Falls	02130802				✓	
Lower Monocacy River	02140302			✓	✓	
Magothy River	MD-MAGMH-02131001		✓			
Patapsco River LN Branch	02130906	✓			✓	
Patuxent River Tidal Segmentsheds	02131101, 02131102					
• **Patuxent Mesohaline**	02131101 PAXMH		✓			
• **Patuxent Oligohaline**	02131101 PAXOH		✓			
• **Patuxent Tidal Fresh**	02131102 PAXTF		✓			

Table 1-1: Maryland 8-Digit Watersheds with TMDLs and MDOT SHA Responsibility						
Watershed Name	**MD Basin Code/ Assessment Unit ID**	**Pollutant**				
		Bacteria	**PCBs**	**Phosphorus**	**Sediment**	**Trash**
Patuxent River Upper	02131104	✓			✓	
Potomac River MO County	02140202				✓	
Potomac River Lower Tidal	02140101		✓			
Potomac River Middle Tidal	02140102		✓			
Potomac River Upper Tidal	02140201		✓			
Rock Creek	02140206			✓	✓	
Seneca Creek	02140208				✓	
Severn River Mesohaline	MD-SEVMH-02131002		✓			
South River	02131003				✓	
South River Mesohaline	MD-SOUMH-02131003		✓			
Swan Creek	02130706				✓	
Upper Monocacy River	02140303			✓	✓	
West and Rhode Rivers Mesohaline	MD-WST-RHDMH-02131004		✓			
Note: See Table 3-2 for details on MDOT SHA WLAs, reduction requirements, and implementation plan modeling results.						

D. MDOT SHA MS4 PERMIT REQUIREMENTS

Requirements in the MDOT SHA MS4 Permit that pertain to this Implementation Plan are listed below and taken directly from Part IV.E. of the Permit:

Restoration Plans and Total Maximum Daily Loads (Permit Part IV.E.)

In compliance with §402(p)(3)(B)(iii) of the CWA, MS4 Permits must require stormwater controls to reduce the discharge of pollutants to the MEP. By regulation at 40 CFR §122.44, BMPs and programs implemented pursuant to this permit must be consistent with applicable WLAs developed under EPA approved TMDLs. In pursuit of these goals, SHA shall coordinate watershed assessments with surrounding jurisdictions and annually report on restoration plans, opportunities for public participation, and TMDL compliance status to MDE. As required below, watershed assessments and restoration plans shall include a thorough discussion of water quality analysis findings based on coordination with surrounding jurisdictions, TMDL documents and other resources when available, identification of water quality improvement opportunities, and a schedule for BMP and programmatic implementation to meet stormwater WLAs included in EPA approved TMDLs. SHA shall address both specific WLAs and target loads when SHA is part of larger aggregate loads. A list of EPA approved TMDLs for SHA in the permit area is included in Attachment B of the permit.

Watershed Assessments (Permit Part IV.E.1.)

SHA shall coordinate watershed assessments with surrounding jurisdictions, which shall include, but not be limited to the evaluation of available State and county watershed assessments, SHA data, visual watershed inspections targeting SHA ROW and facilities, and approved stormwater WLAs to:

- *Determine current water quality conditions;*
- *Include the results of visual inspections targeting SHA ROW and facilities conducted in areas identified as priority for restoration;*
- *Identify and rank water quality problems for restoration associated with SHA ROW and facilities;*
- *Achieve water quality goals by identifying all structural and nonstructural water quality improvement projects to be implemented using the watershed assessments established; and*
- *Specify pollutant load reduction benchmarks and deadlines that demonstrate progress toward meeting all applicable stormwater WLAs.*

Restoration Plans (Permit Part IV.E.2.a.)

Within one year of permit issuance, SHA shall submit an impervious surface area assessment consistent with the methods described in the MDE document "Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated, Guidance for National Pollutant Discharge Elimination System Stormwater Permits" (MDE, August 2014 or subsequent versions). Upon approval by MDE, this impervious surface area assessment shall serve as the baseline for the restoration efforts required in this permit.

By the end of this permit term, SHA shall commence and complete the implementation of restoration efforts for twenty percent of SHA's impervious surface area consistent with the methodology described in the MDE document cited in PART IV.E.2.a. that has not already been restored to the MEP. Equivalent acres restored of impervious surfaces, through new retrofits or the retrofit of pre-2002 structural BMPs, shall be based upon the treatment of the WQv [Water Quality Volume] *criteria and associated list of practices defined in the 2000 Maryland Stormwater Design Manual. For alternate BMPs, the basis for calculation of equivalent impervious acres restored is based upon the pollutant loads from forested cover.*

Coordinated TMDL Implementation Plan (Permit Part IV.E.2.b.)

Within one year of permit issuance, a coordinated TMDL implementation plan shall be submitted to MDE for approval that addresses all EPA approved stormwater WLAs (prior to the effective date of the permit) and requirements of Part VI.A., Chesapeake Bay Restoration by 2025 for SHA's storm sewer system. Both specific WLAs and aggregate WLAs which SHA is a part of shall be addressed in the TMDL implementation plans. Any subsequent stormwater WLAs for SHA's storm sewer system shall be addressed by the coordinated TMDL implementation plan within one year of EPA approval. Upon approval by MDE, this implementation plan will be enforceable under this permit. As part of the coordinated TMDL implementation plan, SHA shall:

- *Include a final date for meeting applicable WLAs and a detailed schedule for implementing all structural and nonstructural water quality improvement projects, enhanced stormwater management programs, and alternative stormwater control initiatives necessary for meeting applicable WLAs;*
- *Provide detailed cost estimates for individual projects, programs, controls, and plan implementation;*
- *Evaluate and track the execution of the coordinated implementation plan through monitoring or modeling to document the progress toward meeting established benchmarks, deadlines, and stormwater WLAs; and*
- *Develop an ongoing, iterative process that continuously implements structural and nonstructural restoration projects, program enhancements, new and additional programs, and alternative BMPs where the EPA-approved TMDL stormwater WLAs are not being met according to the benchmarks and deadlines established as part of SHA's watershed assessments.*

Public Participation (Permit Part IV.E.3.)

SHA shall provide opportunity to the public regarding the development of its coordinated TMDL implementation plan by allowing for public participation, soliciting input, and incorporating any relevant ideas and program improvements that can aid in achieving TMDLs and water quality standards according to the actions below. SHA shall provide:

- *Notice in a regional newspaper and on SHA's website outlining how the public may obtain information on the development of the coordinated TMDL implementation plan and opportunities for comment;*
- *Procedures for providing copies of the coordinated TMDL implementation plan to interested parties upon request;*

- *A minimum 30-day comment period before finalizing the coordinated TMDL implementation plan; and*
- *A summary in each annual report of how SHA addressed or will address any material comment received from the public.*

In response to this public participation requirement, MDOT SHA posted a draft of the Plan on its website on August 1, 2016. The 30-day public comment period ended on August 31. A summary of comments received was included in the 2016 MDOT SHA MS4 annual report submitted to MDE in October. The annual report was posted on the MDOT SHA MS4 Permit webpage accessed from the link below:

http://www.roads.maryland.gov/Index.aspx?pageid=336

Subsequent to the 2016 version of this Implementation Plan, additional TMDLs were issued by MDE and MDOT SHA developed individual implementation plans, placed each one on 30-day public notice, and delivered them to MDE within a year of TMDL issuance. Those individual plans have been integrated into this updated version of the MDOT SHA Implementation Plan under **Part IV, MDOT SHA Watershed TMDL Implementation Plans**.

E. PROJECT IMPLEMENTATION METHODOLOGIES

E.1. Regulatory Guidance and Permitting

Compliance efforts for impervious restoration, the Bay TMDL, and local TMDLs are included in this Plan. Because of these multiple areas of compliance (MS4 and separate TMDLs), accounting for progress can be complicated. The MS4 impervious restoration and Chesapeake Bay TMDL compliance can be handled with the same set of practices that reduce nitrogen, phosphorus, and sediment for local TMDLs. Other local TMDLs require reductions of trash, PCBs, and bacteria, and these pollutants call for different strategies. Guidance for preparing implementation plans has been developed by MDE and the Chesapeake Bay Program (CBP) and is listed below.

MDE TMDL Data Center Guidance

The following guidance is available on the MDE TMDL Data Center website:

- MDE Recommendations for Addressing the PCB SW-WLA, MDE, July 2013;
- Guidance for Developing a Stormwater Wasteload Allocation Implementation Plan for Bacteria Total Maximum Daily Loads, MDE, May 2014;
- Guidance for Developing Stormwater Wasteload Allocation Implementation Plans for Trash/Debris Total Maximum Daily Loads, MDE, May 2014;
- Trash Monitoring Guidance, MDE, July 2014;
- Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated, MDE, August 2014;
- General Guidance for Developing a Stormwater Wasteload Allocation (SW-WLA) Implementation Plan, MDE, October 2014;
- Guidance for Developing Stormwater Wasteload Allocation Implementation Plans for Nutrient and Sediment Total Maximum Daily Loads, MDE, November 2014; and
- Optional Worksheet for MS4 Stormwater WLA Implementation Planning Spreadsheet, MDE, June 2015.

Chesapeake Bay Program (CBP) Guidance

The following guidance is approved by the CBP and is available on the Chesapeake Stormwater Network (CSN) website:

- Recommendations of the Expert Panel to Define Removal Rates for Urban Nutrient Management, CBP Urban Stormwater Work Group (USWG), Watershed Technical Work Group (WTWG) and Water Quality Goal Implementation Team (WQGIT), March 2013;
- Recommendations of the Expert Panel to Define Removal Rates for Erosion and Sediment Control Practices, CBP USWG, WTWG, and WQGIT, April 2014;
- Recommendations of the Expert Panel to Define Removal Rates for Urban Filter Strips and Stream Buffer Upgrade Practices, CBP USWG, WTWG, and WQGIT, June 2014;
- Recommendations of the Expert Panel to Define Removal Rates for Individual Stream Restoration Projects, CBP USWG, WTWG, and WQGIT, September 2014;
- Recommendations of the Expert Panel to Define Removal Rates for the Elimination of Discovered Nutrient Discharges from Grey Infrastructure, CBP USWG, WTWG, and WQGIT, November 2014;
- Recommendations of the Expert Panel to Define Removal Rates for New State Stormwater Performance Standards, CBP USWG, WTWG, WQGIT, January 2015;
- Recommendations of the Expert Panel to Define Removal Rates for Urban Stormwater Retrofit Projects, CBP USWG, WTWG, WQGIT, January 2015;
- Potential Benefits of Nutrient and Sediment Practices to Reduce Toxic Contaminants in the Chesapeake Bay Watershed, Part 1: Removal of Urban Toxic Contaminants, CBP Toxic Contaminants Workgroup (TCW), December 2015;
- Recommendations of the Expert Panel to Define Removal Rates for Street and Storm Drain Cleaning Practices, CBP, May 2016;
- Recommendations of the Expert Panel to Define Removal Rates for Floating Treatment Wetlands in Existing Wet Ponds, CBP USWG, July 2016; and
- Recommendations of the Expert Panel to Define Removal Rates for Shoreline management projects, CBP USWG, WTWG, and WQGIT, June 2017.

Permits for Construction Projects

Permits or other authorizations for construction projects are obtained following standard practices to comply with all State and federal laws. General permits are pursued when possible. Permits include:

- National Environmental Policy Act (NEPA)/Maryland Environmental Policy Act (MEPA) clearances that also include Section 106 cultural resources;
- Maryland SWM and Erosion and Sediment Control Approvals;
- Maryland Reforestation Law, Roadside Tree Law, and Forest Conservation Act;
- Maryland Aviation Administration (MAA) for projects within airport clear zones;
- Critical Area Commission;
- Maryland Dam Safety for thermal impacts related to construction in Use III waters and certain stormwater embankments;
- Maryland and Federal Wetland and Waterways for impacts to US waters and wetlands;

- US Army Corps of Engineers (USACE) Chesapeake Bay Total Maximum Daily Load Regional General Permit (Bay TMDL RGP); USACE, July 2015; and
- Others as needed.

E.2. Urban Sector Focus

MDE has specified that at least half of the 20 percent impervious restoration should be within the urban sector. This means that at least 10 percent of the impervious restoration must be provided by practices that treat MDOT SHA impervious surface runoff directly or are placed within urban land areas if outside MDOT SHA right-of-way.

In the Maryland WIP I, the urban sector is required to meet MS4 impervious treatment as the method to address Bay restoration. For purposes of complying with the MS4 Permit, MDE considers all lands within MDOT SHA ROW as urban. Under this definition, MDOT SHA roads that traverse agricultural, forested, or rural areas are considered urban areas.

In accordance with this MDE policy for urban sector focus, MDOT SHA plans to provide impervious restoration to at least 10 percent of the untreated impervious area within MDOT SHA ROW or urban land use areas as defined by the 2010 Maryland Department of Planning (MDP) land use/land cover classification definitions (MDP, 2010). These classifications include:

11 Low-density residential
12 Medium-density residential
13 High-density residential
14 Commercial
15 Industrial
16 Institutional
17 Extractive
18 Open urban land
191 Large lot subdivision (agriculture)
192 Large lot subdivision (forest)
80 Transportation

E.3. Watershed Focus

When investigating areas that are suitable for restoration practices, MDOT SHA focuses on impaired watersheds that are regulated under EPA-approved TMDLs. Impervious restoration practices or activities located in areas with local TMDL coverage can also be credited towards the 20 percent MS4 impervious restoration requirement and Chesapeake Bay pollutant reductions. Because restoration practices in these watersheds comply with multiple water quality initiatives, increased efficiency in utilizing resources such as funding and staffing as well as meeting timeframes for compliance can be achieved.

Besides focusing on impaired watersheds, MDOT SHA also recognizes the value of the anti-degradation policy defined in the CWA and Maryland law. This policy seeks to maintain high quality waters in good condition and to discourage activities that will cause them to degrade. Within Maryland, many Tier II (high quality) catchments have been designated but there are currently no Tier III (waters of national significance) designations. MDOT SHA uses GIS data that includes high quality waters when performing site searches and, if opportunities exist, targets these areas with restoration practices.

Input from counties is also sought regularly and in instances when a local jurisdiction requests MDOT SHA to focus on certain watersheds, MDOT SHA works with the jurisdiction to develop agreements under which the implementation of appropriate practices can be undertaken as a partnership. In most instances, these would be watersheds with an EPA-approved TMDL in place, but they could also be watersheds of other local significance.

E.4. Partnerships

MDOT SHA is unique among the MS4s in that our lands and roadways are present in most counties and municipalities in Maryland. Likewise, State roads traverse most watersheds. It cannot be denied that MDOT SHA has a significant presence throughout Maryland, but that presence is not accompanied with a governance role in local communities. Officials associated with municipalities and counties can provide much insight and value when engaging the public, when seeking to understand local environmental and water quality concerns, or when developing projects within their jurisdictions.

MDOT SHA has an established outreach program tasked with coordinating pollution reduction and other MS4 activities with other MS4 municipalities and counties. The purpose is to establish a cooperative relationship that will provide mutual benefit for both entities and the constituents or customers they serve. This coordination is important to ensure that local officials are informed and can provide input on MDOT SHA's planned restoration activities.

This outreach program also extends to other governmental MS4 and non-MS4 agencies, such as the United States Geological Survey (USGS), the United State Fish and Wildlife Service (USFWS), and the Maryland Environmental Trust (MET). Partnerships with agencies such as these leverage unique research and analytical capabilities, alternative contracting methods, and conservation land holdings and easements.

Various mechanisms are employed to foster these partnerships ranging from formally executed agreements to meetings documented by minutes to quick emails following up on daily project related issues.

E.5. Redevelopment Credit

MDE defines 'redevelopment' as development projects where 40 percent or greater of the project site is existing impervious surfaces. Projects were existing impervious surfaces are less then 40 percent are 'new development'. According to the MDE stormwater regulations, both these designations carry a requirement to provide water quality treatment for runoff from existing impervious surfaces. For redevelopment, the requirement is 50 percent of the existing impervious surfaces and for new development the requirement is 100 percent. Practices that are implemented in order to meet this requirement are identified as being eligible to be included in MS4 impervious accounting as either baseline treatment or impervious restoration credit.

As MDOT SHA modifies or expands the existing roadway network to improve safety and mobility, SWM practices are implemented or upgraded to treat runoff from existing, untreated roadway segments to meet current SWM standards. Through negotiations with MDE relative to MDOT SHA development projects, redevelopment credit also includes both reconstructed impervious areas and impervious area removal. For further discussion of redevelopment credit, see **Part II.B.2., Baseline Runoff Treatment Assessment**.

E.6. Existing Grass Channel Inventory

Many MDOT SHA roadways drain to open channel grass swales that convey stormwater runoff from the roadway to storm drains or downstream waterways. See **Figure 1-4** for an example of a grass swale along the I-70 median in Baltimore County. MDE recognizes that certain of these existing channels effectively reduce pollutants in runoff and approved the *MDOT SHA Existing Water Quality Grass Swale Identification Protocol* in May 2016 (MDOT SHA, 2016). This document details a procedure to identify and evaluate existing grass

swales against the MDE stormwater criteria for the open channel BMP. A full inventory and analysis of existing grass swales along MDOT SHA rights-of-way and within the MS4 coverage area has been completed. This analysis has been used to calculate actual levels of treatment currently being provided for both pollutant reductions and impervious restoration acreages and qualifying swales have been documented as spatial features within the MDOT SHA NPDES database. For further discussion describing how this analysis was included in the MDOT SHA baseline impervious calculation, refer to **Part II.B.2., Baseline Runoff Treatment Assessment**.



Figure 1-4: Existing Grass Channel along Median of I-70 in Baltimore County

E.7. Nutrient Credit Trading Program

The Maryland Department of Agriculture (MDA) and MDE are partnering to establish a nutrient credit trading and offset program. Although the program is currently under development, principles and draft guidance are available. Under this approach, sectors are given the flexibility to meet their load limits by purchasing credits or offsets generated from load reductions elsewhere. MS4s would be allowed to purchase credits at market rate and enter into cross-sector trading agreements to meet up to half of their impervious surface area treatment required under the MS4 Permit conditions. Cross-sector trading will include point source and non-point sources. For example, transactions can occur between two point sources such as Waste Water Treatment Plants (WWTP) and regulated MS4 jurisdictions, or between a point source and non-point source such as regulated MS4 jurisdictions and agricultural operations.

Trading is proposed to be allowed for MS4 restoration credits within three geographic regions called Maryland Trading Regions (see **Figure 1-5**):

- Potomac River Basin;
- Patuxent River Basin; and
- A combination of the remaining Susquehanna River Basin, Eastern Shore, and Western Shore.

Once the trading program and guidance are finalized, MDOT SHA intends to utilize this program as another practice to meet restoration requirements. For example, in areas where opportunities to implement traditional nutrient and sediment reduction strategies are limited, MDOT SHA anticipates the ability to utilize credit trading.

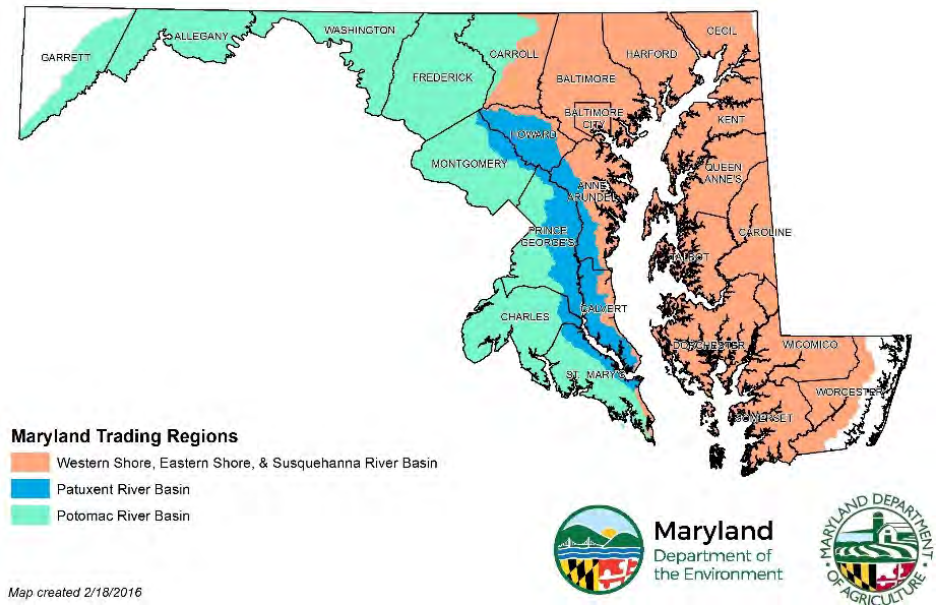


Figure 1-5: Proposed Maryland Trading Regions
(MDA & MDE, 2016)

E.8. Research

Through established statewide research funding, MDOT SHA can explore practices that will provide the most effective use of resources. Some current practices under study include outfall stabilization crediting for nutrient removal, methods to measure pollutant removal from inlet cleaning and street sweeping, and determining effectiveness of stormwater control practices in removing bacteria and other toxic contaminants such as PCBs.

E.9. Program Funding

MDOT SHA ensures the MS4 impervious restoration and TMDL implementation plan activities are adequately funded. Projected allocations and costs for impervious restoration are discussed in **Part II, Impervious Restoration Plan and Chesapeake Bay TMDL Compliance** and projected costs for local TMDL implementation are discussed in **Parts III, Coordinated TMDL Implementation Plan** and **Part IV, MDOT SHA Watershed TMDL Implementation Plans**.

F. RESTORATION PRACTICE DESCRIPTIONS

This section describes the practices used to meet impervious restoration goals and TMDL pollutant reductions. **Part II** and **Part III** detail how these practices are or will be combined in implementing restoration and TMDL reduction strategies. Current restoration practices are taken from MDE's *Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated* (MDE, 2014b) and the CBP technical workgroup protocols. As new practices are developed, MDOT SHA will consider potential to implement them.

For the most efficient treatment or offset of stormwater pollution, combinations of currently approved measures are being implemented. The MDOT SHA right-of-way has been reviewed using geographic information system (GIS) analysis and a myriad of base data to determine the best combination of treatment strategies along any given roadway corridor with the goal of maximizing the use of MDOT SHA owned properties. Additionally, MDOT SHA is partnering with local MS4 municipalities and counties, other governmental agencies, and private organizations to implement projects outside of MDOT SHA right-of-way.

F.1. Design, Inspection & Maintenance Standards

A variety of restoration practices are being employed. Some practices produce reductions through an annually conducted operations activity

such as street sweeping, inlet cleaning, or educational outreach. Others, such as structural stormwater controls and tree planting, are permanent, built practices and are designed and constructed to certain standards. MDOT SHA adheres to the following standards for constructed practices:

- MDE 2000 Maryland Stormwater Design Manual and updates;
- MDE 2011 Maryland Standards and Specifications for Soil Erosion and Sediment Control and updates;
- Specifications for Performing Landscaping Activities for the Maryland Aviation Administration;
- American Association of State Highway and Transportation Officials (AASHTO) Roadside Design Guide;
- MDOT SHA Book of Standards for Highway & Incidental Structures;
- MDOT SHA Standard Specifications for Construction Materials;
- MDOT SHA Highway Drainage Manual;
- MDOT SHA Stormwater Management Site Development Criteria Manual; and
- MDOT SHA Landscape Design Guide.

Built restoration practices are required to be inspected every three years and necessary maintenance or remediation efforts undertaken in order to ensure optimal pollutant removal and to continue to receive credit against the 20 percent impervious restoration and pollutant load reductions. Also, the Bay Program requires that pollutant removal credits be renewed at established timeframes for certain practices and inspections serve as confirmation of practice functionality. SHA has developed inspection and maintenance manuals for structural stormwater controls and tree sites. A geodatabase is used to track inspection timeframes, maintenance or remediation requirements, and completion dates.

F.2. Alternative Practices

MDE recognizes that not all the impervious restoration and load reductions can be accomplished by building new or upgrading existing structural stormwater controls and allows for construction of alternative practices that are effective at offsetting the pollutant loads generated by impervious surfaces without treating stormwater runoff directly. These alternative practices are assigned impervious treatment equivalencies that calibrate the effectiveness of these practices against equivalent reductions in loading rates from urban land use. MDE (2014b, p. 19, Table 7) has provided a list of acceptable alternative practices. Accordingly, the alternative practices currently used by SHA include tree planting, stream restoration, catch basin cleaning, street sweeping, and outfall stabilization. Other types of alternative practices may be employed in the future.

F.3. Categories of Practices

Restoration practices can also be organized into four categories: structural stormwater controls, land use changes, environmental restoration, and source controls. These categories are helpful in understanding the mechanisms for pollutant removal. Each category is defined below and detailed descriptions of practices and how they are being used by SHA are included in **Sections F.4** through **F.7**.

Structural Stormwater Controls

Structural stormwater (SW) controls are engineered practices that receive stormwater runoff from developed areas and, using a variety of mechanisms, reduce pollutants and slow runoff velocities to minimize impacts when discharged to downstream waterways. They are engineered to optimize pollutant removal and are designed and built under standards contained in the *2000 Maryland Stormwater Design Manual* (MDE, 2009a). Structural SW controls are discussed in **Section F.4**.

Land Use Changes

Land use change practices reduce pollutants by replacing existing land cover that generates high levels of pollutants with one that generates lower levels. This will provide an overall decrease in pollutants without capturing and treating stormwater runoff directly. Examples of land use changes are planting trees or removing impervious pavement. Land use change BMPs are discussed in **Section F.5**.

Environmental Restoration

Environmental restoration aims to counteract the effects of urbanization on natural stream channels. Urbanization with increased impervious surfaces, reduced tree canopy, and straightened, steepened and less permeable runoff conveyances changes the characteristics of stormwater runoff by increasing volumes and duration of flows. Tributaries, streams, and rivers conveying these flows can be impacted by one or more of the following problems: flooding, increased erosion of banks, deeper channel bottoms, changes in channel configuration and location, loss of aquatic habitat and species, and loss of wetlands as floodplains become dryer. Activities that restore natural channels establish equilibrium between the flowing water, structure and configuration of channels, and species and habitat. Environmental restoration practices include stream restoration, wetland restoration, and outfall stabilization and are discussed in **Section F.6**.

Source Controls

Source controls remove pollutants before they reach waterways and include methods to reduce the generation of pollutants such as recycling/reuse efforts or educational campaigns. They also include physically capturing and removing pollutants for disposal elsewhere, typically in landfills. Catch basin cleaning and street sweeping are examples and are discussed in **Section F.7**.

F.4. Structural Stormwater Controls

Grass Swales

Grass swales are grass-lined channels that convey stormwater draining from roadways towards discharge points or outfalls. They are designed to certain cross-sectional geometries, longitudinal profiles, and side slopes in order to control the rate and depth at which stormwater flows through the swale. Pollutant reductions are achieved through vegetative filtering, sedimentation, and biological uptake. Swales can attenuate larger flows by slowing and infiltrating runoff during flows. They are typically located within roadway median areas or along roadsides. See **Figure 1-6** for an example of a grass swale.



Figure 1-6: Grass Swale Example along MD 220 in Washington County

Bioswales

Bioswales are structural swales designed with a multi-tier filtration system consisting of filter media, transition, and drainage layers working in combination to remove pollutants. Bioswales use an

engineered soil filter media that is very porous and consists of sand, soil and organic matter such as mulch or compost. Stormwater flows onto the surface of the facility and as it seeps through the media, it is filtered. Plants within the facility also provide treatment through biological processes associated with the root systems and uptake of water and nutrients. The process removes sediment, as well as nitrogen and phosphorus. Bioswales can also attenuate flows by storing and infiltrating stormwater runoff to the ground below. They are viable in all soil types (based on USGS Hydrologic Soil classifications); however, underdrain systems are required in soils with low infiltration rates (typically hydraulic soil groups C & D). They can be used in areas with lower infiltration rates if an underdrain is also used. See **Figure 1-7** for an example bioswale under construction.



Figure 1-7: Bioswale during construction along MD 214 in Prince George's County

Wet Swales

Wet swales are structural swales that can be used in poorly drained soil types and are ideal for treating highway runoff in low-lying, flat terrain with high groundwater. Wet swales often intercept shallow groundwater to maintain a wetland plant community. Check dams are placed within the swale to help promote saturated soil or shallow standing water conditions and to temporarily store runoff before returning the treated stormwater to the conveyance system. The saturated soil and wetland vegetation provide an ideal environment for gravitational settling, biological uptake, and microbial activity.

Submerged Gravel Wetlands

Submerged gravel wetlands (SGW) are "flow through" filters that use wetland plants, a soil layer, and a gravel chamber to provide water quality treatment. Stormwater runoff draining to an SGW is treated primarily through filtration, but also sedimentation, physical and chemical sorption, microbially mediated transformation, uptake, and attenuation. Stormwater flows to the pretreatment forebay, where sedimentation occurs first; the pretreated runoff is then stored on the surface of the wetland. Filtration, sorption, and transformation occur as the stormwater travels through the wetland vegetation, soil layer, and/or gravel chimneys and passes through the gravel substrate that hosts a microbe-rich environment. While some uptake occurs in the wetland vegetation, most of the treatment is within the gravel substrate. To sustain the microbes and the wetland plants, the gravel substrate and soil layers must remain wet between storm events. For this reason, SGWs are used typically in poorly draining soils (typically hydraulic soil groups C & D) and/or areas of high ground water. See **Figure 1-8** for an example of an SGW.



Figure 1-8: Submerged Gravel Wetland in Silver Spring, Montgomery County, MD

Surface Sand Filters

Surface sand filters are practices that capture and temporarily store runoff and pass it through a filter bed of sand media. Filtered stormwater is either returned to the conveyance system or partially infiltrated into the soil. Surface sand filter facilities are versatile and may be adapted for use almost anywhere. Facilities can be located in poorly draining soils with the use of an underdrain system to discharge the treated runoff to a conveyance system. See **Figure 1-9** for an example of a surface sand filter.



Figure 1-9: Surface Sand Filter along MD 355 in Montgomery County

Bioretention and Micro-Bioretention Facilities

Bioretention systems use very porous media consisting of sand, soil, and organic matter such as mulch or compost for filtering stormwater runoff. Stormwater flows onto the surface of the facility and as it seeps through the media, it is filtered. Plants within the facility also provide treatment through biological processes associated with the root systems and uptake of water and nutrients. Bioretention facilities are versatile and may be adapted for use anywhere there is landscaping, although maintenance considerations prohibit their use in certain contexts.

Filtered stormwater is either returned to the conveyance system or partially infiltrated into the soil. Facilities may use underdrains to discharge the treated runoff to storm drain systems, though underdrains are not necessary in well-drained soils.

The specific facility type, bioretention or micro-bioretention, is determined based on the size of the area draining to the facility. Micro-bioretention facilities are typically limited to a half acre drainage area and are typically used in smaller landscaped areas. If properly maintained, micro-bioretention facilities can provide water quality treatment while adding aesthetic value to the site. See **Figure 1-10** for an example of a bioretention facility.



Figure 1-10: Bioretention Facility at MD 139 in Baltimore County

Rain Gardens

Rain gardens are shallow, planted depressional areas designed to infiltrate stormwater into the soil. This is an effective method to remove pollutants and recharge groundwater supplies. Soil requirements are an important factor when planning to implement this strategy. Soils must have high infiltration capabilities, low groundwater tables, and be located within a relatively flat area. Also, they must not be located within areas of karst topography, which are areas geologically characterized by soluble bedrock, such as limestone. Water infiltrating into the ground in these areas can dissolve bedrock and increase the potential of causing sink holes.

Infiltration Trenches

Infiltration trenches are relatively deep linear trenches designed to capture and infiltrate a certain amount of runoff volume based on the size of the area draining to them. They are limited by certain infiltration capabilities of the underlying soils and restrictions in karst topography. These trenches are sized to hold the runoff while allowing infiltration

into the native soils over a prescribed period of time. They are filled with stone and the sides are lined with geotextile to prevent soils along the sides of the trench from migrating to the bottom and clogging them with fine sediments that will prevent water from infiltrating. SHA uses this practice when space is limited and the right soils are underlying the area. See **Figure 1-11** for an example of an infiltration trench.



Figure 1-11: Infiltration Trench along US 113 in Worcester County

Wet Ponds and Wetlands

Using permanent pools of water to reduce pollutants in stormwater runoff has been a long standing treatment method in Maryland. Recent SWM practices that encourage infiltration to native soils and emulate natural flow patterns prior to urban development have been determined to be more effective at removing pollutants. For this reason, SHA only uses wet pond and surface wetland facilities when necessary due to site constraints such as high ground water and/or large drainage areas.

Stormwater wet ponds and surface wetlands are facilities that have a permanent pool or shallow wetland with deep water zones. These facilities provide water quality treatment through biological uptake from algae growing within the permanent pool/wetland areas. Wetland plants provide additional nutrient uptake, and physical and chemical treatment processes allow filtering and absorption of nutrients. Surface pond/wetlands practices are best suited for areas of high ground water and/or poorly draining soils; however, they can be used if larger drainage areas exist and impermeable liners are placed beneath the facility to ensure the permanent ponding necessary to achieve the pollutant removal is provided. See **Figure 1-12** for an example wet pond.



Figure 1-12: Wet Pond along US 113 in Worcester County

F.5. Land Use Changes

Impervious Area Removal

Impervious surfaces increase runoff because they prevent rainwater from penetrating the ground. As a result, runoff can increase water volumes in nearby streams and cause flooding and erosion. Pollutants that are deposited on impervious surfaces from vehicles or atmospheric deposition, such as gasoline, nitrogen and oil, can wash into streams. Impervious surfaces often increase the temperature of

runoff which can raise stream water temperatures. These factors all lead to poor stream health.

Impervious area removal is the replacement of impervious surfaces, such as asphalt and concrete, with pervious surfaces, such as grass, meadow plants, or trees. Replacing impervious surfaces such as abandoned roadways and concrete lined ditches with permeable surfaces allows rainfall to infiltrate into the ground which reduces runoff and pollution entering downstream waterways. Grass lining in ditches also slows the flow of runoff through the ditch allowing pollutants to be filtered and settled. Generally, trees provide better infiltration and pollutant removal than grass or meadows. The type of vegetation installed will depend upon the site context, roadside safety, and sight distance requirement for motorists. See **Figure 1-13** for an example of impervious area removal.



Figure 1-13: Before and After Image of a Concrete Ditch Lining Removal along I-70 in Washington County

Tree Planting

Tree planting is an economical strategy that converts grass or meadow areas to forested land. . Forests produce less runoff than impervious, grass, or meadow areas and provide higher sorption rates of nutrients and sediment for rainwater falling on the site directly. By capturing rainfall in the canopy and bark; trees encourage rainwater to evaporate back into the air. Leaves also release moisture in a process called transpiration. Trees also absorb many pollutants through their root systems. In addition, their roots and leaf litter improve soil conditions for infiltration and can transform pollutants into less harmful substances. The roots also bind soils, preventing erosion. See **Figures 1-14** and **1-15** below for photos of recent MDOT SHA tree planting sites.



Figure 1-14: MDOT SHA Tree Planting Site at Perring Parkway and I-695 in Baltimore County



Figure 1-15: MDOT SHA Tree Planting Site along US 15 in Frederick County

F.6. Environmental Restoration

Stream Restoration

Stream restoration reestablishes the structure, function, and self-sustaining behavior of the stream system prior to disturbance. The restoration design focuses on the physical and biological components of the stream system and its watershed. Restoration includes a broad range of measures such as removing watershed disturbances that are causing stream instability; installing structures and planting vegetation to stabilize stream banks and provide habitat; and reconstructing the curves, bends and depth of channels within the stream. See **Figure 1-16** for an example of stream restoration.



Figure 1-16: MDOT SHA Stream Restoration Project at MD 139 before, during, and after Construction

Step Pool Systems

Step pool systems are applied in steep channel conditions to manage flow energy. These systems generally consist of steps or weirs constructed of rock, separated by pools that reduce flow energy between steps. Native vegetation is installed to provide additional stabilization, greater pollutant processing, shading, and habitat. In appropriate conditions, filter media and configurations that encourage greater infiltration are incorporated into the systems to provide added pollutant processing efficiency. Step pool systems may be utilized within steep stream restoration reaches or in outfall stabilization situations. See **Figure 1-17** for an example of a step pool system.



Figure 1-17: Example Step Pool System at Avalon State Park after Construction

Outfall Stabilization

Outfall stabilization repairs channels when significant erosion occurs due to increase and change in the characteristics of stormwater discharge that occurs when it discharges from one type of conveyance to another such as from a pipe to ditches, adjacent lands, or stream channels. Different methods are used to stabilize outfalls including the use of natural materials and structures, rock riprap, vegetation and matting, or stepped grade changes. The stabilization is designed to control flows for existing storm drains based on the magnitude and frequency of a flow event. See **Figure 1-18** for an example of outfall stabilization.



Figure 1-18: MD 210 Outfall before and after Stabilization in Anne Arundel County

F.7. Source Controls

Street Sweeping

Sweeping roadways is not only an important means to keep them clear of trash and debris, but it also results in a reduction of pollutants associated with roadway debris. This material is collected for disposal into approved landfills resulting in pollutants removed prior to entering waterways. Different types of sweeping equipment exist with different levels of effectiveness at removing debris. Sweeping prevents buildup along sections of roadway and allows for the free flow of water from the highway to enter into drainage systems. MDE's current sweeping BMP definition requires sweeping to be performed two times per month (MDE, 2014b). MDOT SHA has designated routes for this sweeping frequency which occurs from April through November. See **Figure 1-19** for an example of street sweeping.



Figure 1-19: Typical MDOT SHA Mechanical Street Sweeper

Inlet Cleaning

Inlets are grated openings in the storm drain system that capture stormwater runoff and convey it to a piped. Many inlets have depressed bottoms or chambers that capture sediment and debris preventing them from entering downstream conveyances or waterways. These catch basins must be cleaned periodically and sediment and trash make up the majority of the material that is removed. This practice ensures safer roadways by maintaining free drainage and improves water quality in by removing captured sediment and trash before it enters downstream waterways. See **Figure 1-20** for an example of inlet cleaning.



Figure 1-20: Inlet Catch Basin Cleaning before and after

Structural Stormwater Controls

Structural stormwater controls are discussed under **F.4, Structural Stormwater Controls**, but they also act as source controls for trash and debris. Regular maintenance provides removal and disposal.

Litter Education and Outreach Program

The MDOT SHA Office of Communications (OC) and Office of Maintenance (OOM) collaborate on public education programs which include disseminating information through articles, social media, and

hosting environmental awareness events at schools and civic events. The program offers materials such as coloring books, brochures, and speakers to educate the public. Other on-going public education initiatives by MDOT SHA include Keep Maryland Beautiful environmental education grants; press releases and articles; and social media using Twitter, Facebook, YouTube and Instagram.

MDOT SHA has posted a public education website that focuses on water quality initiatives. The site can be accessed at the link below and key components include:

https://www.roads.maryland.gov/Index.aspx?Pageid=48

- Proper erosion and sediment control,
- Proper disposal of vehicle fluids
- Storm drain stenciling,
- Roadside dumping,
- Litter and Trash Disposal,
- Vehicle Idling,
- Alternative modes of transportation,
- Car care, and
- Proper pet waste disposal.

Employee Recycling and Reuse Program

MDOT SHA employees lead by example, and actively seek to reduce littering and increase recycling. These recycling efforts are evaluated through the MDOT Excellerator program which includes two performance measures to track the percentage of office waste and non-office waste diverted from the landfill or incineration through recycling. The MDOT Excellerator Report is updated and shared each quarter, and is publicly available online.

Recycled office Waste Includes:

- Commingled containers (glass, metal, and plastic);
- Glass (fluorescent light tubes, mixed glass containers);
- Metals (mixed cans, and tin/steel cans);
- Paper (corrugated cardboard, mixed paper, shredded paper and newspaper);
- Plastic (mixed plastic bottles, other plastics);
- Electronics; and
- Printer cartridges

Non-Office Waste Includes:

- Lead-acid batteries (vehicle);
- Compostables (grass, leaves, brush, branches, mixed yard trimmings, food waste, and other);
- Metals (white goods - refrigerators, stoves, washing machines, dryers,
- water heaters, and air conditioners);
- Animal protein/solid fat;
- Tires;
- Antifreeze;
- Industrial fluids;
- Motor oil;
- Scrap automobiles; and
- Scrap metals.

Litter Reduction, Collection, and Disposal

MDOT SHA has many programs in place to address and control litter within MDOT SHA right-of-way. A critical aspect of MDOT SHA year-round highway maintenance is the removal of litter from roadway shoulders and drainage systems. MDOT SHA uses a multi-pronged approach to control litter utilizing state workers, contractors, inmate crews, as well as labor donated through the Sponsor-A-Highway (SAH) program and partnerships with Adopt-A-Highway (AAH) volunteers.

Instead of just picking up litter, MDOT SHA now provides our crews and volunteers with the means to separate recyclables from trash. All seven MDOT SHA Districts are currently recycling roadway litter in a

formal manner. As the recycling efforts increase, the volume of waste taken to landfills continues to decrease.

MDOT SHA currently collects a substantial amount of litter and trash as described below:

- Maintenance Crew Clean-ups – Each maintenance shop is responsible to perform many routine activities including trash clean-up as well as mowing, plowing, and other activities. Trash clean-ups are performed regularly throughout the year with additional attention in the Spring and Summer mowing seasons. Spot cleaning is scheduled upon public request for hot spots close to the landfills.

- Contracted Crew Clean-ups –MDOT SHA also enters into contractual agreements for supplemental clean-ups along the right-of-way. This includes contracts with private companies as well as inmate crews contracted with various state penitentiaries. Contracts are awarded for designated roadway segments and contractors are required to pick up on a regular schedule.

- Adopt-A-Highway (AAH) – This program encourages volunteer groups (families, non-profit organizations, schools and civic organizations) to pick up litter along one to two mile stretches of non-interstate roadways four times a year for a two-year period as a community service. MDOT SHA provides each group with training, safety vests, trash bags, and tips on how to pick up trash and recyclables. The trash collected is placed in bags that are picked up by MDOT SHA maintenance crews. MDOT SHA will also place signs recognizing the organization or group at both ends of the adopted roadside.

- Sponsor-A-Highway (SAH) – This MDOT SHA corporate sponsorship program allows corporations to sponsor sections of Maryland roadways by funding contracted clean-ups for one-mile sections of roads. The sponsor enters an agreement with a maintenance provider to remove litter from the sponsored highway segment, typically an interstate roadway. The maintenance providers are responsible for removal of trash from sponsored segments of roadways.

  Each sponsor is acknowledged by a sign with a recognition panel that is placed at the beginning of the highway segment they are sponsoring. MDOT SHA does not receive any reimbursement from the sponsor or maintenance provider. MDOT SHA's primary roles are to ensure litter removal is properly performed, ensure recognition signs are installed to the Federal Highway Administration (FHWA)'s Manual on Uniform Traffic Control Devices (MUTCD) standards, manage the inventory of segments available for sponsorship, review additional areas for inclusion in the program, and approve artwork submitted for sponsor panels.

Illicit Discharge Detection and Elimination (IDDE)

Illicit discharges are defined as a dry weather flows that have measurable pollutants or pathogens. The MDOT SHA IDDE program conducts regular field screenings and sampling for a subset of our outfalls annually and also for any reported suspected illicit discharges. Sampling does not directly test for bacteria, but the testing does detect indicators of sewage. If an illicit discharge is confirmed, MDOT SHA works with local jurisdictions to disconnect the discharge from the storm drain system.

Geese/Waterfowl Prevention at Ponds

Waterfowl have been known to establish colonies at pond sites, particularly in large stormwater ponds with a permanent pool adjacent to grassy areas, or areas with attractive waterfowl habitat. As these colonies increase in size, overcrowding can result. In general, an overcrowded bird population in a pond creates high nutrient and

bacteria loads from fecal material. Waterfowl are also known to carry pathogens that can be dangerous to humans. Two birds per acre of pond is a manageable number that will not result in significant property damage or water quality impairments (Clemson Cooperative Extension, 2015). Once the number of waterfowl exceed this ratio, control measures may be considered.

Generally, MDOT SHA ponds are not attractive to waterfowl because shore areas are not maintained in a lawn condition, making it difficult for the waterfowl to forage and nest. MDOT SHA inspects SWM control structures on a 3-year cycle and evidence of waterfowl infestation is taken into consideration. If a colony is identified, measures may be undertaken to eradicate the colony in cooperation with the Maryland Department of Natural Resources (DNR).

Cattle Fencing and Pasture Stream Buffers

Cows and other pasture animals with open access to streams contribute to poor water quality, stream bank degradation, and erosion. As the animals walk through the water, they pollute the stream with manure, urine, and pathogens. Cattle can also consume and trample the vegetation on stream banks as they enter and exit the channel. The decrease in stream bank vegetation and associated root systems leads to an increased amount of sediment, pesticides, nutrients, and phosphorus entering into the water (Pennsylvania Association of Conservation Districts [PACD], 2009).

Installation of fencing along streams protects stream banks, allows a natural riparian buffer to reestablish and thrive, and limits access to stream banks by farm animals. Riparian buffers are vegetated areas running parallel to a stream and they are important because they reduce and slow runoff from adjacent farm fields; reduce erosion; trap sediment, pesticides, and nutrients carried in farm field runoff; strengthen and stabilize stream banks with plant roots; and discourage farm animals from entering the stream. See **Figure 1-21** for examples of streams with and without cattle fencing.



Figure 1-21: Example of Streams with and without Cattle Fencing

MDOT SHA does not manage farm or pasture land, however, MDOT SHA may use these techniques on stream restoration projects in rural areas to protect the restoration work if there is potential for the presence of cattle or horses.

Pet Waste Disposal Stations

Bacteria and nutrient pollution can be attributed to pet feces. When pet owners do not pick up after their pets and the waste is left on a lawn or impervious surface, it washes into storm drains and nearby streams. MDOT SHA has installed pet waste collection stations at highway rest areas to encourage proper disposal of pet waste by the traveling public. See **Figure 1-22** for an example of a pet waste disposal station.



Figure 1-22: Pet Waste Disposal Station at the I-70 Eastbound Rest Area and Welcome Center

Drainage System and Waterway Clean-ups

Periodically, MDOT will host a stream clean-up where trash, litter, dumping and other forms of debris are collected and removed from stream valleys and riparian areas. Participants can be state workers, volunteers, or contracted crews and trash and debris collected is disposed of at a landfill. Increasing these types of stream clean-ups is a viable option for trash and litter TMDL reductions.

An enhancement to trash reduction can also mean the addition of trash interceptor devices at outfalls or within streams to remove trash and debris. Examples of such devices are sock traps, screen or netting traps, and in-stream interceptors. See **Figure 1-23** for an example outfall trash collection device.



Figure 1-23: Outfall Trash Sock

MARYLAND DEPARTMENT OF TRANSPORTATION

STATE HIGHWAY ADMINISTRATION

Part II

Impervious Restoration Plan & Chesapeake Bay TMDL Compliance







II. IMPERVIOUS RESTORATION PLAN AND CHESAPEAKE BAY TMDL COMPLIANCE

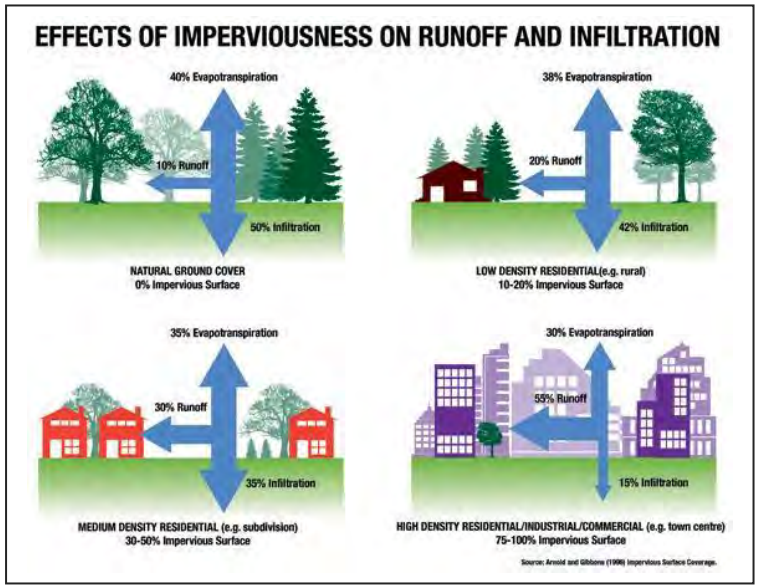
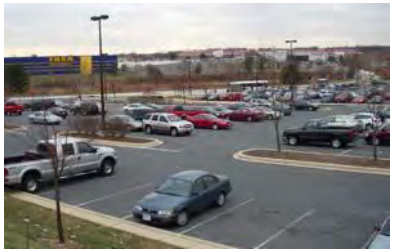


Figure 2-1: Effects of Imperviousness on Runoff and Infiltration
(Source: EPA, 2016)

A. URBANIZATION AND IMPERVIOUS SURFACE RESTORATION

Urbanization increases paved surfaces and decreases areas where rainfall can seep into the ground. This results in increased volumes and frequency of stormwater runoff because more water flows from impervious surfaces that had previously infiltrated into the ground (see **Figure 2-1**). Along with this runoff come pollutants including trash, organic debris, and sediments that are picked up along the way. Often, urban runoff flows directly to waterways without being detained and treated to minimize pollutant discharges or to allow infiltration. By requiring MS4 jurisdictions to treat a portion of their existing impervious surfaces, EPA and MDE are seeking to offset increases in runoff and pollutant loading from past development. This will improve conditions in the waterways where these areas drain.


Park and Rides


Urban Interstates


Rural Interstates


Collector Roads


Rest Areas


Maintenance Shops/Offices

Figure 2-2: MDOT SHA Typical Impervious Surfaces

SHA owns and operates impervious surfaces in the form of interstate highways, arterial and collector roads, park and rides, rest areas, maintenance shops, material storage facilities, and offices. Examples of MDOT SHA impervious surfaces are shown in **Figure 2-2**.

MDOT SHA MS4 Permit Requirements

This part of the plan details MDOT SHA compliance for impervious restoration. Wording detailing this requirement taken from **Part III.E.2.a** of the MDOT SHA MS4 permit is copied below. Full wording from the permit for **Part III.E. Restoration Plans and TMDLs**, is included in **Part I, Program Introduction**.

Restoration Plans (Permit Part III.E.2.a)

Within one year of permit issuance, SHA shall submit an impervious surface area assessment consistent with the methods described in the MDE document "Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated, Guidance for National Pollutant Discharge Elimination System Stormwater Permits" (MDE, August 2014 or subsequent versions). Upon approval by MDE, this impervious surface area assessment shall serve as the baseline for the restoration efforts required in this permit.

By the end of this permit term, SHA shall commence and complete the implementation of restoration efforts for twenty percent of SHA's impervious surface area consistent with the methodology described in the MDE document cited in PART III.E.2.a. that has not already been restored to the MEP. Equivalent acres restored of impervious surfaces, through new retrofits or the retrofit of pre-2002 structural BMPs, shall be based upon the treatment of the WQv criteria and associated list of practices defined in the 2000 Maryland Stormwater Design Manual. For alternate BMPs, the basis for calculation of equivalent impervious acres restored is based upon the pollutant loads from forested cover.

By complying with the 20 percent impervious restoration requirement, MDOT SHA will also be accomplishing its part in restoring the Chesapeake Bay (Bay). The Bay TMDL was issued in December 2010 and Maryland issued its WIP I that same month (see **Part I, Program Introduction** for additional discussion). Wording from the MDOT SHA MS4 permit relating the 20 percent restoration requirement to Chesapeake Bay restoration is copied below.

Chesapeake Bay Restoration by 2025 (Permit Part VI.A)

A Chesapeake Bay TMDL has been developed by the EPA for the six Bay States (Delaware, Maryland, New York, Pennsylvania, Virginia, and West Virginia) and the District of Columbia. The TMDL describes the level of effort that will be necessary for meeting water quality criteria and restoring the Chesapeake Bay. This permit is requiring compliance with the Chesapeake Bay TMDL through the use of a strategy that calls for the restoration of twenty percent of previously developed impervious land with little or no controls within this five year permit term as described in Maryland's Watershed Implementation Plan. The TMDL is an aggregate of nonpoint sources or the load allocations (LA), and point sources or WLAs, and a margin of safety. The State is required to issue NPDES permits to point source discharges that are consistent with the assumptions of any applicable TMDL, including those approved subsequent to permit issuance.

Urban stormwater is defined in the CWA as a point source discharge and will subsequently be a part of Maryland's Chesapeake Bay WLA. The NPDES stormwater permits can play a significant role in regulating pollutants from Maryland's urban sector and in the development of Chesapeake Bay

Watershed Implementation Plans. Therefore, Maryland's NPDES stormwater permits issued to SHA and other municipalities will require coordination with MDE's Watershed Implementation Plan and be used as the regulatory backbone for controlling urban pollutants toward meeting the Chesapeake Bay TMDL by 2025.

B. IMPERVIOUS AREA ASSESSMENT

An inventory of impervious surfaces (in acres) currently owned by MDOT SHA within the MS4 areas and an assessment to quantify those impervious surfaces that receive runoff treatment was performed. This inventory and assessment was used to compute the untreated impervious baseline acreage against which the 20 percent impervious restoration requirement was computed. This restoration must be completed by the permit expiration date of October 8, 2020.

MDOT SHA and MDE have coordinated to arrive at the MDE-approved baseline impervious area assessment that is applied to the current MS4 permit compliance as follows:

- MDOT SHA owns 25,663.5 acres of impervious surfaces within the MS4 areas.
- Treated impervious surfaces total 2,558.7 acres.
- Untreated impervious surfaces total 23,104.8 acres (25,663.5 minus 2,558.7). This is the untreated surface baseline.
- 4,621 acres of impervious surfaces (23,104.8 multiplied by 0.2) is the 20 percent impervious restoration requirement.

Procedures and methods used by MDOT SHA to derive key elements of this assessment are discussed in the following sections.

B.1. Impervious Surface Inventory

An inventory of MDOT SHA-owned impervious surfaces was conducted by producing a planning-level ROW GIS layer demarcating MDOT SHA-owned property and an impervious surface layer. The ROW layer was produced by extracting data from the MDP Property View GIS product and refining it with property boundary data from other sources such as recorded plats and ROW GIS data from other agencies. The ROW layer was then edited to contain only those surfaces within the MS4 areas.

The impervious surface layer was produced using high-resolution aerial imagery consistent with the baseline dates listed in **Table 2-1a**. The layer was generated using the Feature Analyst toolset within GIS, along with desktop review and calibration, to produce polygons from the aerial imagery. This layer was then intersected with the ROW layer to create a GIS layer representing MDOT SHA impervious surfaces within MS4 areas.

Table 2-1: Impervious Baseline Dates by County

County	Baseline Date
Anne Arundel	12/31/2005
Baltimore	12/31/2005
Carroll	12/31/2005
Cecil	12/31/2005
Charles	12/31/2004
Fredrick	12/31/2005
Harford	12/31/2004
Howard	12/31/2002
Montgomery	12/31/2004
Prince George's	12/31/2005
Washington	12/31/2005
City of Salisbury (Wicomico)	12/31/2006

B.2.Baseline Runoff Treatment Assessment

According to MDE direction, stormwater control structures and alternative BMPs that were built (and are currently in functioning condition) prior to the previous MDOT SHA MS4 permit term expiration date of October 21, 2010 can be applied to the baseline treatment. A database of existing MDOT SHA-owned stormwater control structures, conveyances, and drainage areas was developed by MDOT SHA under the previous MS4 permit database development, tracking and reporting requirement and was used to identify BMPs to be used in this accounting.

BMP Verification and Functionality

MDE requires that all BMPs be verified, inspected, and maintained per State stormwater management regulations to ensure proper function for WQ treatment. Before being included in the MDOT SHA baseline assessment of facilities providing runoff treatment, data associated with these practices were evaluated to ensure they meet requirements for inspection, maintenance and functionality. MDOT SHA has undertaken a robust stormwater control structure (SW BMP) inspection program using qualified stormwater professionals to inspect and document the SW BMP condition. Ratings are used to determine the functional level provided by the SW BMP which indicates whether the SW BMP is providing WQ treatment. A failed rating indicates that the SW BMP is not providing WQ treatment.

SW BMPs may fail to varying degrees. Some may require major maintenance activities to bring it to functionality, some may require minor reconstruction, and some may require complete, structural overhaul. Because the timeframes associated with these degrees also vary, MDOT SHA developed a Non-Functioning BMP Protocol to document procedures for handling BMPs that fail to varying degrees. This protocol can be found in the MDOT SHA FY19 MS4 annual report as Appendix A.

Documenting WQv

MDE also requires documentation including plans, design specifications, and complete maintenance records in order to claim baseline or restoration credit. For baseline facilities, MDOT SHA has evaluated its records for existing stormwater control structures to determine if adequate documentation exists to demonstrate water quality treatment levels provided. In cases where records were not located, an analysis was performed using field surveys and accepted engineering computational standards to determine water quality treatment levels used in the baseline assessment. Documentation was produced to accompany these analyses and support runoff treatment assigned to these facilities. All documentation supporting treatment assessment are filed and associated with database records.

Impervious Disconnection

MDE allows removing impervious surfaces from the treatment requirement for areas that are considered to be “disconnected” from storm drain systems because they drain to open areas or channels. One method to employ this concept is the use of open section roads with swales that meet the grass swale criteria provided by MDE (2009a) (MDE, 2014a). An open section road is one where stormwater is not conveyed by closed storm drain systems but instead drains to open channels. MDOT SHA developed the *Existing Water Quality Grass Swale Identification Protocol* to document criteria used to evaluate existing open channels or ditches that meet these criteria. This protocol was initially approved by MDE on April 16, 2013 and was recently revised and approved by MDE on May 18, 2016. It is available on the MDOT SHA website.

An extensive inventory was undertaken within the MS4 areas along MDOT SHA ROW and open section roadways to identify, document, field verify, and place open channels that qualify for this treatment credit into the MDOT SHA database. These open channels are considered to

be structural stormwater controls and will be inspected according to the three-year requirement for other practices.

Redevelopment Treatment

Redevelopment credit and pavement removal associated with new roadway improvement projects can be counted towards the MDOT SHA baseline assessment and restoration treatment provided (discussed in the following **Section C**). Redevelopment is a requirement of past and present stormwater regulations that currently requires 50 percent of existing impervious surfaces within a site development area to be included in the water quality volume calculations used in determining the stormwater management needs of the project. The existing impervious areas that receive runoff treatment or are removed as a result of new roadway improvement projects are credited towards restoration at the rate allowable based on the *Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated* guidelines.

Cross-Jurisdictional Treatment

This analysis looks at overlaps in baseline treatment or restoration credit with adjacent Phase I MS4 entities and resolves them for the MDOT SHA data and impervious baseline accounting. MDE has directed the MS4 community that the MS4 entity directly treating SW runoff can claim the impervious area against their baseline or restoration accounting and the MS4 that owns the impervious area can remove the area from their baseline untreated accounting.

Cross-jurisdictional treatment is defined as areas of MDOT SHA owned impervious surfaces that are treated by another jurisdiction's restoration or baseline SW BMP. The MDOT SHA impervious surfaces were evaluated, classified, and determined to be treated for baseline accounting if the other jurisdiction's BMPs meet the following criteria:

- Provides water quality treatment,
- Implementation status is 'Complete' or 'Under Construction',
- Passing inspection record,
- Treats MDOT SHA impervious surfaces, and
- Rainfall treated (Pe) value is greater than zero.

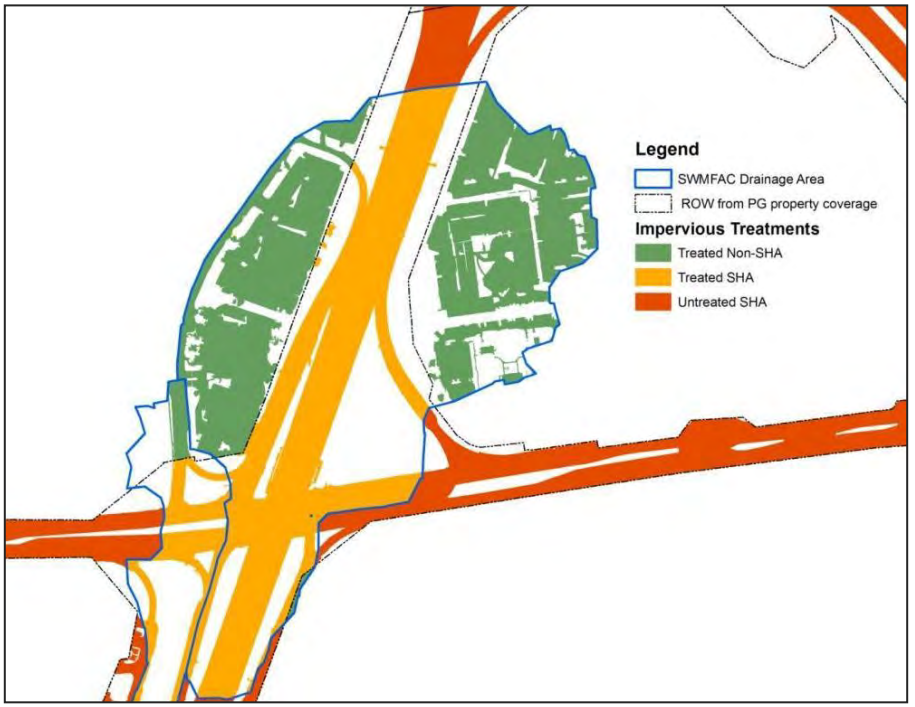


Figure 2-3: GIS Analysis of Impervious Accounting Categories

Figure 2-3 illustrates a GIS analysis of MDOT SHA roadways and stormwater control structures to determine impervious runoff treatment. The blue lines designate drainage areas associated with stormwater control structures. The yellow areas are MDOT SHA impervious surfaces draining to control structures and considered treated. The red areas are MDOT SHA impervious surfaces that are not draining to control structures or qualifying open channels and are considered untreated. The green areas are impervious surfaces outside of MDOT SHA ROW and not owned by MDOT SHA. Although these off-site areas fall within the drainage areas of MDOT SHA structural stormwater

controls, it was the practice in the past for MDOT SHA to treat only water quality volumes associated with MDOT SHA roadways and allow the volumes associated with these offsite areas to bypass the water quality treatment components of structural stormwater controls. Therefore, for the baseline development, these off-site areas are not included as MDOT SHA runoff treatment provided.

C. IMPERVIOUS RESTORATION PLAN

MDOT SHA and MDE determined 4,621 acres of existing impervious surfaces must be retrofitted for runoff treatment or offset by alternative practices by October 8, 2020.

C.1. MEP Treatment Standard

In compliance with the CWA, the MS4 permit requires the use of structural stormwater controls or alternate practices to reduce the discharge of pollutants from MDOT SHA storm sewer systems to the MEP. The MEP standard for impervious restoration projects is treatment of the WQv. The WQv is defined as the storage needed to capture and treat runoff from 90% of the average annual rainfall and is equal to 1 inch in the Eastern Rainfall Zone (east of Frederick County) and 0.9 inch in the Western Rainfall Zone (west of and including Frederick County) in Maryland (MDE, 2009a).

MDE allows for pro-rating of the treatment credit for practices that cannot meet the WQv. This means that if a facility treats less than the WQv, the credit will be reduced and if the facility treats more, the credit will be increased. For MDE-provided rates for reduction and increase, see MDE (2014a), *Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated, Section III - BMP Implementation and Restoration Credits*.

MDE recognizes that not all restoration can be accomplished through the use to structural stormwater controls. Therefore, MDE has developed a list of alternative practices that are acceptable to offset the impacts of impervious surfaces in the areas they are constructed. These alternative practices are assigned impervious treatment equivalencies that can be used to determine the amount of impervious surfaces that are considered treated by these practices (see Table 7 in *Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated*, MDE, 2014a, and MDE *Stream Restoration Crediting Clarification for MS4 Permitting Purposes* dated 4/30/2019).

C.2. Restoration Treatment Strategy

MDOT SHA is implementing a combination of built practices, maintenance activities, and redevelopment credit which are included in **Tables 2-2a-g** located at the end of this part starting on page 2-11. Each entry includes location information and impervious acres treated. **Figure 2-5** illustrates the mix of practices proposed and the amount of impervious restoration to be accomplished by each practice type. For BMP sites identified in FY20 and FY21 the locations are known however the impervious acreage treatment of the BMP are estimated according to the construction plans. The majority of the BMPs that are scheduled to be completed in FY20 and FY21 are currently under construction and the estimated credit associated with the projects are highly accurate. Descriptions of the built and annual activity practices are included in **Part I.F. Restoration Practices**.

On April 30, 2019 MDE issued a memorandum “Stream Restoration Crediting Clarification for MS4 Permitting Purposes” which increased the planning rates for stream restoration and impervious acre equivalents. After implementing this memorandum to current and future projects, MDOT SHA now anticipates to exceed the restoration goal of 4,621 acres and now estimates impervious restoration credit to be approximately 9,960 acres.

Figure 2-4 illustrates the current MDOT SHA impervious restoration plan by State fiscal year (FY). The State FY is from July 1 to June 30. For each FY over the permit duration, a certain number of practices have

been or will be built including tree planting, pavement removal, new stormwater control structures, retrofit stormwater control structures, stream restoration and outfall stabilization. Although it appears from the graph that restoration efforts will continue beyond the 2020 deadline into FY 2021, the deadline of October 8, 2020 falls within the first quarter of FY 2021.

Figure 2-4 also includes maintenance activities such as inlet cleaning, storm drain cleaning, and street sweeping, which will be increased during the permit term to meet its ultimate impervious credit acreage goal as shown in **Table 2-2a**. Moving forward, redevelopment credit will be assessed for restoration credit as new roadway projects are built.

Progress Reporting and Adaptive Management

Annual reports will be submitted to MDE that will document progress in meeting proposed restoration credit benchmarks. Each report will include a database and written description of compliance measures. If benchmarks are not being met, both the Bay TMDL and the MDE MS4 permit allow for adjustments in the plan to ensure restoration goals are met. MDE (2014a) explains this adaptive management concept as follows:

> *With respect to permit compliance, MS4 jurisdictions are required to continuously re-evaluate, fine tune and adjust restoration efforts when established benchmarks cannot be met. Remaining on schedule to accomplish all permit conditions while continuously looking for opportunities to improve these efforts becomes a delicate balance. MS4 jurisdictions should carefully identify any delays in implementation schedules and provide a remedial action plan for current and future projects in order to facilitate restoration and improve program implementation. MDE will consider the level of restoration achieved and compare to implementation schedules and required benchmarks to determine compliance with permit requirements.* (p. 25)

MDOT SHA has made adjustments to this plan as needed and will continue to provide an update on the total acres of impervious restoration credit achieved in each MS4 annual report.

Urban BMP Placement

As stated in **Part I.E.2. Urban Sector Focus,** a focus on urban areas is required with a minimum of half of the 20 percent restoration requirement accomplished with practices on MDOT SHA ROW or with practices that are located within urban land uses if placed off MDOT SHA ROW. MDOT SHA has prepared a best management practice (BMP) placement protocol to outline this approach to locating BMPs for impervious treatment credit. Baseline practices do not have to comply with these criteria.

C.3. Restoration Viewer

MDOT SHA developed a website with an interactive map that the public can use to follow implementation progress and to explore projects in their area and throughout the eleven MS4 counties. The MDOT SHA Bay Restoration Viewer can be found at the link:

www.roads.maryland.gov/index.aspx?PageId=714

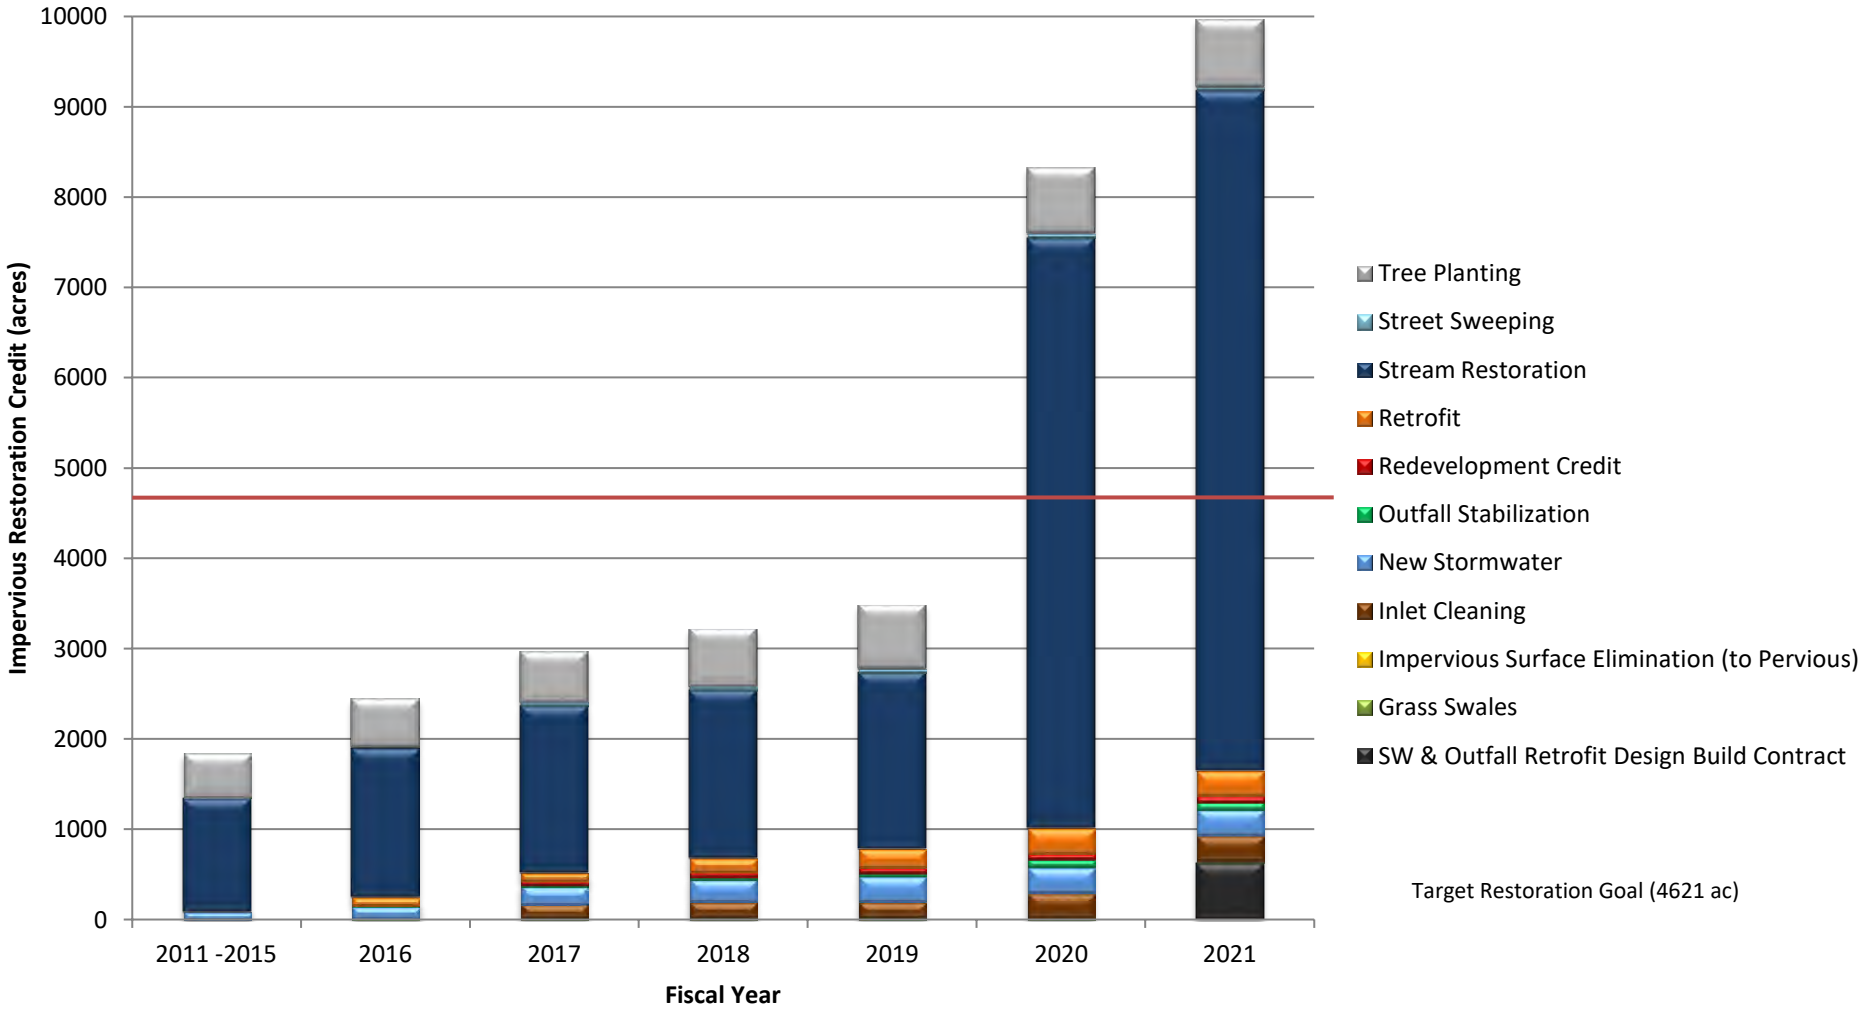


Figure 2-4: Cumulative Restoration Plan by Fiscal Year with Practice Menu

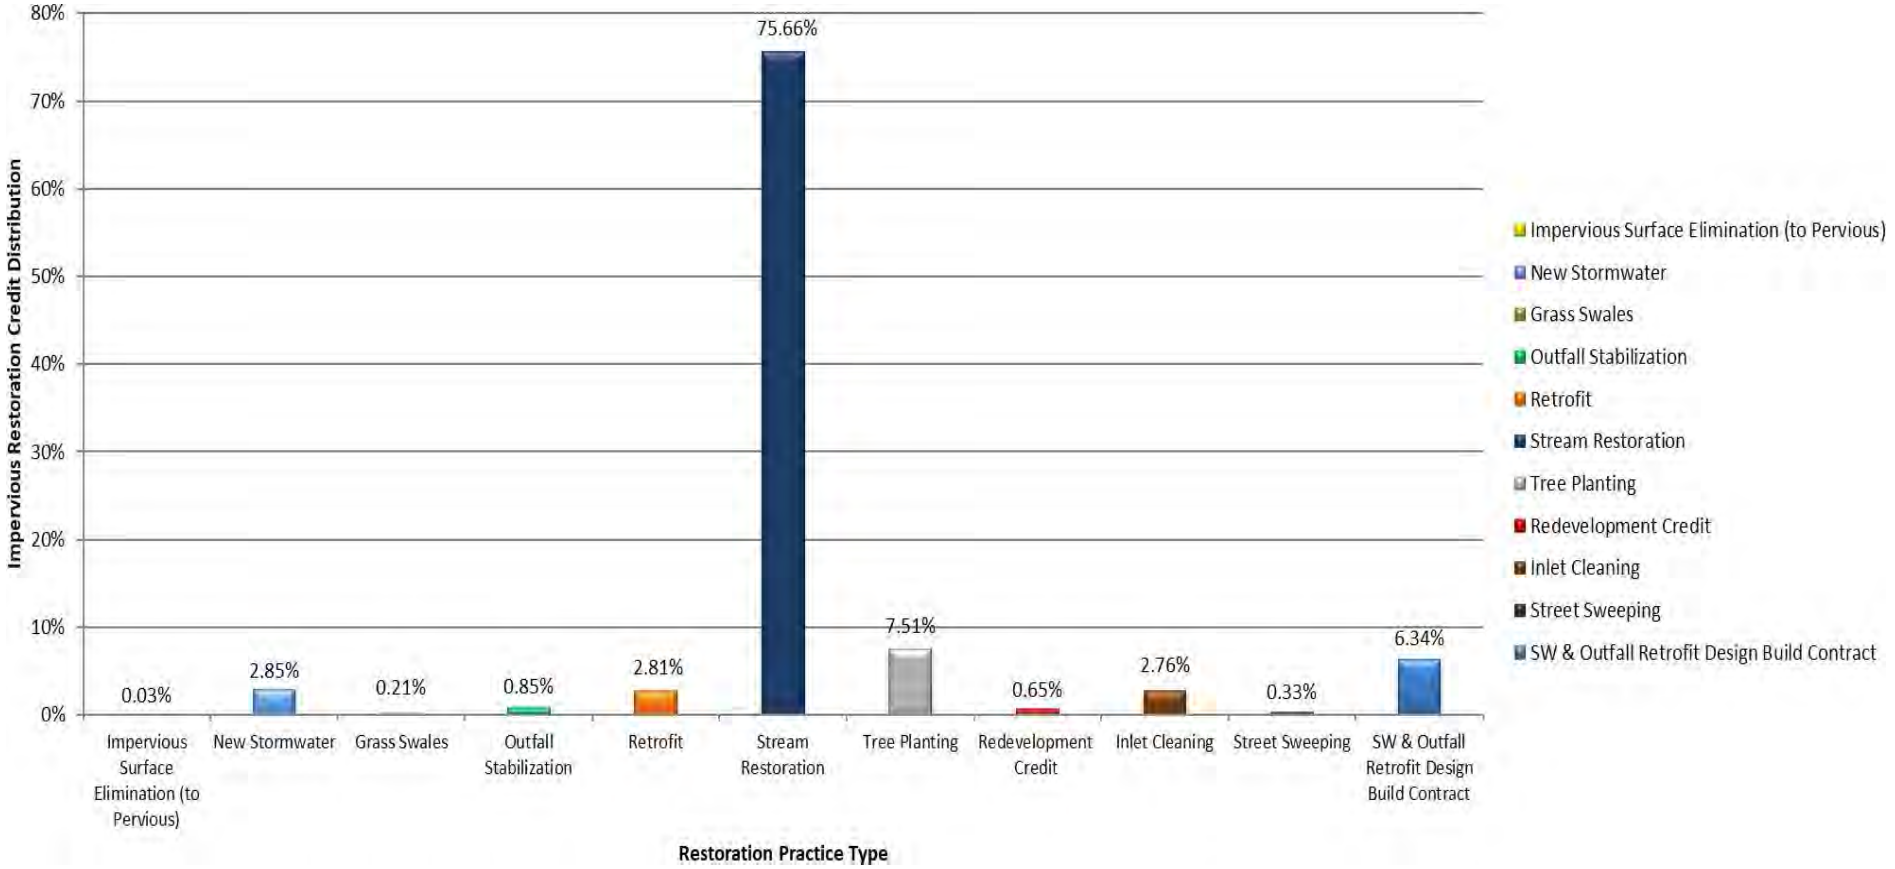


Figure 2-5: Percent of Restoration Treatment Accomplished by Practice Type

D. SCHEDULE AND FUNDING

In order to meet the 20 percent impervious restoration requirement by October 8, 2020, a specific number of acres has been planned for treatment each year. **Table 2-1a** shows the projected percentages of impervious treatment, projected percent progress towards the 20% restoration goal, and actual funding for FY11 to FY19 and the projected funding for FY20 and FY21. The impervious treatment acres by fiscal year were determined based on the 20 percent restoration goal for 2020 and based on completed projects and preliminary planning efforts that assessed the feasibility of implementing various restoration strategies, along with the associated project design and construction schedules. Projected funding was determined based on the estimated costs to implement each strategy specific project over the permit term.

These funding projections are consistent with the Maryland Department of Transportation (MDOT) Consolidated Transportation Program (CTP) for FY 2016 to FY 2021, which is Maryland's six-year capital budget for transportation projects. In addition, the projected funding also accounts for operational activities.

Table 2-1a: Percentage of Impervious Treatment by Fiscal Year & Funding Allocations 2011-2021

Year (Fiscal)	Projected Percentage of Impervious Treatment Acres	Projected Percent Progress Toward Restoration Goal	Funding Projection/Expenditures by Fiscal Year* (Millions)
2011-15	4%	20%	$96
2016	6%	30%	$53
2017	8%	40%	$64
2018	9%	45%	$79
2019	10%	50%	$113
2020	19%	95%	$113
2021	20%	100%	$69

** Funding Projections for FY 2011 –-2019 are based on actual expenditures.*

E. COMPREHENSIVE LIST OF RESTORATION PRACTICES

Tables 2-2a through **2-2f** below provide a comprehensive list of annual operations practices, and completed, programmed and planned built impervious restoration practices broken down by year. Each table entry includes location information and estimated impervious runoff treatment acreage. This list is based on preliminary baseline impervious estimates. Projects and information listed are subject to change and may be modified due to unforeseen circumstances.

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed

Unique BMP #	BMP Type	8-Digit Watershed Name	8-Digit Watershed Code	Northing	Easting	Impervious Treated (acres)
SH12ALN000003	Stream Restoration	Anacostia River	02140205	159559.85	402146.09	60.78
SH12ALN000013	Stream Restoration	Anacostia River	02140205	159559.47	397321.50	180.33
SH12ALN000018	Stream Restoration	Little Patuxent River	02131105	164274.84	418585.79	59.19
SH12ALN000029	Stream Restoration	Little Patuxent River	02131105	174235.63	416127.26	31.32
SH13ALN000005	Stream Restoration	Anacostia River	02140205	160042.82	401413.54	16.38
SH13ALN000007	Stream Restoration	Anacostia River	02140205	158520.42	401822.08	83.67
SH13ALN000014	Stream Restoration	Rock Creek	02140206	163439.62	386982.29	145.62
SH13ALN000017	Stream Restoration	Deer Creek	02120202	221430.99	441003.14	34.80
SH13ALN000032	Stream Restoration	Seneca Creek	02140208	170966.32	383824.12	119.73
SH14ALN000008	Stream Restoration	Anacostia River	02140205	148865.47	405647.43	129.00
SH14ALN000010	Stream Restoration	Rock Creek	02140206	162449.00	391909.38	87.21
SH15ALN000002	Stream Restoration	Severn River	02131002	159493.48	431938.55	0.00
SH15ALN000004	Stream Restoration	Anacostia River	02140205	158745.99	400685.31	21.36
SH15ALN000006	Stream Restoration	Anacostia River	02140205	158471.35	400379.90	60.42
SH15ALN000009	Stream Restoration	Anacostia River	02140205	151553.44	408448.77	24.18
SH15ALN000015	Stream Restoration	Atkisson Reservoir	02130703	204740.72	456761.66	63.00
SH15ALN000016	Stream Restoration	Little Patuxent River	02131105	177825.43	412849.52	135.00
SH16ALN000011	Stream Restoration	Rock Creek	02140206	160195.12	391644.34	188.76
SH16ALN000012	Stream Restoration	Anacostia River	02140205	157814.56	398261.67	155.13

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16ALN000031	Stream Restoration	South River	02131003	145891.51	438563.02	48.28
SH16ALN000044	Stream Restoration	Patapsco River L N Br	02130906	171819.50	425505.56	6.00
SH17ALN000045	Stream Restoration	Anacostia River	02140205	155213.31	401010.05	99.18
SH17ALN000046	Stream Restoration	Anacostia River	02140205	154518.98	401632.13	91.65
SH18ALN000047	Stream Restoration	Patapsco River L N Br	02130906	173446.15	423202.32	7.14
SH19ALN000050	Stream Restoration	Potomac River FR Cnty	02140301	185918.26	345651.52	91.89
SH15ALN000035	Outfall Stabilization	Severn River	02131002	159509.01	431999.29	7.50
SH17ALN000036	Outfall Stabilization	Piscataway Creek	02140203	112612.86	399955.14	3.55
SH17ALN000037	Outfall Stabilization	Piscataway Creek	02140203	115659.99	400855.96	2.14
SH17ALN000038	Outfall Stabilization	Piscataway Creek	02140203	115358.50	400979.82	1.40
SH17ALN000039	Outfall Stabilization	Piscataway Creek	02140203	111718.18	399211.40	1.93
SH17ALN000041	Outfall Stabilization	Potomac River U tidal	02140201	119836.63	400705.06	1.19
SH17ALN000043	Outfall Stabilization	Potomac River U tidal	02140201	120063.30	400694.64	0.68
SH18ALN000048	Outfall Stabilization	Cabin John Creek	02140207	153942.03	386610.65	9.40
SH19ALN000049	Outfall Stabilization	Bird River	02130803	190518.24	444582.33	7.88
SH16RST130531	FY16 restoration new stormwater BMP project.	Little Patuxent River	02131105	180175.30	409550.06	0.27
SH16RST210197	FY16 restoration new stormwater BMP project.	Conococheague Creek	02140504	220795.58	335320.73	0.32
SH16RST210198	FY16 restoration new stormwater BMP project.	Conococheague Creek	02140504	220795.67	335289.23	0.13
SH16RST210210	FY16 restoration new stormwater BMP project.	Antietam Creek	02140502	220644.66	336627.96	0.07
SH16RST080772	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	89210.79	400886.39	0.50
SH16RST130624	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	171226.26	417921.02	0.30

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST130627	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	170286.93	419819.05	0.49
SH16RST130620	FY16 restoration new stormwater BMP project.	Little Patuxent River	02131105	173822.69	416132.87	0.31
SH16RST100320	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192635.00	367756.54	0.32
SH16RST100325	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192128.38	369623.76	0.36
SH16RST100334	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	191731.04	371583.78	0.46
SH16RST100321	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192534.48	367991.41	0.27
SH16RST100303	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	201009.51	365757.46	0.49
SH16RST100304	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	201176.71	365812.34	0.80
SH16RST100305	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	201659.54	365858.88	1.71
SH16RST100306	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	202272.79	365772.85	0.92
SH16RST100312	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	204428.46	365220.57	0.44
SH16RST100311	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	204140.12	365407.05	0.40
SH16RST100314	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	204760.24	365001.66	0.42
SH16RST130622	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	172624.90	417183.46	0.29

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST100327	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192114.67	369951.18	0.41
SH16RST100329	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192053.42	370383.61	0.58
SH16RST100331	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	191941.07	370916.99	0.65
SH16RST100310	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	203719.34	365631.06	1.54
SH16RST100461	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	205217.68	364704.16	0.19
SH16RST100462	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	205705.10	364385.59	0.44
SH16RST100463	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	205947.50	364226.94	0.09
SH16RST100464	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	206436.65	363907.25	0.60
SH16RST100465	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	206582.21	363814.54	0.39
SH16RST100466	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	206957.81	363653.77	0.56
SH16RST100467	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	207162.47	363606.27	0.75
SH16RST100468	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	207707.89	363522.97	0.33
SH16RST100469	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	207999.21	363477.44	1.20
SH16RST100470	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	208846.96	363283.17	0.77

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST100471	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	208981.10	363234.59	0.48
SH16RST100472	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	209348.67	363101.05	0.18
SH16RST100473	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	209615.13	363034.12	0.94
SH16RST100474	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	209864.42	363008.48	0.67
SH16RST100475	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	210171.28	363001.52	0.71
SH16RST100476	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	210586.06	362971.93	0.80
SH16RST100477	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	210851.01	362926.60	0.96
SH16RST100299	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	200206.76	365434.87	0.72
SH16RST130621	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	172649.02	417090.61	0.47
SH16RST130628	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	170120.36	419969.29	0.31
SH16RST130630	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	169488.10	420545.38	0.49
SH16RST130625	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	171105.17	418896.81	0.16
SH16RST100302	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	200988.73	365750.17	0.33
SH16RST100322	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192158.44	368728.81	0.31

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST100324	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192126.25	369458.11	0.33
SH16RST100333	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	191797.61	371369.28	0.71
SH16RST130619	FY16 restoration new stormwater BMP project.	Little Patuxent River	02131105	174653.91	415973.60	0.57
SH16RST130629	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	169716.09	420338.72	0.47
SH16RST130631	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	168362.08	421893.95	0.11
SH16RST130632	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	168284.53	422009.43	0.29
SH16RST100309	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	203105.06	365745.77	0.32
SH16RST100316	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	205089.04	364787.11	0.45
SH16RST130623	FY16 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	172541.40	417473.10	0.39
SH16RST100313	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	204591.86	365111.42	0.40
SH16RST210194	FY16 restoration new stormwater BMP project.	Conococheague Creek	02140504	220794.46	335950.74	0.30
SH16RST210207	FY16 restoration new stormwater BMP project.	Conococheague Creek	02140504	220710.34	333551.18	0.19
SH16RST210193	FY16 restoration new stormwater BMP project.	Conococheague Creek	02140504	220794.76	335875.16	0.17
SH16RST210195	FY16 restoration new stormwater BMP project.	Conococheague Creek	02140504	220794.95	335856.15	0.07

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST210196	FY16 restoration new stormwater BMP project.	Conococheague Creek	02140504	220794.83	335823.63	0.17
SH16RST210206	FY16 restoration new stormwater BMP project.	Conococheague Creek	02140504	220721.33	333577.16	0.19
SH16RST210211	FY16 restoration new stormwater BMP project.	Antietam Creek	02140502	220670.18	336574.38	0.19
SH16RST080760	FY16 restoration new stormwater BMP project.	Zekiah Swamp	02140108	86689.14	401055.08	1.14
SH16RST100301	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	200793.40	365655.99	0.87
SH16RST100300	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	200543.32	365535.83	0.73
SH16RST080777	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	89988.54	400961.02	0.82
SH16RST100335	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	191658.07	371808.73	0.81
SH16RST100323	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192122.92	369225.82	0.62
SH16RST100326	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192129.66	369734.24	0.68
SH16RST100330	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192009.34	370656.26	0.68
SH16RST100315	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	204930.84	364890.60	0.33
SH16RST100319	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192800.98	367365.83	0.24
SH16RST100332	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	191863.47	371166.22	0.53

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST100328	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	192090.87	370129.39	0.59
SH16RST080796	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	93816.90	401482.79	0.25
SH16RST080767	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	88653.78	400832.48	0.26
SH16RST080785	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	91280.50	401082.23	0.37
SH16RST080786	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	91426.59	401095.18	0.32
SH16RST080788	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	91784.39	401130.09	0.37
SH16RST080797	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	93982.79	401516.93	0.44
SH16RST080750	FY16 restoration new stormwater BMP project.	Potomac River L tidal	02140101	85092.62	402219.12	0.83
SH16RST080764	FY16 restoration new stormwater BMP project.	Potomac River L tidal	02140101	84679.97	402521.97	0.48
SH16RST080756	FY16 restoration new stormwater BMP project.	Zekiah Swamp	02140108	86048.08	401514.01	0.67
SH16RST080758	FY16 restoration new stormwater BMP project.	Zekiah Swamp	02140108	86385.84	401264.63	0.43
SH16RST100479	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	211082.66	362884.93	0.26
SH16RST100480	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	211245.18	362854.70	0.74
SH16RST100481	FY16 restoration new stormwater BMP project.	Upper Monocacy River	02140303	211565.96	362798.05	0.48

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST080500	FY16 restoration new stormwater BMP project.	Potomac River L tidal	02140101	77731.85	403032.12	0.46
SH16RST080510	FY16 restoration new stormwater BMP project.	Wicomico River	02140106	80100.65	403908.93	0.35
SH16RST080780	FY16 restoration new stormwater BMP project.	Port Tobacco River	02140109	90626.90	401018.91	0.96
SH16RST161120	FY16 restoration new stormwater BMP project.	Western Branch	02131103	127811.41	413931.71	1.63
SH16RST161121	FY16 restoration new stormwater BMP project.	Western Branch	02131103	127745.79	414149.29	0.51
SH16RST021225	FY16 restoration new stormwater BMP project.	Severn River	02131002	151842.98	442635.18	0.56
SH16RST021223	FY16 restoration new stormwater BMP project.	Severn River	02131002	151951.44	442565.41	0.58
SH16RST021222	FY16 restoration new stormwater BMP project.	Magothy River	02131001	154321.36	440996.88	0.79
SH16RST021241	FY16 restoration new stormwater BMP project.	Severn River	02131002	150506.45	443494.55	0.65
SH16RST021238	FY16 restoration new stormwater BMP project.	Severn River	02131002	151492.57	442860.99	0.67
SH16RST021239	FY16 restoration new stormwater BMP project.	Severn River	02131002	151179.48	443062.63	0.46
SH16RST021240	FY16 restoration new stormwater BMP project.	Severn River	02131002	150944.66	443213.16	0.46
SH16RST021232	FY16 restoration new stormwater BMP project.	Magothy River	02131001	152368.51	442296.81	0.28
SH16RST021244	FY16 restoration new stormwater BMP project.	Severn River	02131002	150219.44	443679.98	0.33

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST021237	FY16 restoration new stormwater BMP project.	Severn River	02131002	151655.89	442755.63	0.29
SH16RST100336	FY16 restoration new stormwater BMP project.	Lower Monocacy River	02140302	191705.24	371775.97	0.35
SH16RST210524	FY17 restoration new stormwater BMP project.	Little Tonoloway Creek	02140509	228593.23	298273.80	0.21
SH16RST210525	FY17 restoration new stormwater BMP project.	Little Tonoloway Creek	02140509	228446.77	298199.85	0.43
SH16RST210526	FY17 restoration new stormwater BMP project.	Little Tonoloway Creek	02140509	228376.61	298169.70	0.14
SH16RST210529	FY17 restoration new stormwater BMP project.	Little Tonoloway Creek	02140509	227999.78	298155.90	0.40
SH16RST210530	FY17 restoration new stormwater BMP project.	Little Tonoloway Creek	02140509	227401.87	298402.23	0.39
SH16RST210533	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	227166.98	298624.00	0.22
SH16RST210545	FY17 restoration new stormwater BMP project.	Tonoloway Creek	02140507	226504.22	300727.85	0.29
SH16RST210548	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225716.43	301669.13	0.56
SH16RST210549	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225665.92	301789.80	0.20
SH16RST210550	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225577.53	302027.27	0.51
SH16RST210551	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225556.58	302094.94	0.21
SH16RST210552	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225490.18	302312.56	0.26

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST210553	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225446.49	302483.96	0.23
SH16RST210554	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225194.40	303222.68	0.25
SH16RST210555	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225127.58	303358.53	0.25
SH16RST210556	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	225065.86	303557.57	0.22
SH16RST210558	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	224993.29	303940.07	0.25
SH16RST210559	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	224983.49	303928.40	0.34
SH16RST210571	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	219845.64	311222.11	0.05
SH16RST210572	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	219531.17	311616.92	0.83
SH16RST210573	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	218919.06	312099.36	1.23
SH16RST210574	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	218643.32	312305.72	0.09
SH16RST210575	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	219201.85	311903.49	0.86
SH16RST210576	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	224891.36	304340.66	0.77
SH16RST210577	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	224741.74	305001.91	0.67
SH16RST210578	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	224545.74	305569.56	0.58

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST210579	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	224452.41	305709.64	0.57
SH16RST210580	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	224132.77	306077.22	0.79
SH16RST210581	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	224071.59	306146.89	0.80
SH16RST210582	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	223936.77	306302.34	0.39
SH16RST210584	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	221907.35	309018.75	0.38
SH16RST210585	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	221791.67	309132.70	0.36
SH16RST210586	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	221762.03	309162.09	0.17
SH16RST210587	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	221681.67	309252.45	0.17
SH16RST210588	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	221660.80	309274.76	0.63
SH16RST210589	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	221466.14	309530.65	0.63
SH17RST030737	FY17 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	200330.36	429190.56	0.44
SH16RST060286	FY17 restoration new stormwater BMP project.	Liberty Reservoir	02130907	213698.54	400413.22	22.76
SH16RST210523	FY17 restoration new stormwater BMP project.	Little Tonoloway Creek	02140509	228765.94	298360.22	0.87
SH16RST210560	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	218259.33	312680.67	0.34

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST210562	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	219478.42	311672.02	0.29
SH16RST210565	FY17 restoration new stormwater BMP project.	Licking Creek	02140506	221041.70	310048.77	0.48
SH16RST210566	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	220457.55	310546.17	0.13
SH16RST210567	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	220427.25	310571.21	0.13
SH16RST210568	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	220281.50	310689.12	0.37
SH16RST210569	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	220228.86	310741.82	0.09
SH16RST210590	FY17 restoration new stormwater BMP project.	Potomac River WA Cnty	02140501	221427.42	309586.59	0.43
SH16RST210591	FY17 restoration new stormwater BMP project.	Little Conococheague	02140505	220576.37	320883.86	0.32
SH16RST210592	FY17 restoration new stormwater BMP project.	Little Conococheague	02140505	220567.58	320927.81	0.43
SH16RST210593	FY17 restoration new stormwater BMP project.	Little Conococheague	02140505	220652.12	320528.58	1.48
SH16RST210594	FY17 restoration new stormwater BMP project.	Little Conococheague	02140505	220672.99	320580.07	0.25
SH16RST210595	FY17 restoration new stormwater BMP project.	Conococheague Creek	02140504	217718.04	331505.99	0.52
SH16RST210596	FY17 restoration new stormwater BMP project.	Conococheague Creek	02140504	217590.55	331743.19	0.70
SH16RST210598	FY17 restoration new stormwater BMP project.	Marsh Run	02140503	215600.90	334578.11	0.45

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST210599	FY17 restoration new stormwater BMP project.	Marsh Run	02140503	215604.28	334737.50	0.38
SH16RST210600	FY17 restoration new stormwater BMP project.	Marsh Run	02140503	215610.22	335103.04	0.29
SH16RST210601	FY17 restoration new stormwater BMP project.	Marsh Run	02140503	215613.77	335314.43	0.56
SH16RST210602	FY17 restoration new stormwater BMP project.	Marsh Run	02140503	215594.84	335564.54	0.50
SH16RST210603	FY17 restoration new stormwater BMP project.	Marsh Run	02140503	215554.20	335828.13	0.17
SH16RST210604	FY17 restoration new stormwater BMP project.	Marsh Run	02140503	215547.53	335866.99	0.62
SH16RST210605	FY17 restoration new stormwater BMP project.	Marsh Run	02140503	215487.03	336263.77	0.48
SH16RST210606	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	215466.39	336442.79	0.37
SH16RST210609	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	214799.22	341473.98	0.36
SH16RST210610	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	214766.33	341516.53	0.30
SH16RST210612	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	214882.94	342012.44	1.17
SH16RST210613	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	214899.05	342259.45	0.27
SH16RST210614	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	214898.81	342295.07	0.45
SH16RST210615	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	214877.33	342556.57	0.57

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST210616	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	214347.07	343583.30	0.46
SH16RST210617	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	213951.60	344067.53	1.07
SH16RST210618	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	212391.03	345990.28	0.50
SH16RST210619	FY17 restoration new stormwater BMP project.	Antietam Creek	02140502	212212.79	346123.45	0.85
SH17RST161088	FY18 restoration new stormwater BMP project.	Patuxent River upper	02131104	136781.75	424123.71	5.46
SH17RST161089	FY18 restoration new stormwater BMP project.	Western Branch	02131103	127470.59	422687.46	4.45
SH18RST021556	FY18 restoration new stormwater BMP project.	Baltimore Harbor	02130903	170966.30	434819.08	0.35
SH18RST021562	FY18 restoration new stormwater BMP project.	Baltimore Harbor	02130903	169572.03	433859.78	0.26
SH18RST021563	FY18 restoration new stormwater BMP project.	Baltimore Harbor	02130903	169506.53	434086.89	0.13
SH18RST021566	FY18 restoration new stormwater BMP project.	Baltimore Harbor	02130903	171073.71	433993.71	0.57
SH18RST021569	FY18 restoration new stormwater BMP project.	Baltimore Harbor	02130903	170993.96	433645.09	0.86
SH17RST030744	FY18 restoration new stormwater BMP project.	Back River	02130901	185115.81	444184.74	1.16
SH18RST161269	FY18 restoration new stormwater BMP project.	Western Branch	02131103	123802.51	416342.00	0.99
SH18RST161270	FY18 restoration new stormwater BMP project.	Western Branch	02131103	124029.17	416504.44	1.32

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18RST161271	FY18 restoration new stormwater BMP project.	Western Branch	02131103	123851.12	416987.60	1.05
SH18RST082828	FY18 restoration new stormwater BMP project.	Mattawoman Creek	02140111	99002.84	383696.58	0.59
SH18RST082829	FY18 restoration new stormwater BMP project.	Mattawoman Creek	02140111	98897.90	383855.55	5.08
SH18RST082831	FY18 restoration new stormwater BMP project.	Mattawoman Creek	02140111	98305.52	383839.61	0.13
SH18RST082832	FY18 restoration new stormwater BMP project.	Mattawoman Creek	02140111	98246.30	383642.40	0.25
SH18RST082833	FY18 restoration new stormwater BMP project.	Mattawoman Creek	02140111	98035.42	383850.12	0.25
SH18RST031878	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174397.29	425257.06	0.58
SH18RST031877	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174468.19	425352.29	1.24
SH18RST031876	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174315.05	430278.58	2.47
SH18RST122047	FY18 restoration new stormwater BMP project.	Lower Winters Run	02130702	198446.10	459731.49	0.30
SH18RST070489	FY18 restoration new stormwater BMP project.	Northeast River	02130608	219502.78	489444.19	0.79
SH18RST070484	FY18 restoration new stormwater BMP project.	Northeast River	02130608	224549.80	488241.10	0.36
SH18RST070485	FY18 restoration new stormwater BMP project.	Northeast River	02130608	224608.09	488215.82	0.84
SH18RST070487	FY18 restoration new stormwater BMP project.	Northeast River	02130608	222677.83	489445.31	0.31

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18RST070490	FY18 restoration new stormwater BMP project.	Little Elk Creek	02130605	216711.43	498926.15	0.39
SH18RST070491	FY18 restoration new stormwater BMP project.	Little Elk Creek	02130605	216767.09	498953.59	0.32
SH18RST070492	FY18 restoration new stormwater BMP project.	Little Elk Creek	02130605	221354.32	498522.18	1.00
SH18RST070493	FY18 restoration new stormwater BMP project.	Northeast River	02130608	223070.11	489221.09	0.12
SH18RST070494	FY18 restoration new stormwater BMP project.	Northeast River	02130608	224329.79	488382.52	0.19
SH18RST070495	FY18 restoration new stormwater BMP project.	Northeast River	02130608	223398.49	489006.90	0.67
SH18RST122227	FY18 restoration new stormwater BMP project.	Bush River	02130701	200968.67	465603.23	0.52
SH18RST122228	FY18 restoration new stormwater BMP project.	Bush River	02130701	200797.73	465719.58	1.03
SH18RST122232	FY18 restoration new stormwater BMP project.	Gunpowder River	02130702	194506.76	459709.12	2.66
SH18RST210961	FY18 restoration new stormwater BMP project.	Little Conococheague	02140505	220799.24	321136.44	0.93
SH18RST210978	FY18 restoration new stormwater BMP project.	Conococheague Creek	02140504	220765.07	335341.72	0.50
SH18RST210979	FY18 restoration new stormwater BMP project.	Conococheague Creek	02140504	220824.56	335469.85	0.43
SH18RST210980	FY18 restoration new stormwater BMP project.	Conococheague Creek	02140504	220692.26	335510.34	0.74
SH18RST210981	FY18 restoration new stormwater BMP project.	Conococheague Creek	02140504	220736.08	335549.31	0.98

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18RST210982	FY18 restoration new stormwater BMP project.	Conococheague Creek	02140504	220637.99	335565.51	0.41
SH18RST210983	FY18 restoration new stormwater BMP project.	Conococheague Creek	02140504	220578.37	335439.79	0.59
SH18RST031889	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	173688.35	425585.61	0.45
SH18RST031890	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	173519.14	425698.07	0.30
SH18RST031891	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	173321.26	425757.11	0.66
SH18RST031892	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	173168.50	425761.83	0.37
SH18RST031893	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	173580.10	425636.41	0.22
SH18RST031901	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	175324.60	424238.73	0.36
SH18RST031902	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	175168.44	424603.16	0.48
SH18RST101299	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	190620.48	377584.69	0.53
SH18RST101302	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	190213.92	377573.92	0.43
SH18RST101303	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	190367.67	377882.77	0.36
SH18RST101306	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	186691.36	366411.21	1.35
SH18RST101307	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	195534.30	357955.66	0.90

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18RST101309	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	186731.92	366403.65	0.68
SH18RST101312	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	195712.46	357824.20	1.25
SH18RST101313	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	190406.67	377309.80	0.75
SH18RST021935	FY18 restoration new stormwater BMP project.	Baltimore Harbor	02130903	169563.85	433959.88	0.27
SH18RST031899	FY18 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	172824.63	425791.14	0.72
SH18RST101701	FY18 restoration new stormwater BMP project.	Lower Monocacy River	02140302	190378.52	377841.65	0.06
SH19RST021568	FY19 restoration new stormwater BMP project.	Baltimore Harbor	02130903	165513.38	434363.58	0.69
SH19RST122226	FY19 restoration new stormwater BMP project.	Bush River	02130701	201412.67	464663.73	0.30
SH19RST122231	FY19 restoration new stormwater BMP project.	Lower Winters Run	02130702	195253.35	459423.16	1.48
SH19RST031897	FY19 restoration new stormwater BMP project.	Lower Gunpowder Falls	02130802	192746.76	437242.65	4.24
SH19RST021564	FY19 restoration new stormwater BMP project.	Baltimore Harbor	02130903	169677.02	434347.16	1.06
SH19RST031866	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	173800.90	424780.70	0.48
SH19RST031871	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174468.19	425352.29	0.62
SH19RST210950	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	213289.49	345107.00	1.06

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19RST210969	FY19 restoration new stormwater BMP project.	Conococheague Creek	02140504	221035.31	335891.84	0.55
SH19RST210970	FY19 restoration new stormwater BMP project.	Conococheague Creek	02140504	220929.32	335712.10	0.62
SH19RST031896	FY19 restoration new stormwater BMP project.	Lower Gunpowder Falls	02130802	192662.33	438088.48	1.92
SH19RST031864	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	175232.74	426857.67	1.13
SH19RST031867	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	173481.14	424615.92	0.67
SH19RST122230	FY19 restoration new stormwater BMP project.	Lower Winters Run	02130702	195408.68	459399.42	0.19
SH19RST210951	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	214850.69	341075.15	0.59
SH19RST031895	FY19 restoration new stormwater BMP project.	Lower Gunpowder Falls	02130802	192700.49	437933.63	0.49
SH19RST031868	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	173260.95	424502.62	0.55
SH19RST031869	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174286.59	425130.98	0.43
SH19RST031874	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174952.49	426534.81	0.53
SH19RST122225	FY19 restoration new stormwater BMP project.	Bush River	02130701	201737.02	464732.89	0.41
SH19RST210973	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	220856.42	351605.54	0.60
SH19RST031873	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174642.21	425896.03	1.68

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19RST031875	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174761.68	426281.16	0.71
SH19RST031898	FY19 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	193676.58	436111.64	0.36
SH19RST031870	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174397.29	425257.06	0.36
SH19RST210955	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	214907.61	341560.21	2.34
SH19RST210959	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	215032.45	339130.30	1.19
SH19RST021565	FY19 restoration new stormwater BMP project.	Baltimore Harbor	02130903	165742.05	434213.26	0.64
SH19RST122224	FY19 restoration new stormwater BMP project.	Bush River	02130701	201731.13	464583.96	0.26
SH19RST210972	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	219621.70	350628.08	0.66
SH19RST031894	FY19 restoration new stormwater BMP project.	Lower Gunpowder Falls	02130802	193351.04	436390.69	0.73
SH19RST031865	FY19 restoration new stormwater BMP project.	Patapsco River L N Br	02130906	174019.42	424907.11	0.91
SH19RST210947	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	208538.71	347791.37	0.60
SH19RST210948	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	211669.36	344406.91	1.74
SH19RST210956	FY19 restoration new stormwater BMP project.	Antietam Creek	02140502	214647.08	341516.69	4.78
SH13RST130532	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	179796.16	410173.78	0.46

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14RST080518	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	82783.79	403869.60	0.19
SH12RST130536	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	179470.39	410687.90	0.37
SH14RST080515	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	81433.75	404109.40	0.29
SH13RST150460	VBY-FY15 restoration new stormwater BMP project.	Potomac River MO Cnty	02140202	161618.92	380198.04	0.22
SH13RST130534	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	179574.70	410535.11	0.94
SH13RST080523	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	84321.53	402786.15	0.21
SH13RST130522	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	181047.34	408211.24	0.73
SH13RST130524	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	180727.51	408640.04	0.48
SH13RST130525	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	180642.51	408781.31	0.41
SH14RST080517	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	81627.78	404121.22	0.44
SH13RST130520	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	181474.37	407730.20	0.27
SH13RST150444	VBY-FY15 restoration new stormwater BMP project.	Seneca Creek	02140208	163698.25	376625.14	0.16
SH13RST150449	VBY-FY15 restoration new stormwater BMP project.	Potomac River MO Cnty	02140202	161903.11	379810.63	0.23
SH13RST150450	VBY-FY15 restoration new stormwater BMP project.	Potomac River MO Cnty	02140202	161666.04	380112.07	0.22

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST150451	VBY-FY15 restoration new stormwater BMP project.	Potomac River MO Cnty	02140202	161227.52	380656.01	0.29
SH13RST130539	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	180760.51	408588.74	0.42
SH13RST070052	VBY-FY15 restoration new stormwater BMP project.	L Susquehanna River	02120201	212093.88	480629.15	0.45
SH13RST070053	VBY-FY15 restoration new stormwater BMP project.	L Susquehanna River	02120201	212245.72	480906.69	1.23
SH13RST150459	VBY-FY15 restoration new stormwater BMP project.	Potomac River MO Cnty	02140202	161976.14	379742.80	0.40
SH13RST080520	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	83427.72	403444.68	0.26
SH15RST160319	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	138735.97	413043.61	0.74
SH13RST150456	VBY-FY15 restoration new stormwater BMP project.	Seneca Creek	02140208	163305.99	377729.32	0.21
SH14RST160398	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	137028.79	422977.42	0.27
SH13RST030576	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	223730.41	430483.50	0.23
SH13RST030578	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	223195.56	430500.15	1.08
SH13RST150457	VBY-FY15 restoration new stormwater BMP project.	Seneca Creek	02140208	162751.02	378981.42	0.58
SH15RST130576	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167401.76	412619.98	0.36
SH13RST070087	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	213432.35	485011.52	0.27

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST030571	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	225350.28	430731.03	0.23
SH14RST160410	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	136964.80	423548.88	0.46
SH14RST160418	VBY-FY15 restoration new stormwater BMP project.	Patuxent River upper	02131104	136697.73	424755.73	0.75
SH14RST030567	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	226214.21	430694.22	0.97
SH15RST021283	VBY-FY15 restoration new stormwater BMP project.	South River	02131003	143800.62	430319.36	0.31
SH14RST160391	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	137279.79	421977.57	0.50
SH14RST160396	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	137104.54	422635.62	0.48
SH14RST160397	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	137044.39	422844.01	0.58
SH14RST160399	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	137019.81	423058.74	0.60
SH14RST160412	VBY-FY15 restoration new stormwater BMP project.	Patuxent River upper	02131104	136869.30	424063.35	0.73
SH14RST160416	VBY-FY15 restoration new stormwater BMP project.	Patuxent River upper	02131104	136724.08	424649.83	0.63
SH14RST082133	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	98143.97	415819.46	0.65
SH14RST082134	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	98151.79	415703.28	0.62
SH13RST070072	VBY-FY15 restoration new stormwater BMP project.	L Susquehanna River	02120201	212416.18	481330.73	1.45

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST070081	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	212933.59	483263.15	0.55
SH13RST070083	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	213056.30	483727.66	0.37
SH13RST070086	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	213376.86	484875.50	0.69
SH13RST070088	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	213487.40	485133.76	0.67
SH13RST082138	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	99919.44	412104.98	0.25
SH13RST030575	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	224211.38	430463.57	1.04
SH13RST030570	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	225538.47	430780.96	0.12
SH14RST030569	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	225573.27	430790.35	0.25
SH15RST021282	VBY-FY15 restoration new stormwater BMP project.	South River	02131003	144035.62	431432.35	0.67
SH13RST070071	VBY-FY15 restoration new stormwater BMP project.	L Susquehanna River	02120201	212340.69	481127.38	0.21
SH13RST070074	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	212672.98	482273.60	0.46
SH15RST021302	VBY-FY15 restoration new stormwater BMP project.	South River	02131003	145267.18	433113.96	0.35
SH13RST030581	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	222214.19	430227.60	0.20
SH13RST070073	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	212626.83	482097.77	0.53

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST070075	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	212717.42	482450.68	0.64
SH13RST070076	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	212765.51	482625.19	0.56
SH15RST130568	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167127.02	413088.88	0.12
SH15RST130570	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	166686.68	413769.28	0.30
SH13RST030573	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	224548.31	430517.05	0.07
SH13RST030574	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	224501.56	430506.45	0.39
SH15RST160827	VBY-FY15 restoration new stormwater BMP project.	Anacostia River	02140205	141967.89	411909.99	0.71
SH15RST160830	VBY-FY15 restoration new stormwater BMP project.	Anacostia River	02140205	143688.99	411674.13	0.73
SH15RST160831	VBY-FY15 restoration new stormwater BMP project.	Anacostia River	02140205	143736.86	411600.62	0.63
SH14RST021338	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	122255.33	429745.51	0.29
SH12RST120320	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	204396.12	456924.06	0.94
SH12RST120310	VBY-FY15 restoration new stormwater BMP project.	Lower Winters Run	02130702	201433.00	458560.49	0.55
SH13RST120335	VBY-FY15 restoration new stormwater BMP project.	Lower Winters Run	02130702	201909.27	458370.75	0.30
SH13RST120341	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	204760.77	456679.18	0.85

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST120345	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	206188.96	456114.19	0.73
SH12RST120328	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	205939.62	456348.44	0.41
SH12RST120311	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	202840.89	457925.31	0.28
SH13RST070077	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	212876.15	483047.56	1.15
SH15RST021298	VBY-FY15 restoration new stormwater BMP project.	Patuxent River upper	02131104	143168.35	427703.23	0.32
SH15RST021299	VBY-FY15 restoration new stormwater BMP project.	Patuxent River upper	02131104	143219.13	428153.30	0.41
SH15RST021295	VBY-FY15 restoration new stormwater BMP project.	South River	02131003	143927.62	430950.88	0.33
SH14RST082135	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	98183.96	415303.22	0.43
SH14RST080519	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	82814.00	403854.66	0.80
SH14RST210203	VBY-FY15 restoration new stormwater BMP project.	Conococheague Creek	02140504	220797.63	334842.39	0.69
SH13RST150452	VBY-FY15 restoration new stormwater BMP project.	Potomac River MO Cnty	02140202	160055.83	381691.03	0.16
SH13RST150446	VBY-FY15 restoration new stormwater BMP project.	Seneca Creek	02140208	163368.38	376963.36	0.23
SH13RST150447	VBY-FY15 restoration new stormwater BMP project.	Seneca Creek	02140208	162646.04	379136.06	0.20
SH13RST150448	VBY-FY15 restoration new stormwater BMP project.	Seneca Creek	02140208	162602.66	379181.23	0.17

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST030582	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	221910.75	430129.14	0.19
SH13RST030585	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	221124.45	429854.48	1.24
SH13RST030583	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	221576.82	430020.70	0.22
SH14RST160400	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	136989.61	423327.34	0.91
SH14RST160411	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	136940.73	423730.78	0.73
SH14RST030568	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	225892.52	430805.64	1.30
SH14RST210209	VBY-FY15 restoration new stormwater BMP project.	Antietam Creek	02140502	220624.82	336567.11	0.30
SH13RST150445	VBY-FY15 restoration new stormwater BMP project.	Seneca Creek	02140208	163351.29	377015.54	0.14
SH13RST080522	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	84190.80	402883.73	0.31
SH12RST130533	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	179755.34	410241.30	0.54
SH14RST210204	VBY-FY15 restoration new stormwater BMP project.	Conococheague Creek	02140504	220802.96	334991.47	0.17
SH13RST080521	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	83536.72	403365.17	0.45
SH13RST130526	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	180511.31	408996.92	0.35
SH14RST210199	VBY-FY15 restoration new stormwater BMP project.	Conococheague Creek	02140504	220795.84	335444.71	0.29

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14RST210216	VBY-FY15 restoration new stormwater BMP project.	Conococheague Creek	02140504	220769.23	336282.72	0.28
SH14RST080516	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	81599.90	404121.02	0.28
SH14RST210201	VBY-FY15 restoration new stormwater BMP project.	Conococheague Creek	02140504	220798.55	335139.91	0.43
SH14RST210202	VBY-FY15 restoration new stormwater BMP project.	Conococheague Creek	02140504	220796.41	335088.75	0.19
SH14RST210208	VBY-FY15 restoration new stormwater BMP project.	Antietam Creek	02140502	220599.55	336612.63	0.04
SH13RST080524	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	84347.39	402766.66	0.23
SH13RST080525	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	84458.25	402687.07	0.43
SH13RST070046	VBY-FY15 restoration new stormwater BMP project.	L Susquehanna River	02120201	211893.55	480295.47	0.44
SH14RST210205	VBY-FY15 restoration new stormwater BMP project.	Conococheague Creek	02140504	220789.53	334981.76	0.09
SH15RST130552	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	162955.29	416847.12	0.20
SH15RST130563	VBY-FY15 restoration new stormwater BMP project.	Middle Patuxent River	02131106	169533.07	407176.15	0.12
SH15RST130549	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	163739.21	415817.36	0.95
SH13RST130521	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	181293.82	407932.93	0.42
SH13RST130527	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	180408.84	409166.00	0.51

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST130528	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	180294.02	409354.25	0.54
SH13RST130529	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	180258.98	409413.00	0.45
SH13RST130530	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	179885.12	410034.63	0.42
SH14RST160394	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	137232.19	422379.55	0.65
SH13RST030580	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	222504.44	430322.42	0.16
SH13RST070082	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	212976.08	483423.79	0.82
SH13RST070084	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	213106.90	483915.19	0.74
SH13RST070085	VBY-FY15 restoration new stormwater BMP project.	Furnace Bay	02130609	213225.53	484363.81	0.92
SH13RST082136	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	98445.53	414223.58	0.52
SH13RST082139	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	100226.58	412083.09	0.43
SH13RST030587	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	222777.37	430413.60	0.70
SH13RST030572	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	224681.02	430549.92	0.25
SH13RST030577	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	223525.31	430497.28	0.77
SH13RST030584	VBY-FY15 restoration new stormwater BMP project.	Loch Raven Reservoir	02130805	221350.87	429947.27	0.21

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST070051	VBY-FY15 restoration new stormwater BMP project.	L Susquehanna River	02120201	211978.26	480432.58	0.44
SH15RST130566	VBY-FY15 restoration new stormwater BMP project.	Middle Patuxent River	02131106	168800.72	408490.03	0.19
SH15RST130569	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167167.63	413131.81	0.37
SH15RST130571	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167717.85	411903.93	0.39
SH14RST160390	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	137238.72	421739.59	0.46
SH15RST130572	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167356.96	412589.27	0.44
SH15RST130574	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167257.06	412802.04	0.20
SH15RST130564	VBY-FY15 restoration new stormwater BMP project.	Middle Patuxent River	02131106	169201.33	407949.92	0.70
SH15RST130562	VBY-FY15 restoration new stormwater BMP project.	Middle Patuxent River	02131106	169540.01	407156.21	0.05
SH15RST130544	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	166058.41	414372.10	0.31
SH15RST130573	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167300.11	412709.56	0.20
SH15RST130577	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167534.16	412331.54	0.31
SH15RST130546	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	164436.07	415332.70	0.49
SH15RST130555	VBY-FY15 restoration new stormwater BMP project.	Middle Patuxent River	02131106	168280.54	410582.88	0.64

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15RST130557	VBY-FY15 restoration new stormwater BMP project.	Middle Patuxent River	02131106	170929.03	405252.66	0.29
SH15RST130559	VBY-FY15 restoration new stormwater BMP project.	Middle Patuxent River	02131106	170802.94	405443.37	1.11
SH15RST130575	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	167194.37	412940.30	0.20
SH15RST130551	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	163577.72	416022.22	0.38
SH15RST130561	VBY-FY15 restoration new stormwater BMP project.	Middle Patuxent River	02131106	169577.03	407049.58	0.54
SH14RST160415	VBY-FY15 restoration new stormwater BMP project.	Patuxent River upper	02131104	136811.42	424297.42	0.38
SH14RST021341	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	124601.82	429001.45	0.64
SH14RST021343	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	124736.65	428930.95	0.42
SH14RST021348	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	125767.03	427614.49	0.49
SH14RST021349	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	125801.64	427563.54	0.06
SH14RST021351	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	125825.18	427531.64	0.05
SH14RST021354	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	125851.05	427494.22	0.31
SH14RST021359	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	125931.60	427378.91	0.18
SH14RST021364	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	126013.75	427265.55	0.35

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14RST021369	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	126378.42	426788.56	0.32
SH14RST021370	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	126761.80	426249.77	0.34
SH14RST021371	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	126926.70	425889.86	0.50
SH14RST021374	VBY-FY15 restoration new stormwater BMP project.	Patuxent River middle	02131102	127034.54	425465.89	0.68
SH15RST160886	VBY-FY15 restoration new stormwater BMP project.	Western Branch	02131103	136222.67	414858.53	0.99
SH15RST021449	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	147545.67	425848.76	1.00
SH15RST021450	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	147765.71	425893.44	0.37
SH15RST021451	VBY-FY15 restoration new stormwater BMP project.	Little Patuxent River	02131105	147882.71	425916.81	0.23
SH14RST082128	VBY-FY15 restoration new stormwater BMP project.	Patuxent River lower	02131101	94214.15	419652.50	0.75
SH14RST082122	VBY-FY15 restoration new stormwater BMP project.	Patuxent River lower	02131101	93477.34	419641.81	0.45
SH14RST082123	VBY-FY15 restoration new stormwater BMP project.	Patuxent River lower	02131101	93554.81	419643.08	0.27
SH14RST082124	VBY-FY15 restoration new stormwater BMP project.	Patuxent River lower	02131101	93663.90	419644.78	0.17
SH14RST082125	VBY-FY15 restoration new stormwater BMP project.	Patuxent River lower	02131101	93835.60	419647.98	0.26
SH14RST082126	VBY-FY15 restoration new stormwater BMP project.	Patuxent River lower	02131101	93943.54	419649.48	0.26

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14RST082127	VBY-FY15 restoration new stormwater BMP project.	Patuxent River lower	02131101	94096.86	419651.30	0.44
SH13RST082140	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	103676.55	411143.98	0.16
SH13RST082141	VBY-FY15 restoration new stormwater BMP project.	Zekiah Swamp	02140108	103784.39	411107.38	0.98
SH14RST080513	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	80733.08	404005.84	0.44
SH12RST080506	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	78496.15	403637.13	0.62
SH14RST080507	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	79522.68	403820.53	0.48
SH14RST080508	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	79817.08	403865.76	0.50
SH14RST080512	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	80556.53	403977.70	0.36
SH12RST080501	VBY-FY15 restoration new stormwater BMP project.	Potomac River L tidal	02140101	77797.42	403127.66	0.25
SH12RST080502	VBY-FY15 restoration new stormwater BMP project.	Potomac River L tidal	02140101	77881.55	403228.15	0.28
SH12RST080503	VBY-FY15 restoration new stormwater BMP project.	Potomac River L tidal	02140101	78016.19	403360.71	0.31
SH12RST080504	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	78143.66	403459.97	0.44
SH12RST080505	VBY-FY15 restoration new stormwater BMP project.	Wicomico River	02140106	78314.87	403559.08	0.33
SH13RST120347	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	206309.52	455943.64	0.62

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13RST120349	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	207070.10	454996.18	0.35
SH13RST120343	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	205285.84	456547.86	0.23
SH13RST120337	VBY-FY15 restoration new stormwater BMP project.	Lower Winters Run	02130702	202263.61	458201.68	0.24
SH13RST120333	VBY-FY15 restoration new stormwater BMP project.	Lower Winters Run	02130702	201323.68	458590.40	0.31
SH12RST120315	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	203772.38	457454.22	0.47
SH12RST120314	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	203298.50	457707.55	0.24
SH12RST120321	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	205083.09	456598.28	0.29
SH12RST120313	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	203041.47	457832.11	0.37
SH12RST120312	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	202916.41	457893.27	0.15
SH12RST120318	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	204183.55	457117.17	0.11
SH12RST120319	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	204374.02	456943.95	0.15
SH12RST120324	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	207292.54	454748.82	0.21
SH12RST120317	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	203866.56	457392.36	0.28
SH12RST120323	VBY-FY15 restoration new stormwater BMP project.	Atkisson Reservoir	02130703	206873.42	455220.11	0.14
SH16RST021617	Stormwater - Grass Swale	Severn River	02131002	155985.29	431579.77	0.55

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16RST021571	Stormwater - Grass Swale	Baltimore Harbor	02130903	169617.20	431745.51	0.30
SH16RST021576	Stormwater - Grass Swale	Baltimore Harbor	02130903	165757.49	430672.37	0.97
SH16RST021577	Stormwater - Grass Swale	Baltimore Harbor	02130903	165499.54	430632.39	0.40
SH16RST021583	Stormwater - Grass Swale	Baltimore Harbor	02130903	161490.07	431286.72	0.76
SH16RST021584	Stormwater - Grass Swale	Baltimore Harbor	02130903	161300.63	431357.03	0.55
SH16RST021585	Stormwater - Grass Swale	Baltimore Harbor	02130903	161098.56	431439.00	1.06
SH16RST021586	Stormwater - Grass Swale	Baltimore Harbor	02130903	160573.14	431676.27	0.35
SH16RST021587	Stormwater - Grass Swale	Baltimore Harbor	02130903	160459.64	431727.11	0.42
SH16RST021588	Stormwater - Grass Swale	Severn River	02131002	155848.66	431399.00	0.53
SH16RST021591	Stormwater - Grass Swale	Severn River	02131002	155200.08	431095.53	0.60
SH16RST021592	Stormwater - Grass Swale	Severn River	02131002	154236.04	431991.02	0.40
SH16RST021593	Stormwater - Grass Swale	Severn River	02131002	154103.77	432089.95	0.23
SH16RST021575	Stormwater - Grass Swale	Baltimore Harbor	02130903	168421.04	431739.57	0.25
SH16RST021579	Stormwater - Grass Swale	Baltimore Harbor	02130903	163399.09	430765.39	1.14
SH16RST021580	Stormwater - Grass Swale	Baltimore Harbor	02130903	163191.05	430787.97	0.56
SH17RST021600	Stormwater - Grass Swale	South River	02131003	151192.26	433358.87	0.34
SH17RST021615	Stormwater - Grass Swale	South River	02131003	147853.75	435442.04	0.41
SH17RST021616	Stormwater - Grass Swale	Baltimore Harbor	02130903	160792.95	431577.67	1.30
SH17RST021610	Stormwater - Grass Swale	South River	02131003	148618.00	434601.51	0.39
SH17RST021611	Stormwater - Grass Swale	South River	02131003	148475.16	434749.70	0.79
SH17RST021612	Stormwater - Grass Swale	South River	02131003	148326.82	434876.18	0.28
SH17RST021614	Stormwater - Grass Swale	South River	02131003	147954.13	435241.47	0.83
SH17RST021594	Stormwater - Grass Swale	Severn River	02131002	153813.29	432308.23	0.29
SH17RST021595	Stormwater - Grass Swale	South River	02131003	152591.33	433420.69	0.25
SH17RST021596	Stormwater - Grass Swale	South River	02131003	152084.61	433550.56	0.53

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH17RST021598	Stormwater - Grass Swale	South River	02131003	151620.22	433514.54	0.51
SH17RST021599	Stormwater - Grass Swale	South River	02131003	151394.78	433441.33	0.66
SH17RST021601	Stormwater - Grass Swale	South River	02131003	150992.47	433296.17	0.80
SH17RST021602	Stormwater - Grass Swale	South River	02131003	150769.45	433299.31	0.22
SH17RST021603	Stormwater - Grass Swale	South River	02131003	150577.49	433336.85	0.71
SH17RST021604	Stormwater - Grass Swale	South River	02131003	150348.41	433383.66	0.42
SH17RST021605	Stormwater - Grass Swale	South River	02131003	149745.86	433507.27	0.48
SH17RST021606	Stormwater - Grass Swale	South River	02131003	149213.27	433635.59	0.64
SH17RST021607	Stormwater - Grass Swale	South River	02131003	149055.14	433743.91	0.52
SH17RST021608	Stormwater - Grass Swale	South River	02131003	148836.62	434143.98	0.47
SH17RST021597	Stormwater - Grass Swale	South River	02131003	151799.46	433546.26	0.76
SH19RST020044	Retrofit	Severn River	02131002	157244.12	427497.72	1.71
SH16RST020090	Retrofit	Severn River	02131002	155529.16	430566.81	2.78
SH16RST020163	Retrofit	South River	02131003	149355.98	433629.39	1.52
SH16RST020221	Retrofit	Severn River	02131002	153637.30	432492.82	0.73
SH18RST020232	Retrofit	Baltimore Harbor	02130903	166889.23	430950.77	6.03
SH19RST020235	Retrofit	Baltimore Harbor	02130903	162605.56	430836.18	7.24
SH16RST020252	Retrofit	South River	02131003	146510.08	438730.38	3.37
SH19RST020253	Retrofit	Severn River	02131002	150989.63	448602.34	2.79
SH19RST020254	Retrofit	Severn River	02131002	150997.36	448486.77	4.75
SH16RST020262	Retrofit	South River	02131003	146277.05	439107.18	1.98
SH16RST020266	Retrofit	South River	02131003	146243.11	438968.32	1.10
SH16RST020269	Retrofit	South River	02131003	146311.34	438355.84	19.84
SH16RST020337	Retrofit	Patuxent River middle	02131102	126163.71	427008.74	1.20
SH16RST020438	Retrofit	Severn River	02131002	154974.35	431285.78	11.02

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18RST020525	Retrofit	South River	02131003	145235.28	439310.86	0.87
SH16RST020547	Retrofit	Baltimore Harbor	02130903	162247.60	430927.95	16.80
SH19RST020566	Retrofit	Baltimore Harbor	02130903	170917.92	431097.15	4.90
SH17RST030181	Retrofit	Bird River	02130803	189787.86	448217.96	1.84
SH17RST030186	Retrofit	Bird River	02130803	190008.66	448423.09	0.88
SH17RST030230	Retrofit	Back River	02130901	185031.25	444228.81	2.90
SH17RST030267	Retrofit	Loch Raven Reservoir	02130805	193908.13	434579.05	1.90
SH19RST060149	Retrofit	S Branch Patapsco	02130908	195513.69	399334.55	1.19
SH19RST100035	Retrofit	Lower Monocacy River	02140302	207300.38	373258.62	2.33
SH18RST100037	Retrofit	Lower Monocacy River	02140302	206029.91	372864.27	0.80
SH19RST100038	Retrofit	Upper Monocacy River	02140303	201812.52	370337.48	4.78
SH19RST100171	Retrofit	Lower Monocacy River	02140302	188759.24	383492.25	10.03
SH17RST120055	Retrofit	Deer Creek	02120202	210389.84	464481.73	0.83
SH17RST120094	Retrofit	Lower Winters Run	02130702	196802.07	456546.22	2.60
SH18RST120103	Retrofit	Bynum Run	02130704	208360.73	457544.83	1.38
SH18RST120104	Retrofit	Bynum Run	02130704	208480.04	457742.18	1.00
SH18RST120136	Retrofit	Deer Creek	02120202	210045.21	465575.40	1.69
SH16RST150021	Retrofit	Rock Creek	02140206	160507.76	393500.69	0.61
SH16RST150023	Retrofit	Anacostia River	02140205	161792.04	393727.25	9.43
SH16RST150026	Retrofit	Cabin John Creek	02140207	154321.19	386751.45	2.29
SH16RST150029	Retrofit	Cabin John Creek	02140207	154172.08	386587.08	0.88
SH19RST150204	Retrofit	Seneca Creek	02140208	168762.16	377879.20	5.75
SH16RST150342	Retrofit	Rock Creek	02140206	160128.28	393188.53	2.66
SH16RST150343	Retrofit	Rock Creek	02140206	160328.59	393480.09	2.40
SH16RST160101	Retrofit	Anacostia River	02140205	132813.54	408582.64	5.98

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19RST160160	Retrofit	Western Branch	02131103	132351.77	408428.92	1.25
SH16RST160170	Retrofit	Patuxent River upper	02131104	158886.89	413133.26	0.07
SH16RST160171	Retrofit	Patuxent River upper	02131104	158942.58	413179.94	0.14
SH19RST160177	Retrofit	Anacostia River	02140205	150402.24	405410.15	1.76
SH16RST160189	Retrofit	Piscataway Creek	02140203	121223.53	410451.60	0.50
SH16RST160190	Retrofit	Piscataway Creek	02140203	119758.58	410493.58	0.20
SH16RST160210	Retrofit	Western Branch	02131103	142074.86	413805.95	1.81
SH19RST160453	Retrofit	Mattawoman Creek	02140111	110366.61	398685.69	1.58
SH19RST160656	Retrofit	Anacostia River	02140205	150472.98	404990.58	1.82
SH16RST160702	Retrofit	Anacostia River	02140205	147483.15	408515.21	2.40
SH18RST160737	Retrofit	Piscataway Creek	02140203	122199.49	410123.85	25.30
SH18RST210001	Retrofit	Conococheague Creek	02140504	220473.79	331330.69	3.55
SH18RST210015	Retrofit	Marsh Run	02140503	216020.27	335708.08	2.55
SH18RST210017	Retrofit	Antietam Creek	02140502	222826.28	340058.25	9.03
SH18RST210200	Retrofit	Little Tonoloway Creek	02140509	226240.49	293338.11	1.61
SH18RST210213	Retrofit	Conococheague Creek	02140504	217893.25	333541.11	1.36
SH11APY000231	Tree Planting	Loch Raven Reservoir	02130805	200724.15	429549.85	0.20
SH11APY000232	Tree Planting	Lower Monocacy River	02140302	192317.80	362994.70	2.22
SH11APY000233	Tree Planting	Lower Monocacy River	02140302	192485.66	363106.76	1.92
SH11APY000234	Tree Planting	Lower Monocacy River	02140302	192631.87	363075.76	0.62
SH11APY000235	Tree Planting	Lower Monocacy River	02140302	192443.15	363236.12	0.23
SH11APY000236	Tree Planting	Lower Monocacy River	02140302	192410.85	363412.09	0.60
SH11APY000237	Tree Planting	Lower Monocacy River	02140302	192084.53	363675.83	2.11
SH11APY000238	Tree Planting	Lower Monocacy River	02140302	192121.29	363829.13	0.44
SH11APY000239	Tree Planting	Lower Monocacy River	02140302	192192.70	363756.37	1.16

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH11APY000240	Tree Planting	Lower Monocacy River	02140302	192293.47	363635.28	0.22
SH11APY000241	Tree Planting	Lower Monocacy River	02140302	192218.35	363427.57	0.52
SH11APY000242	Tree Planting	Lower Monocacy River	02140302	192307.07	363489.40	0.42
SH11APY000243	Tree Planting	Lower Monocacy River	02140302	192304.36	363330.37	0.12
SH11APY000244	Tree Planting	Lower Monocacy River	02140302	192368.15	363293.65	0.13
SH11APY000245	Tree Planting	Lower Monocacy River	02140302	192422.21	362984.90	0.43
SH11APY000248	Tree Planting	Lower Susquehanna River	02120201	214768.58	474368.11	1.23
SH11APY000249	Tree Planting	Lower Susquehanna River	02120201	214691.28	474353.39	1.19
SH11APY000250	Tree Planting	Lower Susquehanna River	02120201	214758.43	474573.15	1.16
SH11APY000251	Tree Planting	Lower Susquehanna River	02120201	214401.89	474134.89	1.81
SH11APY000252	Tree Planting	Lower Susquehanna River	02120201	214220.61	473984.00	3.65
SH11APY000253	Tree Planting	Lower Susquehanna River	02120201	214928.58	473306.29	2.80
SH11APY000254	Tree Planting	Lower Susquehanna River	02120201	214806.95	473224.56	2.84
SH11APY000255	Tree Planting	Lower Susquehanna River	02120201	214820.93	473449.24	1.91
SH11APY000256	Tree Planting	Lower Susquehanna River	02120201	214701.41	473520.95	5.74
SH11APY000257	Tree Planting	Lower Susquehanna River	02120201	214680.07	473189.64	2.88
SH11APY000258	Tree Planting	Little Gunpowder Falls	02130804	194117.84	454474.84	1.13
SH11APY000259	Tree Planting	Little Gunpowder Falls	02130804	193984.91	454490.44	1.01
SH11APY000260	Tree Planting	Lower Susquehanna River	02120201	214716.11	474110.66	2.81
SH11APY000261	Tree Planting	Little Patuxent River	02131105	167675.63	411942.82	1.66
SH11APY000262	Tree Planting	Little Patuxent River	02131105	167160.12	412706.88	0.11
SH11APY000263	Tree Planting	Middle Patuxent River	02131106	168398.17	409330.96	0.26
SH11APY000264	Tree Planting	Middle Patuxent River	02131106	184554.87	397941.21	0.07
SH11APY000265	Tree Planting	Middle Patuxent River	02131106	183078.46	402136.04	0.09
SH11APY000266	Tree Planting	Middle Patuxent River	02131106	182783.62	402684.90	0.26

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH11APY000267	Tree Planting	Little Patuxent River	02131105	181966.16	409351.65	0.14
SH11APY000268	Tree Planting	S Branch Patapsco	02130908	183775.20	400141.22	0.14
SH11APY000269	Tree Planting	Little Patuxent River	02131105	175888.69	415272.42	1.69
SH11APY000270	Tree Planting	Little Patuxent River	02131105	173965.44	416099.12	0.43
SH11APY000271	Tree Planting	Rocky Gorge Dam	02131107	164096.24	408452.56	0.34
SH11APY000272	Tree Planting	Rocky Gorge Dam	02131107	163902.34	408326.51	0.12
SH11APY000273	Tree Planting	Rocky Gorge Dam	02131107	164191.41	408182.23	0.24
SH11APY000274	Tree Planting	Little Patuxent River	02131105	174683.57	415913.90	0.32
SH11APY000275	Tree Planting	Little Patuxent River	02131105	164328.55	408807.27	0.64
SH11APY000276	Tree Planting	Patuxent River upper	02131104	162349.98	411706.93	0.94
SH11APY000277	Tree Planting	Patuxent River upper	02131104	162117.31	412140.60	0.10
SH11APY000278	Tree Planting	Patapsco River L N Br	02130906	169121.58	419442.62	0.44
SH11APY000279	Tree Planting	Little Patuxent River	02131105	164035.41	409136.42	0.12
SH11APY000280	Tree Planting	Little Patuxent River	02131105	164110.39	409582.20	0.03
SH11APY000281	Tree Planting	Little Patuxent River	02131105	164093.32	409662.83	0.02
SH11APY000282	Tree Planting	Little Patuxent River	02131105	163981.61	409870.81	0.05
SH11APY000283	Tree Planting	Little Patuxent River	02131105	164013.57	409901.25	0.06
SH11APY000284	Tree Planting	Little Patuxent River	02131105	163884.85	410097.06	0.09
SH11APY000285	Tree Planting	Little Patuxent River	02131105	163715.32	410432.10	0.15
SH11APY000286	Tree Planting	Little Patuxent River	02131105	163499.23	410845.55	0.09
SH11APY000287	Tree Planting	Patapsco River L N Br	02130906	170643.98	419454.07	0.48
SH11APY000288	Tree Planting	Little Patuxent River	02131105	175299.36	415853.00	0.25
SH11APY000289	Tree Planting	Little Patuxent River	02131105	167327.38	412712.19	1.98
SH11APY000290	Tree Planting	Little Patuxent River	02131105	164203.91	408733.21	1.16
SH11APY000291	Tree Planting	Rocky Gorge Dam	02131107	164083.55	408820.29	0.08

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH11APY000292	Tree Planting	Little Patuxent River	02131105	164150.92	408668.38	0.05
SH11APY000293	Tree Planting	Little Patuxent River	02131105	165523.33	409673.13	0.44
SH11APY000294	Tree Planting	Little Patuxent River	02131105	167162.06	413076.03	2.00
SH11APY000295	Tree Planting	Middle Patuxent River	02131106	168379.45	409618.58	0.10
SH11APY000296	Tree Planting	Middle Patuxent River	02131106	182987.19	402307.99	0.07
SH11APY000297	Tree Planting	Little Patuxent River	02131105	167537.54	412247.89	1.54
SH11APY000298	Tree Planting	Little Patuxent River	02131105	174346.51	416028.72	0.28
SH11APY000299	Tree Planting	Patapsco River L N Br	02130906	172605.88	422227.57	2.82
SH11APY000300	Tree Planting	Little Patuxent River	02131105	174768.59	415917.83	0.21
SH11APY000301	Tree Planting	Middle Patuxent River	02131106	182698.81	402848.79	0.03
SH11APY000302	Tree Planting	Cabin John Creek	02140207	153900.95	389952.44	0.19
SH11APY000303	Tree Planting	Rock Creek	02140206	153826.36	389987.07	0.14
SH11APY000305	Tree Planting	Rock Creek	02140206	153858.54	390053.53	0.13
SH11APY000306	Tree Planting	Cabin John Creek	02140206	153798.59	389858.82	0.07
SH11APY000308	Tree Planting	Rock Creek	02140206	153928.15	389989.48	0.26
SH11APY000309	Tree Planting	Cabin John Creek	02140207	154020.71	389796.96	0.08
SH11APY000310	Tree Planting	Cabin John Creek	02140207	153965.57	389827.62	0.04
SH11APY000311	Tree Planting	Anacostia River	02140205	142555.13	412106.94	0.47
SH11APY000312	Tree Planting	Anacostia River	02140205	142469.56	412133.65	0.68
SH11APY000313	Tree Planting	Anacostia River	02140205	142668.38	411924.47	0.41
SH11APY000314	Tree Planting	Anacostia River	02140205	142495.23	411993.24	0.30
SH11APY000315	Tree Planting	Anacostia River	02140205	142138.14	412108.84	0.02
SH11APY000316	Tree Planting	Anacostia River	02140205	142231.93	412273.58	0.80
SH11APY000317	Tree Planting	Anacostia River	02140205	142250.69	412301.37	0.02
SH11APY000318	Tree Planting	Anacostia River	02140205	142157.29	412153.42	0.29

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH11APY000319	Tree Planting	Anacostia River	02140205	142029.73	412090.62	0.34
SH11APY000320	Tree Planting	Anacostia River	02140205	142044.85	412178.89	0.33
SH11APY000321	Tree Planting	Anacostia River	02140205	142005.44	412127.83	0.30
SH11APY000322	Tree Planting	Anacostia River	02140205	142056.78	412347.05	0.82
SH11APY000323	Tree Planting	Anacostia River	02140205	142143.14	412297.16	0.40
SH11APY000324	Tree Planting	Anacostia River	02140205	142055.53	412459.62	0.58
SH11APY000325	Tree Planting	Anacostia River	02140205	142100.13	412514.31	0.16
SH11APY000326	Tree Planting	Anacostia River	02140205	142218.93	412405.63	0.02
SH11APY000327	Tree Planting	Anacostia River	02140205	142027.44	412533.87	0.11
SH11APY000328	Tree Planting	Anacostia River	02140205	141882.48	412194.87	0.50
SH11APY000329	Tree Planting	Anacostia River	02140205	141918.04	412252.18	0.09
SH11APY000330	Tree Planting	Anacostia River	02140205	141797.37	412283.79	0.47
SH11APY000332	Tree Planting	Anacostia River	02140205	141829.31	412165.37	0.03
SH11APY000333	Tree Planting	Anacostia River	02140205	141574.62	412338.18	0.87
SH11APY000334	Tree Planting	Anacostia River	02140205	141812.39	412415.83	0.75
SH11APY000335	Tree Planting	Anacostia River	02140205	141885.20	412404.10	0.25
SH11APY000336	Tree Planting	Anacostia River	02140205	141929.31	412382.78	0.40
SH11APY000337	Tree Planting	Anacostia River	02140205	141636.43	412486.17	1.10
SH11APY000338	Tree Planting	Anacostia River	02140205	141869.57	412009.46	0.32
SH11APY000339	Tree Planting	Anacostia River	02140205	141902.43	412072.00	0.09
SH11APY000340	Tree Planting	Anacostia River	02140205	141957.59	411861.87	0.15
SH11APY000341	Tree Planting	Anacostia River	02140205	142054.16	412054.96	0.14
SH11APY003001	Tree Planting	Liberty Reservoir	02130907	199462.92	399784.47	4.42
SH11APY003002	Tree Planting	Liberty Reservoir	02130907	201572.62	400936.00	1.45
SH11APY003007	Tree Planting	Potomac River L tidal	02140101	85464.64	393785.62	0.08

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH11APY003008	Tree Planting	Potomac River L tidal	02140101	85392.49	393958.55	0.04
SH11APY003009	Tree Planting	Nanjemoy Creek	02140110	86502.22	393184.79	0.30
SH11APY003010	Tree Planting	Lower Susquehanna River	02120201	214111.92	474130.79	1.10
SH11APY003011	Tree Planting	Lower Susquehanna River	02120201	214067.53	473943.57	3.36
SH11APY003012	Tree Planting	Lower Susquehanna River	02120201	214400.45	473891.20	2.24
SH11APY003013	Tree Planting	Lower Susquehanna River	02120201	214258.58	473826.48	1.29
SH11APY003014	Tree Planting	Deer Creek	02120202	217092.45	461948.62	5.20
SH11APY003019	Tree Planting	Liberty Reservoir	02130907	201218.09	400562.09	4.30
SH11APY003020	Tree Planting	Liberty Reservoir	02130907	201380.35	400683.05	0.91
SH11APY003021	Tree Planting	Liberty Reservoir	02130907	201406.96	400611.99	1.18
SH11APY003022	Tree Planting	Liberty Reservoir	02130907	201468.09	400551.99	1.66
SH12APY000342	Tree Planting	Patapsco River L N Br	02130906	172520.64	429528.43	0.37
SH12APY000343	Tree Planting	Patapsco River L N Br	02130906	172370.32	429583.42	0.47
SH12APY000344	Tree Planting	Patapsco River L N Br	02130906	172318.20	429454.14	0.52
SH12APY000345	Tree Planting	Baltimore Harbor	02130903	170843.48	431010.34	0.21
SH12APY000346	Tree Planting	Baltimore Harbor	02130903	170421.22	431746.74	0.28
SH12APY000347	Tree Planting	Baltimore Harbor	02130903	167183.80	431237.98	0.20
SH12APY000348	Tree Planting	Baltimore Harbor	02130903	164421.12	430650.33	0.05
SH12APY000349	Tree Planting	Baltimore Harbor	02130903	164320.34	430650.40	0.06
SH12APY000350	Tree Planting	Baltimore Harbor	02130903	164014.62	430615.84	0.76
SH12APY000352	Tree Planting	Baltimore Harbor	02130903	165743.45	434257.99	0.71
SH12APY000353	Tree Planting	Baltimore Harbor	02130903	163076.56	435556.55	0.10
SH12APY000354	Tree Planting	Baltimore Harbor	02130903	163032.69	434645.40	0.30
SH12APY000355	Tree Planting	Patapsco River L N Br	02130906	166552.24	423974.85	0.04
SH12APY000356	Tree Planting	Patapsco River L N Br	02130906	166686.03	424029.64	0.01

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH12APY000357	Tree Planting	Severn River	02131002	155935.35	434341.69	0.63
SH12APY000358	Tree Planting	Lower Gunpowder Falls	02130802	194981.67	449431.84	17.15
SH12APY000359	Tree Planting	Gunpowder River	02130801	188222.81	455121.35	7.64
SH12APY000360	Tree Planting	Jones Falls	02130904	194017.79	429095.06	0.24
SH12APY000361	Tree Planting	Jones Falls	02130904	193990.72	428877.51	0.01
SH12APY000362	Tree Planting	Jones Falls	02130904	194114.48	428794.09	0.12
SH12APY000363	Tree Planting	Jones Falls	02130904	193968.68	428804.27	0.30
SH12APY000364	Tree Planting	Jones Falls	02130904	193420.26	429011.14	0.67
SH12APY000365	Tree Planting	Jones Falls	02130904	193604.85	429070.22	0.55
SH12APY000366	Tree Planting	Jones Falls	02130904	193638.74	429122.26	0.03
SH12APY000367	Tree Planting	Jones Falls	02130904	193363.87	429199.60	0.07
SH12APY000368	Tree Planting	Jones Falls	02130904	193061.35	429072.08	0.26
SH12APY000369	Tree Planting	Jones Falls	02130904	192514.29	428937.05	0.50
SH12APY000370	Tree Planting	Jones Falls	02130904	192500.92	429049.71	0.15
SH12APY000371	Tree Planting	Jones Falls	02130904	192390.47	428887.46	0.12
SH12APY000372	Tree Planting	Jones Falls	02130904	191153.18	428935.06	0.22
SH12APY000373	Tree Planting	Jones Falls	02130904	190921.91	429010.88	0.08
SH12APY000374	Tree Planting	Jones Falls	02130904	190249.76	429211.53	0.45
SH12APY000376	Tree Planting	Jones Falls	02130904	189685.35	429839.17	0.21
SH12APY000377	Tree Planting	Gwynns Falls	02130905	189738.21	421512.25	0.20
SH12APY000378	Tree Planting	Gwynns Falls	02130905	191070.34	420577.17	2.95
SH12APY000379	Tree Planting	Gwynns Falls	02130905	190715.84	420913.60	1.26
SH12APY000380	Tree Planting	Deer Creek	02120202	227905.82	429580.40	0.43
SH12APY000381	Tree Planting	Loch Raven Reservoir	02130805	226299.14	430322.22	0.35
SH12APY000382	Tree Planting	Loch Raven Reservoir	02130805	202825.56	428690.11	0.22

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH12APY000383	Tree Planting	Jones Falls	02130904	196726.77	431437.60	0.11
SH12APY000384	Tree Planting	Loch Raven Reservoir	02130805	209005.39	428581.27	0.55
SH12APY000385	Tree Planting	Loch Raven Reservoir	02130805	215127.54	429303.11	0.24
SH12APY000386	Tree Planting	Loch Raven Reservoir	02130805	216353.56	428932.89	0.12
SH12APY000387	Tree Planting	Loch Raven Reservoir	02130805	217669.73	428414.01	0.62
SH12APY000388	Tree Planting	Loch Raven Reservoir	02130805	220512.55	429100.80	0.17
SH12APY000389	Tree Planting	Loch Raven Reservoir	02130805	221701.01	430098.04	0.13
SH12APY000390	Tree Planting	Loch Raven Reservoir	02130805	222563.16	430377.63	0.47
SH12APY000391	Tree Planting	Loch Raven Reservoir	02130805	222753.76	430441.40	0.10
SH12APY000392	Tree Planting	Loch Raven Reservoir	02130805	223069.90	430525.42	0.10
SH12APY000393	Tree Planting	Loch Raven Reservoir	02130805	223810.00	430441.81	0.32
SH12APY000394	Tree Planting	Deer Creek	02120202	226922.79	430252.09	0.49
SH12APY000395	Tree Planting	Loch Raven Reservoir	02130805	226249.92	430541.02	0.93
SH12APY000396	Tree Planting	Deer Creek	02120202	227930.95	429809.39	0.19
SH12APY000397	Tree Planting	Loch Raven Reservoir	02130805	206566.06	429166.80	0.31
SH12APY000399	Tree Planting	Gwynns Falls	02130905	189702.79	421850.94	0.38
SH12APY000401	Tree Planting	Jones Falls	02130904	192005.35	426657.76	0.14
SH12APY000402	Tree Planting	Gwynns Falls	02130905	190668.81	422807.55	0.28
SH12APY000403	Tree Planting	Gwynns Falls	02130905	190608.81	422860.33	0.28
SH12APY000404	Tree Planting	Loch Raven Reservoir	02130805	198582.85	430288.22	0.15
SH12APY000405	Tree Planting	Loch Raven Reservoir	02130805	200658.88	429561.64	0.10
SH12APY000406	Tree Planting	Loch Raven Reservoir	02130805	200722.54	429537.39	0.04
SH12APY000407	Tree Planting	Loch Raven Reservoir	02130805	199749.76	429215.12	0.34
SH12APY000408	Tree Planting	Loch Raven Reservoir	02130805	200319.83	429185.48	0.05
SH12APY000409	Tree Planting	Loch Raven Reservoir	02130805	200180.58	429128.13	0.03

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH12APY000410	Tree Planting	Jones Falls	02130904	193503.51	429137.79	0.23
SH12APY000414	Tree Planting	Big Elk Creek	02130606	228089.70	499406.13	1.13
SH12APY000415	Tree Planting	Big Elk Creek	02130606	227154.76	498505.75	1.32
SH12APY000416	Tree Planting	Potomac River M tidal	02140102	87967.77	376896.14	1.34
SH12APY000417	Tree Planting	Mattawoman Creek	02140111	101043.88	386444.64	8.78
SH12APY000418	Tree Planting	Potomac River M tidal	02140102	105901.93	389922.94	2.16
SH12APY000419	Tree Planting	Mattawoman Creek	02140111	100085.72	392563.00	0.35
SH12APY000420	Tree Planting	Patuxent River lower	02131101	97196.39	418470.03	0.41
SH12APY000421	Tree Planting	Patuxent River lower	02131101	96386.52	419180.15	0.32
SH12APY000422	Tree Planting	Patuxent River lower	02131101	96202.17	419319.07	0.08
SH12APY000423	Tree Planting	Patuxent River lower	02131101	96217.10	419370.30	0.27
SH12APY000424	Tree Planting	Zekiah Swamp	02140108	104953.97	410594.96	0.16
SH12APY000425	Tree Planting	Zekiah Swamp	02140108	104787.14	410717.70	0.50
SH12APY000426	Tree Planting	Potomac River L tidal	02140101	85555.77	395166.74	1.66
SH12APY000427	Tree Planting	Nanjemoy Creek	02140110	86728.51	393283.90	1.23
SH12APY000428	Tree Planting	Port Tobacco River	02140109	86853.42	395685.70	0.04
SH12APY000429	Tree Planting	Port Tobacco River	02140109	86284.02	395759.65	1.67
SH12APY000430	Tree Planting	Port Tobacco River	02140109	86622.41	396201.83	0.32
SH12APY000431	Tree Planting	Potomac River M tidal	02140102	105680.12	389578.05	2.71
SH12APY000432	Tree Planting	Mattawoman Creek	02140111	99440.44	392742.41	0.25
SH12APY000433	Tree Planting	Mattawoman Creek	02140111	99372.77	392839.41	0.15
SH12APY000434	Tree Planting	Mattawoman Creek	02140111	99271.23	392772.98	0.05
SH12APY000435	Tree Planting	Mattawoman Creek	02140111	98930.47	392777.92	0.46
SH12APY000436	Tree Planting	Mattawoman Creek	02140111	98300.38	392771.45	0.32
SH12APY000437	Tree Planting	Mattawoman Creek	02140111	97997.68	392685.24	0.08

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH12APY000439	Tree Planting	Potomac River L tidal	02140101	85259.70	394032.14	2.72
SH12APY000440	Tree Planting	Potomac River L tidal	02140101	85928.25	395682.10	0.95
SH12APY000441	Tree Planting	Potomac River L tidal	02140101	84757.44	393672.35	0.81
SH12APY000442	Tree Planting	Potomac River L tidal	02140101	84759.88	394296.96	0.84
SH12APY000443	Tree Planting	Potomac River L tidal	02140101	85140.84	394677.24	1.03
SH12APY000444	Tree Planting	Potomac River L tidal	02140101	84820.72	393943.85	0.48
SH12APY000445	Tree Planting	Potomac River L tidal	02140101	86145.61	396007.76	0.64
SH12APY000446	Tree Planting	Potomac River L tidal	02140101	85082.88	394275.27	0.39
SH12APY000447	Tree Planting	Potomac River L tidal	02140101	84410.77	393974.29	0.32
SH12APY000448	Tree Planting	Potomac River L tidal	02140101	84715.15	393793.31	0.37
SH12APY000449	Tree Planting	Potomac River L tidal	02140101	85095.38	393899.33	0.24
SH12APY000450	Tree Planting	Potomac River L tidal	02140101	85185.60	394269.42	0.10
SH12APY000451	Tree Planting	Potomac River L tidal	02140101	85281.65	394151.15	0.19
SH12APY000452	Tree Planting	Potomac River L tidal	02140101	85749.45	395472.48	0.13
SH12APY000453	Tree Planting	Potomac River L tidal	02140101	84591.54	393617.08	0.04
SH12APY000454	Tree Planting	Potomac River L tidal	02140101	85648.48	395358.85	0.09
SH12APY000455	Tree Planting	Nanjemoy Creek	02140110	86341.05	392856.56	1.01
SH12APY000456	Tree Planting	Nanjemoy Creek	02140110	86362.34	393040.60	0.56
SH12APY000457	Tree Planting	Nanjemoy Creek	02140110	86460.38	392754.41	0.21
SH12APY000458	Tree Planting	Nanjemoy Creek	02140110	86495.72	392987.25	0.12
SH12APY000462	Tree Planting	Mattawoman Creek	02140111	98664.89	392792.85	0.24
SH12APY000463	Tree Planting	Deer Creek	02120202	217380.81	462598.97	2.81
SH12APY000464	Tree Planting	Deer Creek	02120202	217535.16	462327.35	4.94
SH12APY000465	Tree Planting	Little Patuxent River	02131105	165602.11	409520.79	0.11
SH12APY000466	Tree Planting	Little Patuxent River	02131105	167948.98	410774.72	0.21

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH12APY000467	Tree Planting	Little Patuxent River	02131105	170170.46	412016.09	0.23
SH12APY000468	Tree Planting	Little Patuxent River	02131105	176028.09	415380.72	0.72
SH12APY000469	Tree Planting	Little Patuxent River	02131105	175846.24	415486.13	0.40
SH12APY000470	Tree Planting	Little Patuxent River	02131105	176049.25	415248.21	0.75
SH12APY000471	Tree Planting	Middle Patuxent River	02131106	165634.83	409538.23	0.14
SH12APY000472	Tree Planting	Little Patuxent River	02131105	167881.39	410737.95	0.08
SH12APY000473	Tree Planting	Little Patuxent River	02131105	165481.48	409471.69	0.00
SH12APY000474	Tree Planting	Little Patuxent River	02131105	165508.03	409495.14	0.01
SH12APY000475	Tree Planting	Anacostia River	02140205	152719.17	400656.84	0.27
SH12APY000476	Tree Planting	Anacostia River	02140205	160299.04	406113.03	0.14
SH12APY000477	Tree Planting	Rocky Gorge Dam	02131107	160514.26	406184.69	0.14
SH12APY000478	Tree Planting	Rocky Gorge Dam	02131107	160849.67	406276.65	0.12
SH12APY000479	Tree Planting	Rocky Gorge Dam	02131107	161532.48	406438.22	0.08
SH12APY000480	Tree Planting	Rocky Gorge Dam	02131107	161570.90	406366.00	0.08
SH12APY000481	Tree Planting	Rocky Gorge Dam	02131107	161666.50	406409.05	0.31
SH12APY000482	Tree Planting	Rocky Gorge Dam	02131107	161668.60	406358.64	0.14
SH12APY000483	Tree Planting	Rocky Gorge Dam	02131107	161645.88	406470.48	0.11
SH12APY000484	Tree Planting	Rocky Gorge Dam	02131107	161787.02	406555.91	0.56
SH12APY000485	Tree Planting	Rocky Gorge Dam	02131107	162089.32	406733.80	0.33
SH12APY000486	Tree Planting	Potomac River MO Cnty	02140202	157163.31	367884.50	0.81
SH12APY000487	Tree Planting	Potomac River MO Cnty	02140202	156960.88	367789.76	2.15
SH12APY000488	Tree Planting	Potomac River MO Cnty	02140202	156758.30	367628.62	1.16
SH12APY000489	Tree Planting	Potomac River MO Cnty	02140202	156935.52	367297.90	0.39
SH12APY000490	Tree Planting	Potomac River MO Cnty	02140202	156378.83	366992.96	2.09
SH12APY000491	Tree Planting	Potomac River MO Cnty	02140202	155888.32	366276.43	1.28

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH12APY000492	Tree Planting	Potomac River MO Cnty	02140202	156037.77	366322.23	1.68
SH12APY000493	Tree Planting	Potomac River MO Cnty	02140202	156317.27	366382.50	2.38
SH12APY000494	Tree Planting	Potomac River MO Cnty	02140202	156612.24	365933.92	1.63
SH12APY000495	Tree Planting	Potomac River MO Cnty	02140202	156717.13	366324.28	1.35
SH12APY000496	Tree Planting	Potomac River MO Cnty	02140202	156467.25	365292.26	0.33
SH12APY000497	Tree Planting	Potomac River MO Cnty	02140202	156413.98	365216.21	0.22
SH12APY000501	Tree Planting	Potomac River MO Cnty	02140202	156488.79	363859.41	0.73
SH12APY000502	Tree Planting	Potomac River MO Cnty	02140202	156430.86	363796.46	0.57
SH12APY000503	Tree Planting	Potomac River MO Cnty	02140202	156106.17	366404.87	0.37
SH12APY000504	Tree Planting	Patuxent River middle	02131102	119203.16	425497.69	0.49
SH12APY000505	Tree Planting	Patuxent River lower	02131101	107526.84	426532.97	1.41
SH12APY000506	Tree Planting	Patuxent River lower	02131101	107282.65	426731.24	0.73
SH12APY000507	Tree Planting	Patuxent River lower	02131101	106768.02	426524.06	1.08
SH12APY000508	Tree Planting	Patuxent River lower	02131101	106995.51	426110.40	0.51
SH12APY000509	Tree Planting	Patuxent River middle	02131102	119233.37	425246.61	0.27
SH12APY000510	Tree Planting	Patuxent River middle	02131102	118342.29	425004.66	1.00
SH12APY000511	Tree Planting	Patuxent River middle	02131102	117960.86	424601.96	2.64
SH12APY000513	Tree Planting	Sideling Hill Creek	02140510	222317.60	284794.46	1.18
SH12APY003000	Tree Planting	Back River	02130901	178888.95	445651.99	0.12
SH12APY003001	Tree Planting	Lower Gunpowder Falls	02130802	192832.93	436943.24	0.23
SH12APY003002	Tree Planting	Back River	02130901	175184.12	446943.49	0.33
SH12APY003004	Tree Planting	Lower Monocacy River	02140302	192945.85	367162.37	0.23
SH12APY003005	Tree Planting	Potomac River U tidal	02140201	125885.17	400145.82	0.17
SH13APY000515	Tree Planting	Severn River	02131002	159187.04	426369.74	0.37
SH13APY000516	Tree Planting	Patapsco River L N Br	02130906	166974.91	423412.34	1.07

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000517	Tree Planting	Baltimore Harbor	02130903	164769.63	427509.05	0.19
SH13APY000518	Tree Planting	Baltimore Harbor	02130903	165319.77	430536.46	0.82
SH13APY000519	Tree Planting	Baltimore Harbor	02130903	165132.42	430536.19	1.68
SH13APY000520	Tree Planting	Baltimore Harbor	02130903	165098.73	430730.48	0.65
SH13APY000521	Tree Planting	Baltimore Harbor	02130903	164870.67	430771.49	1.03
SH13APY000522	Tree Planting	Baltimore Harbor	02130903	164731.53	430738.72	0.90
SH13APY000523	Tree Planting	Severn River	02131002	158258.05	432242.19	1.47
SH13APY000524	Tree Planting	Severn River	02131002	158712.16	432307.99	0.37
SH13APY000525	Tree Planting	Baltimore Harbor	02130903	166860.88	431000.60	0.59
SH13APY000526	Tree Planting	Baltimore Harbor	02130903	167851.44	431507.00	0.08
SH13APY000527	Tree Planting	Baltimore Harbor	02130903	167762.40	431446.51	0.32
SH13APY000528	Tree Planting	Baltimore Harbor	02130903	165091.17	428941.69	0.39
SH13APY000529	Tree Planting	Baltimore Harbor	02130903	165178.92	429080.15	3.01
SH13APY000530	Tree Planting	Patapsco River L N Br	02130906	164821.84	426463.85	1.23
SH13APY000531	Tree Planting	Jones Falls	02130904	194280.35	431933.71	0.05
SH13APY000532	Tree Planting	Gwynns Falls	02130905	196205.37	415847.02	0.14
SH13APY000533	Tree Planting	Gwynns Falls	02130905	189858.30	421467.09	0.33
SH13APY000534	Tree Planting	Gwynns Falls	02130905	190046.13	421401.51	1.41
SH13APY000535	Tree Planting	Gwynns Falls	02130905	191235.99	420607.18	0.59
SH13APY000536	Tree Planting	Gwynns Falls	02130905	192931.64	419969.16	0.26
SH13APY000538	Tree Planting	Gwynns Falls	02130905	193519.65	418592.96	0.13
SH13APY000539	Tree Planting	Gwynns Falls	02130905	193759.59	418149.25	0.50
SH13APY000540	Tree Planting	Gwynns Falls	02130905	193981.80	417819.58	0.18
SH13APY000541	Tree Planting	Gwynns Falls	02130905	196861.02	415416.22	0.19
SH13APY000542	Tree Planting	Gwynns Falls	02130905	196929.96	415354.54	0.09

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000543	Tree Planting	Gwynns Falls	02130905	197866.33	414739.14	0.27
SH13APY000544	Tree Planting	Gwynns Falls	02130905	193590.69	417957.14	0.64
SH13APY000545	Tree Planting	Loch Raven Reservoir	02130805	203231.80	428539.09	0.29
SH13APY000546	Tree Planting	Back River	02130901	183757.97	444282.68	0.19
SH13APY000547	Tree Planting	Back River	02130901	180895.66	442752.37	0.27
SH13APY000548	Tree Planting	Back River	02130901	180804.53	442865.56	0.12
SH13APY000549	Tree Planting	Back River	02130901	180320.41	442934.48	0.15
SH13APY000550	Tree Planting	Back River	02130901	180230.42	442915.35	0.27
SH13APY000551	Tree Planting	Back River	02130901	179913.83	443411.01	0.28
SH13APY000552	Tree Planting	Back River	02130901	180009.93	443427.23	0.18
SH13APY000553	Tree Planting	Back River	02130901	179840.68	443670.94	0.80
SH13APY000554	Tree Planting	Back River	02130901	179536.88	444086.02	0.16
SH13APY000555	Tree Planting	Baltimore Harbor	02130903	178816.83	445483.58	0.11
SH13APY000556	Tree Planting	Back River	02130901	179095.80	445420.70	0.22
SH13APY000557	Tree Planting	Back River	02130901	178853.01	445580.13	0.57
SH13APY000558	Tree Planting	Baltimore Harbor	02130903	178215.13	446122.06	0.11
SH13APY000559	Tree Planting	Back River	02130901	177613.96	446445.90	0.10
SH13APY000560	Tree Planting	Back River	02130901	177837.74	446441.14	0.23
SH13APY000561	Tree Planting	Back River	02130901	176477.40	446843.92	0.09
SH13APY000562	Tree Planting	Back River	02130901	176412.34	446727.14	0.17
SH13APY000563	Tree Planting	Back River	02130901	175530.46	447055.18	0.27
SH13APY000564	Tree Planting	Lower Gunpowder Falls	02130802	192587.53	437459.90	0.19
SH13APY000565	Tree Planting	Back River	02130901	192135.55	438791.08	0.72
SH13APY000566	Tree Planting	Loch Raven Reservoir	02130805	193879.48	434489.05	0.28
SH13APY000567	Tree Planting	Back River	02130901	192220.49	438728.89	0.41

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000568	Tree Planting	Jones Falls	02130904	194667.51	430854.13	0.64
SH13APY000569	Tree Planting	Gwynns Falls	02130905	182884.62	422059.21	0.25
SH13APY000570	Tree Planting	Back River	02130901	192063.41	439059.71	0.09
SH13APY000571	Tree Planting	Back River	02130901	192146.75	438973.25	0.24
SH13APY000572	Tree Planting	Gwynns Falls	02130905	182687.16	421913.65	0.41
SH13APY000573	Tree Planting	Loch Raven Reservoir	02130805	194063.41	433284.93	0.19
SH13APY000575	Tree Planting	Lower Gunpowder Falls	02130802	193633.16	436226.48	0.24
SH13APY000576	Tree Planting	Back River	02130901	183561.75	446700.10	0.11
SH13APY000577	Tree Planting	Back River	02130901	183594.90	446796.49	0.14
SH13APY000578	Tree Planting	Back River	02130901	183370.65	446779.49	0.73
SH13APY000579	Tree Planting	Back River	02130901	181229.51	442831.21	0.30
SH13APY000580	Tree Planting	Back River	02130901	180690.22	441484.36	0.36
SH13APY000581	Tree Planting	Back River	02130901	180685.23	441800.96	0.26
SH13APY000582	Tree Planting	Back River	02130901	180637.67	441643.62	0.19
SH13APY000583	Tree Planting	Back River	02130901	180755.50	441655.45	0.31
SH13APY000584	Tree Planting	Back River	02130901	184952.39	444150.40	0.11
SH13APY000585	Tree Planting	Back River	02130901	185172.35	444091.51	0.16
SH13APY000586	Tree Planting	Back River	02130901	185115.34	444155.50	0.24
SH13APY000587	Tree Planting	Back River	02130901	178987.57	445563.64	0.10
SH13APY000588	Tree Planting	Back River	02130901	179005.21	445378.70	0.29
SH13APY000589	Tree Planting	Back River	02130901	178666.23	449508.98	0.83
SH13APY000590	Tree Planting	Gwynns Falls	02130905	182146.65	421897.24	1.55
SH13APY000591	Tree Planting	Back River	02130901	178873.68	445519.73	0.20
SH13APY000592	Tree Planting	Back River	02130901	179026.33	445382.99	0.06
SH13APY000594	Tree Planting	Jones Falls	02130904	194105.77	431858.18	0.07

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000595	Tree Planting	Double Pipe Creek	02140304	211801.74	398716.56	0.30
SH13APY000596	Tree Planting	Double Pipe Creek	02140304	210097.18	397193.60	0.23
SH13APY000597	Tree Planting	Double Pipe Creek	02140304	209833.42	396499.61	0.27
SH13APY000598	Tree Planting	Double Pipe Creek	02140304	208486.05	391816.02	0.26
SH13APY000599	Tree Planting	Double Pipe Creek	02140304	214575.46	395950.34	0.72
SH13APY000600	Tree Planting	Double Pipe Creek	02140304	215067.52	395151.77	0.90
SH13APY000601	Tree Planting	S Branch Patapsco	02130908	190150.25	387650.95	0.06
SH13APY000602	Tree Planting	S Branch Patapsco	02130908	189194.05	387383.30	0.20
SH13APY000603	Tree Planting	S Branch Patapsco	02130908	188563.50	386660.77	0.09
SH13APY000604	Tree Planting	S Branch Patapsco	02130908	188386.60	402923.27	0.16
SH13APY000605	Tree Planting	Double Pipe Creek	02140304	212963.81	399243.66	0.38
SH13APY000606	Tree Planting	Double Pipe Creek	02140304	212198.90	399047.02	0.17
SH13APY000607	Tree Planting	Double Pipe Creek	02140304	211906.79	398829.53	0.05
SH13APY000608	Tree Planting	Double Pipe Creek	02140304	211217.51	398321.88	0.14
SH13APY000609	Tree Planting	Double Pipe Creek	02140304	211637.01	398587.79	0.18
SH13APY000610	Tree Planting	Double Pipe Creek	02140304	211424.81	398462.21	0.14
SH13APY000611	Tree Planting	Double Pipe Creek	02140304	209932.55	396773.70	0.01
SH13APY000612	Tree Planting	Double Pipe Creek	02140304	209530.83	396072.62	0.09
SH13APY000613	Tree Planting	Double Pipe Creek	02140304	209735.14	396327.86	0.11
SH13APY000614	Tree Planting	Double Pipe Creek	02140304	209618.21	396173.40	0.08
SH13APY000615	Tree Planting	Patuxent River lower	02131101	96069.71	419359.11	0.32
SH13APY000616	Tree Planting	Patuxent River lower	02131101	96081.24	419469.59	0.15
SH13APY000617	Tree Planting	Patuxent River lower	02131101	95917.65	419503.16	0.14
SH13APY000618	Tree Planting	Patuxent River lower	02131101	96214.77	419430.56	0.08
SH13APY000619	Tree Planting	Patuxent River lower	02131101	97075.48	418608.04	0.15

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000620	Tree Planting	Patuxent River lower	02131101	96461.89	419269.79	0.51
SH13APY000621	Tree Planting	Patuxent River lower	02131101	96657.28	418966.66	0.17
SH13APY000622	Tree Planting	Lower Monocacy River	02140302	192354.50	364104.56	0.75
SH13APY000623	Tree Planting	Lower Monocacy River	02140302	192858.66	367189.87	2.17
SH13APY000624	Tree Planting	Lower Monocacy River	02140302	193046.40	369650.17	0.25
SH13APY000625	Tree Planting	Lower Monocacy River	02140302	206588.33	373151.01	0.28
SH13APY000626	Tree Planting	Lower Monocacy River	02140302	208064.33	373012.14	0.22
SH13APY000627	Tree Planting	Lower Monocacy River	02140302	197203.15	365217.75	0.17
SH13APY000628	Tree Planting	Lower Monocacy River	02140302	197423.07	365365.09	0.43
SH13APY000630	Tree Planting	Upper Monocacy River	02140303	215349.79	363392.78	0.20
SH13APY000631	Tree Planting	Upper Monocacy River	02140303	218700.74	364886.36	0.33
SH13APY000632	Tree Planting	Upper Monocacy River	02140303	225950.15	373393.49	0.03
SH13APY000633	Tree Planting	Upper Monocacy River	02140303	226053.04	373211.47	0.21
SH13APY000634	Tree Planting	Upper Monocacy River	02140303	218639.57	364781.50	0.11
SH13APY000635	Tree Planting	Lower Winters Run	02130702	195167.44	459431.23	0.25
SH13APY000636	Tree Planting	Gunpowder River	02130801	194958.22	459435.42	0.07
SH13APY000637	Tree Planting	Atkisson Reservoir	02130703	206094.08	454021.90	0.34
SH13APY000638	Tree Planting	Atkisson Reservoir	02130703	207954.72	454286.30	0.40
SH13APY000639	Tree Planting	Bynum Run	02130704	209509.40	454349.17	0.41
SH13APY000640	Tree Planting	Bynum Run	02130704	209701.97	454401.75	0.26
SH13APY000641	Tree Planting	Bynum Run	02130704	209795.54	454432.74	0.18
SH13APY000642	Tree Planting	Bynum Run	02130704	209883.86	454503.87	0.52
SH13APY000643	Tree Planting	Bynum Run	02130704	210015.29	454551.50	1.28
SH13APY000644	Tree Planting	Bynum Run	02130704	209952.15	454407.44	0.29
SH13APY000645	Tree Planting	Conowingo Dam	02120204	220449.35	468578.02	0.23

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000647	Tree Planting	Atkisson Reservoir	02130703	208120.08	454212.64	0.39
SH13APY000648	Tree Planting	Lower Winters Run	02130702	195072.59	459408.34	0.04
SH13APY000649	Tree Planting	Patapsco River L N Br	02130906	171156.50	418484.83	0.39
SH13APY000650	Tree Planting	Patapsco River L N Br	02130906	171144.78	418684.49	0.11
SH13APY000651	Tree Planting	Patapsco River L N Br	02130906	171153.59	418811.02	0.09
SH13APY000652	Tree Planting	Patapsco River L N Br	02130906	168897.56	421215.98	0.22
SH13APY000653	Tree Planting	Patapsco River L N Br	02130906	169072.27	421035.38	0.24
SH13APY000654	Tree Planting	Little Patuxent River	02131105	169371.19	416131.71	0.25
SH13APY000655	Tree Planting	Little Patuxent River	02131105	169268.51	416168.19	0.59
SH13APY000656	Tree Planting	Little Patuxent River	02131105	169171.42	416313.19	0.14
SH13APY000657	Tree Planting	Middle Patuxent River	02131106	178443.16	401084.77	0.49
SH13APY000658	Tree Planting	Middle Patuxent River	02131106	178397.34	401161.49	0.21
SH13APY000659	Tree Planting	Little Patuxent River	02131105	163476.88	416363.26	0.71
SH13APY000660	Tree Planting	Little Patuxent River	02131105	163383.15	416096.74	0.79
SH13APY000661	Tree Planting	Little Patuxent River	02131105	163270.22	416252.59	0.61
SH13APY000662	Tree Planting	Little Patuxent River	02131105	174599.81	413917.41	0.49
SH13APY000663	Tree Planting	Little Patuxent River	02131105	173254.72	413457.08	0.05
SH13APY000664	Tree Planting	Little Patuxent River	02131105	173354.08	413495.69	0.15
SH13APY000665	Tree Planting	Little Patuxent River	02131105	173150.04	413450.37	0.08
SH13APY000667	Tree Planting	Middle Patuxent River	02131106	167966.34	410680.84	0.23
SH13APY000668	Tree Planting	Middle Patuxent River	02131106	168184.29	410624.98	0.26
SH13APY000669	Tree Planting	Little Patuxent River	02131105	168317.94	410954.19	0.07
SH13APY000670	Tree Planting	Little Patuxent River	02131105	168014.24	410897.81	0.24
SH13APY000671	Tree Planting	Little Patuxent River	02131105	181810.90	407448.52	0.24
SH13APY000672	Tree Planting	Little Patuxent River	02131105	181852.41	407282.07	0.34

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000673	Tree Planting	Middle Patuxent River	02131106	182210.91	403999.49	0.79
SH13APY000674	Tree Planting	Middle Patuxent River	02131106	182386.51	403826.61	0.30
SH13APY000675	Tree Planting	Patapsco River L N Br	02130906	180975.09	414872.60	0.08
SH13APY000676	Tree Planting	Little Patuxent River	02131105	163448.65	410948.43	0.06
SH13APY000678	Tree Planting	Little Patuxent River	02131105	164075.53	409382.99	0.06
SH13APY000679	Tree Planting	Little Patuxent River	02131105	164068.33	409515.52	0.05
SH13APY000680	Tree Planting	Little Patuxent River	02131105	164051.59	409587.90	0.01
SH13APY000681	Tree Planting	Patapsco River L N Br	02130906	169008.97	423928.25	0.77
SH13APY000682	Tree Planting	Middle Patuxent River	02131106	178908.68	401463.02	0.61
SH13APY000683	Tree Planting	Middle Patuxent River	02131106	179352.72	402117.05	0.87
SH13APY000684	Tree Planting	Patapsco River L N Br	02130906	169052.39	423861.58	0.61
SH13APY000685	Tree Planting	Lower Monocacy River	02140302	179004.17	372091.22	0.47
SH13APY000686	Tree Planting	Anacostia River	02140205	149842.87	398680.84	0.21
SH13APY000687	Tree Planting	Anacostia River	02140205	149698.52	398622.36	0.14
SH13APY000688	Tree Planting	Anacostia River	02140205	149733.16	398481.05	0.07
SH13APY000689	Tree Planting	Anacostia River	02140205	149841.85	398518.90	0.18
SH13APY000690	Tree Planting	Anacostia River	02140205	149651.90	399524.73	0.11
SH13APY000691	Tree Planting	Anacostia River	02140205	149799.10	399437.33	0.13
SH13APY000692	Tree Planting	Seneca Creek	02140208	171327.01	384235.41	0.36
SH13APY000693	Tree Planting	Seneca Creek	02140208	171482.10	384335.98	0.33
SH13APY000694	Tree Planting	Seneca Creek	02140208	171632.62	384462.45	0.13
SH13APY000695	Tree Planting	Seneca Creek	02140208	171612.02	384254.98	0.29
SH13APY000696	Tree Planting	Seneca Creek	02140208	171377.62	384083.59	0.18
SH13APY000697	Tree Planting	Western Branch	02131103	139028.36	412890.99	0.51
SH13APY000698	Tree Planting	Western Branch	02131103	136211.07	413151.01	0.58

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000699	Tree Planting	Western Branch	02131103	136278.18	413243.07	0.21
SH13APY000700	Tree Planting	Potomac River U tidal	02140201	128120.18	406818.11	0.21
SH13APY000701	Tree Planting	Potomac River U tidal	02140201	128089.43	406860.70	0.33
SH13APY000702	Tree Planting	Potomac River U tidal	02140201	128181.88	406971.48	0.46
SH13APY000703	Tree Planting	Potomac River U tidal	02140201	128106.84	407042.66	0.37
SH13APY000704	Tree Planting	Piscataway Creek	02140203	117818.01	402342.30	1.54
SH13APY000705	Tree Planting	Piscataway Creek	02140203	118547.96	402698.46	0.15
SH13APY000706	Tree Planting	Potomac River U tidal	02140201	125818.33	400185.65	0.70
SH13APY000707	Tree Planting	Anacostia River	02140205	139084.99	412859.78	0.09
SH13APY000708	Tree Planting	Conococheague Creek	02140504	220571.54	326901.58	1.04
SH13APY000709	Tree Planting	Conococheague Creek	02140504	220430.55	327381.54	0.55
SH13APY000710	Tree Planting	Conococheague Creek	02140504	219995.35	328235.68	0.49
SH13APY000711	Tree Planting	Conococheague Creek	02140504	216681.28	332501.51	0.58
SH13APY000712	Tree Planting	Conococheague Creek	02140504	216762.57	332663.35	0.70
SH13APY000713	Tree Planting	Conococheague Creek	02140504	216841.65	332749.57	0.35
SH13APY000714	Tree Planting	Marsh Run	02140503	215537.91	335059.01	0.53
SH13APY000715	Tree Planting	Antietam Creek	02140502	214963.57	341423.27	0.65
SH13APY000716	Tree Planting	Antietam Creek	02140502	214765.75	341501.29	0.79
SH13APY000717	Tree Planting	Antietam Creek	02140502	208618.66	347772.65	0.52
SH13APY000718	Tree Planting	Conococheague Creek	02140504	220688.13	325006.32	1.30
SH13APY000719	Tree Planting	Conococheague Creek	02140504	220604.75	325743.78	0.84
SH13APY000720	Tree Planting	Little Conococheague	02140505	220686.75	324017.39	0.43
SH13APY000721	Tree Planting	Conococheague Creek	02140504	220680.08	324336.49	0.18
SH13APY000722	Tree Planting	Little Conococheague	02140505	220883.14	321383.47	0.88
SH13APY000723	Tree Planting	Little Conococheague	02140505	220701.50	323817.58	0.44

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000724	Tree Planting	Little Conococheague	02140505	220582.28	320893.16	0.27
SH13APY000725	Tree Planting	Potomac River WA Cnty	02140501	220249.29	319685.34	0.54
SH13APY000726	Tree Planting	Potomac River WA Cnty	02140501	219795.85	318844.07	1.37
SH13APY000727	Tree Planting	Little Conococheague	02140505	220618.78	320652.23	1.78
SH13APY000728	Tree Planting	Potomac River WA Cnty	02140501	219123.15	317959.95	0.33
SH13APY000729	Tree Planting	Potomac River WA Cnty	02140501	224795.59	304965.50	0.95
SH13APY000730	Tree Planting	Potomac River WA Cnty	02140501	227181.41	298574.83	0.19
SH13APY000731	Tree Planting	Potomac River WA Cnty	02140501	227139.61	298469.96	0.31
SH13APY000732	Tree Planting	Little Tonoloway Creek	02140509	227082.50	298346.07	0.54
SH13APY000733	Tree Planting	Potomac River WA Cnty	02140501	225442.71	302566.43	0.44
SH13APY000734	Tree Planting	Little Tonoloway Creek	02140509	227696.09	298202.75	0.70
SH13APY000735	Tree Planting	Little Tonoloway Creek	02140509	227888.21	297894.82	0.73
SH13APY000736	Tree Planting	Little Tonoloway Creek	02140509	227327.03	298404.41	0.37
SH13APY000737	Tree Planting	Little Tonoloway Creek	02140509	227242.15	298362.43	0.33
SH13APY000738	Tree Planting	Little Tonoloway Creek	02140509	228155.25	298137.32	0.85
SH13APY000739	Tree Planting	Little Tonoloway Creek	02140509	227995.76	298021.75	0.48
SH13APY000741	Tree Planting	Little Tonoloway Creek	02140509	226205.20	292991.29	0.27
SH13APY000742	Tree Planting	Little Tonoloway Creek	02140509	226197.67	293125.69	0.25
SH13APY000743	Tree Planting	Little Tonoloway Creek	02140509	227900.57	294517.36	0.25
SH13APY000744	Tree Planting	Little Tonoloway Creek	02140509	227915.03	294646.11	0.12
SH13APY000745	Tree Planting	Conococheague Creek	02140504	220864.68	335789.14	0.56
SH13APY000746	Tree Planting	Conococheague Creek	02140504	226074.54	336479.42	0.37
SH13APY000747	Tree Planting	Conococheague Creek	02140504	225923.70	336564.49	1.15
SH13APY000748	Tree Planting	Conococheague Creek	02140504	225995.09	336673.84	0.45
SH13APY000749	Tree Planting	Antietam Creek	02140502	215364.58	337464.39	0.80

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH13APY000750	Tree Planting	Antietam Creek	02140502	215634.08	337460.59	0.91
SH13APY000751	Tree Planting	Little Conococheague	02140505	220767.55	322330.25	0.93
SH13APY000752	Tree Planting	Marsh Run	02140503	215638.40	334821.24	0.53
SH13APY000753	Tree Planting	Conococheague Creek	02140504	220842.65	335955.64	0.19
SH13APY000754	Tree Planting	Antietam Creek	02140502	215364.41	337297.48	0.56
SH13APY000755	Tree Planting	Conococheague Creek	02140504	221220.49	331423.63	0.63
SH13APY000756	Tree Planting	Potomac River WA Cnty	02140501	227144.11	298523.93	0.16
SH13APY000757	Tree Planting	Conococheague Creek	02140504	220672.69	324299.23	0.09
SH13APY000758	Tree Planting	Little Conococheague	02140505	220323.27	319853.53	0.07
SH13APY000759	Tree Planting	Conococheague Creek	02140504	215640.31	333737.71	0.37
SH13APY000760	Tree Planting	Marsh Run	02140503	215506.74	335106.83	0.28
SH13APY000761	Tree Planting	Potomac River WA Cnty	02140501	219069.50	317857.43	0.28
SH13APY000762	Tree Planting	Antietam Creek	02140502	214939.93	341558.96	0.40
SH13APY000763	Tree Planting	Marsh Run	02140503	215627.52	334110.22	0.39
SH13APY001580	Tree Planting	Severn River	02131002	155832.60	434638.06	0.32
SH13APY001581	Tree Planting	Lower Winters Run	02130702	195309.88	459408.85	0.36
SH13APY001587	Tree Planting	S Branch Patapsco	02130908	190400.08	387703.00	0.56
SH13APY001590	Tree Planting	Jones Falls	02130904	194201.18	432061.82	0.12
SH13APY001591	Tree Planting	Jones Falls	02130904	194251.40	432025.35	0.09
SH13APY001593	Tree Planting	Jones Falls	02130904	194050.62	431819.65	0.07
SH13APY003000	Tree Planting	Gwynns Falls	02130905	191253.73	420673.06	0.72
SH14APY000764	Tree Planting	Bodkin Creek	02130902	161380.61	442393.88	0.38
SH14APY000765	Tree Planting	Bodkin Creek	02130902	161315.64	442447.40	0.59
SH14APY000766	Tree Planting	Double Pipe Creek	02140304	211300.21	385766.12	0.16
SH14APY000767	Tree Planting	Double Pipe Creek	02140304	209848.03	389066.66	0.42

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14APY000768	Tree Planting	Double Pipe Creek	02140304	208678.93	392917.87	0.17
SH14APY000769	Tree Planting	Double Pipe Creek	02140304	208884.77	394368.92	0.66
SH14APY000770	Tree Planting	S Branch Patapsco	02130908	190649.54	387758.32	0.40
SH14APY000771	Tree Planting	Double Pipe Creek	02140304	210389.76	397587.70	0.86
SH14APY000772	Tree Planting	Double Pipe Creek	02140304	210945.31	398098.85	0.45
SH14APY000773	Tree Planting	Double Pipe Creek	02140304	211978.35	398901.84	0.07
SH14APY000774	Tree Planting	S Branch Patapsco	02130908	190813.77	387825.16	0.17
SH14APY000775	Tree Planting	S Branch Patapsco	02130908	188168.33	387145.45	0.19
SH14APY000776	Tree Planting	Upper Monocacy River	02140303	222106.95	385847.56	0.60
SH14APY000777	Tree Planting	Upper Monocacy River	02140303	222670.37	386283.64	0.62
SH14APY000778	Tree Planting	Upper Monocacy River	02140303	226847.50	389187.43	0.12
SH14APY000779	Tree Planting	Double Pipe Creek	02140304	199780.42	393311.22	0.27
SH14APY000780	Tree Planting	Upper Monocacy River	02140303	224764.81	387581.79	0.30
SH14APY000781	Tree Planting	Upper Monocacy River	02140303	227663.18	389350.51	0.33
SH14APY000782	Tree Planting	S Branch Patapsco	02130908	198405.65	393491.39	0.18
SH14APY000783	Tree Planting	S Branch Patapsco	02130908	191652.77	387849.81	0.35
SH14APY000784	Tree Planting	Lower Monocacy River	02140302	199379.76	390170.00	0.17
SH14APY000785	Tree Planting	S Branch Patapsco	02130908	197889.97	394627.03	0.16
SH14APY000786	Tree Planting	Double Pipe Creek	02140304	217975.70	390786.86	0.14
SH14APY000787	Tree Planting	Upper Monocacy River	02140303	224619.68	387501.61	0.17
SH14APY000788	Tree Planting	S Branch Patapsco	02130908	190899.86	387782.67	0.39
SH14APY000789	Tree Planting	S Branch Patapsco	02130908	191117.40	387793.97	0.47
SH14APY000790	Tree Planting	Upper Monocacy River	02140303	221815.78	385604.55	0.19
SH14APY000791	Tree Planting	Double Pipe Creek	02140304	210752.76	397912.79	0.39
SH14APY000792	Tree Planting	Lower Monocacy River	02140302	194169.69	362461.87	0.39

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14APY000793	Tree Planting	Catoctin Creek	02140305	199806.47	355983.59	0.21
SH14APY000794	Tree Planting	Catoctin Creek	02140305	196531.61	352934.67	0.21
SH14APY000795	Tree Planting	Catoctin Creek	02140305	196343.16	352681.86	0.20
SH14APY000796	Tree Planting	Catoctin Creek	02140305	193759.52	349252.92	0.14
SH14APY000797	Tree Planting	Lower Monocacy River	02140302	190655.38	375184.06	0.04
SH14APY000799	Tree Planting	Lower Monocacy River	02140302	189132.03	382287.50	0.12
SH14APY000800	Tree Planting	Lower Monocacy River	02140302	188901.45	382693.15	0.12
SH14APY000801	Tree Planting	Lower Monocacy River	02140302	188826.40	356835.70	0.59
SH14APY000802	Tree Planting	Lower Monocacy River	02140302	189281.53	357398.89	0.28
SH14APY000803	Tree Planting	Potomac River FR Cnty	02140301	186192.86	345203.28	0.02
SH14APY000804	Tree Planting	Lower Monocacy River	02140302	190906.43	360571.53	0.13
SH14APY000807	Tree Planting	Lower Monocacy River	02140302	206825.09	373215.34	0.76
SH14APY000808	Tree Planting	Lower Monocacy River	02140302	187923.18	385267.73	0.36
SH14APY000810	Tree Planting	Potomac River FR Cnty	02140301	186273.77	345303.23	0.06
SH14APY000811	Tree Planting	Catoctin Creek	02140305	199708.94	356034.64	0.14
SH14APY000812	Tree Planting	Catoctin Creek	02140305	196668.32	353016.33	0.62
SH14APY000814	Tree Planting	Lower Monocacy River	02140302	207106.20	373248.61	0.16
SH14APY000815	Tree Planting	Deer Creek	02120202	212314.28	468158.46	0.54
SH14APY000816	Tree Planting	Swan Creek	02130706	212396.40	468356.04	0.29
SH14APY000817	Tree Planting	Lower Susquehanna River	02120201	212028.76	471827.99	0.79
SH14APY000818	Tree Planting	Broad Creek	02120205	224491.65	460228.91	0.12
SH14APY000819	Tree Planting	Broad Creek	02120205	224926.26	459734.56	0.42
SH14APY000820	Tree Planting	Broad Creek	02120205	225006.69	459608.77	0.11
SH14APY000823	Tree Planting	Lower Susquehanna River	02120201	211903.42	471529.53	0.30
SH14APY000824	Tree Planting	Broad Creek	02120205	225549.32	458309.87	0.10

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14APY000825	Tree Planting	Broad Creek	02120205	226448.15	456692.30	0.05
SH14APY000826	Tree Planting	Lower Susquehanna River	02120201	212200.29	472474.00	0.36
SH14APY000827	Tree Planting	Broad Creek	02120205	228195.80	456316.92	0.09
SH14APY000828	Tree Planting	Lower Susquehanna River	02120201	211894.11	471287.00	0.38
SH14APY000829	Tree Planting	Broad Creek	02120205	225092.61	459424.80	0.03
SH14APY000830	Tree Planting	Broad Creek	02120205	225299.45	458938.99	0.10
SH14APY000831	Tree Planting	Broad Creek	02120205	225289.10	458923.89	0.22
SH14APY000832	Tree Planting	Broad Creek	02120205	225286.27	453800.19	0.57
SH14APY000833	Tree Planting	Broad Creek	02120205	227420.98	455941.31	0.11
SH14APY000834	Tree Planting	Broad Creek	02120205	224373.62	460420.65	0.05
SH14APY000835	Tree Planting	Broad Creek	02120205	223747.24	452571.36	0.07
SH14APY000836	Tree Planting	Lower Susquehanna River	02120201	211951.11	471711.50	0.11
SH14APY000837	Tree Planting	Broad Creek	02120205	225566.75	458318.48	0.01
SH14APY000840	Tree Planting	Broad Creek	02120205	224447.57	453602.70	0.31
SH14APY000842	Tree Planting	Broad Creek	02120205	224542.34	460144.42	0.02
SH14APY000843	Tree Planting	Broad Creek	02120205	225358.00	458753.56	0.06
SH14APY000844	Tree Planting	Broad Creek	02120205	225967.55	457519.16	0.09
SH14APY000846	Tree Planting	Broad Creek	02120205	223700.53	452470.47	0.25
SH14APY000847	Tree Planting	Broad Creek	02120205	227265.76	455787.30	0.18
SH14APY000848	Tree Planting	Lower Susquehanna River	02120201	211946.67	471523.16	0.85
SH14APY000849	Tree Planting	Broad Creek	02120205	225079.22	459416.49	0.07
SH14APY000850	Tree Planting	Lower Susquehanna River	02120201	212200.52	473199.44	0.28
SH14APY000851	Tree Planting	Broad Creek	02120205	223881.94	453116.84	1.61
SH14APY000852	Tree Planting	Broad Creek	02120205	225396.08	458680.43	0.05
SH14APY000855	Tree Planting	Broad Creek	02120205	224165.97	453520.60	0.61

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14APY000856	Tree Planting	Broad Creek	02120205	225927.34	454086.30	0.05
SH14APY000857	Tree Planting	Middle Patuxent River	02131106	168504.77	409058.50	0.21
SH14APY000858	Tree Planting	Middle Patuxent River	02131106	165646.37	409468.53	0.26
SH14APY000859	Tree Planting	Middle Patuxent River	02131106	168410.09	410180.00	0.07
SH14APY000860	Tree Planting	Middle Patuxent River	02131106	168516.54	408827.89	0.31
SH14APY000861	Tree Planting	Patapsco River L N Br	02130906	171794.17	417684.87	0.20
SH14APY000862	Tree Planting	Little Patuxent River	02131105	163472.68	416031.13	0.43
SH14APY000863	Tree Planting	Middle Patuxent River	02131106	168607.55	408639.71	0.48
SH14APY000864	Tree Planting	Little Patuxent River	02131105	168117.22	410684.94	0.68
SH14APY000865	Tree Planting	Middle Patuxent River	02131106	169061.83	408021.90	0.57
SH14APY000866	Tree Planting	Middle Patuxent River	02131106	170376.93	405966.88	0.12
SH14APY000867	Tree Planting	Little Patuxent River	02131105	172891.53	413470.02	0.10
SH14APY000868	Tree Planting	Patapsco River L N Br	02130906	178978.00	415515.66	0.40
SH14APY000869	Tree Planting	Little Patuxent River	02131105	175352.35	415756.57	0.23
SH14APY000870	Tree Planting	Little Patuxent River	02131105	175286.91	415723.99	0.19
SH14APY000871	Tree Planting	Little Patuxent River	02131105	175456.96	415842.74	0.23
SH14APY000872	Tree Planting	Patapsco River L N Br	02130906	171401.40	417767.03	0.17
SH14APY000873	Tree Planting	Patuxent River upper	02131104	162077.71	411789.16	0.22
SH14APY000874	Tree Planting	Patapsco River L N Br	02130906	171223.53	418045.93	0.25
SH14APY000875	Tree Planting	Little Patuxent River	02131105	174882.72	415997.37	0.10
SH14APY000876	Tree Planting	Patapsco River L N Br	02130906	169767.32	420166.06	0.75
SH14APY000877	Tree Planting	Little Patuxent River	02131105	169644.65	416013.70	0.16
SH14APY000878	Tree Planting	Patapsco River L N Br	02130906	171520.39	417671.05	0.09
SH14APY000879	Tree Planting	Patapsco River L N Br	02130906	178678.25	415364.00	0.28
SH14APY000880	Tree Planting	Middle Patuxent River	02131106	170960.30	405126.82	0.31

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14APY000881	Tree Planting	Middle Patuxent River	02131106	169494.60	407180.30	0.09
SH14APY000882	Tree Planting	Little Patuxent River	02131105	164921.69	415108.50	0.14
SH14APY000883	Tree Planting	Little Patuxent River	02131105	162331.10	417376.75	0.14
SH14APY000884	Tree Planting	Little Patuxent River	02131105	162619.57	417327.50	0.13
SH14APY000885	Tree Planting	Little Patuxent River	02131105	163363.98	416458.45	0.57
SH14APY000886	Tree Planting	Little Patuxent River	02131105	166785.92	413729.99	0.37
SH14APY000887	Tree Planting	Middle Patuxent River	02131106	169898.24	406488.22	0.15
SH14APY000888	Tree Planting	Middle Patuxent River	02131106	170742.37	405579.42	0.34
SH14APY000889	Tree Planting	Patapsco River L N Br	02130906	178999.52	415750.18	0.23
SH14APY000890	Tree Planting	Little Patuxent River	02131105	175510.48	415662.09	1.16
SH14APY000891	Tree Planting	Little Patuxent River	02131105	175611.29	415764.51	0.73
SH14APY000892	Tree Planting	Little Patuxent River	02131105	168341.87	417739.04	0.70
SH14APY000893	Tree Planting	Little Patuxent River	02131105	164207.85	408968.71	1.94
SH14APY000894	Tree Planting	Little Patuxent River	02131105	162235.98	417815.64	0.40
SH14APY000895	Tree Planting	Patapsco River L N Br	02130906	169917.11	419995.78	0.40
SH14APY000897	Tree Planting	Little Patuxent River	02131105	169835.29	415788.70	0.50
SH14APY000898	Tree Planting	Middle Patuxent River	02131106	168005.97	410689.42	0.15
SH14APY000899	Tree Planting	Patuxent River upper	02131104	162051.54	412191.55	0.07
SH14APY000900	Tree Planting	Patapsco River L N Br	02130906	171183.41	418666.29	0.19
SH14APY000901	Tree Planting	Patapsco River L N Br	02130906	169621.29	420491.49	0.15
SH14APY000902	Tree Planting	Patapsco River L N Br	02130906	170848.09	419276.40	0.24
SH14APY000903	Tree Planting	Middle Patuxent River	02131106	178498.43	401261.63	0.45
SH14APY000904	Tree Planting	Middle Patuxent River	02131106	170142.45	406122.59	0.07
SH14APY000905	Tree Planting	Little Patuxent River	02131105	165413.52	414699.82	0.15
SH14APY000906	Tree Planting	Little Patuxent River	02131105	162137.18	417787.71	0.61

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14APY000907	Tree Planting	Little Patuxent River	02131105	162951.33	416929.67	0.31
SH14APY000908	Tree Planting	Middle Patuxent River	02131106	169818.13	406597.58	0.15
SH14APY000909	Tree Planting	Patapsco River L N Br	02130906	171639.74	417487.26	0.54
SH14APY000910	Tree Planting	Patapsco River L N Br	02130906	171461.90	417387.21	0.71
SH14APY000911	Tree Planting	Little Patuxent River	02131105	168065.90	410717.01	0.14
SH14APY000912	Tree Planting	Little Patuxent River	02131105	168158.57	410739.30	0.21
SH14APY000913	Tree Planting	Little Patuxent River	02131105	170027.10	415780.37	0.15
SH14APY000914	Tree Planting	Patapsco River L N Br	02130906	171439.68	417574.59	0.56
SH14APY000915	Tree Planting	Little Patuxent River	02131105	163297.14	416098.76	0.12
SH14APY000916	Tree Planting	Middle Patuxent River	02131106	168423.07	408852.47	0.10
SH14APY000917	Tree Planting	Middle Patuxent River	02131106	168888.26	408315.97	0.13
SH14APY000918	Tree Planting	Middle Patuxent River	02131106	168418.83	410042.58	0.09
SH14APY001554	Tree Planting	Middle Patuxent River	02131106	168215.53	410580.54	0.28
SH14APY001555	Tree Planting	Little Patuxent River	02131105	169505.78	416168.39	0.89
SH14APY001556	Tree Planting	Liberty Reservoir	02130907	216255.50	411724.43	3.81
SH14APY001557	Tree Planting	Liberty Reservoir	02130907	216643.15	411699.62	2.63
SH14APY001558	Tree Planting	Liberty Reservoir	02130907	217538.53	411273.54	0.76
SH14APY001559	Tree Planting	Liberty Reservoir	02130907	217885.50	411383.85	3.58
SH14APY001560	Tree Planting	Liberty Reservoir	02130907	218308.84	411403.56	0.91
SH14APY001561	Tree Planting	Liberty Reservoir	02130907	216178.56	411323.08	8.21
SH14APY001562	Tree Planting	Liberty Reservoir	02130907	217120.97	411308.52	10.32
SH14APY001565	Tree Planting	Potomac River FR Cnty	02140301	186837.88	346028.20	0.09
SH14APY001594	Tree Planting	Little Patuxent River	02131105	168799.99	411116.48	0.14
SH14APY001596	Tree Planting	Little Patuxent River	02131105	172861.66	413297.84	0.08
SH14APY001598	Tree Planting	Little Patuxent River	02131105	172779.87	413276.28	0.34

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH14APY001599	Tree Planting	Little Patuxent River	02131105	162436.33	417333.59	0.85
SH14APY001600	Tree Planting	Little Patuxent River	02131105	162687.56	417071.47	0.71
SH14APY001601	Tree Planting	Little Patuxent River	02131105	165534.51	414795.94	0.40
SH14APY001605	Tree Planting	Patuxent River upper	02131104	162067.00	412050.04	1.02
SH14APY001608	Tree Planting	Catoctin Creek	02140305	201434.09	354896.89	0.32
SH14APY001609	Tree Planting	Catoctin Creek	02140305	188213.36	354433.02	0.02
SH14APY001610	Tree Planting	Potomac River FR Cnty	02140301	187050.96	346433.94	0.03
SH14APY001611	Tree Planting	Potomac River FR Cnty	02140301	186949.24	346203.59	0.03
SH14APY001614	Tree Planting	Upper Monocacy River	02140303	203981.05	365550.89	0.04
SH14APY001615	Tree Planting	Upper Monocacy River	02140303	204239.21	365384.61	0.24
SH14APY001616	Tree Planting	Lower Monocacy River	02140302	184128.65	368850.17	0.07
SH14APY001621	Tree Planting	Upper Monocacy River	02140303	201706.85	370326.36	0.59
SH14APY001622	Tree Planting	Catoctin Creek	02140305	199997.55	355192.95	0.86
SH14APY001630	Tree Planting	Bird River	02130803	190452.12	441923.74	0.38
SH14APY001635	Tree Planting	Little Patuxent River	02131105	163109.23	416752.77	0.14
SH14APY001636	Tree Planting	Little Patuxent River	02131105	175800.51	415189.96	0.53
SH14APY003000	Tree Planting	Middle Patuxent River	02131106	182922.58	402563.46	0.21
SH14APY003001	Tree Planting	Anacostia River	02140205	153744.67	406485.53	0.05
SH14APY003002	Tree Planting	Anacostia River	02140205	153758.87	406314.73	0.18
SH15APY000919	Tree Planting	Patapsco River L N Br	02130906	166818.56	423292.94	1.40
SH15APY000920	Tree Planting	Baltimore Harbor	02130903	162961.97	435659.89	0.16
SH15APY000921	Tree Planting	Patapsco River L N Br	02130906	167805.35	422626.65	0.27
SH15APY000922	Tree Planting	Deer Creek	02120202	226640.80	430546.18	1.02
SH15APY000923	Tree Planting	Gwynns Falls	02130905	193833.92	418320.72	0.56
SH15APY000924	Tree Planting	Gwynns Falls	02130905	193673.03	417771.55	0.18

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY000925	Tree Planting	Back River	02130901	180289.13	443063.91	0.21
SH15APY000926	Tree Planting	Gwynns Falls	02130905	193014.34	417452.27	0.18
SH15APY000927	Tree Planting	Gwynns Falls	02130905	182110.12	421757.02	0.08
SH15APY000928	Tree Planting	Lower Gunpowder Falls	02130802	192793.21	439282.71	0.15
SH15APY000929	Tree Planting	Gwynns Falls	02130905	190581.64	421003.72	0.11
SH15APY000930	Tree Planting	Jones Falls	02130904	193429.28	429003.33	0.34
SH15APY000931	Tree Planting	Bird River	02130803	188803.99	449373.25	0.15
SH15APY000932	Tree Planting	Back River	02130901	176252.56	446884.29	0.08
SH15APY000933	Tree Planting	Back River	02130901	177606.66	446548.13	1.19
SH15APY000934	Tree Planting	Bird River	02130803	190467.27	443481.20	0.27
SH15APY000935	Tree Planting	Patapsco River L N Br	02130906	172747.51	425807.30	0.12
SH15APY000936	Tree Planting	Back River	02130901	184730.90	444443.31	0.22
SH15APY000937	Tree Planting	Back River	02130901	183938.97	446220.36	0.15
SH15APY000938	Tree Planting	Patapsco River L N Br	02130906	182168.74	418409.16	0.12
SH15APY000939	Tree Planting	Gwynns Falls	02130905	182081.38	421321.02	0.14
SH15APY000940	Tree Planting	Gwynns Falls	02130905	190921.11	420902.92	0.50
SH15APY000941	Tree Planting	Patapsco River L N Br	02130906	182051.89	419697.42	0.02
SH15APY000942	Tree Planting	Gwynns Falls	02130905	192415.57	420284.22	0.09
SH15APY000944	Tree Planting	Gwynns Falls	02130905	190197.49	421173.58	0.02
SH15APY000945	Tree Planting	Bird River	02130803	190516.82	441457.64	0.26
SH15APY000946	Tree Planting	Jones Falls	02130904	193292.75	428631.01	0.06
SH15APY000947	Tree Planting	Jones Falls	02130904	193048.77	428089.24	0.54
SH15APY000948	Tree Planting	Back River	02130901	180899.79	442724.83	0.24
SH15APY000949	Tree Planting	Back River	02130901	182994.83	447026.43	0.09
SH15APY000950	Tree Planting	Back River	02130901	183216.63	446932.45	0.07

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY000951	Tree Planting	Back River	02130901	183345.65	446954.82	0.13
SH15APY000952	Tree Planting	Back River	02130901	175095.65	446937.30	0.27
SH15APY000953	Tree Planting	Bird River	02130803	189561.42	448955.49	0.10
SH15APY000955	Tree Planting	Back River	02130901	185684.06	443683.79	0.08
SH15APY000956	Tree Planting	Gwynns Falls	02130905	182199.49	421952.12	0.26
SH15APY000957	Tree Planting	Back River	02130901	189184.38	441764.96	0.78
SH15APY000958	Tree Planting	Jones Falls	02130904	191505.69	424863.66	0.13
SH15APY000959	Tree Planting	Bird River	02130803	188649.14	449501.96	0.32
SH15APY000960	Tree Planting	Gwynns Falls	02130905	191501.32	420459.19	0.12
SH15APY000962	Tree Planting	Gwynns Falls	02130905	194126.88	417540.90	0.09
SH15APY000964	Tree Planting	Lower Gunpowder Falls	02130802	193739.37	436356.45	0.10
SH15APY000965	Tree Planting	Gwynns Falls	02130905	191526.63	420370.75	0.15
SH15APY000966	Tree Planting	Deer Creek	02120202	227324.17	430024.83	0.02
SH15APY000968	Tree Planting	Back River	02130901	181008.77	442753.29	0.15
SH15APY000969	Tree Planting	Back River	02130901	183098.21	446984.46	0.19
SH15APY000970	Tree Planting	Back River	02130901	182968.87	447113.69	0.11
SH15APY000971	Tree Planting	Back River	02130901	184845.46	444360.85	0.07
SH15APY000972	Tree Planting	Baltimore Harbor	02130903	178886.90	445361.36	0.09
SH15APY000973	Tree Planting	Gwynns Falls	02130905	191247.41	420624.74	0.31
SH15APY000974	Tree Planting	Back River	02130901	177912.10	446391.10	0.13
SH15APY000975	Tree Planting	Back River	02130901	185641.20	443703.07	0.06
SH15APY000976	Tree Planting	Back River	02130901	186173.92	445959.58	0.06
SH15APY000977	Tree Planting	Jones Falls	02130904	191556.41	424892.15	0.15
SH15APY000978	Tree Planting	Gwynns Falls	02130905	197092.69	415286.85	0.78
SH15APY000979	Tree Planting	Patapsco River L N Br	02130906	175469.26	427149.04	0.09

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY000980	Tree Planting	Gwynns Falls	02130905	182080.47	422165.16	0.06
SH15APY000981	Tree Planting	Back River	02130901	179534.31	444375.63	0.13
SH15APY000982	Tree Planting	Gwynns Falls	02130905	182070.88	422322.77	0.59
SH15APY000983	Tree Planting	Back River	02130901	185101.82	444034.67	0.10
SH15APY000984	Tree Planting	Lower Gunpowder Falls	02130802	192867.82	437038.66	0.24
SH15APY000985	Tree Planting	Deer Creek	02120202	227921.39	429650.94	0.08
SH15APY000986	Tree Planting	Gwynns Falls	02130905	190386.15	421228.37	0.12
SH15APY000987	Tree Planting	Back River	02130901	185541.88	443833.96	0.69
SH15APY000988	Tree Planting	Gwynns Falls	02130905	191139.24	420721.39	0.28
SH15APY000990	Tree Planting	Lower Gunpowder Falls	02130802	193678.24	436358.31	0.04
SH15APY000991	Tree Planting	Jones Falls	02130904	191418.64	423921.65	0.06
SH15APY000992	Tree Planting	Loch Raven Reservoir	02130805	213945.13	428097.84	0.27
SH15APY000993	Tree Planting	Loch Raven Reservoir	02130805	218073.50	428538.93	0.23
SH15APY000994	Tree Planting	Loch Raven Reservoir	02130805	193568.46	436075.89	0.85
SH15APY000995	Tree Planting	Loch Raven Reservoir	02130805	213833.61	427970.77	0.17
SH15APY000996	Tree Planting	Loch Raven Reservoir	02130805	193986.26	434551.55	0.11
SH15APY000997	Tree Planting	Loch Raven Reservoir	02130805	217124.34	428551.27	0.19
SH15APY000998	Tree Planting	Loch Raven Reservoir	02130805	208732.70	428691.20	0.13
SH15APY001000	Tree Planting	Loch Raven Reservoir	02130805	225058.19	430690.60	0.42
SH15APY001002	Tree Planting	Loch Raven Reservoir	02130805	217652.95	428342.24	0.15
SH15APY001003	Tree Planting	Liberty Reservoir	02130907	200341.86	413986.43	0.12
SH15APY001004	Tree Planting	Loch Raven Reservoir	02130805	201986.56	425170.10	0.09
SH15APY001005	Tree Planting	Loch Raven Reservoir	02130805	223864.95	430513.11	0.16
SH15APY001006	Tree Planting	Loch Raven Reservoir	02130805	225357.97	430772.51	0.19
SH15APY001007	Tree Planting	Loch Raven Reservoir	02130805	221068.70	429728.38	0.09

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001008	Tree Planting	Patapsco River L N Br	02130906	175651.31	427403.04	0.25
SH15APY001009	Tree Planting	Gwynns Falls	02130905	182267.99	422182.85	0.10
SH15APY001010	Tree Planting	Gwynns Falls	02130905	182167.78	422229.66	0.67
SH15APY001011	Tree Planting	Patapsco River L N Br	02130906	182059.60	419754.45	0.08
SH15APY001012	Tree Planting	Deer Creek	02120202	227249.01	430061.14	0.19
SH15APY001013	Tree Planting	Gwynns Falls	02130905	192336.14	420310.52	0.14
SH15APY001014	Tree Planting	Gwynns Falls	02130905	192258.91	420332.16	0.03
SH15APY001015	Tree Planting	Gwynns Falls	02130905	190262.62	421164.16	0.16
SH15APY001016	Tree Planting	Gwynns Falls	02130905	193949.65	418326.83	0.08
SH15APY001017	Tree Planting	Double Pipe Creek	02140304	211508.75	385466.13	0.08
SH15APY001018	Tree Planting	Double Pipe Creek	02140304	211280.71	385872.26	0.18
SH15APY001019	Tree Planting	Double Pipe Creek	02140304	211341.77	385801.60	0.05
SH15APY001020	Tree Planting	Double Pipe Creek	02140304	211264.68	386429.04	0.82
SH15APY001021	Tree Planting	Double Pipe Creek	02140304	210954.26	387011.33	0.31
SH15APY001022	Tree Planting	Upper Monocacy River	02140303	223253.58	386688.55	0.15
SH15APY001023	Tree Planting	Upper Monocacy River	02140303	223467.88	386833.83	0.18
SH15APY001024	Tree Planting	Upper Monocacy River	02140303	224888.61	387641.04	0.13
SH15APY001025	Tree Planting	Upper Monocacy River	02140303	226089.47	389048.66	0.14
SH15APY001026	Tree Planting	S Branch Patapsco	02130908	187816.92	385524.73	0.45
SH15APY001027	Tree Planting	S Branch Patapsco	02130908	188036.52	385819.36	0.46
SH15APY001028	Tree Planting	S Branch Patapsco	02130908	188683.85	387001.29	0.14
SH15APY001029	Tree Planting	S Branch Patapsco	02130908	191432.70	387821.92	0.08
SH15APY001030	Tree Planting	S Branch Patapsco	02130908	197421.52	395635.31	0.18
SH15APY001031	Tree Planting	S Branch Patapsco	02130908	198456.12	393346.42	0.11
SH15APY001032	Tree Planting	Double Pipe Creek	02140304	208596.19	392525.75	0.54

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001033	Tree Planting	Double Pipe Creek	02140304	211385.38	385618.22	0.05
SH15APY001034	Tree Planting	Double Pipe Creek	02140304	211323.77	386058.64	0.11
SH15APY001035	Tree Planting	Upper Monocacy River	02140303	223155.90	386630.36	0.15
SH15APY001036	Tree Planting	S Branch Patapsco	02130908	188987.59	387334.51	0.13
SH15APY001037	Tree Planting	S Branch Patapsco	02130908	189975.90	387593.34	0.38
SH15APY001038	Tree Planting	S Branch Patapsco	02130908	191023.76	387838.95	0.23
SH15APY001039	Tree Planting	Lower Monocacy River	02140302	199049.20	391968.87	0.28
SH15APY001040	Tree Planting	S Branch Patapsco	02130908	198342.16	393673.40	0.13
SH15APY001041	Tree Planting	Double Pipe Creek	02140304	208737.57	393056.81	0.30
SH15APY001042	Tree Planting	Double Pipe Creek	02140304	208486.28	391769.18	0.08
SH15APY001043	Tree Planting	S Branch Patapsco	02130908	190143.50	402695.47	0.12
SH15APY001044	Tree Planting	S Branch Patapsco	02130908	189646.11	403016.53	0.04
SH15APY001045	Tree Planting	Upper Monocacy River	02140303	225445.24	388177.15	0.05
SH15APY001046	Tree Planting	Upper Monocacy River	02140303	225528.11	388308.76	0.28
SH15APY001048	Tree Planting	Upper Monocacy River	02140303	223554.27	386887.40	0.07
SH15APY001049	Tree Planting	Upper Monocacy River	02140303	223876.31	387075.98	0.46
SH15APY001050	Tree Planting	Upper Monocacy River	02140303	225925.38	388927.05	0.02
SH15APY001051	Tree Planting	Upper Monocacy River	02140303	227276.28	389248.85	0.25
SH15APY001052	Tree Planting	Upper Monocacy River	02140303	225070.04	387762.51	0.19
SH15APY001053	Tree Planting	Upper Monocacy River	02140303	225278.82	387968.78	0.66
SH15APY001054	Tree Planting	Upper Monocacy River	02140303	224321.35	387331.35	0.64
SH15APY001055	Tree Planting	Back Creek	02130604	206726.42	501747.58	0.14
SH15APY001056	Tree Planting	Back Creek	02130604	206734.55	501685.98	0.17
SH15APY001057	Tree Planting	Octoraro Creek	02120203	228531.03	483112.68	0.47
SH15APY001058	Tree Planting	Octoraro Creek	02120203	227725.25	481857.22	0.31

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001059	Tree Planting	Octoraro Creek	02120203	218587.09	479092.30	0.07
SH15APY001060	Tree Planting	Little Elk Creek	02130605	221892.82	498239.50	0.43
SH15APY001061	Tree Planting	Little Elk Creek	02130605	221675.72	498289.44	0.18
SH15APY001062	Tree Planting	Little Elk Creek	02130605	226538.82	495754.05	0.04
SH15APY001063	Tree Planting	Little Elk Creek	02130605	221568.57	498345.89	0.12
SH15APY001064	Tree Planting	Northeast River	02130608	218083.34	490024.49	0.03
SH15APY001065	Tree Planting	Northeast River	02130608	218058.23	490033.27	0.05
SH15APY001066	Tree Planting	Octoraro Creek	02120203	227801.41	482072.58	0.07
SH15APY001067	Tree Planting	Octoraro Creek	02120203	227760.58	482091.77	0.13
SH15APY001068	Tree Planting	Little Elk Creek	02130605	221119.42	498654.40	0.05
SH15APY001069	Tree Planting	Northeast River	02130608	222862.01	489396.60	0.17
SH15APY001070	Tree Planting	Northeast River	02130608	222930.57	489357.85	0.04
SH15APY001071	Tree Planting	Octoraro Creek	02120203	227108.34	479907.23	0.24
SH15APY001072	Tree Planting	Octoraro Creek	02120203	227641.88	481771.42	0.54
SH15APY001073	Tree Planting	Octoraro Creek	02120203	223442.31	479494.56	0.10
SH15APY001074	Tree Planting	Octoraro Creek	02120203	225579.56	477847.19	0.38
SH15APY001075	Tree Planting	Little Elk Creek	02130605	225988.09	494356.59	0.34
SH15APY001076	Tree Planting	Little Elk Creek	02130605	221485.38	498410.62	0.24
SH15APY001077	Tree Planting	Little Elk Creek	02130605	220973.59	498704.29	0.13
SH15APY001078	Tree Planting	Little Elk Creek	02130605	216615.46	498821.34	0.13
SH15APY001079	Tree Planting	Octoraro Creek	02120203	222906.97	479468.21	0.16
SH15APY001080	Tree Planting	Little Elk Creek	02130605	222082.69	498232.05	0.01
SH15APY001081	Tree Planting	Northeast River	02130608	217947.92	490058.26	0.21
SH15APY001082	Tree Planting	Octoraro Creek	02120203	218692.03	479202.28	0.04
SH15APY001083	Tree Planting	Octoraro Creek	02120203	218431.94	478936.38	0.09

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001084	Tree Planting	Octoraro Creek	02120203	227129.02	480246.58	0.30
SH15APY001085	Tree Planting	Octoraro Creek	02120203	225687.35	477971.38	0.07
SH15APY001086	Tree Planting	Octoraro Creek	02120203	228454.64	483044.24	0.34
SH15APY001087	Tree Planting	Northeast River	02130605	220083.35	495083.28	0.31
SH15APY001088	Tree Planting	Northeast River	02130608	219348.40	489941.24	2.47
SH15APY001089	Tree Planting	Catoctin Creek	02140305	187817.04	352409.14	0.26
SH15APY001090	Tree Planting	Catoctin Creek	02140305	187953.26	353899.18	0.31
SH15APY001091	Tree Planting	Lower Monocacy River	02140302	194120.56	362588.37	0.41
SH15APY001092	Tree Planting	Lower Monocacy River	02140302	194284.63	362491.57	0.13
SH15APY001093	Tree Planting	Lower Monocacy River	02140302	197681.35	365354.36	0.27
SH15APY001095	Tree Planting	Lower Monocacy River	02140302	194327.29	358931.60	0.15
SH15APY001096	Tree Planting	Lower Monocacy River	02140302	184053.24	369188.59	0.26
SH15APY001097	Tree Planting	Lower Monocacy River	02140302	192831.57	360812.05	0.06
SH15APY001098	Tree Planting	Catoctin Creek	02140305	202413.01	351999.46	0.18
SH15APY001099	Tree Planting	Catoctin Creek	02140305	203872.02	350489.44	0.33
SH15APY001100	Tree Planting	Lower Monocacy River	02140302	193066.43	359836.80	0.49
SH15APY001101	Tree Planting	Catoctin Creek	02140305	187979.46	353341.61	0.18
SH15APY001102	Tree Planting	Catoctin Creek	02140305	188304.83	354600.74	0.33
SH15APY001103	Tree Planting	Lower Monocacy River	02140302	194000.04	362536.72	0.13
SH15APY001104	Tree Planting	Lower Monocacy River	02140302	194363.69	362539.02	0.07
SH15APY001105	Tree Planting	Potomac River FR Cnty	02140301	186718.43	356401.69	0.53
SH15APY001106	Tree Planting	Catoctin Creek	02140305	201389.83	354983.17	0.08
SH15APY001107	Tree Planting	Lower Monocacy River	02140302	183899.21	369246.44	0.20
SH15APY001108	Tree Planting	Catoctin Creek	02140305	188020.14	354198.22	0.11
SH15APY001109	Tree Planting	Upper Monocacy River	02140303	216211.15	363888.81	0.14

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001110	Tree Planting	Upper Monocacy River	02140303	224444.76	371471.57	0.22
SH15APY001111	Tree Planting	Upper Monocacy River	02140303	225719.11	372986.90	0.03
SH15APY001112	Tree Planting	Lower Monocacy River	02140302	184209.42	368588.27	0.15
SH15APY001113	Tree Planting	Lower Monocacy River	02140302	191244.71	373070.19	0.11
SH15APY001114	Tree Planting	Lower Monocacy River	02140302	192713.47	365336.91	0.12
SH15APY001115	Tree Planting	Catoctin Creek	02140305	200255.63	354910.11	0.54
SH15APY001116	Tree Planting	Catoctin Creek	02140305	203896.66	350349.20	0.15
SH15APY001117	Tree Planting	Upper Monocacy River	02140303	227757.85	373631.52	0.06
SH15APY001118	Tree Planting	Upper Monocacy River	02140303	227735.42	373563.34	0.16
SH15APY001119	Tree Planting	Upper Monocacy River	02140303	226422.07	373111.21	0.12
SH15APY001120	Tree Planting	Upper Monocacy River	02140303	221375.98	367811.91	0.27
SH15APY001121	Tree Planting	Upper Monocacy River	02140303	218642.86	364909.88	0.41
SH15APY001122	Tree Planting	Upper Monocacy River	02140303	218877.39	365228.77	0.11
SH15APY001123	Tree Planting	Lower Monocacy River	02140302	194379.31	362640.22	0.17
SH15APY001124	Tree Planting	Lower Monocacy River	02140302	195714.02	363986.21	0.33
SH15APY001125	Tree Planting	Upper Monocacy River	02140303	204053.81	365500.95	0.06
SH15APY001126	Tree Planting	Upper Monocacy River	02140303	209913.51	362974.67	0.09
SH15APY001127	Tree Planting	Upper Monocacy River	02140303	199833.51	368722.62	0.23
SH15APY001128	Tree Planting	Upper Monocacy River	02140303	200727.01	369165.31	0.42
SH15APY001129	Tree Planting	Catoctin Creek	02140305	187729.59	349746.75	0.05
SH15APY001130	Tree Planting	Catoctin Creek	02140305	187575.73	348299.13	0.08
SH15APY001131	Tree Planting	Catoctin Creek	02140305	187749.89	351649.90	0.14
SH15APY001132	Tree Planting	Lower Monocacy River	02140302	189493.48	358009.89	0.29
SH15APY001133	Tree Planting	Lower Monocacy River	02140302	195774.96	364072.27	0.22
SH15APY001134	Tree Planting	Upper Monocacy River	02140303	203130.70	365781.92	0.13

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001135	Tree Planting	Upper Monocacy River	02140303	210766.92	362905.44	0.35
SH15APY001136	Tree Planting	Upper Monocacy River	02140303	201900.07	370486.84	0.15
SH15APY001137	Tree Planting	Potomac River FR Cnty	02140301	186665.12	345799.39	0.02
SH15APY001138	Tree Planting	Lower Monocacy River	02140302	190329.53	377649.53	0.22
SH15APY001139	Tree Planting	Potomac River FR Cnty	02140301	182408.59	355581.00	0.33
SH15APY001140	Tree Planting	Lower Monocacy River	02140302	186888.72	366272.09	0.27
SH15APY001141	Tree Planting	Lower Monocacy River	02140302	191598.24	372146.50	0.41
SH15APY001142	Tree Planting	Potomac River FR Cnty	02140301	187131.17	346740.54	0.05
SH15APY001143	Tree Planting	Catoctin Creek	02140305	187997.42	354115.89	0.08
SH15APY001144	Tree Planting	Upper Monocacy River	02140303	217251.13	364072.62	0.09
SH15APY001145	Tree Planting	Upper Monocacy River	02140303	216384.48	363994.44	0.08
SH15APY001146	Tree Planting	Lower Monocacy River	02140302	207653.84	373144.19	0.16
SH15APY001147	Tree Planting	Lower Monocacy River	02140302	194138.61	362671.59	0.05
SH15APY001148	Tree Planting	Lower Monocacy River	02140302	190910.39	374115.25	0.26
SH15APY001149	Tree Planting	Lower Monocacy River	02140302	192827.52	361290.44	0.42
SH15APY001150	Tree Planting	Catoctin Creek	02140305	200435.14	354591.71	0.52
SH15APY001151	Tree Planting	Upper Monocacy River	02140303	226971.55	373308.14	0.16
SH15APY001152	Tree Planting	Upper Monocacy River	02140303	216012.25	363801.89	0.31
SH15APY001153	Tree Planting	Upper Monocacy River	02140303	225960.60	373077.14	0.05
SH15APY001154	Tree Planting	Upper Monocacy River	02140303	225996.76	373171.22	0.88
SH15APY001155	Tree Planting	Upper Monocacy River	02140303	220230.91	366729.26	0.34
SH15APY001156	Tree Planting	Catoctin Creek	02140305	188074.00	354099.46	0.24
SH15APY001157	Tree Planting	Lower Monocacy River	02140302	190906.12	360439.54	0.40
SH15APY001158	Tree Planting	Catoctin Creek	02140305	188104.76	354195.30	0.06
SH15APY001159	Tree Planting	Lower Monocacy River	02140302	188985.89	356901.36	0.22

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001160	Tree Planting	Lower Monocacy River	02140302	190752.84	360192.44	0.36
SH15APY001161	Tree Planting	Lower Monocacy River	02140302	190596.45	359943.46	0.12
SH15APY001162	Tree Planting	Lower Monocacy River	02140302	192312.29	362079.66	0.62
SH15APY001163	Tree Planting	Lower Monocacy River	02140302	192638.81	361857.61	0.50
SH15APY001165	Tree Planting	Lower Monocacy River	02140302	192362.42	361916.34	0.61
SH15APY001166	Tree Planting	Lower Monocacy River	02140302	190645.47	360022.70	0.12
SH15APY001167	Tree Planting	Lower Monocacy River	02140302	192148.26	362231.56	1.49
SH15APY001168	Tree Planting	Lower Monocacy River	02140302	184770.88	367907.23	0.33
SH15APY001169	Tree Planting	Lower Monocacy River	02140302	184375.03	368279.99	0.21
SH15APY001171	Tree Planting	Upper Monocacy River	02140303	210300.79	362969.68	0.04
SH15APY001172	Tree Planting	Lower Monocacy River	02140302	192943.58	360126.92	0.28
SH15APY001173	Tree Planting	Lower Monocacy River	02140302	192879.44	360465.73	0.28
SH15APY001174	Tree Planting	Upper Monocacy River	02140303	227461.10	373445.34	0.12
SH15APY001175	Tree Planting	Upper Monocacy River	02140303	227241.95	373346.78	0.11
SH15APY001176	Tree Planting	Catoctin Creek	02140305	187626.67	349990.27	0.06
SH15APY001177	Tree Planting	Catoctin Creek	02140305	201325.93	354987.21	0.16
SH15APY001178	Tree Planting	Catoctin Creek	02140305	199889.49	355191.74	0.42
SH15APY001179	Tree Planting	Catoctin Creek	02140305	199741.55	355352.38	0.11
SH15APY001180	Tree Planting	Catoctin Creek	02140305	200178.93	354875.52	0.53
SH15APY001181	Tree Planting	Bynum Run	02130704	211060.38	453631.99	0.09
SH15APY001182	Tree Planting	Bynum Run	02130704	209909.97	454616.00	0.24
SH15APY001183	Tree Planting	Bynum Run	02130704	210926.46	455413.45	1.32
SH15APY001184	Tree Planting	Bush River	02130701	200764.63	465735.75	0.12
SH15APY001185	Tree Planting	Bynum Run	02130704	211360.62	455802.86	1.13
SH15APY001186	Tree Planting	Little Gunpowder Falls	02130804	206880.33	448201.33	0.15

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001187	Tree Planting	Little Gunpowder Falls	02130804	205939.28	450132.77	0.17
SH15APY001188	Tree Planting	Atkisson Reservoir	02130703	205784.71	450424.95	0.13
SH15APY001189	Tree Planting	Atkisson Reservoir	02130703	204450.22	451331.55	0.25
SH15APY001190	Tree Planting	Bynum Run	02130704	211636.81	455919.00	0.20
SH15APY001191	Tree Planting	Lower Winters Run	02130702	196741.69	456562.07	0.33
SH15APY001192	Tree Planting	Bush River	02130701	201212.63	465205.09	1.01
SH15APY001193	Tree Planting	Swan Creek	02130706	205445.45	472288.06	0.20
SH15APY001194	Tree Planting	Little Gunpowder Falls	02130804	207113.21	447776.19	0.35
SH15APY001195	Tree Planting	Atkisson Reservoir	02130703	208649.79	445010.93	0.48
SH15APY001196	Tree Planting	Atkisson Reservoir	02130703	210794.23	453786.43	0.06
SH15APY001197	Tree Planting	Bynum Run	02130704	210965.26	453687.49	0.05
SH15APY001198	Tree Planting	Little Gunpowder Falls	02130804	206495.49	448997.21	0.57
SH15APY001199	Tree Planting	Lower Winters Run	02130702	197602.92	460339.16	0.23
SH15APY001200	Tree Planting	Bush River	02130701	202044.20	465176.79	0.10
SH15APY001201	Tree Planting	Atkisson Reservoir	02130703	205834.53	450309.58	0.36
SH15APY001202	Tree Planting	Atkisson Reservoir	02130703	210602.02	453891.70	0.04
SH15APY001203	Tree Planting	Bynum Run	02130704	212196.59	456534.19	0.15
SH15APY001204	Tree Planting	Little Gunpowder Falls	02130804	206989.52	448003.93	0.22
SH15APY001205	Tree Planting	Little Gunpowder Falls	02130804	209074.42	444524.26	0.15
SH15APY001206	Tree Planting	Bynum Run	02130704	211214.85	453516.00	0.18
SH15APY001208	Tree Planting	Deer Creek	02120202	212434.35	456815.73	0.63
SH15APY001209	Tree Planting	Bynum Run	02130704	211541.76	455161.08	0.17
SH15APY001210	Tree Planting	Atkisson Reservoir	02130703	204588.21	456804.21	0.11
SH15APY001212	Tree Planting	Little Gunpowder Falls	02130804	208932.51	444694.58	0.02
SH15APY001213	Tree Planting	Little Gunpowder Falls	02130804	206945.83	448092.10	0.02

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001214	Tree Planting	Atkisson Reservoir	02130703	210726.07	453825.72	0.05
SH15APY001215	Tree Planting	Atkisson Reservoir	02130703	206648.68	448678.73	0.12
SH15APY001216	Tree Planting	Little Gunpowder Falls	02130804	208122.14	445997.61	0.09
SH15APY001217	Tree Planting	Little Gunpowder Falls	02130804	208434.35	445355.55	0.31
SH15APY001218	Tree Planting	Little Gunpowder Falls	02130804	207495.11	447107.34	0.05
SH15APY001219	Tree Planting	Little Gunpowder Falls	02130804	207313.08	447431.31	0.05
SH15APY001220	Tree Planting	Atkisson Reservoir	02130703	206720.77	448533.97	0.12
SH15APY001221	Tree Planting	Atkisson Reservoir	02130703	209384.20	444152.76	0.05
SH15APY001222	Tree Planting	Atkisson Reservoir	02130703	208783.60	444854.90	0.13
SH15APY001223	Tree Planting	Atkisson Reservoir	02130703	210531.34	443120.71	0.13
SH15APY001224	Tree Planting	Bynum Run	02130704	211396.01	453354.07	0.16
SH15APY001226	Tree Planting	Bush River	02130701	201972.00	465121.37	0.17
SH15APY001227	Tree Planting	Bush River	02130701	201839.38	465019.39	0.53
SH15APY001228	Tree Planting	Bush River	02130701	201752.65	464833.21	0.04
SH15APY001229	Tree Planting	Atkisson Reservoir	02130703	204472.01	456896.33	0.15
SH15APY001230	Tree Planting	Patapsco River L N Br	02130906	171518.32	417350.02	0.11
SH15APY001231	Tree Planting	Rock Creek	02140206	148540.53	393201.61	0.53
SH15APY001232	Tree Planting	Rock Creek	02140206	148455.88	393246.17	0.12
SH15APY001233	Tree Planting	Anacostia River	02140205	153710.77	406416.44	0.04
SH15APY001234	Tree Planting	Anacostia River	02140205	154433.73	406369.63	0.22
SH15APY001235	Tree Planting	Anacostia River	02140205	155422.99	407761.12	0.22
SH15APY001236	Tree Planting	Anacostia River	02140205	155297.19	407675.49	0.02
SH15APY001237	Tree Planting	Antietam Creek	02140502	210830.44	345477.33	0.25
SH15APY001238	Tree Planting	Antietam Creek	02140502	211548.21	344540.57	0.37
SH15APY001239	Tree Planting	Antietam Creek	02140502	211075.03	345143.50	0.11

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH15APY001240	Tree Planting	Antietam Creek	02140502	209399.80	347298.62	0.07
SH15APY001241	Tree Planting	Antietam Creek	02140502	211215.53	344958.64	0.14
SH15APY001242	Tree Planting	Antietam Creek	02140502	211723.50	344404.70	0.09
SH15APY001243	Tree Planting	Antietam Creek	02140502	208812.80	347576.77	0.37
SH15APY001244	Tree Planting	Antietam Creek	02140502	209432.04	347198.76	0.16
SH15APY001245	Tree Planting	Antietam Creek	02140502	210429.95	346035.54	0.16
SH15APY001246	Tree Planting	Antietam Creek	02140502	212226.96	343831.94	0.15
SH15APY001247	Tree Planting	Antietam Creek	02140502	212499.76	343521.56	0.03
SH15APY001248	Tree Planting	Antietam Creek	02140502	212940.75	343018.86	0.12
SH15APY001249	Tree Planting	Antietam Creek	02140502	213076.24	342865.00	0.11
SH15APY001250	Tree Planting	Antietam Creek	02140502	213200.09	342724.29	0.08
SH15APY001251	Tree Planting	Antietam Creek	02140502	209443.35	347249.52	0.02
SH15APY001252	Tree Planting	Antietam Creek	02140502	211128.97	345064.37	0.23
SH15APY001253	Tree Planting	Antietam Creek	02140502	214192.72	343717.97	0.13
SH15APY001254	Tree Planting	Conococheague Creek	02140504	215564.33	333779.50	0.69
SH15APY001255	Tree Planting	Antietam Creek	02140502	213291.59	345047.38	0.02
SH15APY001256	Tree Planting	Antietam Creek	02140502	213315.74	345063.24	0.02
SH15APY001547	Tree Planting	Lower Monocacy River	02140302	192197.73	361950.06	0.47
SH15APY003000	Tree Planting	Upper Monocacy River	02140303	225841.92	388836.03	0.16
SH16APY001257	Tree Planting	Patuxent River lower	02131101	118692.57	435247.97	0.14
SH16APY001258	Tree Planting	South River	02131003	142966.37	430997.04	0.15
SH16APY001259	Tree Planting	Patuxent River middle	02131102	126901.24	425864.11	0.12
SH16APY001260	Tree Planting	Patuxent River middle	02131102	123774.82	432440.80	0.09
SH16APY001261	Tree Planting	West River	02131004	136033.39	437523.02	0.06
SH16APY001262	Tree Planting	South River	02131003	137593.78	438556.93	0.23

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001264	Tree Planting	Patuxent River middle	02131102	122676.43	434833.14	0.16
SH16APY001266	Tree Planting	West River	02131004	135444.74	437395.31	0.12
SH16APY001267	Tree Planting	West Chesapeake Bay	02131005	127335.07	434407.12	0.62
SH16APY001268	Tree Planting	Patuxent River middle	02131102	128052.10	434194.74	0.09
SH16APY001269	Tree Planting	Patuxent River middle	02131102	124165.92	431500.08	0.95
SH16APY001270	Tree Planting	Patuxent River middle	02131102	124511.63	430810.55	0.33
SH16APY001271	Tree Planting	Patuxent River middle	02131102	123718.01	432693.42	0.20
SH16APY001272	Tree Planting	West River	02131004	135937.70	437470.68	0.24
SH16APY001273	Tree Planting	South River	02131003	137710.78	438607.09	0.16
SH16APY001274	Tree Planting	Patuxent River middle	02131102	128123.54	434153.01	0.09
SH16APY001275	Tree Planting	Patuxent River middle	02131102	126070.70	434856.47	0.05
SH16APY001278	Tree Planting	Patuxent River lower	02131101	118264.67	435063.22	0.38
SH16APY001279	Tree Planting	South River	02131003	143536.81	430091.68	0.14
SH16APY001280	Tree Planting	Patuxent River middle	02131102	123769.73	432478.52	0.08
SH16APY001281	Tree Planting	Patuxent River middle	02131102	127985.08	434223.16	0.05
SH16APY001283	Tree Planting	Patuxent River middle	02131102	125552.05	434847.66	0.46
SH16APY001284	Tree Planting	Patuxent River middle	02131102	123819.25	433249.16	0.52
SH16APY001286	Tree Planting	Patuxent River middle	02131102	127121.33	434478.45	0.09
SH16APY001287	Tree Planting	Patuxent River middle	02131102	123701.55	432868.61	0.51
SH16APY001288	Tree Planting	West Chesapeake Bay	02131005	128631.18	433553.45	0.41
SH16APY001289	Tree Planting	Patuxent River middle	02131102	125361.64	434849.32	0.19
SH16APY001290	Tree Planting	Patuxent River middle	02131102	128474.74	433739.15	0.04
SH16APY001291	Tree Planting	Patuxent River lower	02131101	117780.58	434748.37	0.17
SH16APY001292	Tree Planting	Patuxent River middle	02131102	124367.94	431167.47	0.19
SH16APY001293	Tree Planting	Severn River	02131002	149552.19	443857.05	0.08

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001294	Tree Planting	Severn River	02131002	149795.80	443913.93	0.18
SH16APY001295	Tree Planting	Severn River	02131002	149615.39	444133.95	0.42
SH16APY001296	Tree Planting	Severn River	02131002	149770.92	444100.53	0.14
SH16APY001297	Tree Planting	Severn River	02131002	149601.77	443819.70	0.15
SH16APY001298	Tree Planting	Severn River	02131002	149784.67	443849.83	0.23
SH16APY001299	Tree Planting	Severn River	02131002	150653.99	445704.64	0.22
SH16APY001300	Tree Planting	Severn River	02131002	151222.17	447625.99	0.12
SH16APY001301	Tree Planting	Severn River	02131002	150518.86	445334.11	0.16
SH16APY001302	Tree Planting	Severn River	02131002	149429.79	444224.70	0.06
SH16APY001303	Tree Planting	Severn River	02131002	146362.75	439418.46	0.13
SH16APY001305	Tree Planting	South River	02131003	145130.08	439753.57	0.11
SH16APY001306	Tree Planting	South River	02131003	145007.65	439847.41	0.15
SH16APY001308	Tree Planting	West Chesapeake Bay	02131005	128560.02	433666.34	0.30
SH16APY001310	Tree Planting	Patuxent River middle	02131102	128277.29	434022.15	0.06
SH16APY001311	Tree Planting	Patuxent River middle	02131102	128255.88	434038.93	0.03
SH16APY001312	Tree Planting	Patuxent River middle	02131102	128217.67	434070.03	0.12
SH16APY001313	Tree Planting	Patapsco River L N Br	02130906	175908.66	427692.01	0.21
SH16APY001314	Tree Planting	Gwynns Falls	02130905	181963.45	422259.94	0.20
SH16APY001315	Tree Planting	Patapsco River L N Br	02130906	172117.48	426003.08	0.12
SH16APY001316	Tree Planting	Patapsco River L N Br	02130906	175649.44	427230.22	0.25
SH16APY001317	Tree Planting	Gwynns Falls	02130905	190325.68	421249.13	0.09
SH16APY001318	Tree Planting	Gwynns Falls	02130905	181736.35	421973.73	0.37
SH16APY001319	Tree Planting	Patapsco River L N Br	02130906	175915.61	427463.85	0.30
SH16APY001320	Tree Planting	Patapsco River L N Br	02130906	176310.63	427966.16	0.29
SH16APY001321	Tree Planting	Patapsco River L N Br	02130906	176172.59	427672.65	0.14

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001322	Tree Planting	Gwynns Falls	02130905	190341.63	421148.72	0.09
SH16APY001323	Tree Planting	Patapsco River L N Br	02130906	175903.92	427412.46	0.30
SH16APY001324	Tree Planting	Patapsco River L N Br	02130906	175728.17	427657.29	0.27
SH16APY001325	Tree Planting	Gwynns Falls	02130905	182056.04	421675.42	0.78
SH16APY001326	Tree Planting	Gwynns Falls	02130905	181756.93	422235.60	0.05
SH16APY001327	Tree Planting	Patapsco River L N Br	02130906	175808.09	427628.44	0.11
SH16APY001328	Tree Planting	Liberty Reservoir	02130907	200892.06	414617.32	0.20
SH16APY001329	Tree Planting	Loch Raven Reservoir	02130805	201848.10	425166.95	0.11
SH16APY001330	Tree Planting	Loch Raven Reservoir	02130805	202224.23	425167.79	0.10
SH16APY001331	Tree Planting	Loch Raven Reservoir	02130805	199975.63	429132.05	0.29
SH16APY001332	Tree Planting	Gwynns Falls	02130905	181864.92	422209.61	0.50
SH16APY001333	Tree Planting	Gwynns Falls	02130905	181860.87	422305.23	0.51
SH16APY001334	Tree Planting	Bird River	02130803	190739.85	443283.19	0.17
SH16APY001336	Tree Planting	Gwynns Falls	02130905	186730.04	421844.00	1.01
SH16APY001337	Tree Planting	Jones Falls	02130904	193931.73	429017.75	0.13
SH16APY001338	Tree Planting	Jones Falls	02130904	193841.50	428975.04	0.09
SH16APY001339	Tree Planting	Jones Falls	02130904	194005.95	428893.11	0.16
SH16APY001340	Tree Planting	Back River	02130901	180079.70	443142.54	0.09
SH16APY001341	Tree Planting	Back River	02130901	189258.86	442018.32	0.08
SH16APY001342	Tree Planting	Bird River	02130803	190678.14	443225.22	0.03
SH16APY001343	Tree Planting	Bird River	02130803	191180.24	443717.08	0.14
SH16APY001344	Tree Planting	Liberty Reservoir	02130907	200228.36	414034.74	0.25
SH16APY001347	Tree Planting	Patapsco River L N Br	02130906	175855.61	427605.39	0.04
SH16APY001348	Tree Planting	Patuxent River lower	02131101	96410.98	419243.08	0.49
SH16APY001349	Tree Planting	Mattawoman Creek	02140111	109692.17	410975.61	0.12

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001350	Tree Planting	Patuxent River lower	02131101	95707.41	419452.41	0.29
SH16APY001351	Tree Planting	Patuxent River lower	02131101	97335.10	418198.51	0.19
SH16APY001352	Tree Planting	Mattawoman Creek	02140111	109882.91	410930.97	0.11
SH16APY001353	Tree Planting	Zekiah Swamp	02140108	105536.70	410907.02	0.35
SH16APY001354	Tree Planting	Atkisson Reservoir	02130703	212528.80	447517.39	0.40
SH16APY001355	Tree Planting	Bynum Run	02130704	211882.70	454046.54	0.39
SH16APY001356	Tree Planting	Little Gunpowder Falls	02130804	207910.04	446358.44	0.03
SH16APY001357	Tree Planting	Little Gunpowder Falls	02130804	207965.76	446276.69	0.10
SH16APY001359	Tree Planting	Bynum Run	02130704	212504.27	452717.08	0.06
SH16APY001360	Tree Planting	Bynum Run	02130704	212685.04	452673.46	0.04
SH16APY001361	Tree Planting	Atkisson Reservoir	02130703	212016.81	449339.86	0.28
SH16APY001362	Tree Planting	Broad Creek	02120205	224196.43	453506.63	0.46
SH16APY001363	Tree Planting	Bynum Run	02130704	212611.19	452692.20	0.04
SH16APY001364	Tree Planting	Bynum Run	02130704	212560.31	452705.77	0.06
SH16APY001365	Tree Planting	Bynum Run	02130704	212226.91	452733.46	0.19
SH16APY001366	Tree Planting	Bynum Run	02130704	212107.73	453155.91	0.55
SH16APY001367	Tree Planting	Broad Creek	02120205	223942.09	453351.44	0.43
SH16APY001368	Tree Planting	Atkisson Reservoir	02130703	212021.16	449622.42	1.78
SH16APY001369	Tree Planting	Little Gunpowder Falls	02130804	207858.88	446385.41	0.30
SH16APY001370	Tree Planting	Atkisson Reservoir	02130703	211992.49	449469.51	0.51
SH16APY001371	Tree Planting	Little Gunpowder Falls	02130804	208006.78	446199.61	0.46
SH16APY001372	Tree Planting	Atkisson Reservoir	02130703	211977.83	450691.13	0.85
SH16APY001373	Tree Planting	Atkisson Reservoir	02130703	213370.41	445370.05	1.75
SH16APY001374	Tree Planting	Atkisson Reservoir	02130703	212034.18	449193.34	0.21
SH16APY001381	Tree Planting	Anacostia River	02140205	152842.50	400622.80	0.33

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001382	Tree Planting	Anacostia River	02140205	152943.45	400754.76	0.70
SH16APY001383	Tree Planting	Seneca Creek	02140208	167462.31	378735.00	0.18
SH16APY001384	Tree Planting	Cabin John Creek	02140207	147222.35	386388.87	0.11
SH16APY001385	Tree Planting	Seneca Creek	02140208	169838.88	377299.88	0.07
SH16APY001386	Tree Planting	Seneca Creek	02140208	168356.65	377884.69	0.10
SH16APY001387	Tree Planting	Seneca Creek	02140208	173617.02	375520.05	0.05
SH16APY001389	Tree Planting	Seneca Creek	02140208	161850.82	367925.13	0.20
SH16APY001390	Tree Planting	Seneca Creek	02140208	164187.65	381390.49	0.06
SH16APY001391	Tree Planting	Potomac River MO Cnty	02140202	159059.81	384107.77	0.11
SH16APY001392	Tree Planting	Seneca Creek	02140208	163463.94	381570.36	0.24
SH16APY001393	Tree Planting	Seneca Creek	02140208	173882.75	375443.82	0.10
SH16APY001394	Tree Planting	Seneca Creek	02140208	168407.79	377738.03	0.24
SH16APY001395	Tree Planting	Rocky Gorge Dam	02131107	166367.00	394793.83	0.03
SH16APY001396	Tree Planting	Rocky Gorge Dam	02131107	166446.40	394809.07	0.07
SH16APY001397	Tree Planting	Cabin John Creek	02140207	148075.50	384694.08	0.07
SH16APY001398	Tree Planting	Cabin John Creek	02140207	148012.97	384811.18	0.04
SH16APY001399	Tree Planting	Seneca Creek	02140208	170081.65	377106.83	0.16
SH16APY001400	Tree Planting	Seneca Creek	02140208	170005.46	377124.79	1.02
SH16APY001401	Tree Planting	Seneca Creek	02140208	170207.70	377165.94	0.13
SH16APY001402	Tree Planting	Seneca Creek	02140208	170295.77	377066.05	0.04
SH16APY001403	Tree Planting	Seneca Creek	02140208	170645.38	376751.94	0.18
SH16APY001404	Tree Planting	Potomac River MO Cnty	02140202	151665.64	379644.98	0.05
SH16APY001405	Tree Planting	Potomac River MO Cnty	02140202	151724.79	379549.54	0.01
SH16APY001406	Tree Planting	Potomac River MO Cnty	02140202	151745.81	379516.04	0.01
SH16APY001407	Tree Planting	Seneca Creek	02140208	166498.53	375666.94	0.04

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001408	Tree Planting	Seneca Creek	02140208	169681.19	378989.43	0.44
SH16APY001409	Tree Planting	Potomac River MO Cnty	02140202	161819.56	384560.69	1.10
SH16APY001410	Tree Planting	Cabin John Creek	02140207	147175.10	386410.99	0.13
SH16APY001411	Tree Planting	Seneca Creek	02140208	169788.99	377331.48	0.07
SH16APY001412	Tree Planting	Seneca Creek	02140208	169991.87	377054.96	0.15
SH16APY001413	Tree Planting	Seneca Creek	02140208	170012.74	377028.03	0.15
SH16APY001414	Tree Planting	Seneca Creek	02140208	170048.91	377018.16	0.03
SH16APY001415	Tree Planting	Potomac River MO Cnty	02140202	151592.49	379766.47	0.03
SH16APY001416	Tree Planting	Seneca Creek	02140208	164158.22	381386.75	0.04
SH16APY001417	Tree Planting	Seneca Creek	02140208	161445.92	378256.10	0.51
SH16APY001418	Tree Planting	Anacostia River	02140205	149569.76	396258.88	0.11
SH16APY001419	Tree Planting	Seneca Creek	02140208	169889.04	376990.93	0.18
SH16APY001420	Tree Planting	Seneca Creek	02140208	161377.32	378239.53	0.06
SH16APY001421	Tree Planting	Anacostia River	02140205	156547.05	403829.81	0.31
SH16APY001422	Tree Planting	Anacostia River	02140205	149599.54	396298.36	0.03
SH16APY001423	Tree Planting	Anacostia River	02140205	161327.36	402324.11	4.43
SH16APY001424	Tree Planting	Rocky Gorge Dam	02131107	161751.20	406421.26	0.07
SH16APY001425	Tree Planting	Rocky Gorge Dam	02131107	161827.75	406465.07	0.10
SH16APY001426	Tree Planting	Rocky Gorge Dam	02131107	160531.27	406112.11	0.32
SH16APY001427	Tree Planting	Anacostia River	02140205	160116.34	406086.38	0.16
SH16APY001428	Tree Planting	Anacostia River	02140205	160230.88	406143.19	0.13
SH16APY001429	Tree Planting	Anacostia River	02140205	147207.32	409740.12	0.10
SH16APY001430	Tree Planting	Western Branch	02131103	136031.50	413089.81	0.29
SH16APY001431	Tree Planting	Mattawoman Creek	02140111	107760.53	395429.85	0.04
SH16APY001432	Tree Planting	Anacostia River	02140205	141914.96	411498.55	0.45

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001433	Tree Planting	Patuxent River upper	02131104	158880.07	413194.34	0.30
SH16APY001434	Tree Planting	Potomac River U tidal	02140201	126125.49	400283.80	0.07
SH16APY001435	Tree Planting	Potomac River U tidal	02140201	125886.16	400055.94	0.06
SH16APY001436	Tree Planting	Potomac River U tidal	02140201	128848.86	410460.19	0.48
SH16APY001437	Tree Planting	Potomac River M tidal	02140102	107594.61	395197.48	0.04
SH16APY001438	Tree Planting	Piscataway Creek	02140203	111859.89	399422.71	0.19
SH16APY001439	Tree Planting	Western Branch	02131103	127165.95	422575.24	0.03
SH16APY001440	Tree Planting	Mattawoman Creek	02140111	110047.78	399178.20	0.11
SH16APY001441	Tree Planting	Patuxent River upper	02131104	159186.56	409683.19	0.24
SH16APY001442	Tree Planting	Anacostia River	02140205	139920.14	410998.43	0.06
SH16APY001443	Tree Planting	Potomac River U tidal	02140201	126103.74	400141.03	0.13
SH16APY001444	Tree Planting	Mattawoman Creek	02140111	107897.83	395562.29	0.03
SH16APY001445	Tree Planting	Potomac River U tidal	02140201	130299.36	411441.08	0.04
SH16APY001446	Tree Planting	Mattawoman Creek	02140111	107709.15	395359.89	0.02
SH16APY001447	Tree Planting	Potomac River U tidal	02140201	130236.13	411310.20	0.40
SH16APY001448	Tree Planting	Mattawoman Creek	02140111	110447.60	398611.22	0.06
SH16APY001449	Tree Planting	Anacostia River	02140205	139644.52	410846.20	0.08
SH16APY001450	Tree Planting	Anacostia River	02140205	139917.31	410764.04	0.12
SH16APY001451	Tree Planting	Potomac River U tidal	02140201	125988.74	400165.00	0.30
SH16APY001452	Tree Planting	Anacostia River	02140205	143721.85	411596.26	0.17
SH16APY001453	Tree Planting	Anacostia River	02140205	139961.13	410925.56	0.12
SH16APY001454	Tree Planting	Potomac River U tidal	02140201	125938.04	400032.74	0.10
SH16APY001455	Tree Planting	Potomac River U tidal	02140201	129661.64	405093.77	0.08
SH16APY001456	Tree Planting	Anacostia River	02140205	148687.87	409230.74	0.06
SH16APY001457	Tree Planting	Western Branch	02131103	134071.97	418766.58	0.17

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001458	Tree Planting	Western Branch	02131103	135507.90	424314.68	0.16
SH16APY001459	Tree Planting	Anacostia River	02140205	148992.49	409347.64	0.06
SH16APY001460	Tree Planting	Western Branch	02131103	132936.70	413286.81	0.12
SH16APY001461	Tree Planting	Anacostia River	02140205	148701.66	409194.40	0.25
SH16APY001462	Tree Planting	Western Branch	02131103	127337.92	422523.29	0.13
SH16APY001463	Tree Planting	Western Branch	02131103	130369.49	411726.81	0.36
SH16APY001464	Tree Planting	Potomac River U tidal	02140201	125983.94	400037.12	0.09
SH16APY001465	Tree Planting	Potomac River U tidal	02140201	125959.60	400035.54	0.03
SH16APY001466	Tree Planting	Potomac River U tidal	02140201	125943.49	400199.11	0.17
SH16APY001467	Tree Planting	Western Branch	02131103	127291.66	421750.86	0.07
SH16APY001468	Tree Planting	Western Branch	02131103	127314.94	421811.01	0.08
SH16APY001469	Tree Planting	Western Branch	02131103	127130.95	422602.54	0.04
SH16APY001470	Tree Planting	Potomac River M tidal	02140102	107655.68	395284.57	0.04
SH16APY001471	Tree Planting	Antietam Creek	02140502	214925.65	342203.99	0.12
SH16APY001472	Tree Planting	Antietam Creek	02140502	214964.13	341511.28	0.05
SH16APY001473	Tree Planting	Antietam Creek	02140502	199366.72	342995.37	0.33
SH16APY001474	Tree Planting	Antietam Creek	02140502	197843.16	342718.74	0.34
SH16APY001475	Tree Planting	Antietam Creek	02140502	197672.01	342715.90	0.04
SH16APY001476	Tree Planting	Antietam Creek	02140502	197503.24	342734.42	0.23
SH16APY001477	Tree Planting	Antietam Creek	02140502	197131.03	342832.85	0.05
SH16APY001478	Tree Planting	Antietam Creek	02140502	195600.41	343070.74	1.77
SH16APY001479	Tree Planting	Antietam Creek	02140502	195185.54	342921.63	0.32
SH16APY001480	Tree Planting	Potomac River FR Cnty	02140301	192674.90	343445.65	0.54
SH16APY001481	Tree Planting	Antietam Creek	02140502	194360.52	342900.73	0.86
SH16APY001482	Tree Planting	Potomac River FR Cnty	02140301	194069.79	342989.78	0.59

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001483	Tree Planting	Potomac River FR Cnty	02140301	192113.66	343674.60	0.08
SH16APY001484	Tree Planting	Potomac River FR Cnty	02140301	191849.28	343638.69	0.34
SH16APY001485	Tree Planting	Antietam Creek	02140502	202901.13	344263.93	0.05
SH16APY001486	Tree Planting	Antietam Creek	02140502	202854.22	344294.69	0.50
SH16APY001487	Tree Planting	Antietam Creek	02140502	202549.69	344202.29	1.03
SH16APY001488	Tree Planting	Antietam Creek	02140502	201552.49	343845.91	0.08
SH16APY001489	Tree Planting	Antietam Creek	02140502	201272.63	343761.13	0.08
SH16APY001490	Tree Planting	Potomac River FR Cnty	02140301	191560.23	343538.73	0.10
SH16APY001491	Tree Planting	Potomac River FR Cnty	02140301	191493.05	343512.60	0.17
SH16APY001492	Tree Planting	Potomac River FR Cnty	02140301	191403.04	343476.27	0.22
SH16APY001493	Tree Planting	Potomac River FR Cnty	02140301	191126.25	343371.97	0.21
SH16APY001494	Tree Planting	Potomac River FR Cnty	02140301	189112.87	342240.91	0.26
SH16APY001495	Tree Planting	Potomac River FR Cnty	02140301	188970.22	342189.92	0.04
SH16APY001496	Tree Planting	Potomac River FR Cnty	02140301	188934.55	342176.42	0.06
SH16APY001497	Tree Planting	Potomac River FR Cnty	02140301	188664.42	342062.70	0.13
SH16APY001498	Tree Planting	Potomac River FR Cnty	02140301	187535.21	341488.31	0.30
SH16APY001499	Tree Planting	Potomac River FR Cnty	02140301	186330.37	341187.73	0.15
SH16APY001500	Tree Planting	Potomac River FR Cnty	02140301	185850.16	341058.04	0.11
SH16APY001501	Tree Planting	Potomac River FR Cnty	02140301	185153.21	339827.42	0.24
SH16APY001502	Tree Planting	Potomac River FR Cnty	02140301	186694.87	341259.91	0.06
SH16APY001503	Tree Planting	Potomac River FR Cnty	02140301	186590.41	341234.14	0.33
SH16APY001504	Tree Planting	Potomac River FR Cnty	02140301	187716.61	341510.03	0.16
SH16APY001505	Tree Planting	Antietam Creek	02140502	197188.94	342813.74	0.07
SH16APY001506	Tree Planting	Antietam Creek	02140502	197117.11	342894.80	0.84
SH16APY001507	Tree Planting	Antietam Creek	02140502	198088.07	342726.37	0.23

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001508	Tree Planting	Antietam Creek	02140502	199528.05	343160.70	0.99
SH16APY001509	Tree Planting	Antietam Creek	02140502	201451.72	343815.87	0.04
SH16APY001510	Tree Planting	Antietam Creek	02140502	199215.95	342982.75	0.13
SH16APY001511	Tree Planting	Antietam Creek	02140502	201358.48	343786.51	0.05
SH16APY001512	Tree Planting	Antietam Creek	02140502	194605.35	342827.40	0.22
SH16APY001513	Tree Planting	Potomac River FR Cnty	02140301	185885.41	341076.43	0.04
SH16APY001514	Tree Planting	Marsh Run	02140503	215471.28	336130.07	0.28
SH16APY001515	Tree Planting	Marsh Run	02140503	215498.31	335960.64	0.19
SH16APY001516	Tree Planting	Antietam Creek	02140502	213143.23	345082.50	0.19
SH16APY001517	Tree Planting	Antietam Creek	02140502	212202.12	343793.26	0.63
SH16APY001518	Tree Planting	Antietam Creek	02140502	214249.74	343759.38	0.13
SH16APY001519	Tree Planting	Antietam Creek	02140502	212910.83	345480.25	0.18
SH16APY001520	Tree Planting	Antietam Creek	02140502	214381.60	343597.75	0.11
SH16APY001521	Tree Planting	Antietam Creek	02140502	214431.38	343536.54	0.12
SH16APY001522	Tree Planting	Antietam Creek	02140502	213317.67	345014.45	0.17
SH16APY001523	Tree Planting	Antietam Creek	02140502	214868.67	342252.98	0.14
SH16APY001524	Tree Planting	Conococheague Creek	02140504	213681.26	342127.51	0.05
SH16APY001525	Tree Planting	Antietam Creek	02140502	196864.49	342981.66	0.13
SH16APY001526	Tree Planting	Potomac River FR Cnty	02140301	191209.97	343400.10	0.08
SH16APY001527	Tree Planting	Potomac River FR Cnty	02140301	191315.19	343445.39	0.17
SH16APY001528	Tree Planting	Potomac River FR Cnty	02140301	189019.43	342207.18	0.13
SH16APY001529	Tree Planting	Antietam Creek	02140502	199280.29	343022.67	0.08
SH16APY001530	Tree Planting	Conococheague Creek	02140504	220717.90	335705.19	0.56
SH16APY001531	Tree Planting	Potomac River FR Cnty	02140301	192210.68	343672.46	0.09
SH16APY001532	Tree Planting	Antietam Creek	02140502	213407.28	344845.46	0.14

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001541	Tree Planting	Severn River	02131002	150973.32	447423.22	0.34
SH16APY001542	Tree Planting	Patuxent River middle	02131102	126857.89	425905.32	0.24
SH16APY001543	Tree Planting	Severn River	02131002	156841.52	428128.26	0.59
SH16APY001544	Tree Planting	Severn River	02131002	156913.57	427919.55	0.57
SH16APY001545	Tree Planting	Patuxent River middle	02131102	124077.35	433787.54	0.07
SH16APY001546	Tree Planting	South River	02131003	145911.00	438977.87	0.30
SH16APY001552	Tree Planting	Patuxent River middle	02131102	123827.34	431956.01	0.12
SH16APY001553	Tree Planting	Patuxent River middle	02131102	123840.20	431903.21	0.05
SH16APY001563	Tree Planting	West Chesapeake Bay	02131005	120527.08	435297.10	0.09
SH16APY001564	Tree Planting	Patuxent River middle	02131102	120875.12	435221.04	0.27
SH16APY001567	Tree Planting	South River	02131003	137833.51	438662.68	0.03
SH16APY001568	Tree Planting	Nanjemoy Creek	02140110	91277.79	379800.75	0.28
SH16APY001569	Tree Planting	Severn River	02131002	158260.85	427015.25	0.36
SH16APY001570	Tree Planting	Severn River	02131002	155125.64	430965.65	0.46
SH16APY001571	Tree Planting	Zekiah Swamp	02140108	105798.50	410890.40	0.19
SH16APY001572	Tree Planting	Severn River	02131002	151078.59	447386.19	0.21
SH16APY001573	Tree Planting	Patuxent River lower	02131101	97174.57	418387.34	0.35
SH16APY001575	Tree Planting	South River	02131003	137874.28	438684.42	0.02
SH16APY001576	Tree Planting	Patuxent River lower	02131101	97354.33	418273.02	0.10
SH16APY001577	Tree Planting	Severn River	02131002	159114.70	426518.67	0.33
SH16APY001578	Tree Planting	Gilbert Swamp	02140107	89554.76	416010.52	0.20
SH16APY001579	Tree Planting	Gilbert Swamp	02140107	89695.42	414793.75	0.32
SH16APY001582	Tree Planting	Patapsco River L N Br	02130906	172460.08	429384.40	0.46
SH16APY001597	Tree Planting	Back River	02130901	192035.20	438781.99	0.36
SH16APY001602	Tree Planting	Deer Creek	02120202	226863.76	430368.93	0.30

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH16APY001603	Tree Planting	Deer Creek	02120202	227751.04	429857.02	0.22
SH16APY001604	Tree Planting	Patapsco River L N Br	02130906	175753.89	427819.09	0.20
SH16APY001612	Tree Planting	Loch Raven Reservoir	02130805	218317.47	428205.40	0.35
SH16APY003000	Tree Planting	Baltimore Harbor	02130903	162943.48	435221.00	0.33
SH17APY001548	Tree Planting	Potomac River WA Cnty	02140501	202437.11	335579.99	5.33
SH17APY001549	Tree Planting	Antietam Creek	02140502	201619.55	336108.80	1.62
SH17APY001550	Tree Planting	Potomac River WA Cnty	02140501	201383.82	335401.87	0.80
SH17APY001551	Tree Planting	Antietam Creek	02140502	201950.99	336110.26	1.56
SH17APY001639	Tree Planting	Patuxent River upper	02131104	136647.13	424837.36	0.07
SH17APY001640	Tree Planting	Anacostia River	02140205	148452.06	409184.41	0.16
SH17APY001641	Tree Planting	Potomac River U tidal	02140201	127968.00	409199.56	0.09
SH17APY001642	Tree Planting	Anacostia River	02140205	148541.30	409243.38	0.16
SH17APY001643	Tree Planting	Anacostia River	02140205	146878.36	409949.92	0.27
SH17APY001644	Tree Planting	Potomac River U tidal	02140201	129530.26	405101.51	0.07
SH17APY001646	Tree Planting	Western Branch	02131103	141255.83	412621.85	1.28
SH17APY001647	Tree Planting	Anacostia River	02140205	132799.89	408854.87	0.08
SH17APY001648	Tree Planting	Western Branch	02131103	141308.91	412551.52	0.04
SH17APY001649	Tree Planting	Potomac River U tidal	02140201	126919.20	402917.37	0.19
SH17APY001650	Tree Planting	Anacostia River	02140205	146825.65	408123.49	0.28
SH17APY001651	Tree Planting	Western Branch	02131103	142226.40	413545.03	0.26
SH17APY003000	Tree Planting	S Branch Patapsco	02130908	187341.27	410210.08	0.08
SH17APY003001	Tree Planting	S Branch Patapsco	02130908	187309.00	410112.90	0.09
SH18APY001679	Tree Planting	Octoraro Creek	02120203	225899.23	478145.58	0.22
SH18APY001680	Tree Planting	Octoraro Creek	02120203	227628.16	481460.78	0.47
SH18APY001681	Tree Planting	Baltimore Harbor	02130903	164512.11	427010.12	0.17

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18APY001682	Tree Planting	Patapsco River L N Br	02130906	164651.91	426996.11	0.08
SH18APY001683	Tree Planting	Patapsco River L N Br	02130906	165420.25	422103.48	0.35
SH18APY001684	Tree Planting	Patapsco River L N Br	02130906	165792.36	422280.85	0.60
SH18APY001685	Tree Planting	Patapsco River L N Br	02130906	165455.20	422004.35	0.15
SH18APY001686	Tree Planting	Patapsco River L N Br	02130906	164635.18	426910.51	0.15
SH18APY001687	Tree Planting	Patapsco River L N Br	02130906	166671.55	423679.40	0.26
SH18APY001688	Tree Planting	Patapsco River L N Br	02130906	165247.81	422037.30	0.31
SH18APY001689	Tree Planting	Patapsco River L N Br	02130906	165359.31	421863.11	0.27
SH18APY001690	Tree Planting	Patapsco River L N Br	02130906	165133.89	421880.48	0.20
SH18APY001691	Tree Planting	Patapsco River L N Br	02130906	170284.71	426572.34	0.20
SH18APY001692	Tree Planting	Patapsco River L N Br	02130906	164657.51	425305.36	0.08
SH18APY001693	Tree Planting	Patapsco River L N Br	02130906	167522.03	423701.09	0.26
SH18APY001694	Tree Planting	Patapsco River L N Br	02130906	171279.61	426382.73	0.04
SH18APY001695	Tree Planting	Patapsco River L N Br	02130906	165102.76	426564.33	0.11
SH18APY001696	Tree Planting	Severn River	02131002	156286.76	431834.50	0.63
SH18APY001697	Tree Planting	Severn River	02131002	155849.09	431490.22	0.32
SH18APY001698	Tree Planting	Severn River	02131002	155138.94	431067.65	0.39
SH18APY001699	Tree Planting	Severn River	02131002	155767.31	431246.65	0.10
SH18APY001700	Tree Planting	Little Patuxent River	02131105	161453.04	417572.82	0.09
SH18APY001701	Tree Planting	Little Patuxent River	02131105	158648.07	417471.72	0.08
SH18APY001702	Tree Planting	Little Patuxent River	02131105	161437.71	418743.48	0.10
SH18APY001703	Tree Planting	Severn River	02131002	159310.09	426372.48	0.45
SH18APY001704	Tree Planting	Severn River	02131002	155769.31	431358.32	0.22
SH18APY001705	Tree Planting	Severn River	02131002	146499.96	440326.96	0.13
SH18APY001706	Tree Planting	Severn River	02131002	146425.56	440250.70	0.05

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18APY001707	Tree Planting	Severn River	02131002	150896.83	449501.00	0.15
SH18APY001708	Tree Planting	Magothy River	02131001	160766.33	436462.79	0.11
SH18APY001709	Tree Planting	West River	02131004	133219.72	437890.36	0.26
SH18APY001710	Tree Planting	Patuxent River middle	02131102	126882.68	426102.85	0.07
SH18APY001711	Tree Planting	South River	02131003	145040.30	439596.49	0.10
SH18APY001712	Tree Planting	South River	02131003	146326.47	436302.92	0.26
SH18APY001713	Tree Planting	South River	02131003	146343.79	439338.15	0.06
SH18APY001714	Tree Planting	South River	02131003	144895.45	439709.54	0.26
SH18APY001715	Tree Planting	Patuxent River middle	02131102	123251.49	429340.70	0.08
SH18APY001716	Tree Planting	Patuxent River middle	02131102	123829.47	429182.99	0.10
SH18APY001717	Tree Planting	South River	02131003	145415.34	439253.44	0.06
SH18APY001718	Tree Planting	Severn River	02131002	146520.39	440388.78	0.17
SH18APY001719	Tree Planting	Severn River	02131002	146827.65	440484.88	0.20
SH18APY001720	Tree Planting	West Chesapeake Bay	02131005	124845.94	436500.64	0.26
SH18APY001721	Tree Planting	South River	02131003	144935.91	439578.98	0.10
SH18APY001722	Tree Planting	Baltimore Harbor	02130903	169221.27	431677.52	0.12
SH18APY001723	Tree Planting	Baltimore Harbor	02130903	169559.72	434168.77	0.23
SH18APY001724	Tree Planting	Baltimore Harbor	02130903	170722.19	431994.11	0.80
SH18APY001725	Tree Planting	Baltimore Harbor	02130903	171030.74	432683.86	0.41
SH18APY001726	Tree Planting	Baltimore Harbor	02130903	171026.27	433480.41	0.05
SH18APY001727	Tree Planting	Baltimore Harbor	02130903	170500.67	431856.57	0.11
SH18APY001728	Tree Planting	Baltimore Harbor	02130903	162393.85	430915.17	0.30
SH18APY001729	Tree Planting	Baltimore Harbor	02130903	163915.34	430679.63	0.05
SH18APY001730	Tree Planting	Baltimore Harbor	02130903	163973.28	430765.83	0.20
SH18APY001731	Tree Planting	Baltimore Harbor	02130903	164601.05	427208.73	0.29

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18APY001732	Tree Planting	Baltimore Harbor	02130903	164221.95	430658.76	0.37
SH18APY001733	Tree Planting	Baltimore Harbor	02130903	165618.77	434167.98	0.15
SH18APY001734	Tree Planting	Baltimore Harbor	02130903	166615.34	431030.68	0.15
SH18APY001735	Tree Planting	Baltimore Harbor	02130903	165417.66	429057.45	0.38
SH18APY001736	Tree Planting	Baltimore Harbor	02130903	164899.94	430496.83	0.70
SH18APY001737	Tree Planting	Baltimore Harbor	02130903	165046.41	430345.66	0.18
SH18APY001738	Tree Planting	Baltimore Harbor	02130903	163811.78	440983.00	0.22
SH18APY001739	Tree Planting	Baltimore Harbor	02130903	165056.83	427925.63	0.05
SH18APY001740	Tree Planting	Baltimore Harbor	02130903	164944.31	430827.30	0.30
SH18APY001741	Tree Planting	Baltimore Harbor	02130903	164951.41	430912.95	0.26
SH18APY001742	Tree Planting	Baltimore Harbor	02130903	165324.05	430390.23	0.15
SH18APY001743	Tree Planting	Baltimore Harbor	02130903	164485.96	430737.46	0.27
SH18APY001744	Tree Planting	Baltimore Harbor	02130903	165233.74	428206.96	0.66
SH18APY001745	Tree Planting	Baltimore Harbor	02130903	168044.19	431594.42	0.13
SH18APY001746	Tree Planting	South River	02131003	145633.13	439150.27	0.10
SH18APY001747	Tree Planting	Patuxent River middle	02131102	122142.94	429720.39	0.07
SH18APY001748	Tree Planting	Baltimore Harbor	02130903	161969.95	430770.87	0.14
SH18APY001749	Tree Planting	Baltimore Harbor	02130903	162053.61	430703.60	0.05
SH18APY001750	Tree Planting	Patapsco River L N Br	02130906	171070.44	426350.90	0.06
SH18APY001751	Tree Planting	Patapsco River L N Br	02130906	163554.55	427208.35	0.09
SH18APY001752	Tree Planting	Baltimore Harbor	02130903	163080.34	435490.25	0.15
SH18APY001753	Tree Planting	Patapsco River L N Br	02130906	162911.98	426997.82	0.05
SH18APY001754	Tree Planting	Severn River	02131002	158364.70	432120.56	0.32
SH18APY001756	Tree Planting	Severn River	02131002	159723.00	432055.06	0.20
SH18APY001757	Tree Planting	Severn River	02131002	159857.79	432011.28	0.07

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18APY001758	Tree Planting	Baltimore Harbor	02130903	171143.21	433256.74	0.18
SH18APY001759	Tree Planting	Severn River	02131002	155536.32	430883.29	0.04
SH18APY001760	Tree Planting	Severn River	02131002	159032.63	426722.01	0.34
SH18APY001761	Tree Planting	Severn River	02131002	159228.52	426544.04	0.46
SH18APY001762	Tree Planting	Patapsco River L N Br	02130906	170153.01	426056.45	0.14
SH18APY001763	Tree Planting	Patapsco River L N Br	02130906	164730.84	425421.59	0.09
SH18APY001764	Tree Planting	Patapsco River L N Br	02130906	164768.50	425312.78	0.26
SH18APY001765	Tree Planting	South River	02131003	145978.90	438854.90	0.11
SH18APY001767	Tree Planting	Little Patuxent River	02131105	150215.19	426271.74	0.19
SH18APY001768	Tree Planting	Severn River	02131002	156950.54	427698.23	0.26
SH18APY001769	Tree Planting	Baltimore Harbor	02130903	167612.68	431498.25	0.05
SH18APY001783	Tree Planting	Potomac River L tidal	02140101	84337.00	393729.20	0.30
SH18APY001808	Tree Planting	Double Pipe Creek	02140304	214182.26	396535.78	0.37
SH18APY001809	Tree Planting	Liberty Reservoir	02130907	208942.89	401279.92	0.15
SH18APY001810	Tree Planting	Double Pipe Creek	02140304	215911.36	393417.38	0.35
SH18APY001811	Tree Planting	Double Pipe Creek	02140304	215970.54	393317.94	0.15
SH18APY001812	Tree Planting	Liberty Reservoir	02130907	198910.69	399898.59	0.45
SH18APY001813	Tree Planting	Double Pipe Creek	02140304	218216.86	390189.83	0.82
SH18APY001814	Tree Planting	Double Pipe Creek	02140304	218524.98	389706.55	3.38
SH18APY001815	Tree Planting	Upper Monocacy River	02140303	223189.68	369754.09	0.80
SH18APY001816	Tree Planting	Upper Monocacy River	02140303	223418.22	369924.71	0.23
SH18APY001817	Tree Planting	Upper Monocacy River	02140303	223974.30	370218.89	0.05
SH18APY001818	Tree Planting	Upper Monocacy River	02140303	223815.89	370348.32	0.20
SH18APY001819	Tree Planting	Upper Monocacy River	02140303	223986.30	370401.71	0.17
SH18APY001821	Tree Planting	Octoraro Creek	02120203	223799.38	479461.46	0.44

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18APY001822	Tree Planting	Octoraro Creek	02120203	226289.23	478538.73	0.52
SH18APY001823	Tree Planting	Octoraro Creek	02120203	227223.15	480587.51	0.64
SH18APY001824	Tree Planting	Northeast River	02130608	222750.50	489456.00	0.14
SH18APY001825	Tree Planting	Northeast River	02130608	225511.21	487797.98	0.14
SH18APY001826	Tree Planting	Northeast River	02130608	224215.15	488468.74	0.24
SH18APY001827	Tree Planting	Northeast River	02130608	226027.19	487590.63	0.39
SH18APY001828	Tree Planting	Northeast River	02130608	223744.17	488829.49	0.89
SH18APY001829	Tree Planting	Lower Susquehanna River	02120201	216461.60	479750.95	0.16
SH18APY001830	Tree Planting	Octoraro Creek	02120203	223648.30	479485.30	0.12
SH18APY001831	Tree Planting	Northeast River	02130608	222206.12	489633.39	0.45
SH18APY001832	Tree Planting	Octoraro Creek	02120203	227104.89	478949.57	0.84
SH18APY001835	Tree Planting	Baltimore Harbor	02130903	170933.90	432587.53	1.64
SH18APY001838	Tree Planting	Upper Monocacy River	02140303	224273.69	370555.47	0.47
SH18APY001839	Tree Planting	Upper Monocacy River	02140303	224306.13	370699.96	0.63
SH18APY001840	Tree Planting	Upper Monocacy River	02140303	223992.65	369788.95	0.05
SH18APY001841	Tree Planting	Upper Monocacy River	02140303	224014.99	370269.51	0.09
SH18APY001844	Tree Planting	Octoraro Creek	02120203	222371.73	479346.13	0.14
SH18APY001845	Tree Planting	Octoraro Creek	02120203	222703.66	479445.85	0.34
SH18APY001846	Tree Planting	Octoraro Creek	02120203	223571.17	479491.17	0.14
SH18APY001847	Tree Planting	Lower Susquehanna River	02120201	218270.38	478773.20	0.58
SH18APY001848	Tree Planting	Octoraro Creek	02120203	218778.52	479291.27	0.18
SH18APY001849	Tree Planting	Octoraro Creek	02120203	227739.88	482100.62	0.44
SH18APY001850	Tree Planting	Octoraro Creek	02120203	225723.82	478059.30	0.51
SH18APY001851	Tree Planting	Octoraro Creek	02120203	226251.60	478614.82	0.37
SH18APY001852	Tree Planting	Northeast River	02130608	224999.73	488120.35	0.20

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH18APY001853	Tree Planting	Northeast River	02130608	223297.16	489122.80	1.81
SH18APY001854	Tree Planting	Little Elk Creek	02130605	222785.35	498179.83	0.13
SH18APY001855	Tree Planting	Lower Susquehanna River	02120201	217975.50	478481.10	0.11
SH18APY001856	Tree Planting	Northeast River	02130608	217724.60	490077.70	0.46
SH18APY001857	Tree Planting	Northeast River	02130608	221913.79	489722.67	0.29
SH18APY001858	Tree Planting	Northeast River	02130608	221787.46	489754.68	0.27
SH18APY001859	Tree Planting	Octoraro Creek	02120203	227127.21	480336.21	0.15
SH18APY001860	Tree Planting	Upper Monocacy River	02140303	223683.96	370703.73	0.14
SH18APY001861	Tree Planting	Liberty Reservoir	02130907	199013.15	399863.29	0.32
SH18APY001863	Tree Planting	Conococheague Creek	02140504	223874.02	328065.25	8.79
SH18APY001864	Tree Planting	Marsh Run	02140503	207678.52	334434.90	4.75
SH18APY001865	Tree Planting	Antietam Creek	02140502	212895.04	345255.23	9.67
SH18APY001866	Tree Planting	Antietam Creek	02140502	200454.09	337639.13	0.80
SH18APY001867	Tree Planting	Mattawoman Creek	02140111	106787.63	402094.89	2.93
SH18APY001868	Tree Planting	Mattawoman Creek	02140111	107015.21	402341.57	0.34
SH18APY001869	Tree Planting	Antietam Creek	02140502	212759.10	345156.55	4.59
SH18APY001870	Tree Planting	Conococheague Creek	02140504	224056.60	328159.31	1.13
SH18APY001871	Tree Planting	Marsh Run	02140503	207775.25	334461.49	2.83
SH18APY001873	Tree Planting	Double Pipe Creek	02140304	219085.65	389129.33	1.36
SH19APY001872	Tree Planting	Mattawoman Creek	02140111	107832.31	403358.91	0.19
SH19APY001943	Tree Planting	Atkisson Reservoir	02130703	212111.32	452633.33	0.16
SH19APY001944	Tree Planting	Atkisson Reservoir	02130703	212090.76	451306.99	0.71
SH19APY001945	Tree Planting	Atkisson Reservoir	02130703	211864.69	450131.60	0.19
SH19APY001946	Tree Planting	Atkisson Reservoir	02130703	211982.51	451100.94	0.15
SH19APY001947	Tree Planting	Atkisson Reservoir	02130703	212232.15	452628.75	1.30

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19APY001948	Tree Planting	Atkisson Reservoir	02130703	212206.27	452388.83	2.68
SH19APY001949	Tree Planting	Bynum Run	02130704	212250.08	453024.92	0.30
SH19APY001950	Tree Planting	Bynum Run	02130704	210588.12	454978.64	0.18
SH19APY001951	Tree Planting	Bynum Run	02130704	210816.56	455327.30	0.32
SH19APY001952	Tree Planting	Double Pipe Creek	02140304	219995.55	387166.91	0.36
SH19APY001953	Tree Planting	Double Pipe Creek	02140304	219979.85	387414.14	0.84
SH19APY001954	Tree Planting	Double Pipe Creek	02140304	219846.66	388339.38	0.23
SH19APY001955	Tree Planting	Double Pipe Creek	02140304	219819.58	388283.25	0.10
SH19APY001956	Tree Planting	Double Pipe Creek	02140304	219687.46	388512.51	0.72
SH19APY001957	Tree Planting	S Branch Patapsco	02130908	195673.77	399488.94	1.03
SH19APY001958	Tree Planting	S Branch Patapsco	02130908	195839.89	399481.01	0.23
SH19APY001959	Tree Planting	Double Pipe Creek	02140304	209774.15	389396.14	1.16
SH19APY001960	Tree Planting	Double Pipe Creek	02140304	209514.36	396043.25	0.15
SH19APY001961	Tree Planting	Double Pipe Creek	02140304	209794.19	396409.39	0.61
SH19APY001962	Tree Planting	Double Pipe Creek	02140304	219548.61	407118.48	0.19
SH19APY001963	Tree Planting	Liberty Reservoir	02130907	195996.47	399214.14	1.80
SH19APY001964	Tree Planting	Double Pipe Creek	02140304	208651.33	392834.26	0.09
SH19APY001965	Tree Planting	Double Pipe Creek	02140304	208619.01	392648.13	0.42
SH19APY001966	Tree Planting	Liberty Reservoir	02130907	198591.22	399995.71	0.41
SH19APY001967	Tree Planting	Liberty Reservoir	02130907	196045.56	399646.46	2.47
SH19APY001968	Tree Planting	Liberty Reservoir	02130907	209395.98	401419.90	0.27
SH19APY001969	Tree Planting	Liberty Reservoir	02130907	209532.01	401467.02	0.51
SH19APY001970	Tree Planting	Liberty Reservoir	02130907	213873.89	402997.03	0.53
SH19APY001971	Tree Planting	Double Pipe Creek	02140304	215473.72	394518.38	0.72
SH19APY001972	Tree Planting	Liberty Reservoir	02130907	209755.27	401540.01	0.23

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19APY001973	Tree Planting	Double Pipe Creek	02140304	208877.70	394571.25	0.16
SH19APY001974	Tree Planting	Upper Monocacy River	02140303	223019.85	386536.24	0.77
SH19APY001975	Tree Planting	Upper Monocacy River	02140303	225725.93	388651.61	0.21
SH19APY001976	Tree Planting	Upper Monocacy River	02140303	223607.78	386923.19	0.28
SH19APY001977	Tree Planting	Upper Monocacy River	02140303	223680.62	386967.24	0.14
SH19APY001978	Tree Planting	Upper Monocacy River	02140303	223748.79	387008.11	0.27
SH19APY001979	Tree Planting	Double Pipe Creek	02140304	215098.48	395210.46	0.44
SH19APY001980	Tree Planting	Liberty Reservoir	02130907	191831.07	407680.87	0.30
SH19APY001981	Tree Planting	Double Pipe Creek	02140304	219268.76	388975.82	0.50
SH19APY001982	Tree Planting	Double Pipe Creek	02140304	219145.38	389159.11	0.49
SH19APY001983	Tree Planting	Double Pipe Creek	02140304	219756.90	388525.84	0.30
SH19APY001984	Tree Planting	Double Pipe Creek	02140304	208549.83	392153.73	0.46
SH19APY001985	Tree Planting	Double Pipe Creek	02140304	211424.64	398451.60	0.22
SH19APY001986	Tree Planting	Double Pipe Creek	02140304	215789.97	393618.38	0.69
SH19APY001987	Tree Planting	Upper Monocacy River	02140303	225779.53	388742.34	0.19
SH19APY001988	Tree Planting	Catoctin Creek	02140305	187869.31	352201.11	0.26
SH19APY001989	Tree Planting	Catoctin Creek	02140305	187791.09	351304.28	0.24
SH19APY001990	Tree Planting	Lower Monocacy River	02140302	190679.55	360217.47	0.52
SH19APY001991	Tree Planting	Catoctin Creek	02140305	200360.56	355702.24	0.20
SH19APY001992	Tree Planting	Catoctin Creek	02140305	200520.25	355610.40	0.72
SH19APY001993	Tree Planting	Catoctin Creek	02140305	195573.65	352024.31	0.64
SH19APY001994	Tree Planting	Potomac River FR Cnty	02140301	182186.79	355491.81	1.23
SH19APY001995	Tree Planting	Lower Monocacy River	02140302	189010.95	357048.14	0.20
SH19APY001996	Tree Planting	Potomac River FR Cnty	02140301	187272.15	347367.90	0.31
SH19APY001997	Tree Planting	Catoctin Creek	02140305	202046.85	354402.17	0.20

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19APY001998	Tree Planting	Catoctin Creek	02140305	202813.08	353782.17	0.69
SH19APY001999	Tree Planting	Catoctin Creek	02140305	205950.37	350435.88	0.25
SH19APY002000	Tree Planting	Catoctin Creek	02140305	207013.95	349187.82	0.42
SH19APY002001	Tree Planting	Potomac River FR Cnty	02140301	181128.99	354871.17	0.69
SH19APY002002	Tree Planting	Potomac River FR Cnty	02140301	183373.17	355773.55	0.76
SH19APY002003	Tree Planting	Potomac River FR Cnty	02140301	183644.13	355826.98	0.72
SH19APY002004	Tree Planting	Potomac River FR Cnty	02140301	184980.23	356077.46	1.40
SH19APY002005	Tree Planting	Catoctin Creek	02140305	201184.04	353941.66	0.13
SH19APY002006	Tree Planting	Upper Monocacy River	02140303	218726.89	364845.55	0.12
SH19APY002007	Tree Planting	Upper Monocacy River	02140303	222690.83	369654.38	0.70
SH19APY002008	Tree Planting	Catoctin Creek	02140305	194772.79	350640.17	0.63
SH19APY002009	Tree Planting	Catoctin Creek	02140305	200656.00	354460.80	1.31
SH19APY002010	Tree Planting	Catoctin Creek	02140305	199404.29	355729.59	0.28
SH19APY002011	Tree Planting	Lower Monocacy River	02140302	184109.77	364041.95	0.17
SH19APY002012	Tree Planting	Catoctin Creek	02140305	201342.43	353703.87	0.18
SH19APY002013	Tree Planting	Catoctin Creek	02140305	204657.60	351948.30	0.12
SH19APY002014	Tree Planting	Catoctin Creek	02140305	193783.95	349350.54	0.19
SH19APY002015	Tree Planting	Catoctin Creek	02140305	192711.10	347124.06	0.65
SH19APY002016	Tree Planting	Catoctin Creek	02140305	192831.14	347518.97	0.40
SH19APY002017	Tree Planting	Catoctin Creek	02140305	193159.84	348172.31	0.19
SH19APY002018	Tree Planting	Potomac River FR Cnty	02140301	183035.64	355652.30	0.10
SH19APY002019	Tree Planting	Potomac River FR Cnty	02140301	185438.90	356176.54	0.76
SH19APY002020	Tree Planting	Potomac River FR Cnty	02140301	182354.86	355561.42	0.12
SH19APY002021	Tree Planting	Catoctin Creek	02140305	201804.62	354599.01	0.24
SH19APY002022	Tree Planting	Catoctin Creek	02140305	205211.67	351291.80	0.12

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19APY002023	Tree Planting	Catoctin Creek	02140305	199378.96	356194.25	0.10
SH19APY002024	Tree Planting	Catoctin Creek	02140305	187774.59	351960.90	0.28
SH19APY002025	Tree Planting	Catoctin Creek	02140305	187828.29	352576.21	0.16
SH19APY002026	Tree Planting	Potomac River FR Cnty	02140301	186830.28	356358.43	0.31
SH19APY002027	Tree Planting	Catoctin Creek	02140305	203591.43	353160.47	0.75
SH19APY002028	Tree Planting	Catoctin Creek	02140305	203271.34	353419.16	0.25
SH19APY002029	Tree Planting	Catoctin Creek	02140305	203208.28	353473.29	0.23
SH19APY002030	Tree Planting	Catoctin Creek	02140305	203068.96	353581.74	0.65
SH19APY002031	Tree Planting	Catoctin Creek	02140305	193822.81	349502.79	0.17
SH19APY002032	Tree Planting	Catoctin Creek	02140305	187889.32	352374.80	0.10
SH19APY002033	Tree Planting	Catoctin Creek	02140305	202170.00	354311.31	0.12
SH19APY002034	Tree Planting	Catoctin Creek	02140305	206931.26	349283.41	0.14
SH19APY002035	Tree Planting	Catoctin Creek	02140305	201902.93	354519.76	0.11
SH19APY002036	Tree Planting	Catoctin Creek	02140305	203436.53	353283.44	0.30
SH19APY002037	Tree Planting	Catoctin Creek	02140305	192845.10	347622.80	0.12
SH19APY002038	Tree Planting	Catoctin Creek	02140305	193176.70	348112.86	0.39
SH19APY002039	Tree Planting	Catoctin Creek	02140305	192874.07	347720.22	0.22
SH19APY002040	Tree Planting	Catoctin Creek	02140305	203619.90	350659.31	0.25
SH19APY002041	Tree Planting	Upper Monocacy River	02140303	218717.83	364774.23	0.09
SH19APY002042	Tree Planting	Catoctin Creek	02140305	194715.38	350504.13	0.16
SH19APY002043	Tree Planting	Potomac River FR Cnty	02140301	185940.47	344756.55	0.16
SH19APY002044	Tree Planting	Upper Monocacy River	02140303	198686.84	365702.41	0.15
SH19APY002045	Tree Planting	Deer Creek	02120202	212465.32	456918.32	0.21
SH19APY002046	Tree Planting	Broad Creek	02120205	225125.47	453707.35	0.47
SH19APY002047	Tree Planting	Broad Creek	02120205	224782.86	453643.21	0.20

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19APY002048	Tree Planting	Broad Creek	02120205	223944.06	453302.46	0.43
SH19APY002049	Tree Planting	Broad Creek	02120205	223820.06	452788.25	0.45
SH19APY002050	Tree Planting	Broad Creek	02120205	226022.30	457285.76	0.37
SH19APY002051	Tree Planting	Swan Creek	02130706	212554.03	468920.21	0.36
SH19APY002052	Tree Planting	Swan Creek	02130706	212558.92	469012.32	0.13
SH19APY002053	Tree Planting	Swan Creek	02130706	212405.93	469814.85	0.24
SH19APY002054	Tree Planting	Atkisson Reservoir	02130703	211847.47	449385.55	0.37
SH19APY002055	Tree Planting	Lower Winters Run	02130702	201532.39	452871.70	0.24
SH19APY002056	Tree Planting	Broad Creek	02120205	224856.03	453648.54	0.24
SH19APY002057	Tree Planting	Broad Creek	02120205	223781.30	452651.09	0.31
SH19APY002058	Tree Planting	Atkisson Reservoir	02130703	209327.08	444220.90	0.13
SH19APY002059	Tree Planting	Loch Raven Reservoir	02130805	202786.84	428585.17	0.35
SH19APY002060	Tree Planting	Loch Raven Reservoir	02130805	208980.58	428449.71	0.22
SH19APY002061	Tree Planting	Loch Raven Reservoir	02130805	226113.97	431266.88	0.15
SH19APY002062	Tree Planting	Back River	02130901	175219.66	446756.89	0.46
SH19APY002063	Tree Planting	Deer Creek	02120202	227180.27	430182.59	0.47
SH19APY002064	Tree Planting	Loch Raven Reservoir	02130805	226466.96	430677.32	1.22
SH19APY002065	Tree Planting	Loch Raven Reservoir	02130805	209108.82	428592.63	0.29
SH19APY002066	Tree Planting	Loch Raven Reservoir	02130805	203093.86	428531.10	0.82
SH19APY002067	Tree Planting	Atkisson Reservoir	02130703	212123.02	452124.82	0.13
SH19APY002068	Tree Planting	S Branch Patapsco	02130908	197759.02	394923.03	0.25
SH19APY002069	Tree Planting	Loch Raven Reservoir	02130805	212693.48	428939.51	0.28
SH19APY002070	Tree Planting	Loch Raven Reservoir	02130805	212698.73	428879.58	0.05
SH19APY002071	Tree Planting	Loch Raven Reservoir	02130805	212640.18	428895.42	0.02
SH19APY002072	Tree Planting	Loch Raven Reservoir	02130805	212690.96	428511.55	0.05

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19APY002073	Tree Planting	Catoctin Creek	02140305	202076.36	352717.55	0.12
SH19APY002074	Tree Planting	Lower Monocacy River	02140302	191042.61	360658.43	0.36
SH19APY002075	Tree Planting	Lower Monocacy River	02140302	192518.70	364606.68	1.06
SH19APY002076	Tree Planting	Lower Monocacy River	02140302	190535.01	377673.67	0.21
SH19APY002077	Tree Planting	Lower Monocacy River	02140302	194933.68	358381.37	0.23
SH19APY002078	Tree Planting	Lower Monocacy River	02140302	199613.78	388232.58	0.32
SH19APY002079	Tree Planting	Double Pipe Creek	02140304	219520.42	388838.33	0.14
SH19APY002080	Tree Planting	Double Pipe Creek	02140304	209666.62	396223.03	0.16
SH19APY002081	Tree Planting	Liberty Reservoir	02130907	208421.36	401062.99	0.46
SH19APY002082	Tree Planting	Little Gunpowder Falls	02130804	209105.81	444548.28	0.18
SH19APY002083	Tree Planting	Swan Creek	02130706	212524.55	469403.63	0.14
SH19APY002084	Tree Planting	Bynum Run	02130704	209483.43	454284.17	0.15
SH19APY002085	Tree Planting	Atkisson Reservoir	02130703	208067.34	454269.60	0.36
SH19APY002086	Tree Planting	Atkisson Reservoir	02130703	205930.30	450285.83	0.12
SH19APY002087	Tree Planting	Broad Creek	02120205	227103.77	455670.67	0.72
SH19APY002088	Tree Planting	Bynum Run	02130704	209750.62	454195.96	0.27
SH19APY002089	Tree Planting	Back River	02130901	192011.77	439007.27	0.23
SH19APY002090	Tree Planting	Gwynns Falls	02130905	189695.41	421990.29	0.19
SH19APY002091	Tree Planting	Gwynns Falls	02130905	190105.66	421199.81	0.35
SH19APY002092	Tree Planting	Gwynns Falls	02130905	189542.97	421934.86	0.08
SH19APY002093	Tree Planting	Jones Falls	02130904	190530.93	429200.74	0.32
SH19APY002094	Tree Planting	Gwynns Falls	02130905	190727.80	421047.17	0.15
SH19APY002095	Tree Planting	Loch Raven Reservoir	02130805	193970.55	433762.24	0.25
SH19APY002096	Tree Planting	Back River	02130901	181135.89	442750.63	0.16
SH19APY002097	Tree Planting	Back River	02130901	192037.81	438924.74	0.30

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH19APY002098	Tree Planting	Back River	02130901	191977.54	438844.12	0.23
SH19APY002099	Tree Planting	Bird River	02130803	191143.14	440513.36	0.21
SH19APY002100	Tree Planting	Back River	02130901	180624.99	441724.22	0.14
SH19APY002101	Tree Planting	Gwynns Falls	02130905	193925.71	417698.53	0.15
SH19APY002102	Tree Planting	Catoctin Creek	02140305	211760.30	350553.65	2.83
SH19APY002103	Tree Planting	<Null>	<Null>	216382.74	411091.64	4.02
SH19APY002104	Tree Planting	Catoctin Creek	02140305	211567.10	350540.23	0.85
SH12APY000411	Impervious Surface Elimination (to pervious)	Liberty Reservoir	02130907	407581.25	201145.56	0.12
SH12APY000412	Impervious Surface Elimination (to pervious)	Upper Monocacy River	02140303	386462.97	222920.45	0.21
SH12APY000413	Impervious Surface Elimination (to pervious)	Upper Monocacy River	02140303	389198.27	227220.34	0.15
SH17APY001539	Impervious Surface Elimination (to pervious)	Lower Monocacy River	02140302	368666.92	192192.50	0.69
SH17APY001538	Impervious Surface Elimination (to pervious)	S Branch Patapsco	02130908	394907.80	197771.27	0.13
SH17APY001537	Impervious Surface Elimination (to pervious)	Double Pipe Creek	02140304	409167.77	221259.12	0.06
SH17APY001536	Impervious Surface Elimination (to pervious)	Upper Monocacy River	02140303	386273.46	222614.69	0.14
SH17APY001535	Impervious Surface Elimination (to pervious)	Lower Monocacy River	02140302	362358.28	192986.66	0.07
SH17APY001534	Impervious Surface Elimination (to pervious)	Lower Monocacy River	02140302	362613.55	194079.77	0.47
SH17APY001533	Impervious Surface Elimination (to pervious)	Little Patuxent River	02131105	418273.00	167125.75	0.17

Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SH17APY001540	Impervious Surface Elimination (to pervious)	Catoctin Creek	02140305	349898.01	193900.00	0.11
SH18APY001872	Impervious Surface Elimination (to pervious)	Patapsco River L N Br	02130906	427830.15	175709.04	0.03
SH18APYXXXXX	Impervious Surface Elimination (to pervious)	Patapsco River L N Br	02130906	425953.13	174653.76	0.11
					Completed BMP Acreage Total	**3204.24**

Table 2-2b: Annual Operations and Redevelopment Impervious Restoration Practices						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
TBD	Redevelopment Credit	Area wide	Area wide	-	-	59.39
TBD	Inlet Cleaning	Area-wide	Area-wide	-	-	175.00
TBD	Street Sweeping Credit	Area wide	Area wide	-	-	33.00
					Completed BMP Acreage Total	**267.39**

Table 2-2c: Fiscal Year 2020 Capital Impervious Restoration Practices Planned						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SHA20ALN160015UR	Stream Restoration	Western Branch	02131103	123553.95	416879.12	234.80
SHA20ALN210019UR	Stream Restoration	Little Tonoloway Creek	02140509	227278.26	297281.74	59.37
SHA20ALN100017UR	Stream Restoration	Lower Monocacy River	02140302	193745.73	380246.33	141.24
SHA20ALN100018UR	Stream Restoration	Lower Monocacy River	02140302	189444.81	378465.88	101.55
SHA20ALN030021UR	Stream Restoration	Loch Raven Reservoir	02130805	220053.52	429984.76	59.76
SHA20ALN030023UR	Stream Restoration	Patapsco River L N Br	02130906	187701.93	414754.90	86.43
SHA20ALN120011UR	Stream Restoration	Deer Creek	02120202	213029.62	460551.69	296.55

Table 2-2c: Fiscal Year 2020 Capital Impervious Restoration Practices Planned						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SHA20ALN030024UR	Stream Restoration	Loch Raven Reservoir	02130805	208481.19	416443.05	181.89
SHA20ALN060008UR	Stream Restoration	Prettyboy Reservoir	02130806	225497.36	415879.60	239.16
SHA20ALN150022UR	Stream Restoration	Seneca Creek	02140208	168840.00	383435.25	91.95
SHA20ALN030025UR	Stream Restoration	Patapsco River L N Br	02130906	184105.61	413780.59	53.40
SHA20ALN130010UR	Stream Restoration	S Branch Patapsco	02130908	185053.75	402760.02	164.91
SHA20ALN100019UR	Stream Restoration	Lower Monocacy River	02140302	198154.63	384037.60	90.93
SHA20ALN020009UR	Stream Restoration	South River	02131003	147592.87	433669.12	359.40
SHA20ALN070011UR	Stream Restoration	Little Elk Creek	02130605	227221.24	495080.10	1095.03
SHA20ALN070012UR	Stream Restoration	Northeast River	02130608	225794.44	491183.52	421.35
SHA20ALN030026UR	Stream Restoration	Loch Raven Reservoir	02130805	200965.70	420487.42	104.01
SHA20ALN020010UR	Stream Restoration	South River	02131003	144074.48	430781.91	88.38
SHA20ALN100020UR	Stream Restoration	Catoctin Creek	02140305	188045.43	348120.78	179.58
SHA20ALN130009UR	Stream Restoration	Little Patuxent River	02131105	173219.98	410832.54	219.06
SHA20ALN160029UR	Stream Restoration	Patuxent River upper	02131104	151166.48	418126.04	40.00
SHA20ALN160028UR	Stream Restoration	Anacostia River	02140205	147391.11	404346.85	2.00
SHA20ALN030022UR	Stream Restoration	Lower Gunpowder Falls	02130802	201493.28	442028.20	279.39
SHA20RST020049	Retrofit	Severn River	02131002	156932.81	427884.13	4.04
SHA20RST020268	Retrofit	South River	02131003	146041.10	438420.88	8.58
SHA20RST020287	Retrofit	Severn River	02131002	151151.88	447394.03	1.63
SHA20RST020363	Retrofit	Baltimore Harbor	02130903	162503.42	431087.89	7.50
SHA20RST020404	Retrofit	South River	02131003	143356.31	430483.74	6.25
SHA20RST130027	Retrofit	Middle Patuxent River	02131106	168750.59	409054.44	16.15
SHA20RST130048	Retrofit	Little Patuxent River	02131105	162042.99	417605.99	2.05
SHA20RST130072	Retrofit	Little Patuxent River	02131105	173332.00	416317.62	1.70
SHA20RST130073	Retrofit	Little Patuxent River	02131105	173136.33	416480.11	1.68
SHA20RST130120	Retrofit	Little Patuxent River	02131105	162064.92	417898.00	1.88
SHA20RST130205	Retrofit	Patapsco River L N Br	02130906	168987.89	421130.67	1.04

Table 2-2c: Fiscal Year 2020 Capital Impervious Restoration Practices Planned						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SHA20RST130206	Retrofit	Patapsco River L N Br	02130906	168868.85	421040.63	0.66
SHA20RST130220	Retrofit	Patapsco River L N Br	02130906	171072.87	418731.51	2.25
SHA20RST132444	Retrofit	Brighton Dam	02131108	173287.07	416402.44	0.42
SHA20RST132445	Retrofit	Brighton Dam	02131108	173192.89	416478.64	0.35
SHA20RST132446	Retrofit	Brighton Dam	02131108	173134.67	416525.88	0.12
SHA20RST150205	Retrofit	Seneca Creek	02140208	168686.57	377811.16	5.68
SHA20RST150601	Retrofit	Anacostia River	02140205	157365.37	404456.01	7.49
SHA20RST150602	Retrofit	Western Branch	02131103	136258.93	414167.81	3.03
SHA20APY080160UT	Tree Planting	Mattawoman Creek	02140111	99481.20	396435.60	4.55
SHA20APY080162UT	Tree Planting	Mattawoman Creek	02140111	99600.08	396555.61	11.92
SHA20APY080120UT	Tree Planting	Mattawoman Creek	02140111	108027.83	402907.19	1.72
SHA20APY080118UT	Tree Planting	Mattawoman Creek	02140111	107738.05	403502.87	0.28
SHA20APY080119UT	Tree Planting	Mattawoman Creek	02140111	107965.72	403145.74	2.02
SHA20APY080121UT	Tree Planting	Mattawoman Creek	02140111	107733.77	402731.91	3.41
SHA20APY080122UT	Tree Planting	Mattawoman Creek	02140111	107540.50	402926.36	0.27
SHA20ALN160018UO	Outfall Stabilization	Piscataway Creek	02140203	115768.42	400797.44	2.79
SHA20ALN160008UO	Outfall Stabilization	Oxon Creek	02140204	132881.51	405513.86	1.22
SHA20ALN160009UO	Outfall Stabilization	Oxon Creek	02140204	132855.86	405436.27	0.91
SHA20ALN160010UO	Outfall Stabilization	Oxon Creek	02140204	132834.61	405363.35	0.97
SHA20ALN030010UO	Outfall Stabilization	Loch Raven Reservoir	02130805	220958.61	429624.85	5.25
SHA20ALN030012UO	Outfall Stabilization	Loch Raven Reservoir	02130805	220890.47	429566.12	5.25
SHA20ALN030011UO	Outfall Stabilization	Loch Raven Reservoir	02130805	220823.54	429480.65	5.25
SHA20ALN030013UO	Outfall Stabilization	Loch Raven Reservoir	02130805	220813.76	429465.50	5.25
SHA20ALN160020UO	Outfall Stabilization	Piscataway Creek	02140203	115965.33	400757.08	1.39
SHA20ALN160011UO	Outfall Stabilization	Piscataway Creek	02140203	118555.76	410326.01	1.59
SHA20ALN130011UO	Outfall Stabilization	Patapsco River L N Br	02130906	169594.81	420358.75	0.32
SHA20ALN150014UO	Outfall Stabilization	Cabin John Creek	02140207	154794.85	386729.26	9.98

Table 2-2c: Fiscal Year 2020 Capital Impervious Restoration Practices Planned						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SHA20ALN160025UR	Outfall Stabilization	Anacostia River	02140205	140032.61	409273.70	6.28
SHA20ALN130008UR	Outfall Stabilization	Patapsco River L N Br	02130906	170456.12	419802.31	1.63
SHA20ALN130011UR	Outfall Stabilization	Patapsco River L N Br	02130906	169598.34	420353.26	1.35
TBD	Impervious Surface Elimination (to pervious)	TBD	TBD	-	-	1.00
Planned BMP Acreage Total						**4737.23**

Table 2-2d: Fiscal Year 2021 Capital Impervious Restoration Practices Planned						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
SHA21ALN070002UR	Stream Restoration	Big Elk Creek	02130606	223726.86	499656.60	164.19
SHA21ALN030011UR	Stream Restoration	Little Gunpowder Falls	02130804	205313.88	444235.01	70.38
SHA21ALN030016UR	Stream Restoration	Little Gunpowder Falls	02130804	204766.29	442050.23	54.87
SHA21ALN100015UR	Stream Restoration	Lower Monocacy River	02140302	199565.43	369962.93	95.55
SHA21ALN100016UR	Stream Restoration	Lower Monocacy River	02140302	207365.18	373533.12	112.17
SHA21ALN060006UR	Stream Restoration	S Branch Patapsco	02130908	191023.89	404475.96	508.50
TBD	Tree Planting	TBD	TBD	-	-	9.23
Planned BMP Acreage Total						**1014.89**

Table 2-2e: Planned 2020-2021 Annual Operations and Redevelopment Impervious Restoration Practices						
Unique BMP #	**BMP Type**	**8-Digit Watershed Name**	**8-Digit Watershed Code**	**Northing**	**Easting**	**Impervious Treated (acres)**
TBD	Redevelopment Credit	Area wide	Area wide	-	-	5.00
TBD	Inlet Cleaning Credit	Area wide	Area wide	-	-	100.00
TBD	ICD Retrofit/Outfalls/SWM	Areawide	Area wide	-	-	631.50
Planned BMP Acreage Total						**736.50**

Table 2-2f: Total Planned Credit	
Table 2-2a: Fiscal Year 2010-2019 Capital Impervious Restoration Practices Constructed	3204.22
Table 2-2b: Annual Operations and Redevelopment Impervious Restoration Practices	267.39
Table 2-2c: Fiscal Year 2020 Capital Impervious Restoration Practices Planned	4737.23
Table 2-2d: Fiscal Year 2021 Capital Impervious Restoration Practices Planned	1014.89
Table 2-2e: Planned 2020-2021 Annual Operations and Redevelopment Impervious Restoration Practices	736.50
Grand Total	**9960.23**

MARYLAND DEPARTMENT OF TRANSPORTATION

STATE HIGHWAY ADMINISTRATION

Part III

Coordinated TMDL Implementation Plan







III. COORDINATED TMDL IMPLEMENTATION PLAN

A. WATER QUALITY STANDARDS AND DESIGNATED USES

While the impervious restoration requirements discussed in **Part II** of this Plan focus on offsetting the impacts of urbanization to uncontrolled stormwater runoff, TMDLs focus on offsetting the impacts of pollutants to waterway designated uses. Both these perspectives address the quality of Maryland surface waters. The Federal Clean Water Act (CWA) established requirements for each State to develop programs to address water pollution including:

- Establishment of WQSs;
- Implementation of water quality monitoring programs;
- Identification and reporting of impaired waters; and
- Development of maximum allowable pollutant loads that when met and not exceeded will restore WQSs to impaired waters, called TMDL documents.

WQSs are based on the concept of designating and maintaining specifically defined uses for each waterbody. **Table 3-1** lists the designated uses for waterways in Maryland. TMDLs are based upon these uses.

One means for the EPA to enforce these standards is through the NPDES program, which regulates discharges from point sources. MDE is the delegated authority to issue NPDES discharge permits within Maryland and also to develop WQSs for Maryland including the water quality criteria that define the parameters to ensure designated uses are met.

Table 3-1: Designated Uses in Maryland

	Use Classes							
Designated Uses	**I**	**I-P**	**II**	**II-P**	**III**	**III-P**	**IV**	**IV-P**
Growth and Propagation of Fish (not trout), other aquatic life and wildlife	✓	✓	✓	✓	✓	✓	✓	✓
Water Contact Sports	✓	✓	✓	✓	✓	✓	✓	✓
Leisure activities involving direct contact with surface water	✓	✓	✓	✓	✓	✓	✓	✓
Fishing	✓	✓	✓	✓	✓	✓	✓	✓
Agricultural Water Supply	✓	✓	✓	✓	✓	✓	✓	✓
Industrial Water Supply	✓	✓	✓	✓	✓	✓	✓	✓
Propagation and Harvesting of Shellfish			✓	✓				
Seasonal Migratory Fish Spawning and Nursery Use			✓	✓				
Seasonal Shallow-water Submerged Aquatic Vegetation Use			✓	✓				
Open-Water Fish and Shellfish Use			✓	✓				
Seasonal Deep-Water Fish and Shellfish Use			✓	✓				
Seasonal Deep-Channel Refuge Use			✓	✓				
Growth and Propagation of Trout					✓	✓		
Capable of Supporting Adult Trout for a Put and Take Fishery							✓	✓
Public Water Supply		✓		✓		✓		✓

Source: http://www.mde.state.md.us/programs/Water/TMDL/Water%20Quality%20Standards/Pages/programs/waterprograms/tmdl/wqstandards/wqs_designated_uses.aspx

MS4 Permit Requirements

The MDOT SHA MS4 Permit requires coordination with county MS4 jurisdictions concerning watershed assessments and development of a coordinated TMDL implementation plan for each watershed that MDOT SHA has a WLA. **Part IV, MDOT SHA Watershed TMDL Implementation Plans** contains implementation plans specific to each local TMDL watershed. It includes a brief description of each watershed including MDOT SHA facilities and land uses, MDOT SHA TMDLs within the watershed, MDOT SHA visual inventory of ROW, a summary of county assessment review, and MDOT SHA pollutant reduction strategies.

Requirements from the MDOT SHA MS4 Permit specific to watershed assessments and coordinated TMDL implementation plans are copied below and include *Part IV.E.1.* and *Part IV.E.2.b.* of the Permit (See **Part I, Program Introduction** for complete wording from *Part IV.E.* of the MDOT SHA MS4 Permit).

Watershed Assessments (Permit Part IV.E.1.)

SHA shall coordinate watershed assessments with surrounding jurisdictions, which shall include, but not be limited to the evaluation of available State and county watershed assessments, SHA data, visual watershed inspections targeting SHA rights-of-way and facilities, and approved stormwater WLAs to:

- *Determine current water quality conditions;*
- *Include the results of visual inspections targeting SHA rights-of-way and facilities conducted in areas identified as priority for restoration;*
- *Identify and rank water quality problems for restoration associated with SHA rights-of-way and facilities;*
- *Using the watershed assessments established under section a. above to achieve water quality goals by identifying all structural and nonstructural water quality improvement projects to be implemented; and*
- *Specify pollutant load reduction benchmarks and deadlines that demonstrate progress toward meeting all applicable stormwater WLAs.*

Coordinated TMDL Implementation Plans (Permit Part IV.E.2.b.)

Within one year of permit issuance, a coordinated TMDL implementation plan shall be submitted to MDE for approval that addresses all EPA approved stormwater WLAs (prior to the effective date of the permit) and requirements of Part VI.A., Chesapeake Bay Restoration by 2025 for SHA's storm sewer system. Both specific WLAs and aggregate WLAs which SHA is a part of shall be addressed in the TMDL implementation plans. Any subsequent stormwater WLAs for SHA's storm sewer system shall be addressed by the coordinated TMDL implementation plan within one year of EPA approval. Upon approval by MDE, this implementation plan will be enforceable under this permit. As part of the coordinated TMDL implementation plan, SHA shall:

- *Include the final date for meeting applicable WLAs and a detailed schedule for implementing all structural and nonstructural water quality improvement projects, enhanced stormwater management programs, and alternative stormwater control initiatives necessary for meeting applicable WLAs;*
- *Provide detailed cost estimates for individual projects, programs, controls, and plan implementation;*
- *Evaluate and track the implementation of the coordinated implementation plan through monitoring or modeling to document the progress toward meeting established benchmarks, deadlines, and stormwater WLAs; and*

- *Develop an ongoing, iterative process that continuously implements structural and nonstructural restoration projects, program enhancements, new and additional programs, and alternative BMPs where EPA approved TMDL stormwater WLAs are not being met according to the benchmarks and deadlines established as part of the SHA's watershed* assessments.

B. WATERSHED ASSESSMENT COORDINATION

According to the USGS (2016):

> *A watershed is an area of land where all water that falls on it and drains off it flows to a common outlet. A watershed is an area of land that drains all the streams and rainfall to a common outlet such as the outflow of a reservoir, mouth of a bay, or any point along a stream channel. The word watershed is sometimes used interchangeably with drainage basin or catchment. The watershed consists of surface water--lakes, streams, reservoirs, and wetlands--and all the underlying ground water. Larger watersheds contain many smaller watersheds. Watersheds are important because the streamflow and the water quality of a river are affected by things, human-induced or not, happening in the land area "above" the river-outflow point.*

The 8-digit scale is the most common management scale for non-tidal watersheds across the state, and therefore is the scale at which most of Maryland's local TMDLs are developed. These watersheds are referred to as 8-digit watersheds due to the numbering scheme used by MDE to identify them. See **Figure 3-1** for an illustration of an 8-digit watershed example in Maryland. The example watershed is the Lower Monocacy River watershed with a code of 02140302. The 8-digit watersheds are often a compilation of smaller streams and tributaries that all flow to the single discharge point. These smaller sub-watersheds in some cases, have their own TMDL documents.

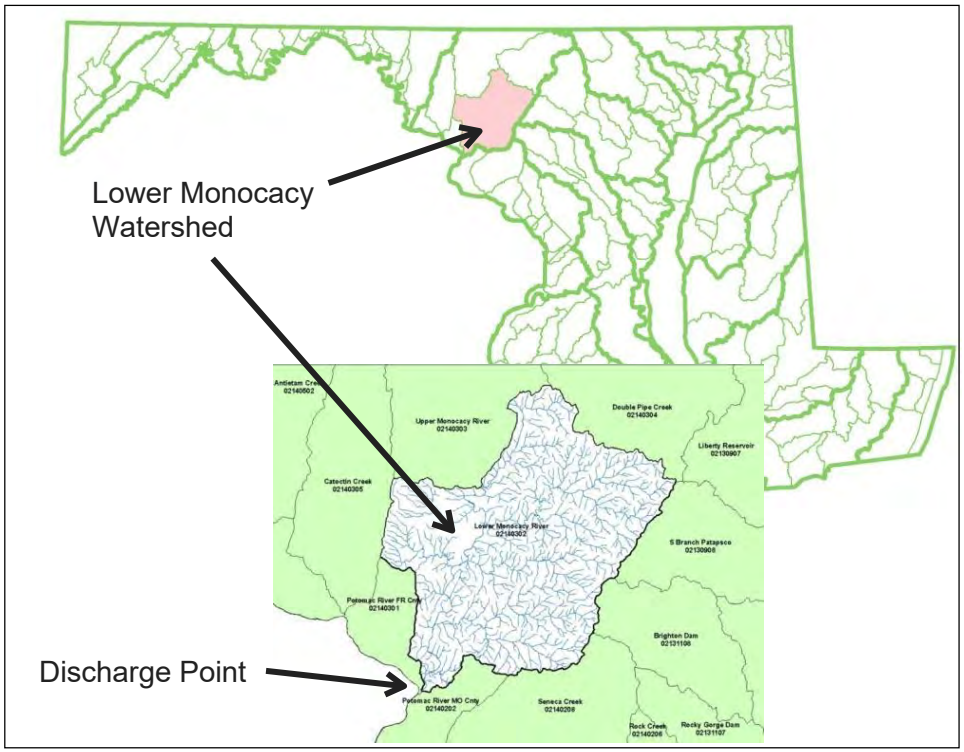


Figure 3-1: Maryland 8-digit Watershed Example

Segmentsheds are watersheds associated with tidal waters, which are referred to as tidal segments. The Chesapeake Bay and its tidal tributaries are divided into 92 segments as shown in **Figure 3-2**. The area draining to the tidal water is the segmentshed. TMDLs can also be written for a segmentshed.

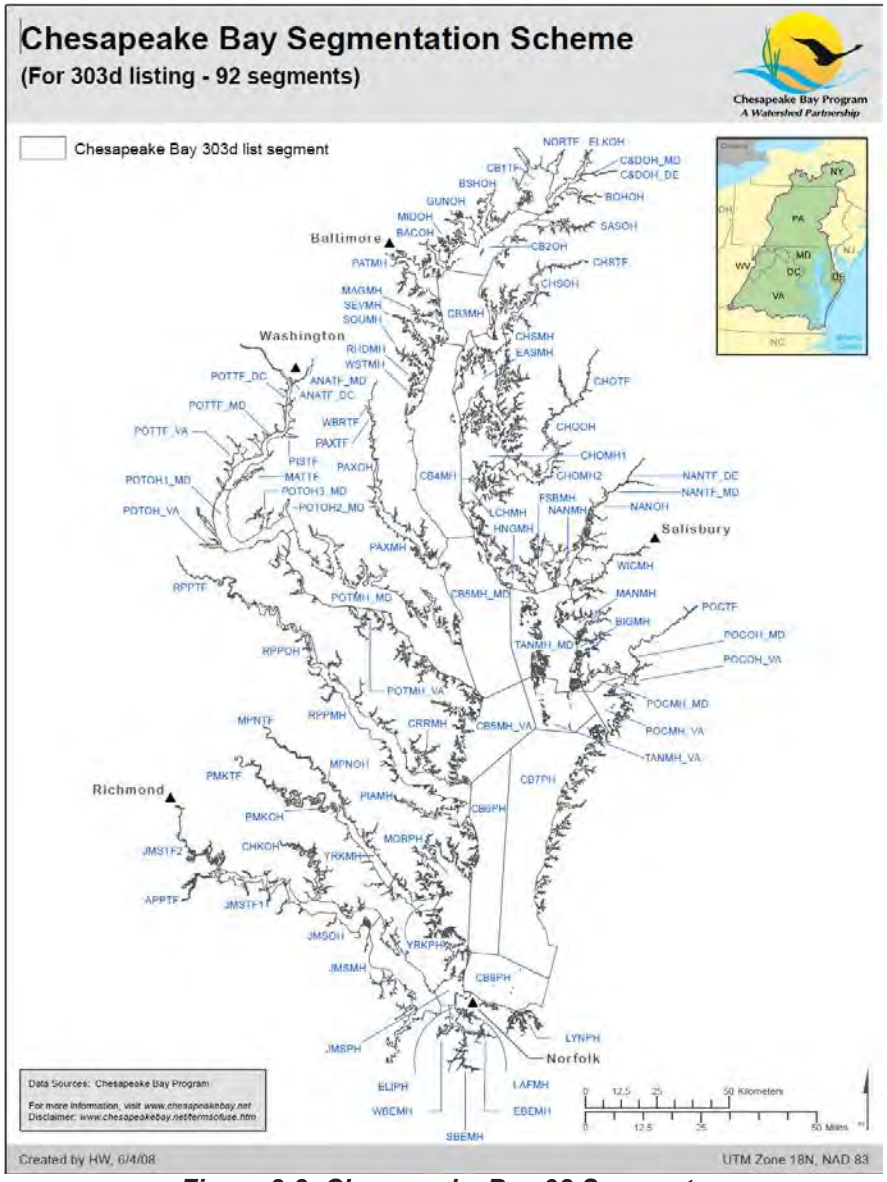


Figure 3-2: Chesapeake Bay 92 Segments

County Watershed Assessments

Each MS4 county performs detailed assessments of local watersheds as a part of its MS4 program. These assessments determine current water quality conditions and include visual inspections; identification and ranking of water quality problems for restoration; prioritization and ranking of structural and non-structural improvement projects; and pollutant reduction benchmarks and deadlines that demonstrate progress toward meeting applicable WQSs. MDOT SHA is not required to duplicate this effort, but coordinates with the MS4 jurisdictions to obtain and review their watershed assessments. Relying on assessments performed by local governments not only avoids redundant analysis but the agencies performing the assessments have close connection to local communities and watershed groups.

Watershed assessment evaluations by MDOT SHA focus on issues that MDOT SHA can improve through practices targeting MDOT SHA ROW or infrastructure. Summaries of watershed assessment evaluations are included in **Part IV, MDOT SHA Watershed Implementation Plans** for each individual watershed plan. Because MDOT SHA property is typically a fraction of land within each of these watersheds, there may be limited information pertinent to MDOT SHA. Results of watershed assessment evaluations are used by MDOT SHA to identify potential project sites or partnership project opportunities. MDOT SHA watershed assessment evaluations focus on the following:

- Impacts to MDOT SHA infrastructure such as failing outfalls and downstream channels;
- Older developed areas with little SWM and available opportunities to install retrofits;
- Degraded streams;
- Priority watershed issues such as improvements within a drinking water reservoir, special protection areas, or Tier II catchments;
- Identification of areas most in need of restoration;

- Description of preferred structural and non-structural BMPs to use within the watershed;
- Potential project sites for BMPs; and,
- In watersheds with PCB TMDLs, identifying locations of any known PCB sources.

In addition to using information from the county watershed assessments, MDOT SHA also undertakes other activities to identify potential project sites and prioritize BMP implementation including:

- On-going coordination meetings with each of the MS4 jurisdictions to discuss potential partnerships with the mutual goal of improving water quality;
- Visual watershed inspections as described below;
- Modeling MDOT SHA load reductions within the watershed based on MDOT SHA land uses and ROW; and,
- Maximizing existing impervious treatment within new development roadway projects (practical design initiative).

C. VISUAL INSPECTIONS TARGETING MDOT SHA ROW AND RESTORATION SITE SEARCHES

C.1. Visual Inspections

MDOT SHA operations and maintenance forces are tasked with managing our built assets including roadways, offices, and shops and often identify and resolve areas with water quality problems or pollutant sources such as erosion or failed outfalls. The MDOT SHA maintenance shops will work with the Highway Hydraulics Division when drainage reports, engineering design, and/or permits are needed to rectify the problem. If problems are severe enough, emergency repairs and permitting may be necessary. Larger, costly repairs that are not emergencies will be reviewed for restoration project potential and if not feasible as restoration credit, will be prioritized based on funding availability.

C.2. Site Searches

The MDOT SHA ROW is also inspected to identify potential restoration projects and operations activities to meet pollutant reductions for current WLAs through both operations and capital programs. Site searches for restoration projects or activities are handled differently depending upon the BMP type. Certain best management practices including street sweeping, inlet cleaning, SW control structure retrofits, new stormwater control structures, grass swale upgrades, tree planting, and outfall stabilization are suited for implementation within the MDOT SHA ROW while others such as stream restoration, are located elsewhere in the watershed. Restoration project site search and assessment procedures are discussed below.

Designated TMDL Street Sweeping Routes

Each MDOT SHA maintenance shop identified specific routes within their shop responsibility boundaries that are swept two times per month and therefore qualify as impervious restoration and TMDL pollutant reduction credits. MDOT SHA has mapped these routes into a GIS and when overlaid with watershed boundaries, can discern load reductions that can be attributed to local TMDL reductions by comparing the overall route length with lengths within watersheds with WLA reduction requirements.

Although much more sweeping is performed by MDOT SHA operations forces than these designated routes, because the frequency requirement of two times per month is not met in other sweeping activities, they are not included in restoration progress numbers.

Enhanced Inlet Cleaning

MDOT SHA operations and maintenance forces routinely clean inlets and pipes along corridors with higher sediment and debris loads that are often characterized by frequently clogging inlet grates, boxes, or pipes and roadway flooding. MDOT SHA has recently sought to expand this on-going program with elements utilized in the Baltimore City inlet cleaning program including: contracted inlet cleaning crews, pre- and post-cleaning documentation of the inlet condition; and targeted loads outside routine corridors.

This enhanced program utilizes information developed through a pilot inlet inspection program that documented potential inlet loading and frequency reaching inlet storage capacity. This pilot has provided essential information to determine potential increases in pollutant reduction that can be achieved to direct the contractors to corridors within watersheds with needed pollutant reductions.

New SW Control Structures and Tree Planting

MDOT SHA has recently developed a process to methodically review MDOT SHA ROW within each watershed for new stormwater BMPs and tree planting. This new process adds a 1.5 X 1.5 mile grid system to track the progress of these investigations allowing prioritized areas to be targeted first and ensures that each watershed is systematically and thoroughly assessed. See **Figure 3-3** for an example of the grid system overlaid on the Anacostia watershed and **Figure 3-4** for a larger scale map of specific grid sections showing various BMP types proposed for restoration.

The watershed review process includes two phases. Phase one is a desktop evaluation of the MDOT SHA ROW using available GIS data, including

- Aerial imagery;
- Street-view mapping;
- Environmental features delineations such as critical area boundary, wetlands buffers, floodplain limit;
- County data such as utilities, storm drain systems, contour and topographic mapping;
- MDOT SHA ROW boundaries;
- Current MDOT SHA stormwater control and restoration practice locations; and
- Drainage area boundaries.

Consultant teams review corridors and propose new stormwater BMPs and/or tree planting sites. The proposed sites are prioritized within watersheds with the highest pollutant reduction needs, as well as by numerous other criteria that address the construction viability of the site. The prioritized sites proceed forward to the second phase of review, field investigations.

Consultant teams use specific guidance to perform detailed field investigations to inspect and assess each site to capture existing conditions, water quality issues, and/or site constraints. This information is used to package restoration stormwater BMPs or tree plantings into design and construction contracts. **Figure 3-5** is an example field investigation summary map that documents observations from the field analysis. A standardized field inspection form is used.

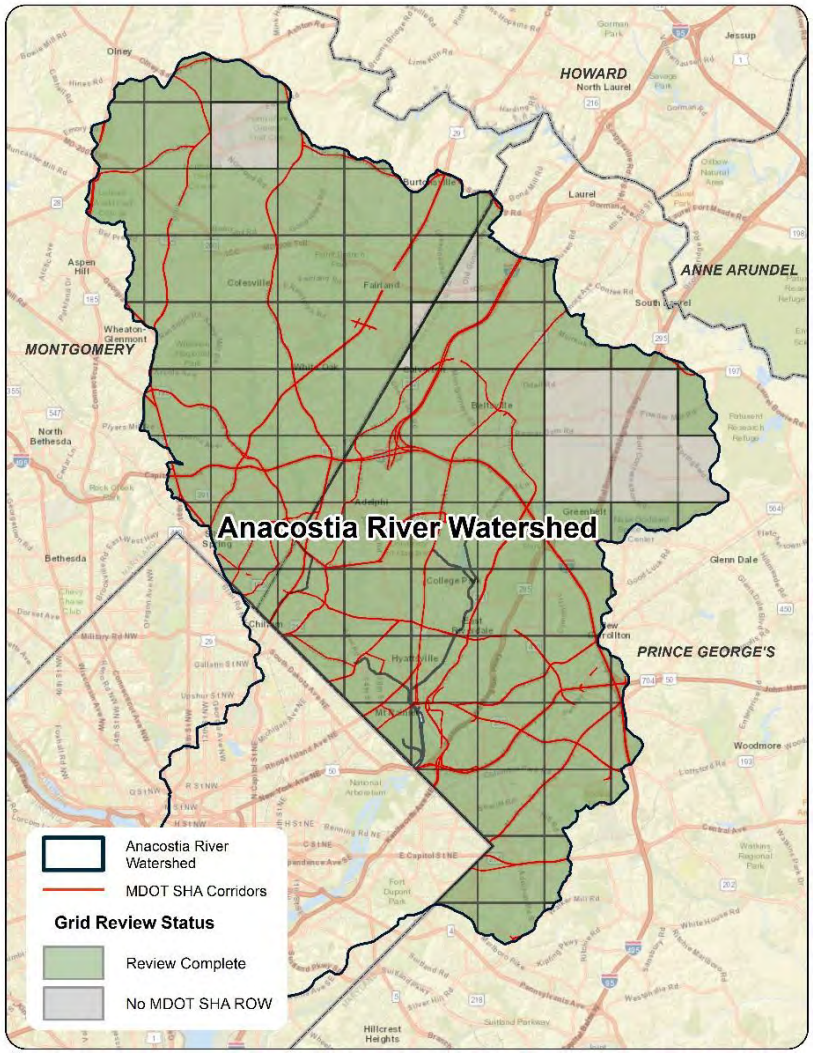


Figure 3-3: Example 1.5-Mile Grid System for Anacostia River Watershed

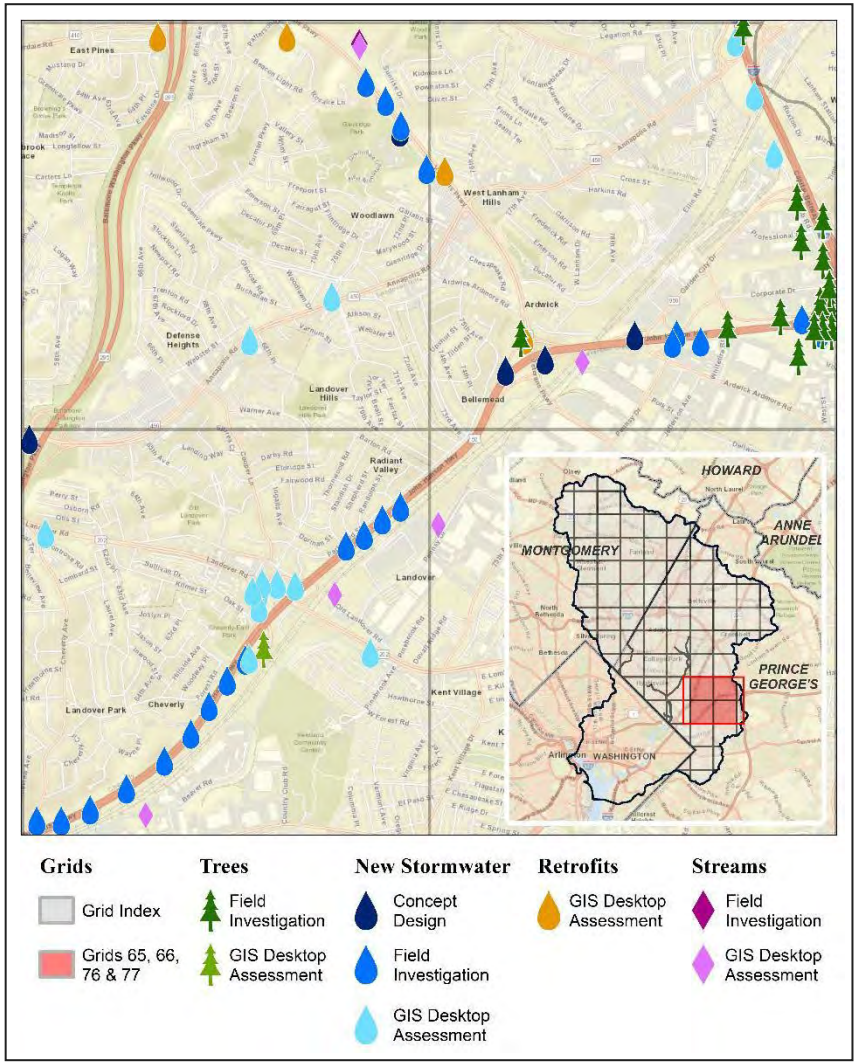


Figure 3-4: Anacostia River Grid Site Search Detail



Figure 3-5: Example Field Investigation Summary Map

Outfall Stabilization

Shortly after the Bay TMDL was issued, MDOT SHA developed an outfall inspection and assessment protocol and assessments were performed along corridors with known priority outfall stabilization issues. This data was captured and summarized in outfall and headwall prioritization reports and was used to target outfalls for field inspections. Standard field inspection sheets and pictures provided results of the field inspections and included assessments of the outfall structure, upstream/downstream channel conditions, and site constraints. Priority sites for restoration projects were chosen based on the reported site condition, potential restoration or TMDL credit, accessibility, property ownership including potential partnership projects, and constraints such as utilities. A final level of project vetting used the following information to determine constructability and design parameters:

- Steep channel slopes,
- Flow regime,
- Major to severe bank instability,
- High bank heights,
- Property ownership,
- Accessibility,
- Public safety, and
- Minimal length 50 feet.

Recently, MDOT SHA created a cross-divisional inspection process that will broaden the use of the outfall assessment to determine both restoration potential and maintenance and repair needs. This will ensure that all identified outfall stability problems will be accessible across divisions and can be incorporated into each division's planning process. A Survey 123 tool is being developed and will collect outfall site inspection data that will aid in ranking and prioritizing future inspection sites for restoration and/or other remediation activities. The new tool and this new process will be implemented in 2019.

Retrofit of Existing SW Control Structures

The MDOT SHA site selection process for retrofits of existing SW control structures involves identifying existing MDOT SHA facilities that have little or no existing water quality treatment of impervious area. These facilities are typically dry ponds, dry-extended detention ponds, undersized wet ponds, undersized infiltration basins, and facilities built prior to the enforcement of the *2000 MDE Stormwater Management Design Manual* (MDE, 2009a). These sites are then prioritized based on factors such as cost effectiveness, net credit potential, site constraints (right-of-way, utilities, noise barriers, access, steep slopes, adjacent roadways, etc.), and environmental permitting requirements (MDE/USACE Non-tidal Wetlands and Waterways, MDE Small Pond, and MD Dam Safety).

Grass Swale Upgrades

MDOT SHA has identified corridors of open-section roadways for grass swale upgrades using specific criteria. Using the *MDOT SHA Existing Water Quality Grass Swale Identification Protocol* (MDOT SHA, 2016), grass swales were evaluated to determine which were currently meeting MDE criteria for water quality and some were identified as having potential to meet the WQ criteria with minor upgrades (classified as 2A swales). Medians and shoulder areas were targeted, and many of these areas were determined to be candidates for grass swale upgrade projects.

Because upgrading existing grass swales is more cost effective than installing a new SW control structure, some sites that were previously identified for new SW control structures have been reclassified as potential grass swale upgrade candidates. The corridors with the highest potential for swale upgrades were evaluated using desktop GIS methods and subsequently field investigated. The resulting data allowed a set of corridors to be selected for design and construction contracts.

Stream Restoration

A two-pronged approach is utilized to identify stream restoration projects. First, MDOT SHA identifies potential stream restoration projects through desktop analyses and review of existing watershed implementation plans. Second, potential sites may be identified through partnerships with local citizens, municipalities, counties and other State or federal government agencies. Once a potential stream restoration location has been identified, the process below is utilized to determine project potential.

Because stream restoration projects are typically located outside of MDOT SHA ROW, a separate digital tool has been used to review each watershed for potential restoration opportunities. The tool was designed to allow designers to fill out forms at each level of review to efficiently store information and prioritize potential restoration opportunities. The stream site investigations include two phases to identify potential stream restoration opportunities. Although not initially tied directly to the grid system described under the new SW control structure and tree discussion above, assessments for stream sites have been integrated into the grid system.

Like most of the other practices, stream sites undergo both a desktop GIS analysis followed by a field investigation. Key parameters that are considered in stream restoration site selection are the following:

- Site Characteristics
  - Existing landuse
  - Channelization
  - Erosion sources
  - Nutrient sources
  - Riparian buffer
  - Downstream stability
- Watershed Characteristics
  - Local TMDLs and other impairments
  - Impervious area draining to site
- Site Constraints
  - Utilities
  - Ownership (public, private)
  - Access
  - Wetlands
  - Rare, threatened, and endangered species

D. BENCHMARKS AND DETAILED COSTS

Benchmarks and target dates demonstrating planned progress toward meeting applicable stormwater WLAs are provided in individual watershed discussions in **Part IV, MDOT SHA Watershed TMDL Implementation Plans**.

Generalized cost information is included for each individual plan that includes an overall estimated cost for the proposed practices. Bid costs for specific construction projects are available on MDOT SHA's website (www.roads.maryland.gov) under Contractors Information Center.

E. POLLUTION REDUCTION STRATEGIES

E.1. MDOT SHA TMDL Responsibilities

TMDLs define the maximum pollutant loading that can be discharged to a waterbody and still meet water quality criteria for maintaining designated uses. **Figure 3-6** illustrates the TMDL concept. The green area on the bar depicts the maximum load that maintains a healthy water environment for the pollutant under consideration. When this load is exceeded, the waterway is considered impaired as illustrated by the red portion of the bar. The example waterway needs restoration through implementation of practices to reduce the pollutant loading to or below the WLA.

Generally, the formula for a TMDL is:

$$TMDL = \sum WLA + \sum LA + MOS$$

Where:

TMDL = total maximum daily load
WLA = wasteload allocation for point sources;
LA = load allocation for non-point sources; and
MOS = margin of safety.

Pollutants for MDOT SHA Focus

Upon issuance of the MS4 Permit, MDOT SHA was named in TMDLs for five different pollutants within the MS4 coverage area including

- Bacteria,
- PCBs,
- Phosphorus,
- Sediment, and
- Trash.

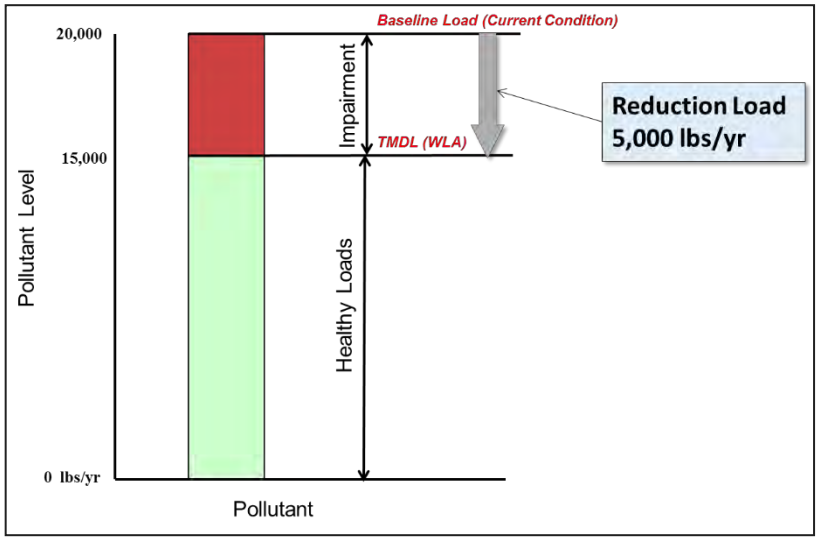


Figure 3-6: Example Wasteload Allocation and Reduction Requirement

The MDOT SHA MS4 Permit covers 11 Maryland counties that cross 84 8-digit watersheds. There are 47 EPA approved TMDL documents that assign MDOT SHA to either an individual WLA or an aggregate WLA. Each watershed may be impaired by multiple pollutants resulting in the development and approval of multiple TMDL documents, so there is not a direct correlation between the number of TMDL documents and the number of watersheds affected. Lists of the TMDL documents addressed by this plan for each pollutant are included in **Sections E.2** through **E.5.**

Figures 3-7A through 3-7D show pollutant specific maps with watersheds identified where MDOT SHA has TMDL reduction requirements. Following the figures is **Table 3-2** that summarizes MDOT SHA reduction targets within each of the watersheds for each pollutant, target end dates to meet the reductions, and projected benchmarks for interim target dates of FY2020 and FY2025. An

explanation of the data contained in Table 3-2 is included prior to the tables.

Modeling Parameters

MDE requires that pollutant modeling follow the guidance in MDE's *Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated* (MDE, 2014b); if other methods are employed, they must be approved by MDE. MDOT SHA developed a restoration modeling protocol that describes the methods used for modeling pollutant load reductions for local TMDLs with MDOT SHA responsibility. This protocol was originally submitted to MDE as Appendix E in the 2016 MDOT SHA MS4 annual report. Updates to this protocol will be periodically implemented and resubmitted for MDE consideration. Once approved, this protocol will be available on the MDOT SHA website.


Different modeling methods are used depending upon the pollutants and current reduction practices in use. The *MDOT SHA Restoration Modeling Protocol* (MDOT SHA, 2018) should be consulted for detailed descriptions.

Aggregated Loads

WLAs may be assigned to each MS4 jurisdiction separately or as an aggregated WLA for all urban stormwater MS4 permittees that combines them into one required allocation and reduction target. The modeling approach developed by MDOT SHA uses MDOT SHA data (both impervious and pervious land as well as BMPs built before the TMDL baseline year, also known as baseline BMPs) to calculate baseline loads and calibrated reduction targets. Following this approach, disaggregation is done for each TMDL.


Available Reduction Practices

MDOT SHA reserves the right to implement new BMPs, activities, and other practices that are not currently available to achieve local TMDL load reduction requirements. MDOT SHA will modify reduction strategies as necessary based on new, approved treatment guidance and will include revised strategies in updates to this implementation plan.

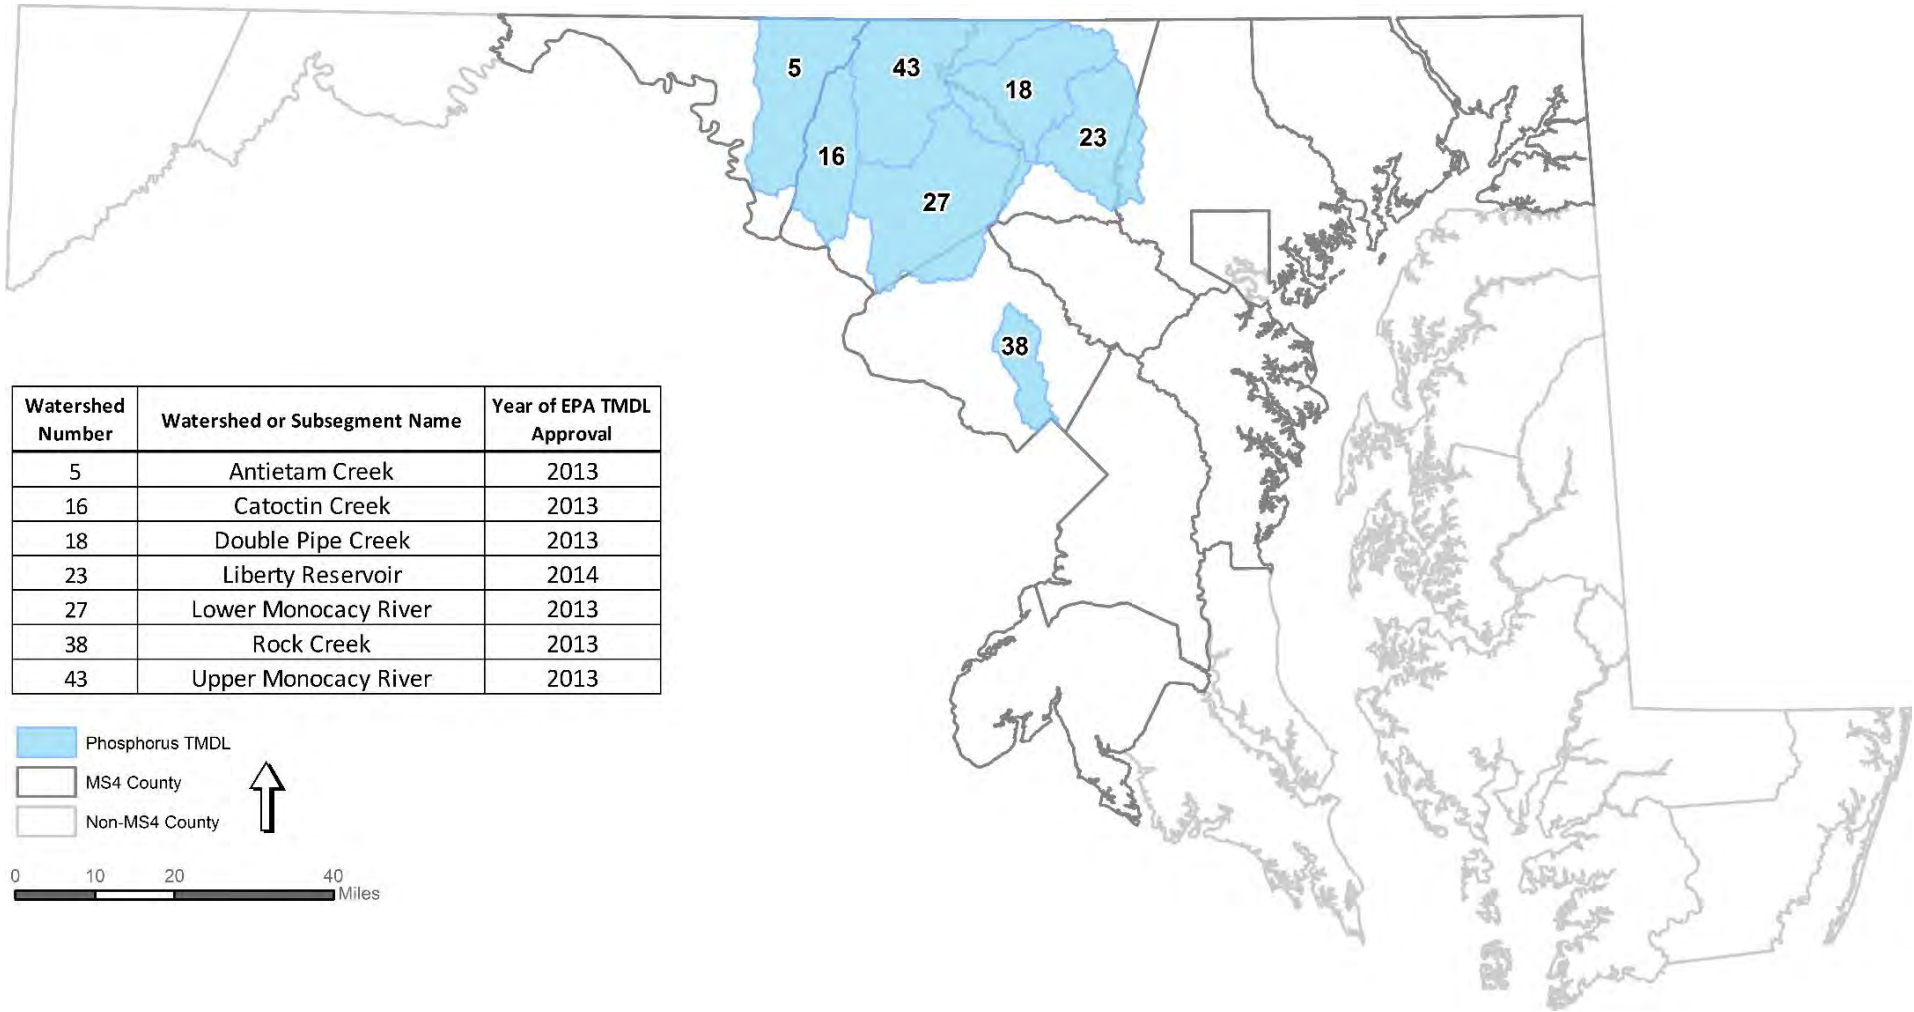


Watershed Number	Watershed or Subsegment Name	Year of EPA TMDL Approval
5	Antietam Creek	2013
16	Catoctin Creek	2013
18	Double Pipe Creek	2013
23	Liberty Reservoir	2014
27	Lower Monocacy River	2013
38	Rock Creek	2013
43	Upper Monocacy River	2013

Figure 3-7A: Watersheds with MDOT SHA Phosphorus TMDLs

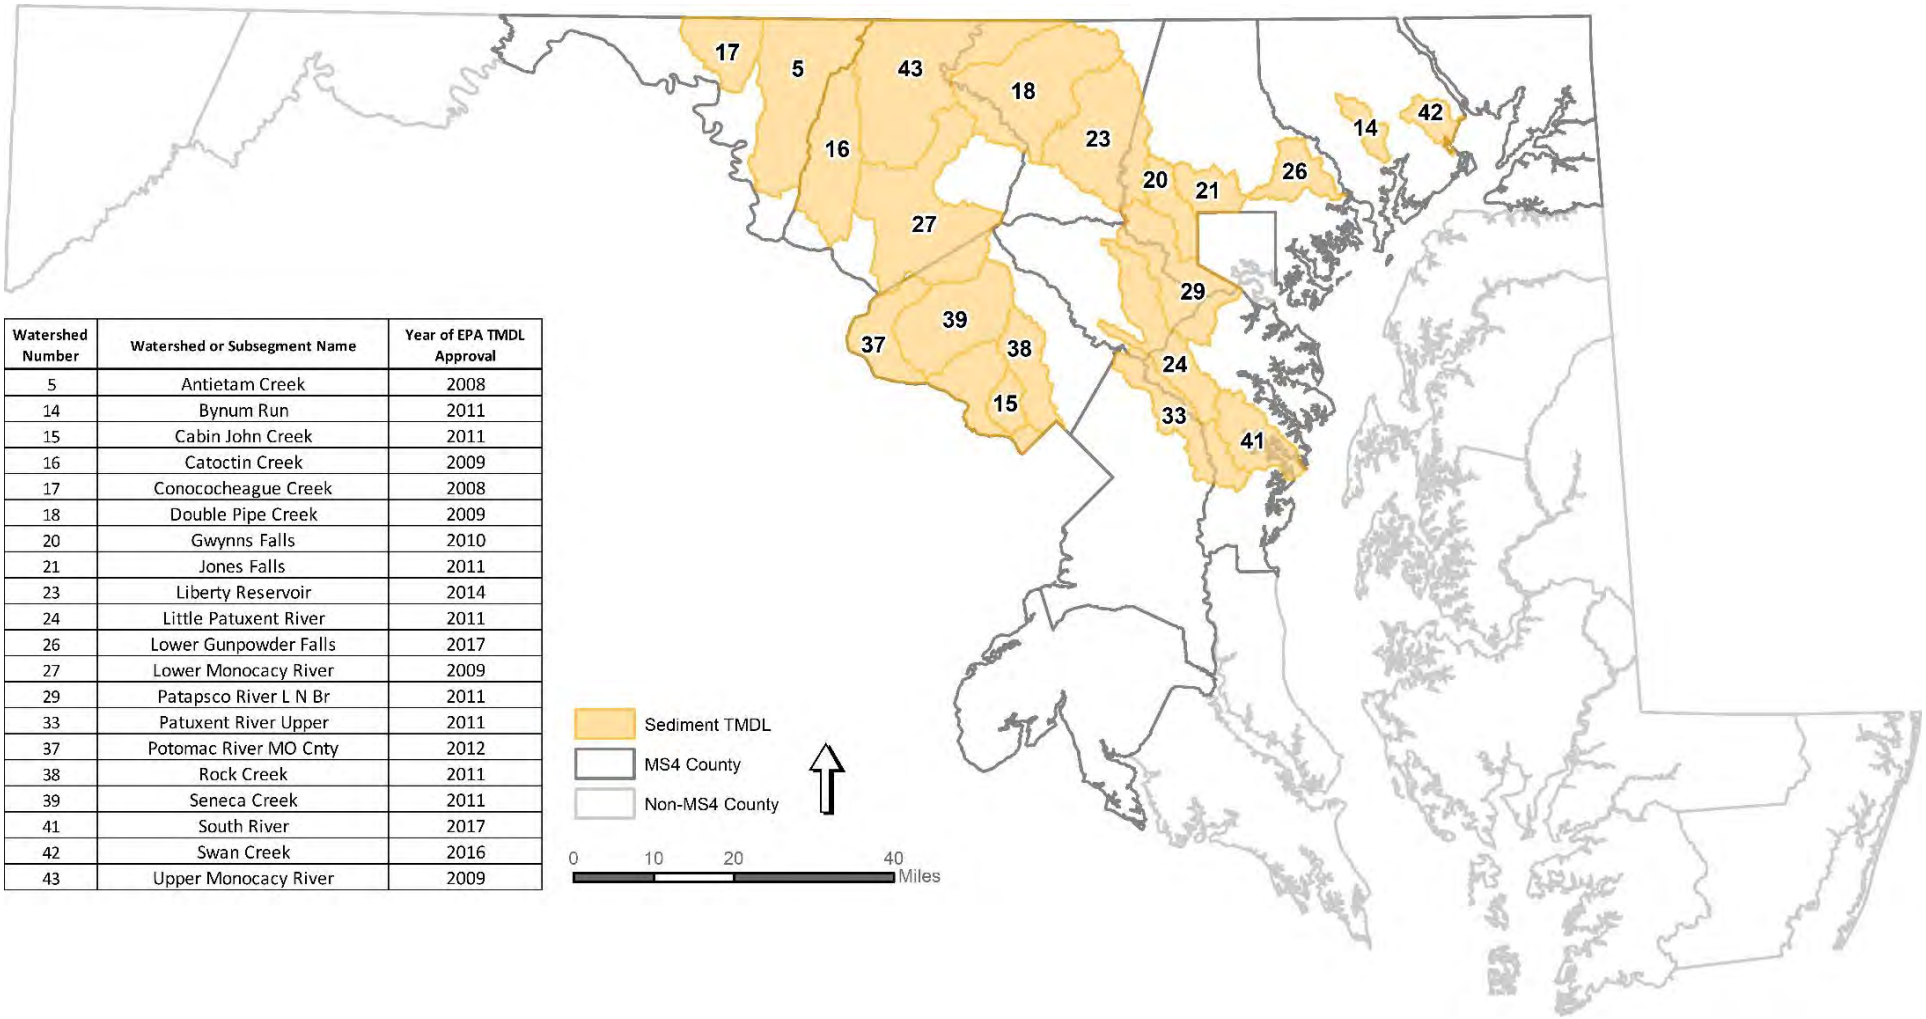


Watershed Number	Watershed or Subsegment Name	Year of EPA TMDL Approval
5	Antietam Creek	2008
14	Bynum Run	2011
15	Cabin John Creek	2011
16	Catoctin Creek	2009
17	Conococheague Creek	2008
18	Double Pipe Creek	2009
20	Gwynns Falls	2010
21	Jones Falls	2011
23	Liberty Reservoir	2014
24	Little Patuxent River	2011
26	Lower Gunpowder Falls	2017
27	Lower Monocacy River	2009
29	Patapsco River L N Br	2011
33	Patuxent River Upper	2011
37	Potomac River MO Cnty	2012
38	Rock Creek	2011
39	Seneca Creek	2011
41	South River	2017
42	Swan Creek	2016
43	Upper Monocacy River	2009

Figure 3-7B: Watersheds with MDOT SHA Sediment TMDLs

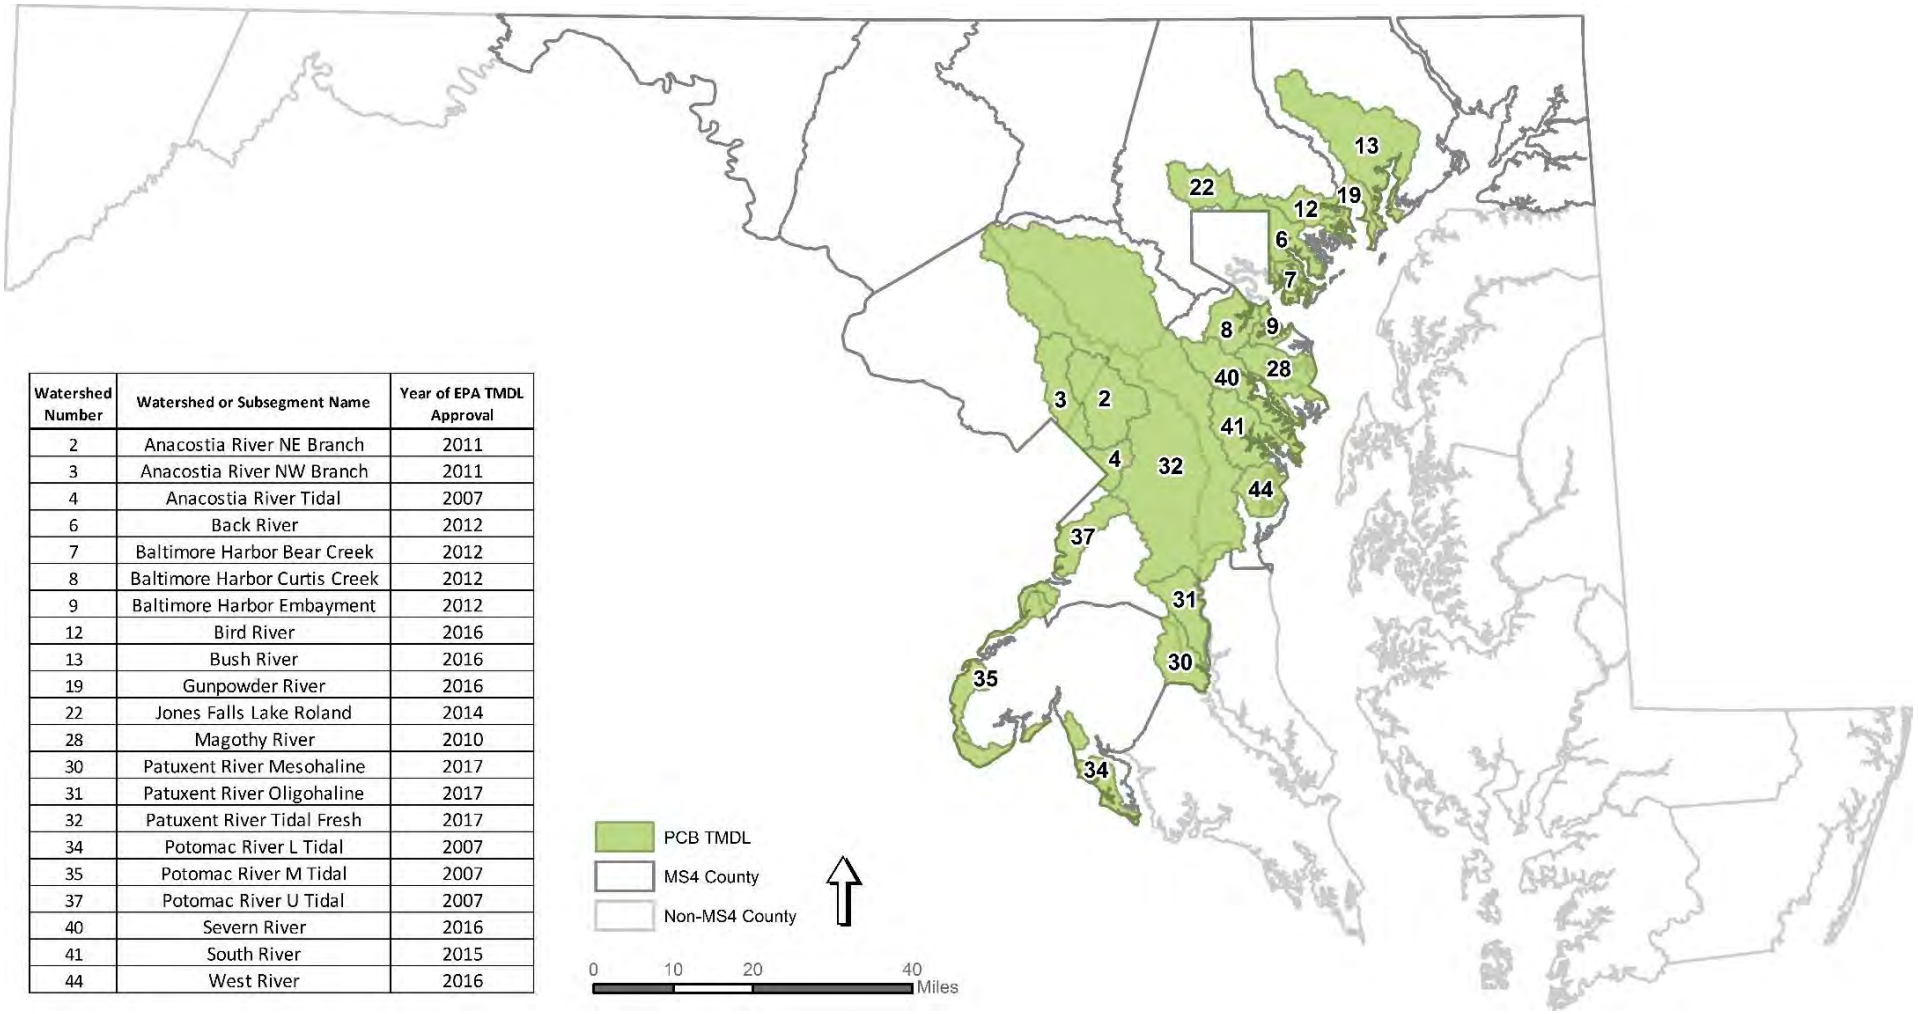


Watershed Number	Watershed or Subsegment Name	Year of EPA TMDL Approval
2	Anacostia River NE Branch	2011
3	Anacostia River NW Branch	2011
4	Anacostia River Tidal	2007
6	Back River	2012
7	Baltimore Harbor Bear Creek	2012
8	Baltimore Harbor Curtis Creek	2012
9	Baltimore Harbor Embayment	2012
12	Bird River	2016
13	Bush River	2016
19	Gunpowder River	2016
22	Jones Falls Lake Roland	2014
28	Magothy River	2010
30	Patuxent River Mesohaline	2017
31	Patuxent River Oligohaline	2017
32	Patuxent River Tidal Fresh	2017
34	Potomac River L Tidal	2007
35	Potomac River M Tidal	2007
37	Potomac River U Tidal	2007
40	Severn River	2016
41	South River	2015
44	West River	2016

Figure 3-7C: Watersheds with MDOT SHA Polychlorinated Biphenyl (PCB) TMDLs

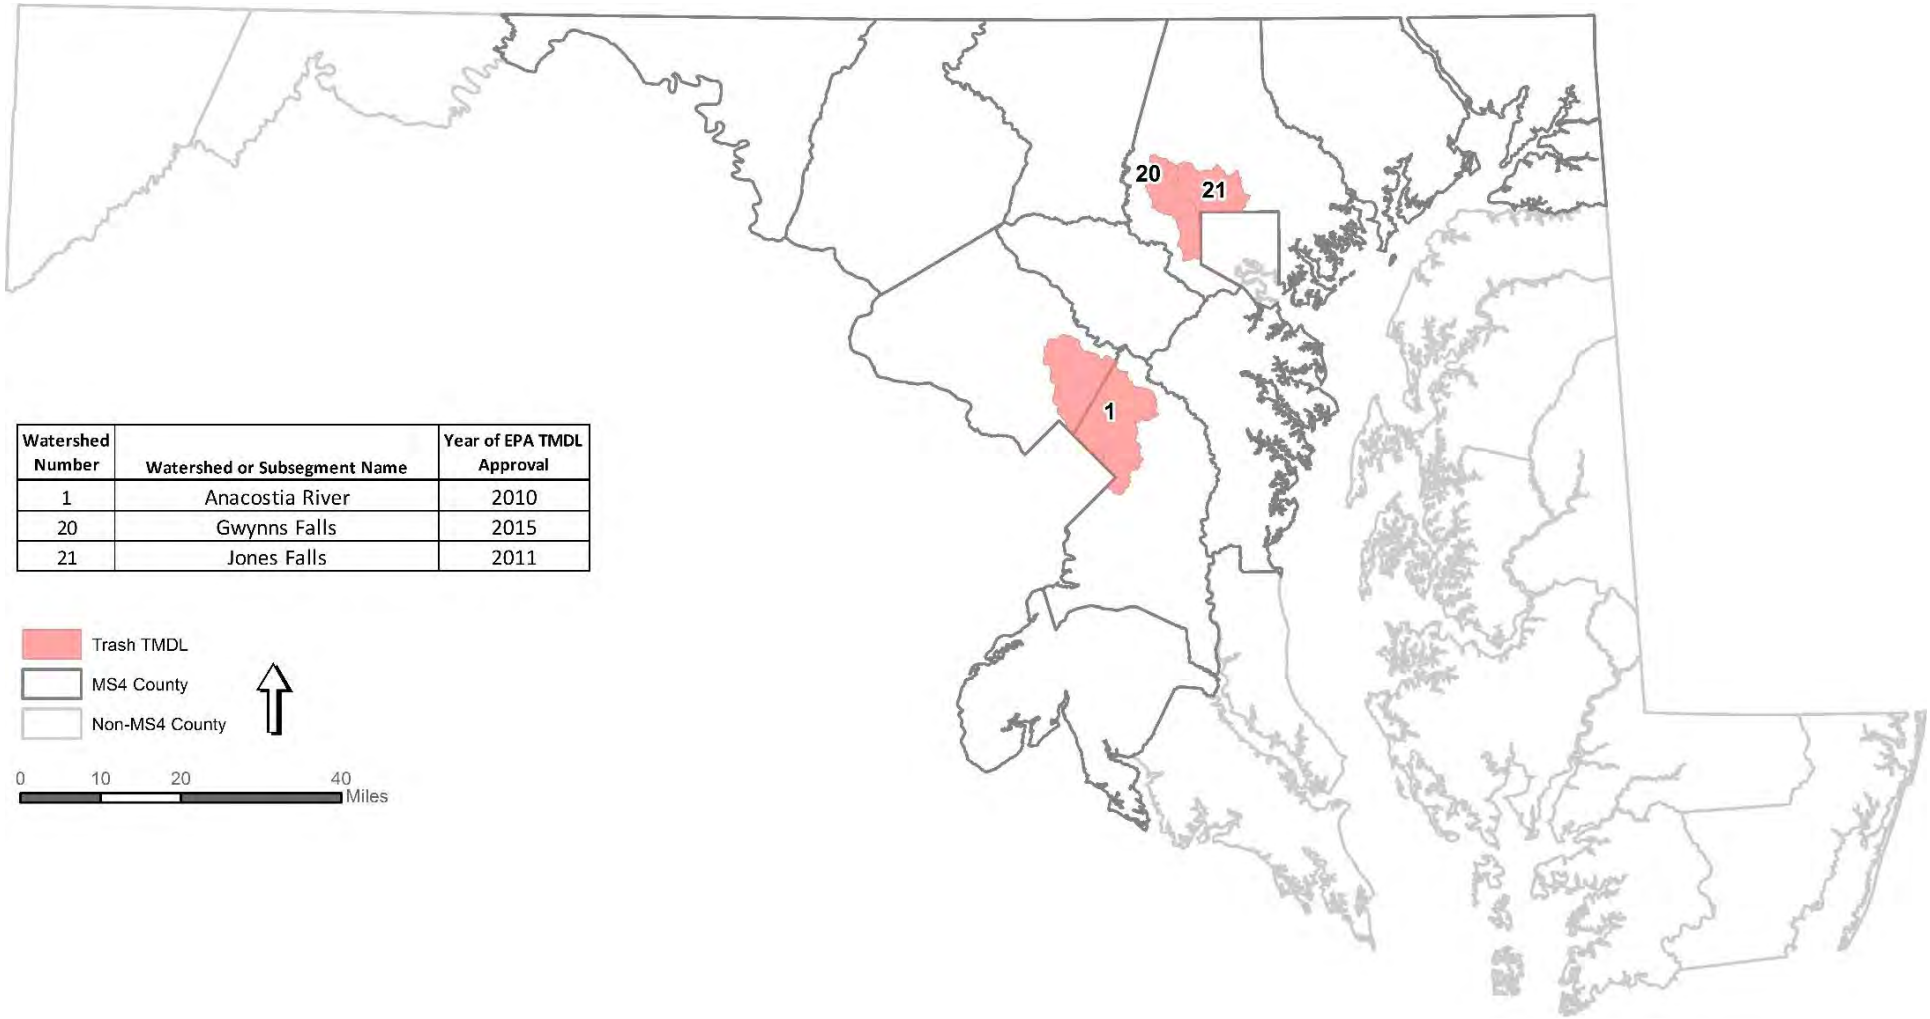

Watershed Number	Watershed or Subsegment Name	Year of EPA TMDL Approval
1	Anacostia River	2010
20	Gwynns Falls	2015
21	Jones Falls	2011

Figure 3-7D: Watersheds with MDOT SHA Trash TMDLs

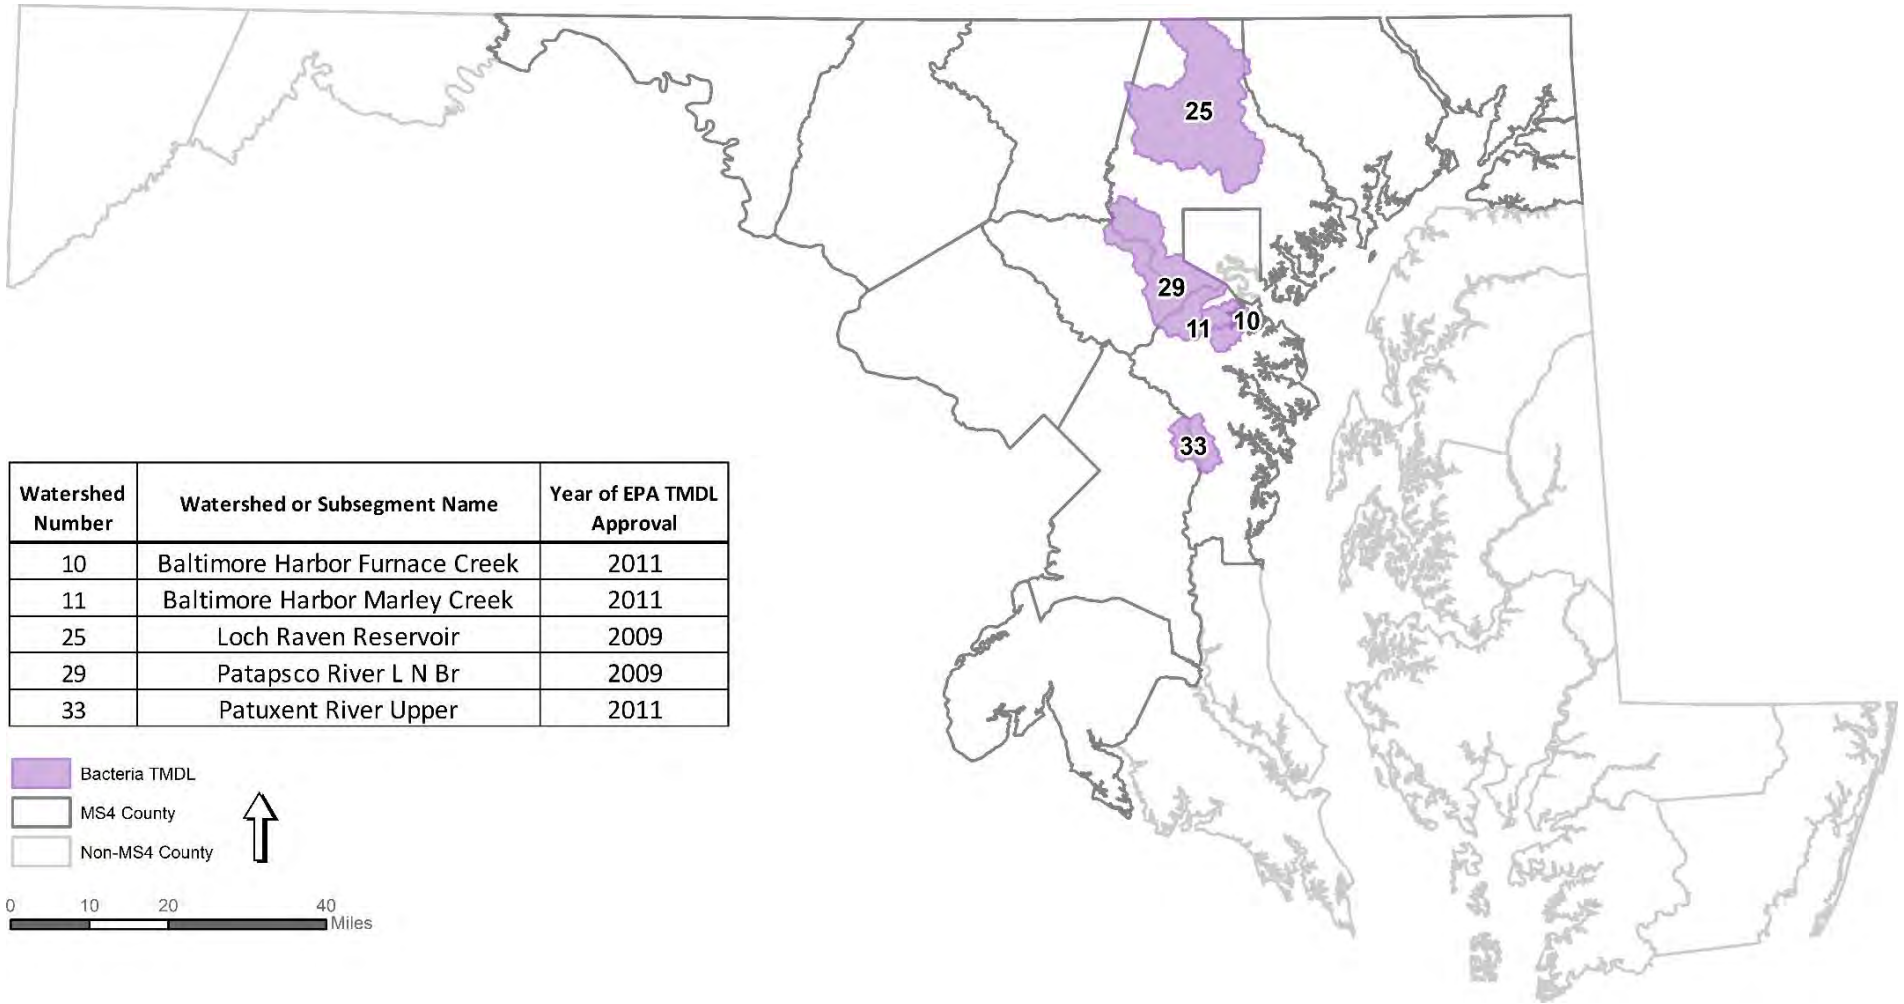

Watershed Number	Watershed or Subsegment Name	Year of EPA TMDL Approval
10	Baltimore Harbor Furnace Creek	2011
11	Baltimore Harbor Marley Creek	2011
25	Loch Raven Reservoir	2009
29	Patapsco River L N Br	2009
33	Patuxent River Upper	2011

Figure 3-7E: Watersheds with MDOT SHA Bacteria TMDLs

Summary of Modeling Results

Table 3-2 summarizes results of MDOT SHA TMDL modeling for the pollutants depicted in the mapping above organized by pollutants and then watersheds. Modeling is performed according to parameters documented in the *MDOT SHA Restoration Modeling Protocol* (MDOT SHA, 2018). Results for phosphorus, sediment, PCB, trash, and bacteria modeling are grouped together in **Table 3-2** following a traditional TMDL method of determining baseline loading, calculating reduction requirement, determining BMPs to meet the reduction, and modeling projected loading for the proposed implementation plan.

In the table, information concerning the TMDL document is shown to the left in columns with gray headings including watershed name, watershed number, county, pollutant, EPA approval date, baseline year, and unit of measure for the pollutant. MDOT SHA modeling results include both load reduction requirements and projected reduction benchmarks by target years. MDOT SHA modeled requirements are shown in the middle with green headings including MDOT baseline loading, percent reduction target, and reduction target in unit measure (e.g., lbs./year). Projected benchmarks are shown to the right of the reduction requirements with tan headings including FY 2020 interim target, FY 2025 interim target. To the far right also in tan are the projected reduction to be achieved by the target year and the target year proposed to meet the reduction requirement. Two additional columns are included with blue headings that provide comparative assessments of the 2025 interim reduction target to be achieved relative to the modeled MDOT SHA baseline and relative to the reduction target.

For all pollutants, the MDOT SHA percent reduction target (green heading) is from the published TMDL document. The baseline year is published on the MDE Data Center and will be used for MDOT SHA implementation planning. This usually correlates to the time-period when monitoring data was collected for the MDE TMDL analysis.

The Target Year (tan heading at far right) is the year MDOT SHA proposes to meet the WLA or show significant progress in efforts toward meeting the WLA. In cases were MDOT SHA does not believe they can meet the WLA by the target year, discussion is added to the reduction strategy sections to analyze the conditions that preclude MDOT SHA from meeting the target reductions with currently available modeling methods, loading, reduction efficiencies, and/or practices. Progress implementing BMPs toward meeting benchmark reductions and target years will be documented in the MDOT SHA annual MS4 reports for each fiscal year. Thus, MDE will be able to track the increase in the reduction achieved from year to year.

Lists of proposed practices and costs to achieve the reduction targets are included in individual watershed plans included as **Part IV, MDOT SHA Watershed TMDL Implementation Plans.**

Table 3-2: MDOT SHA Nutrient, Sediment, PCB and Trash Modeling Results

Watershed Name	Watershed Number	County	Pollutant	EPA Approval Date	Baseline Year	Unit	MDOT SHA Baseline Load	MDOT SHA % Reduction Target	MDOT SHA Reduction Target	2020 Interim Reduction Target	% 2020 Reduction Relative to Reduction Target	2025 Interim Reduction Target	% 2025 Reduction Relative to Reduction Target	Projected Reduction to be Achieved by Target Year	% Reduction to be Achieved Relative to Reduction Target	Target Year
Nutrient and Sediment TMDLs																
Antietam Creek	02140502	WA	Phosphorus	09/25/2013	2000	EOS-lbs/yr	1,295	21.4%	277	102	36.8%	277	100.0%	277	100.0%	2030
			Sediment	12/18/2008	2000	EOS-lbs/yr	1,734,045	58.1%	1,007,480	108,098	10.7%	238,281	23.7%	1,007,480	100.0%	2045
Bynum Run	02130704	HA	Sediment	09/30/2011	2005	EOS-lbs/yr	125,987	19.3%	24,316	16,469	67.7%	24,316	100.0%	24,316	100.0%	2030
Cabin John Creek	02140207	MO	Sediment	09/30/2011	2005	EOS-lbs/yr	1,012,693	22.9%	231,907	79,327	34.2%	98,008	42.3%	231,907	100.0%	2045
Catoctin Creek	02140305	FR	Phosphorus	09/24/2013	2009	EOS-lbs/yr	1,704	9.0%	153	153	100.0%	153	100.0%	153	100.0%	2025
			Sediment	07/31/2009	2000	EOS-lbs/yr	1,210,465	49.1%	594,338	280,379	47.2%	509,359	85.7%	594,338	100.0%	2035
Conococheague Creek	02140504	WA	Sediment	11/24/2008	2000	EOS-lbs/yr	1,152,566	45.3%	522,112	43,821	8.4%	100,574	19.3%	522,112	100.0%	2045
Double Pipe Creek	02140304	FR, CL	Phosphorus	04/26/2013	2009	EOS-lbs/yr	1,575	66.0%	1,040	585	56.3%	1,040	100.0%	1,040	100.0%	2030
		FR, CL	Sediment	02/20/2009	2000	EOS-lbs/yr	972,329	46.8%	455,050	371,013	81.5%	455,050	100.0%	455,050	100.0%	2030
Gwynns Falls	02130905	BA	Sediment	3/10/2010; WLA revised 8/31/2015	2005	EOS-lbs/yr	1,368,169	36.4%	498,014	37,415	7.5%	110,058	22.1%	498,014	100.0%	2050

Table 3-2: MDOT SHA Nutrient, Sediment, PCB and Trash Modeling Results

Watershed Name	Watershed Number	County	Pollutant	EPA Approval Date	Baseline Year	Unit	MDOT SHA Baseline Load	MDOT SHA % Reduction Target	MDOT SHA Reduction Target	2020 Interim Reduction Target	% 2020 Reduction Relative to Reduction Target	2025 Interim Reduction Target	% 2025 Reduction Relative to Reduction Target	Projected Reduction to be Achieved by Target Year	% Reduction to be Achieved Relative to Reduction Target	Target Year
Jones Falls	02130904	BA	Sediment	09/29/2011	2005	EOS-lbs/yr	436,719	21.7%	94,768	64,214	67.8%	94,768	100.0%	94,768	100.0%	2025
Liberty Reservoir	02130907	BA, CL	Phosphorus	05/07/2014	2009	EOS-lbs/yr	1,251	45.0%	563	82	14.5%	563	100.0%	563	100.0%	2035
			Sediment		2009	EOS-lbs/yr	1,126,330	45.0%	506,848	68,649	13.5%	506,848	100.0%	506,848	100.0%	2035
Little Patuxent River	02131105	AA, HO	Sediment	09/30/2011	2005	EOS-lbs/yr	1,454,208	36.1%	524,969	524,969	100.0%	524,969	100.0%	524,969	100.0%	2025
Lower Gunpowder Falls	02130802	BA	Sediment	05/04/2017	2009	EOS-lbs/yr	254,358	67.0%	170,420	170,420	100.0%	170,420	100.0%	170,420	100.0%	2030
Lower Monocacy River	02140302	CL, FR, MO	Phosphorus	05/22/2013	2009	EOS-lbs/yr	4,474	25.0%	1,119	1,108	99.0%	1,119	100.0%	1,119	100.0%	2025
		FR, MO	Sediment	03/17/2009	2000	EOS-lbs/yr	1,648,092	60.8%	1,002,040	384,523	38.4%	834,913	83.3%	1,002,040	100.0%	2045
Patapsco LN Branch	02130906	AA, BA, HO	Sediment	09/30/2011	2005	EOS-lbs/yr	2,631,967	18.0%	473,754	309,836	65.4%	473,754	100.0%	473,754	100.0%	2030
Patuxent River Upper	02131104	AA, HO, PG	Sediment	09/30/2011	2005	EOS-lbs/yr	343,714	11.4%	39,183	39,183	100.0%	39,183	100.0%	39,183	100.0%	2025
Potomac River MO County	02140202	MO	Sediment	09/28/2011	2005	EOS-lbs/yr	885,933	36.2%	320,708	48,320	15.1%	155,573	48.5%	320,708	100.0%	2045
Rock Creek	02140206	MO	Phosphorus	09/23/2013	2009	EOS-lbs/yr	1,106	32.0%	354	354	100.0%	354	100.0%	354	100.0%	2023
			Sediment	09/29/2011	2005	EOS-lbs/yr	1,757,766	37.9%	666,193	661,381	99.3%	666,193	100.0%	666,193	100.0%	2030

Table 3-2: MDOT SHA Nutrient, Sediment, PCB and Trash Modeling Results

Watershed Name	Watershed Number	County	Pollutant	EPA Approval Date	Baseline Year	Unit	MDOT SHA Baseline Load	MDOT SHA % Reduction Target	MDOT SHA Reduction Target	2020 Interim Reduction Target	% 2020 Reduction Relative to Reduction Target	2025 Interim Reduction Target	% 2025 Reduction Relative to Reduction Target	Projected Reduction to be Achieved by Target Year	% Reduction to be Achieved Relative to Reduction Target	Target Year
Seneca Creek	02140208	MO	Sediment	09/30/2011	2005	EOS-lbs/yr	1,328,366	44.9%	596,436	363,663	61.0%	426,812	71.6%	596,436	100.0%	2045
South River	02131003	AA	Sediment	09/28/2017	2009	EOS-lbs/yr	229,305	28.0%	64,205	64,205	100.0%	64,205	100.0%	64,205	100.0%	2025
Swan Creek	02130706	HA	Sediment	09/30/2016	2010	EOS-lbs/yr	59,038	13.0%	7,675	5,400	70.4%	7,675	100.0%	7,675	100.0%	2025
Upper Monocacy River	02140303	CL, FR	Phosphorus	05/07/2013	2009	EOS-lbs/yr	1,808	3.0%	54	54	100.0%	54	100.0%	54	100.0%	2025
		CL, FR	Sediment	12/03/2009	2000	EOS-lbs/yr	842,512	49.0%	412,831	65,776	15.9%	346,081	83.8%	412,831	100.0%	2035
PCB TMDLs																
Anacostia River Tidal	02140205	PG	PCBs	10/31/2007	2005	g/yr	16.10	99.9%	16.08	0.97	6.1%	0.97	6.1%	16.08	100.0%	2050
Back River Oligohaline Tidal	MD-BACOH	BA	PCBs	10/01/2012	2001	g/yr	19.31	53.4%	10.31	0.36	3.5%	0.45	4.4%	10.31	100.0%	2045
Baltimore Harbor - Embayment	02130903	AA, BA	PCBs	10/01/2012	2004	g/yr	6.20	91.1%	5.65	1.36	24.0%	1.36	24.0%	5.65	100.0%	2038
Baltimore Harbor - Bear Creek	MD-PATMH-BEAR-CREEK	BA	PCBs	10/01/2012	2004	g/yr	6.33	91.5%	5.79	0.64	11.1%	0.64	11.1%	5.79	100.0%	2038
Bird River	MD-GUNOH-02130803	BA	PCBs	10/03/2016	2010	g/yr	1.25	70.0%	0.88	0.08	8.9%	0.09	10.6%	0.88	100.0%	2050

Table 3-2: MDOT SHA Nutrient, Sediment, PCB and Trash Modeling Results

Watershed Name	Watershed Number	County	Pollutant	EPA Approval Date	Baseline Year	Unit	MDOT SHA Baseline Load	MDOT SHA % Reduction Target	MDOT SHA Reduction Target	2020 Interim Reduction Target	% 2020 Reduction Relative to Reduction Target	2025 Interim Reduction Target	% 2025 Reduction Relative to Reduction Target	Projected Reduction to be Achieved by Target Year	% Reduction to be Achieved Relative to Reduction Target	Target Year
Bush River Oligohaline	MD-BSHOH-02130701	HA	PCBs	08/02/2016	2010	g/yr	11.06	62.0%	6.85	0.34	4.9%	0.39	5.6%	6.85	100.0%	2050
Baltimore Harbor - Curtis Creek/Bay	MD-PATMH-CURTIS_BAY_CREEK	AA	PCBs	10/01/2012	2004	g/yr	31.30	93.5%	29.26	1.39	4.7%	1.39	4.7%	29.26	100.0%	2038
Gunpowder River Oligohaline	MD-GUNOH-02130801	BA, HA	PCBs	10/03/2016	2010	g/yr	N/A	0.0%	-	-	-	-	-	-	-	-
Lake Roland	MD-02130904-Lake_Roland	BA	PCBs	09/30/2013	2010	g/yr	16.07	29.3%	4.71	0.22	4.7%	0.30	6.3%	4.71	100.0%	2025
Magothy River Mesohaline	MD-MAGM-02131001	AA	PCBs	03/16/2015	2010	g/yr	N/A	0.0%	-	-	-	-	-	-	-	-
NE Branch Anacostia River	02140205	MO, PG	PCBs	09/30/2011	2005	g/yr	7.89	98.6%	7.78	0.23	2.9%	0.40	5.1%	7.78	100.0%	2045
NW Branch Anacostia River	02140205	MO, PG	PCBs	09/30/2011	2005	g/yr	7.70	98.1%	7.55	0.36	4.7%	0.36	4.7%	7.55	100.0%	2045
Patuxent River Mesohaline	02131101-PAXMH	CH, PG	PCBs	09/19/2017	2010	g/yr	N/A	0.0%	-	-	-	-	-	-	-	-

Table 3-2: MDOT SHA Nutrient, Sediment, PCB and Trash Modeling Results

Watershed Name	Watershed Number	County	Pollutant	EPA Approval Date	Baseline Year	Unit	MDOT SHA Baseline Load	MDOT SHA % Reduction Target	MDOT SHA Reduction Target	2020 Interim Reduction Target	% 2020 Reduction Relative to Reduction Target	2025 Interim Reduction Target	% 2025 Reduction Relative to Reduction Target	Projected Reduction to be Achieved by Target Year	% Reduction to be Achieved Relative to Reduction Target	Target Year
Patuxent River Oligohaline	02131101-PAXOH	AA, PG	PCBs	09/19/2017	2010	g/yr	N/A	0.0%	-	-	-	-	-	-	-	-
Patuxent River Tidal Fresh	02131102-PAXTF	AA, FR, HO, MO, PG	PCBs	09/19/2017	2010	g/yr	5.10	99.9%	5.09	0.14	2.7%	0.20	3.9%	5.09	100.0%	2050
Potomac River Lower Tidal	02140101	CH	PCBs	10/31/2007	2005	g/yr	N/A	5.0%	-	-	-	-	-	-	-	-
Potomac River Middle Tidal	02140102	CH, PG	PCBs	10/31/2007	2005	g/yr	N/A	5.0%	-	-	-	-	-	-	-	-
Potomac River Upper Tidal	02140201	CH, PG	PCBs	10/31/2007	2005	g/yr	1.24	92.1%	1.14	0.06	5.0%	0.06	5.4%	1.14	100.0%	2050
Severn River Mesohaline	MD-SEVMH-02131002	AA	PCBs	07/19/2016	2010	g/yr	N/A	0.0%	-	-	-	-	-	-	-	-
South River Mesohaline	MD-SOUMH-02131003	AA	PCBs	04/27/2015	2010	g/yr	N/A	0.0%	-	-	-	-	-	-	-	-
West and Rhode Rivers Mesohaline	MD-WST-RHDMH-02131004	AA	PCBs	01/08/2016	2010	g/yr	N/A	0.0%	-	-	-	-	-	-	-	-

Note: MDOT SHA does not have a PCB WLA reduction responsibility for the following watersheds presented in this table: Gunpowder River, Magothy River Mesohaline, Patuxent River Mesohaline, Patuxent River Oligohaline, Potomac River Lower Tidal, Potomac River Middle Tidal, Potomac River Upper Tidal-Prince George's County portion, Severn River Mesohaline, South River Mesohaline and West and Rhode Rivers Mesohaline. **Table 1-1** indicates that these watersheds list MDOT SHA for PCB responsibility and the reasons there are no reduction requirements for MDOT SHA are mentioned in **Section E.3.**

Table 3-2: MDOT SHA Nutrient, Sediment, PCB and Trash Modeling Results

Watershed Name	Watershed Number	County	Pollutant	EPA Approval Date	Baseline Year	Unit	MDOT SHA Baseline Load	MDOT SHA % Reduction Target	MDOT SHA Reduction Target	2020 Interim Reduction Target	% 2020 Reduction Relative to Reduction Target	2025 Interim Reduction Target	% 2025 Reduction Relative to Reduction Target	Projected Reduction to be Achieved by Target Year	% Reduction to be Achieved Relative to Reduction Target	Target Year
Trash TMDLs																
Anacostia	02140205	MO	Trash	09/21/2010	2009	lbs/yr	N/A	100%	6,044	3,273	54.2%	4,764	78.8%	6,044	100.0%	2035
		PG					N/A	100%	14,134	5,604	39.6%	10,344	73.2%	14,134	100.0%	2035
Patapsco - Gwynns Falls	MD-PATMH-0213095	BA	Trash & Debris	01/05/2015	2011	lbs/yr	N/A	100%	2,415	2,415	100.0%	2,415	100.0%	2,415	100.0%	2025
Patapsco - Jones Falls	MD-PATMH-02130904	BA	Trash & Debris	01/05/2015	2011	lbs/yr	N/A	100%	1,490	1,490	100.0%	1,490	100.0%	1,490	100.0%	2025
Bacteria TMDLs																
Baltimore Harbor - Furnace Creek	MD-PATMH FURNACE _ CREEK	AA	Enterrococci	03/10/2011	2006	billion counts / day	34,094	77.8%	26,525	1,300	4.9%	1,300	4.9%	26,525	100.0%	2050
Baltimore Harbor - Marley Creek	MD-PATMH-MARLEY_ CREEK	AA	Enterrococci	03/10/2011	2006	billion counts /day	20,684	75.8%	15,678	3,050	19.5%	3,050	19.5%	15,678	100.0%	2050
Loch Raven Reservoir	02130805	BA, CL, HA	E. coli	12/03/2009	2004	billion MPN /yr	113,344	87.6%	99,289	1,818	1.8%	1,818	1.8%	99,289	100.0%	2050
Patapsco River LN Branch	02130906	AA, BA, CL, HO	E. coli	12/03/2009	2003	billion MPN /yr	231,593	14.8%	34,276	1,829	5.3%	1,829	5.3%	34,276	100.0%	2050

Table 3-2: MDOT SHA Nutrient, Sediment, PCB and Trash Modeling Results

Watershed Name	Watershed Number	County	Pollutant	EPA Approval Date	Baseline Year	Unit	MDOT SHA Baseline Load	MDOT SHA % Reduction Target	MDOT SHA Reduction Target	2020 Interim Reduction Target	% 2020 Reduction Relative to Reduction Target	2025 Interim Reduction Target	% 2025 Reduction Relative to Reduction Target	Projected Reduction to be Achieved by Target Year	% Reduction to be Achieved Relative to Reduction Target	Target Year
Patuxent	02131104	AA, PG	E. coli	08/09/2011	2009	billion MPN /yr	26,200	45.3%	11,869	45	0.4%	45	0.4%	11,869	100.0%	2050

E.2. Nutrient and Sediment Implementation Plan

E.2.a. Nutrient and Sediment TMDLs with MDOT SHA Responsibility

There are 26 EPA approved phosphorus or sediment TMDLs with MDOT SHA responsibility spanning 20 Maryland 8-digit watersheds The following TMDL documents for phosphorus and sediment are addressed in this plan:

- *Total Maximum Daily Load of Phosphorus in the Antietam Creek Watershed, Washington County, Maryland*, approved by EPA September 25, 2013;
- *Total Maximum Daily Load of Phosphorus in the Catoctin Creek Watershed, Frederick County, Maryland*, approved by EPA September 24, 2013;
- *Total Maximum Daily Load of Phosphorus in the Double Pipe Creek Watershed, Frederick and Carroll Counties, Maryland*, approved by EPA April 26, 2013;
- *Total Maximum Daily Loads of Phosphorus and Sediments for Liberty Reservoir, Baltimore and Carroll Counties, Maryland*, approved by EPA May 7, 2014;
- *Total Maximum Daily Load of Phosphorus in the Lower Monocacy River Watershed, Frederick, Carroll and Montgomery Counties, Maryland*, approved by EPA May 22, 2013;
- *Total Maximum Daily Load of Phosphorus in the Upper Monocacy River Watershed, Frederick and Carroll Counties, Maryland*, approved by EPA May 7, 2013;
- *Total Maximum Daily Load of Phosphorus in the Rock Creek Watershed, Montgomery County, Maryland,* approved by EPA September 26, 2013;
- *Total Maximum Daily Load of Sediment in the Antietam Creek Watershed, Washington County, Maryland*, approved by EPA December 18, 2008;
- *Total Maximum Daily Load of Sediment in the Bynum Run Watershed, Harford County, Maryland*, approved by EPA September 30, 2011;

- *Total Maximum Daily Load of Sediment in the Cabin John Creek Watershed, Montgomery County, Maryland*, approved September 30, 2011;
- *Total Maximum Daily Load of Sediment in the Catoctin Creek Watershed, Frederick County, Maryland*, approved by EPA July 31, 2009;
- *Total Maximum Daily Load of Sediment in the Conococheague Creek Watershed, Washington County, Maryland*, approved by EPA November 24, 2008;
- *Total Maximum Daily Load of Sediment in the Double Pipe Creek Watershed, Frederick and Carroll Counties, Maryland*, approved by EPA February 20, 2009;
- *Total Maximum Daily Load of Sediment in the Gwynns Falls Watershed, Baltimore City and Baltimore County, Maryland*, approved by EPA March 10, 2010 and revised August 31, 2015;
- *Total Maximum Daily Load of Sediment in the Jones Falls Watershed, Baltimore City and Baltimore County, Maryland*, approved September 29, 2011;
- *Total Maximum Daily Load of Sediment in the Little Patuxent River Watershed, Howard and Anne Arundel Counties, Maryland*, September 30, 2011;
- *Total Maximum Daily Load of Sediment in the Lower Gunpowder Falls Watershed, Baltimore County, Maryland,* approved by EPA May 4, 2017;
- *Total Maximum Daily Load of Sediment in the Lower Monocacy River Watershed, Frederick, Carroll, and Montgomery Counties, Maryland*, approved by EPA March 17, 2009;
- *Total Maximum Daily Load of Sediment in the Patapsco River Lower North Branch Watershed, Baltimore City and Baltimore, Carroll, Howard, and Anne Arundel Counties, Maryland*, approved by EPA September 30, 2011;
- *Total Maximum Daily Load of Sediment in the Patuxent River Upper Watershed, Howard, Anne Arundel, and Prince George's Counties, Maryland*, approved by EPA September 30, 2011;
- *Total Maximum Daily Load of Sediment in the Potomac River Montgomery County Watershed, Montgomery and Frederick Counties, Maryland*, approved by EPA June 19, 2012;
- *Total Maximum Daily Load of Sediment in the Rock Creek Watershed, Montgomery County, Maryland*, approved by EPA September 29, 2011;
- *Total Maximum Daily Load of Sediment in the Seneca Creek Watershed, Montgomery County, Maryland*, approved by September 30, 2011;
- *Total Maximum Daily Load of Sediment in the Non-tidal South River Watershed, Anne Arundel County, Maryland,* approved by EPA September 28, 2017;
- *Total Maximum Daily Load of Sediment in the Swan Creek Watershed, Harford County, Maryland,* approved September 30, 2016; and
- *Total Maximum Daily Load of Sediment in the Upper Monocacy River Watershed, Frederick and Carroll Counties, Maryland*, approved December 3, 2009.

Table 3-2 shows a summary of the reduction requirements and projected reduction benchmarks by target years for the current MDOT SHA nutrient and sediment TMDLs. Refer to the *MDOT SHA Restoration Modeling Protocol* (MDOT SHA, 2018) for modeling methods, **Figure 3-7A** for watersheds with phosphorus TMDLs, **Figure 3-7B** for watersheds with sediment TMDLs, and **Part IV** for detailed watershed level implementation plans.

E.2.b. Nutrient and Sediment Sources

Discussions in the TMDLs concerning nutrient and sediment sources focus on types of land use with information derived from the Chesapeake Bay Program Watershed Model (CBP WM). Cropland and regulated urban land tend to be the most significant sources, followed by other agricultural uses and wastewater sources. MDOT SHA researched a number of other references and determined sources beyond land uses that are summarized in **Table 3-3**. Sources of phosphorus are manure, fertilizers used for crops, residential lawn care, and wastewater discharges. Sources of sediment include surface erosion from construction sites and cropland as well as stream erosion.

Table 3-3: Nutrient and Sediment Sources from Various References

Land Use	Nutrient Sources	Sediment Sources
Agriculture	Chemical Fertilizer Manure	Soil Erosion
Urban	Pet Waste Lawn Fertilizer Parking Lot, Roof, and Street Runoff	Construction Erosion Parking Lot, Roof, and Street Runoff
Wastewater	Municipal Industrial Failed Septic Systems Combined Sewer Overflow (CSO) / Sanitary Sewer Overflow (SSO) Leaking Sewers	
Natural	Atmospheric Deposition	Stream Erosion Shoreline Erosion
References used to develop the table are MDE, 2014c; EPA, 2010; Hoos et al., 2000; and Schueler, 2011.		

MDOT SHA Loading Sources

SHA-owned land is a small portion of each of the TMDL watersheds and it consists of relatively uniform land uses including roadways and roadside vegetation. In urbanized areas, the MDOT SHA ROW may extend to include sidewalks and portions of driveways. There are also parking areas associated with MDOT SHA land such as park and ride facilities, office complexes, and maintenance facilities.

Of the land uses in **Table 3-3**, MDOT SHA is a contributor of nutrients and sediments mostly through urban and natural sources. MDOT SHA has no responsibility for agriculture sources.

E.2.c. MDOT SHA Nutrient and Sediment Reduction Strategies

To date, MDOT SHA has used a variety of structural, non-structural, and alternative BMPs to reduce nutrient and sediment in the watersheds that have a corresponding TMDL. However, we have not limited our load reduction activities to just BMP implementation. The use of nutrient credit trading will also be explored as a tool in reaching load reduction targets. When MDOT SHA partners on projects with other MS4 jurisdictions, load splitting can also be used to achieve WLA reductions.

BMP Implementation

In conjunction with restoration efforts for 20 percent of currently untreated impervious surface area, MDOT SHA intends to build or implement BMPs used for impervious restoration in watersheds that also have a local TMDL where possible. Watershed-level pollutant load reductions are modeled from implementation of currently constructed BMPs and BMPs planned for future implementation. The results of this analysis are presented in **Table 3-2** and a chart of the different types of practices used to achieve the results are shown in **Figures 3-8** and **3-9** on the following pages. Proposed practices to be implemented for each watershed are shown in **Part IV, MDOT SHA Watershed TMDL**

Implementation Plan under the specific watersheds with phosphorus and sediment WLAs.

A significant challenge encountered with building BMPs is that there can be a lack of available ROW for BMP placement opportunities. There are instances where MDOT SHA roadway encompasses most of the area in the ROW leaving very little land to construct BMPs. The visual watershed inspection process has indicated areas where BMP placement is possible and where it is not feasible do to utility relocation, conflicts with other MDOT SHA projects, site access problems, and a host of other issues. Therefore, MDOT SHA is continually seeking new opportunities and partnerships to install BMPs.

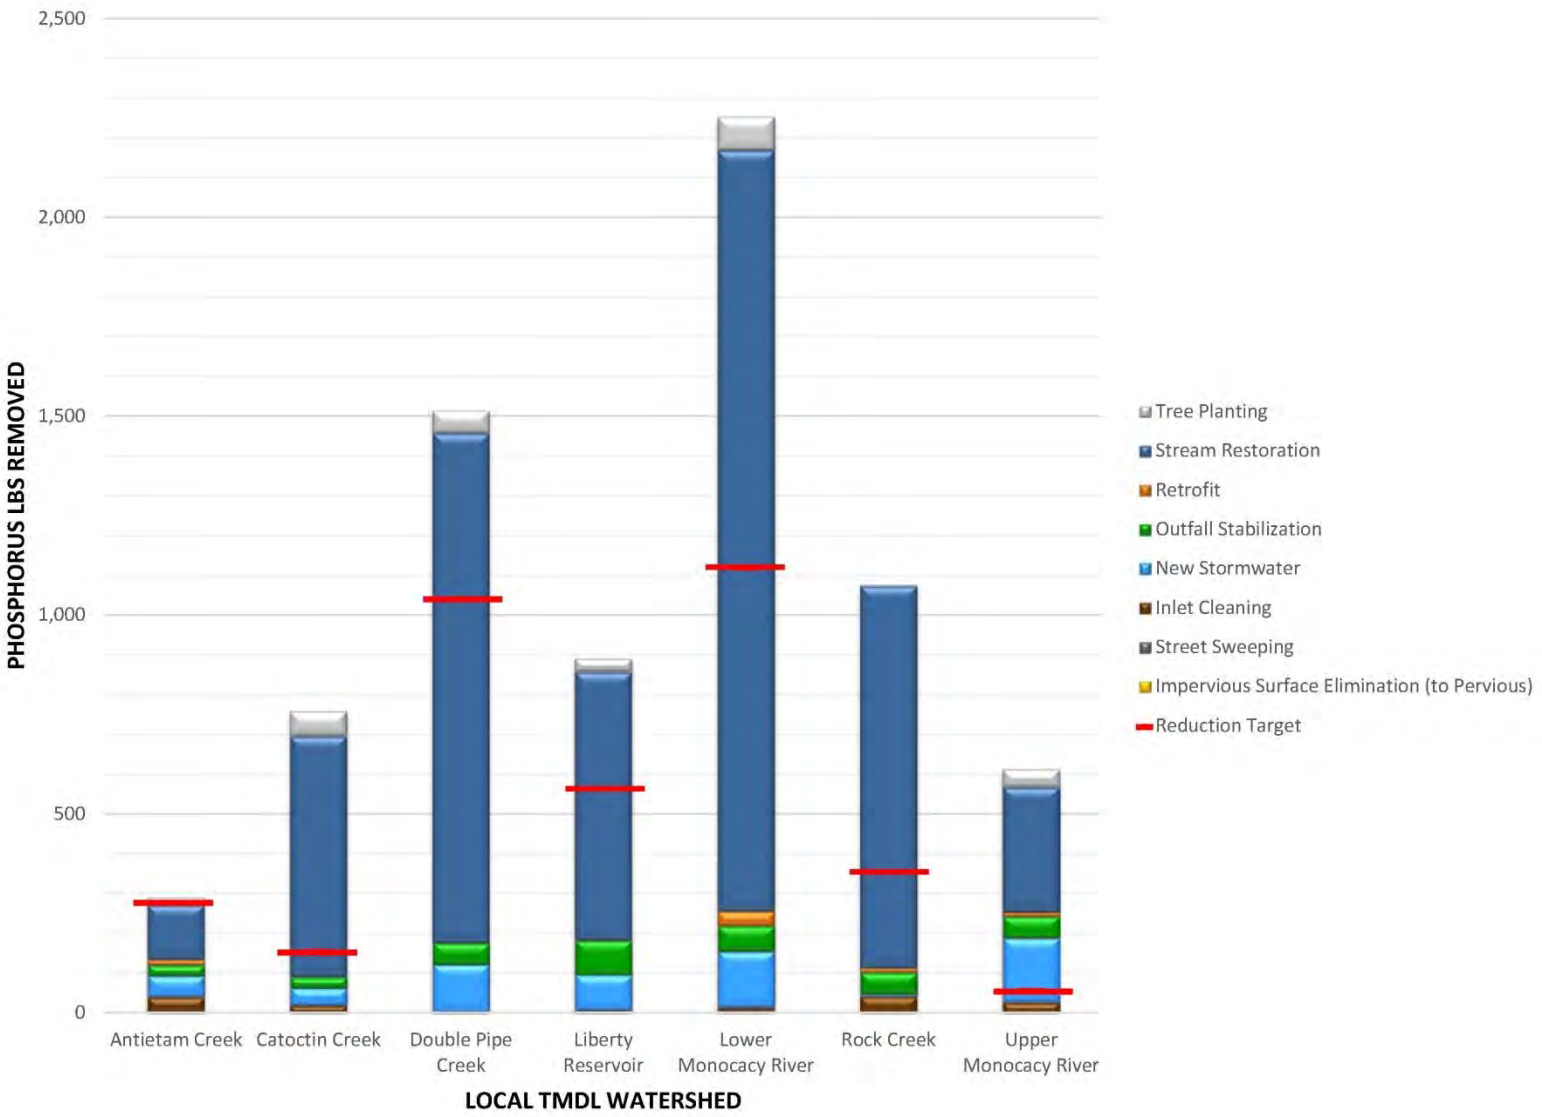


Figure 3-8: Phosphorus WLA Reductions by Watershed with BMP Menu

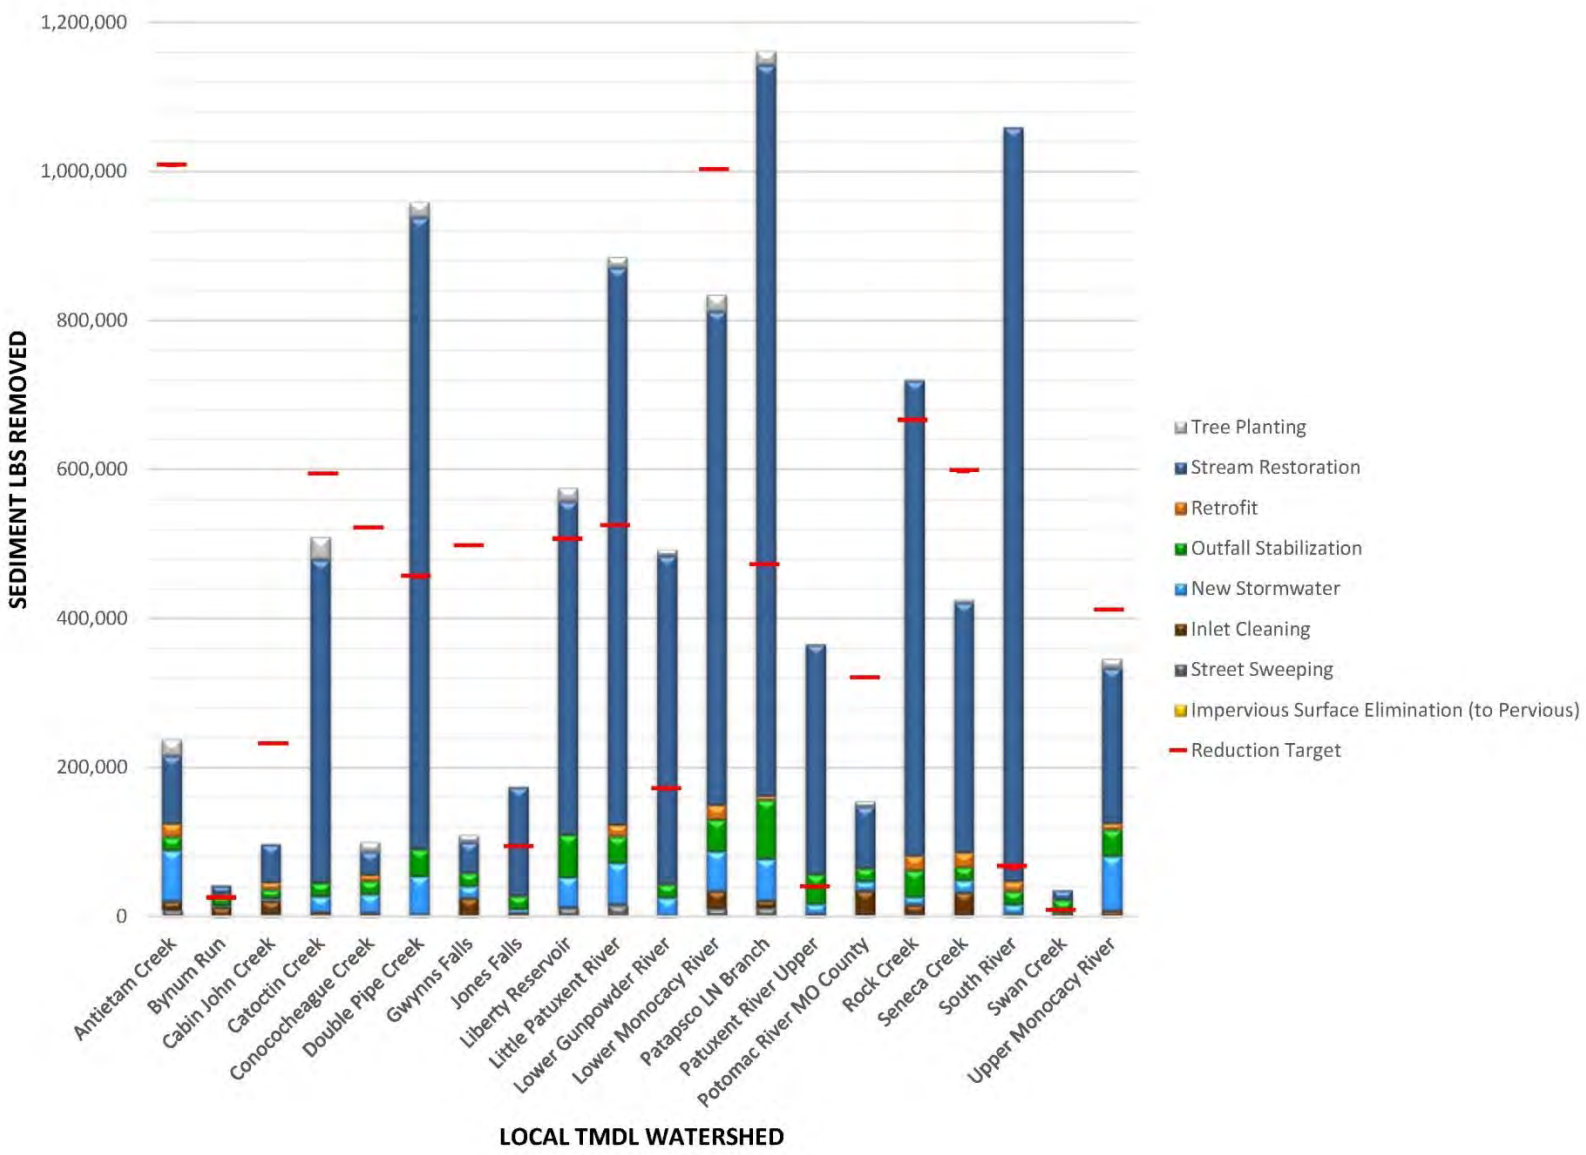


Figure 3-9: Sediment WLA Reductions by Watershed with BMP Menu

Nutrient Credit Trading

MDOT SHA will explore nutrient credit trading when MDE implements a trading policy and modifies the current permit to allow trading. It is anticipated that MS4 jurisdictions will have the ability to purchase phosphorus, nitrogen, sediment, and impervious treatment credits in quantities to fill gaps in current implementation plans. Once the trading regulations and guidance are finalized and approved by EPA, MDOT SHA may to utilize this program to meet TMDL pollutant reduction requirements.

Credit Splitting

MDOT SHA is partnering with other MS4 permittees and government agencies to implement projects that will reduce nutrients and sediments. The goal is to produce projects that will have a mutual benefit to the watershed and both parties in meeting load reduction requirements. Parameters concerning splitting of reductions achieved will be documented through project specific agreements.

TMDL End Dates and Adaptive Management

Currently, when modeling projected reductions for setting interim and final target dates, MDOT SHA only considers potential restoration practices that have some level of certainly based on site search and evaluation processes in place. Also, our modeling only looks forward to 2025 and not beyond. Predictions have been used based on historic data indicating the percent of BMPs removed from projects as project specific constrains are encountered (such as bedrock or property owners deciding not to sell) as they move from site search to construction.

Although MDOT SHA is committed to meeting the WLAs by the listed target years, our current modeling only looks forward to 2025, which may not achieve 100 percent of all required reductions. For some watersheds, 100 percent or greater of the target reduction goal has already been achieved or is anticipated to be achieved for the 2025 milestone. For other watersheds, the 2025 reduction achieved is less than 100 percent. MDOT SHA will work to increase expected reductions and will explore other possibilities such as of nutrient credit trading, partnering with load and credit splitting, or currently unknown alternative methods which cannot be modeled at this time.

E.3. Polychlorinated Biphenyls (PCBs) Implementation Plan

E.3.a. PCB TMDLs Affecting MDOT SHA

There are 12 EPA approved polychlorinated biphenyls (PCBs) TMDLs with MDOT SHA responsibility spanning 21 Maryland 8-digit watersheds**.** The following TMDL documents for PCBs are addressed with this plan:

- *Total Maximum Daily Loads of Polychlorinated Biphenyls for Tidal Portions of the Potomac and Anacostia Rivers in the District of Columbia, Maryland, and Virginia*, approved by EPA October 31, 2007;
- *Total Maximum Daily Loads of Polychlorinated Biphenyls in the Northeast and Northwest Branches of the Nontidal Anacostia River, Montgomery and Prince George's County, Maryland*, approved by EPA September 30, 2011;
- *Total Maximum Daily Load of Polychlorinated Biphenyls in the Back River Oligohaline Tidal Chesapeake Bay Segment, Maryland*, Baltimore City and Baltimore County, Maryland, approved by EPA October 1, 2012;
- *Total Maximum Daily Loads of Polychlorinated Biphenyls in the Baltimore Harbor, Curtis Creek/Bay, and Bear Creek Portions of the Patapsco River Mesohaline Tidal Chesapeake Bay Segment, Maryland,* Baltimore City, Anne Arundel County, and Baltimore County, Maryland, approved by EPA October 1, 2012;
- *Total Maximum Daily Load of Polychlorinated Biphenyls in the Bush River Oligohaline Segment, Harford County, Maryland, approved by EPA August 2, 2016;*
- Total Maximum Daily Load of Polychlorinated Biphenyls in the Gunpowder River and Bird River Subsegments of the Gunpowder River Oligohaline Segment, Baltimore County and Harford County, Maryland, approved by EPA October 3, 2016;
- *Total Maximum Daily Load of Polychlorinated Biphenyls in Lake Roland of Jones Falls Watershed in Baltimore County and Baltimore City, Maryland*, approved by EPA June 30, 2014;
- *Total Maximum Daily Load of Polychlorinated Biphenyls in the Magothy River Mesohaline Chesapeake Bay Tidal Segment, Anne Arundel County, Maryland*, approved by EPA March 16, 2015.;
- *Total Maximum Daily Load of Polychlorinated Biphenyls in the Patuxent River Mesohaline, Oligohaline and Tidal Fresh Chesapeake Bay Segments,* Anne Arundel, Calvert, Charles, Frederick, Howard, Montgomery, Prince George's, and St. Mary's Counties, Maryland, approved by EPA September 19, 2017;
- *Total Maximum Daily Load of Polychlorinated Biphenyls in the Severn River, Mesohaline Chesapeake Bay Tidal Segment, Anne Arundel County, Maryland, approved by EPA July 19, 2016;*
- *Total Maximum Daily Load of Polychlorinated Biphenyls in the South River Mesohaline Chesapeake Bay Segment, Anne Arundel County, Maryland, approved by EPA April 27, 2015; and*
- *Total Maximum Daily Load of Polychlorinated Biphenyls in the West River and Rhode River, Mesohaline Segments, Anne Arundel County, Maryland, approved by EPA January 8, 2016.*

Table 3-2 shows a summary of the reduction requirements and projected reduction benchmarks by target year for the current MDOT SHA PCB TMDLs. Refer to the *MDOT SHA Restoration Modeling Protocol* (MDOT SHA, 2018) for modeling methods, **Figure 3-7C** for

watersheds with PCB TMDLs, and **Part IV** for detailed watershed level implementation plans.

E.3.b. PCB Sources

The objective to establish a TMDL for PCBs is to ensure that the designated use is protected in each of the impaired waterbodies. Monitoring to identify the impairment may have been performed in the water column, in sediments, or in fish tissue depending on whether the impairment was for water contact recreation or fish consumption.

PCBs do not occur naturally in the environment. Therefore, unless existing or historical anthropogenic sources are present, their natural background levels are expected to be zero. Although PCBs are no longer manufactured in the United States, they are still being released to the environment via accidental fires, leaks, or spills from PCB-containing equipment; potential leaks from hazardous waste sites that contain PCBs; illegal or improper dumping; and disposal of PCB-containing products into landfills not designed to handle hazardous waste. Once in the environment, PCBs do not readily break down and tend to cycle between various environmental media such as air, water, and soil.

Sources are not identified in detail, either by land use or other breakdowns. Two non-point sources are related to the waterbody itself: resuspension and diffusion from bottom sediments and tidal exchange with the Bay. Bottom sediments were not considered a source in any of the TMDLs, since the PCBs stayed within the waterbody. The Bay tidal influence can be either a source or sink. For the Magothy, Severn, South, West and Rhodes River TMDLs, the Bay tidal influence is the single major source of PCBs. Back River, on the other hand, exports more PCBs to the Bay than it receives.

There are three diffuse watershed sources including atmospheric deposition, non-regulated watershed runoff, and NPDES regulated stormwater. Also, there are four discrete sources: contaminated sites, WWTP facilities, industrial process water, and Dredged Material Containment Facilities (DMCF), which are described by name in the TMDL. **Table 3-4** shows which sources are described in the thirteen watersheds.

For PCBs, studies have shown the largest sources impacting stormwater are building demolition, building remodeling, and old industrial areas. The main pathways are runoff, wheel and foot tracking, and dust dispersion from industrial areas (San Francisco Estuary Institute [SFEI], 2010).

Table 3-4: PCB Sources in Each TMDL

Source	Contaminant	TMDL Watershed												
		Baltimore Harbor	Back River	Bird River	Bush River	Gunpowder River	Tidal Potomac/ Anacostia River	Non-Tidal Anacostia River	Lake Roland	Magothy River	Patuxent River Segments	Severn River	South River	West & Rhodes River
Non-Point Sources	Bottom Sediments					✓								
	Chesapeake Bay Mainstem Tidal Influence			✓	✓	✓				✓	✓	✓	✓	✓
	Atmospheric Deposition	✓	✓	✓	✓	✓	✓		✓	✓	✓	✓	✓	✓
	Non-regulated Watershed Runoff	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
	Contaminated Sites	✓	✓		✓		✓	✓	✓	✓	✓			
Point Sources	Municipal WWTP and CSO	✓	✓		✓		✓	✓	✓		✓	✓	✓	✓
	Industrial Process Water	✓			✓	✓					✓			
	DMCF	✓												
	NPDES Regulated Stormwater	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓

Significance for SHA

Two of the controllable sources in **Table 3-4** that warrant further investigation relative to MDOT SHA are NPDES-regulated stormwater and contaminated sites. MDOT SHA roadways pass through or near facilities, campuses, or industries that may contribute PCBs to the environment and may as a result, convey PCBs in stormwater runoff from these adjacent areas. Also, MDOT SHA roadways themselves may be sources contributing to contaminated runoff.

The MDOT SHA Environmental Compliance Division (ECD) has conducted inspections on our industrial sites and other maintenance or storage facilities and has not discovered any legacy contaminated sites. Although a comprehensive investigation of MDOT SHA ROW may not be feasible, innovative ways to discover sources within MDOT SHA ROW and other adjacent land uses can be investigated as well.

E.3.c. Proposed No-Action for Certain Watersheds

MDOT SHA is proposing no action for PCBs in several impaired watersheds for the following reasons:

- Tidal influence is largely the source of PCBs,
- Reduction percentage falls within the MOS, and
- Zero percent reduction assigned to regulated stormwater by MDE.

Tidal Influence

In several TMDLs for PCB, MDE modeling demonstrates that tidal influence from the Chesapeake Bay to tidal tributaries contributes most PCB pollution to the waterway. Because loads from resuspension and diffusion from bottom sediments are not considered to be directly controllable loads, see **Table 3-4,** they are not included in the total Polychlorinated Biphenyl (tPCB) baseline load and TMDL allocations. Furthermore, MDE determined that attenuation within the Bay was predictable within specific timeframes and reducing watershed loads by 100 percent would not appreciably change this timeframe. For these reasons, in the following TMDLs MDE assigned a zero percent load reduction to the regulated stormwater sources.

In the Magothy River TMDL (MDE, 2015a), modeling shows that tidal flows from the Chesapeake Bay mainstem to the river were the source of 98.7 percent of PCBs and regulated stormwater was less than 0.2 percent. Modeling predicted attenuation in the Bay within 43.4 years.

In the South River TMDL (MDE, 2015b), tidal influence was the source of 97.8 percent of PCBs and regulated stormwater was less than 0.2 percent. Modeling predicted attenuation of PCBs in the Bay within 12.3 years.

In the Severn River TMDL (MDE, 2016a), tidal influence was the source of 98.2 percent of PCBs and regulated stormwater was less than 0.4 percent. Modeling predicted attenuation of PCBs in the Bay within 46.2 years.

In the West and Rhode Rivers TMDL (MDE, 2016b), modeling shows that tidal influence was the source of 96.8 percent of PCBs and regulated stormwater was less than 0.2 percent. Modeling predicted attenuation in the Bay within 16.8 years.

Reduction within MOS

In the Potomac and Anacostia River TMDL (Haywood & Buchanan, 2007), the Potomac River Lower Tidal, Middle Tidal, and the Charles County portion of Potomac River Upper Tidal watersheds have a reduction requirement of 5 percent, which is entirely due to the MOS. Without the MOS, no additional reduction is required. The reduction attributed to the MOS is expected to be treated through a 93 percent reduction in atmospheric deposition.

Zero Reduction Assigned

In the Gunpowder River and Bird River TMDL (MDE, 2016c), there are separate reduction requirements for the two subsegments that contribute to this TMDL. MDOT SHA has a zero percent reduction target for the Gunpowder River segment.

Similarly, MDE has provided separate reduction requirements for the three segmentsheds, within the Patuxent River TMDL (MDE, 2017a). These segmentsheds are the PAXMH, PAXOH, and PAXTF. For the PAXMH and the PAXOH segmentsheds there are zero percent reductions.

E.3.d. PCB Reduction Strategies

MDOT SHA will implement an adaptive management process that relies on four main PCB reducing efforts:

- Track PCB reductions achieved from ongoing impervious restoration efforts implemented under the MDOT SHA MS4 permit,
- Continue to monitor the development and implementation of new technologies that are shown to reduce PCB concentrations through dichlorination or other methods,

- Continue to develop methods to identify sources or contaminated sites either on MDOT SHA ROW or directly affecting MDOT SHA stormwater runoff and work with appropriate State or federal agencies to eliminate sources, and
- Initiate partnering efforts to reduce PCB concentrations in local watersheds with other jurisdictions where it is perceived to be mutually beneficial for both parties.

Stormwater BMP Reduction Modeling

BMPs used to reduce sediment will provide a secondary benefit in removing PCBs associated with sediments. Modeling results in **Table 3-2** show that minimal reductions are achieved through stormwater BMP implementation alone and there is a need to supplement SW control structures with other strategies to achieve PCB reductions.

Development and Implementation of PCB-Reducing Technologies

The MDOT SHA is reviewing current research on bioremediation of PCBs using biofilms, plants, and other mechanisms. It is understood that there are bacteria in the natural environment that are capable of aerobic dichlorination and anaerobic degradation of PCB congeners. Other technologies such as activated charcoal may also be promising for future implementation. MDOT SHA will continue to explore the possibility of using these new technologies and will implement pilot programs when deemed appropriate.

Source Identification

Methods to improve both the identification of PCBs in MDOT SHA roadway stormwater runoff and sources will be pursued. This can include research coupled with practical applications.

Partnering

When appropriate, MDOT SHA will initiate partnering with other local jurisdictions or agencies to work cooperatively towards PCB reduction targets.

E.4. Trash Implementation Plan

E.4.a. Trash TMDLs Affecting MDOT SHA

There are two EPA approved trash TMDLs with MDOT SHA responsibility spanning three Maryland 8-digit watersheds. The following TMDL documents for trash are addressed with this plan:

- *Total Maximum Daily Loads of Trash for the Anacostia River Watershed, Montgomery and Prince George's Counties, Maryland and the District of Columbia*, approved by EPA September 21, 2010; and

- *Total Maximum Daily Loads of Trash and Debris for the Middle Branch and Northwest Branch Portions of the Patapsco River Mesohaline (PATMH) Tidal Chesapeake Bay Segment, Baltimore City and County, Maryland*, approved by EPA January 5, 2015.

Table 3-2 shows a summary of the reduction requirements and projected reduction benchmarks by target year for the current MDOT SHA trash TMDLs. Refer to the *MDOT SHA Restoration Modeling Protocol* (MDOT SHA, 2018) for modeling methods, **Figure 3-7E** for watersheds with trash TMDLs, and **Part IV** for detailed watershed level implementation plans.

These trash TMDLs (MDE, 2010a; MDE, 2015c) are not written as traditional TMDLs. They are expressed in terms of a quantity to be removed, rather than in terms of the maximum allowable pollutant input. See **Figure 3-10** for an illustration of the trash TMDL concept. Because they are focused on a load to be removed, the term 'baseline' represents the desired level of trash removal and the trash TMDL endpoint is 100 percent removal of the baseline load. A TMDL target equal to 100 percent removal of the baseline load is not the same as zero trash in the watershed, but that the assigned baseline loads are to be removed in their entirety each year.

The reduction goal for MDOT SHA compliance with the TMDLs are listed in **Tables 3-5 and 3-6**.

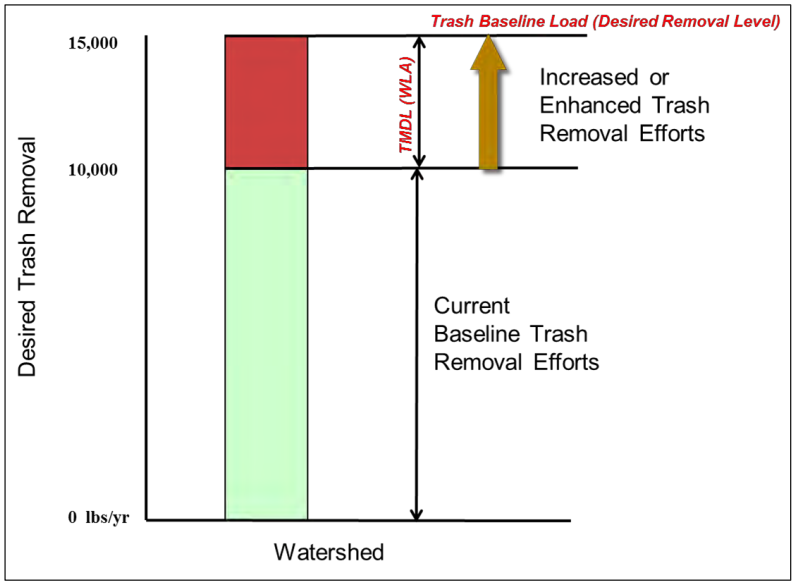


Figure 3-10: Trash TMDL Baseline and WLAs

Table 3-5: Summary of Anacostia River Watershed Baseline Loads and TMDL for MDOT SHA			
Watershed	**Annual WLA**	**5% MOS**	**Annual TMDL** (WLA + 5% MOS)
	Lbs/Year	**Lbs/Yr**	**Lbs/Yr Removed**
Anacostia River (MO County)	5,756	287.8	6,044
Anacostia River (PG County)	13,461	673.05	14,134
Totals	**19,217**	**960.85**	**20,178**

Table 3-6: Summary of PATMH Tidal Bay Segment Baseline Loads and TMDL for MDOT SHA			
Watershed	**Annual WLA**	**5% MOS**	**Annual TMDL** (WLA + 5% MOS)
	Lbs/Year	**Lbs/Yr**	**Lbs/Yr Removed**
Gwynns Falls (BA County)	2,300	115	2,415
Jones Falls (BA County)	1,419	70.9	1,490
Totals	**3,718.7**	**185.9**	**3,905**

E.4.b. Trash Sources and Loading Rates

Sources

The baseline year for this TMDL Implementation Plan is 2010. MDOT SHA has determined this baseline year because the PATMH study was performed in 2010 and 2011, and TMDL loading rates were determined using 2010 land use data. Additionally, the Anacostia River Watershed Trash TMDL was approved in 2010.

Baseline loads and subsequent TMDL allocations are split between point and non-point sources:

- Wasteload Allocation (WLA) addressing point source trash items that can enter the storm sewer system; and
- Load Allocation (LA) assigned to nonpoint source larger trash and debris, usually associated with dumping activities.

WLAs have been assigned to MDOT SHA for trash in these watersheds, although MDOT SHA can demonstrate removal of trash such as dumping, that qualifies as LA removal, it is not credited as WLA load removal.

Loading Rates

Loading rates for different land uses are assigned in the TMDL documents and for MDOT SHA they are 2.22 lbs/ac/yr (Anacostia) and 2.06 lbs/ac/yr (PATMH). Different sampling methodologies were used to determine the baseline trash loading rates for each of the trash TMDLs:

- The Anacostia River TMDL sampling methodology is based on stormwater outfall sampling – storm drain data were collected

downstream of outfalls through the use of either trash fencing or trash nets.

- The PATMH sampling methodology is based on sampling within SW control structures – trash was collected within the fenced boundary of the facilities.

Any upstream practices that were already in place during the trash monitoring studies are inherently captured in these baseline rates. The differing sampling methodologies listed above have implications as to which MDOT SHA trash removal processes were captured in the measured baseline rates. Because the Anacostia sampling was performed downstream of outfalls, all upstream practices including SW control structures are included in the baseline. Alternatively, since the PATMH sampling was performed within SW control structures, trash reductions they provided were not included in the baseline. Therefore, MDOT SHA includes any SW control structures whether built prior to and after 2010 as program enhancements for the PATMH TMDL reductions, but only includes SW control structures built after 2010 for the Anacostia TMDL reductions.

E.4.c. Baseline Trash Reduction

Part I.F.7 lists and describes BMPs used for pollutant source control and includes descriptions of the current MDOT SHA 'litter reduction, collection, and disposal' efforts including maintenance crew clean-ups, contracted crew clean-ups, AAH, and SAH. These current programs cover the Jones Falls, Gwynns Falls, and Anacostia River watersheds and were in existence prior to 2010. Because these practices were in existence prior to 2010, they are inherently captured in the 2010 baseline rates for each trash TMDL. **Tables 3-7 and 3-8** list BMPs that are considered baseline alongside BMPs that will be quantified as enhancements.

Since no significant changes or enhancements have occurred to these programs since 2010, these roadside clean-up activities are not included in modeling for the WLA reduction and attempts to quantify them relative to 2010 have been abandoned.

E.4.d. Enhanced Trash Reduction

Demonstrating and quantifying trash reduction enhancements is key to meeting the WLAs. Certain existing programs have been enhanced since 2010 and other new programs are under development and when in place will be quantified as reduction credit for future interim benchmarks to meet the WLAs. These are listed in **Tables 3-7 and 3-8** and discussed below. See **Table 3-2** for proposed reductions and benchmark timeframes for each watershed and **Part IV** for individual plans that provide lists of trash removal activities to address the WLAs in each watershed. Refer to the *MDOT SHA Restoration Modeling Protocol* (MDOT SHA, 2018) for reduction computational methods.

Table 3-7: Anacostia River Baseline / Enhanced / Initiated Practices

Practice or Activity	Baseline	Enhanced after 2010	Initiated after 2010
Roadside Cleanups	X		
Inlet Cleaning	X	X	
Street Sweeping	X	X	
Stormwater Management Facilities	X		X
Media Relations (Use of Free Media)		X	
Outreach Programs			X
Stream Clean-ups			X

Table 3-8: PATMH Baseline / Enhanced / Initiated Practices			
Practice or Activity	**Baseline**	**Enhanced after 2010**	**Initiated after 2010**
Roadside Cleanups	X		
Inlet Cleaning	X	X	
Street Sweeping	X	X	
Stormwater Management Facilities	X		X
Media Relations (Use of Free Media)		X	

Inlet Cleaning

MDOT SHA routinely cleans storm drain inlets and catch basins to remove sediment, gross solids, litter, and debris that accumulate inside. Currently, MDOT SHA staff perform these activities in response to complaints, flooding, or as routine practice. Recently, MDOT SHA has focused on educating our operations forces concerning the value of cleaning the inlet boxes rather than just the surface debris on grates and developing improved data collection methods. This is the first level of enhancement our inlet cleaning program has undergone.

The second level of inlet cleaning enhancement involves using contracted crews to clean significantly increased numbers of inlets in targeted watersheds. Additional funds have been secured for the operations budget to support this work. It is anticipated that this enhancement will take effect in fiscal year 2019. The Anacostia, Jones Falls, and Gwynns Falls watersheds fall within this enhanced inlet cleaning area.

In conjunction with these enhancements a research study (MSU & CWP, 2018) was performed that characterized inlet material and determined that approximately 5 lbs. of trash is removed from an inlet based on a literature review of inlet debris characterization studies and reviewing and documenting MDOT SHA inlet cleaning operations.

Street Sweeping

The TMDL street sweeping program was created in fiscal year 2014 for the purpose of gaining impervious acre credits. MDOT SHA dedicated select urban routes throughout its MS4 area for bi-weekly sweeping. For this newly created program all the trash reduction associated with TMDL street sweeping will be counted towards the trash WLA.

Loading rates discussed in **Section E.4.b**, acres of annual bi-weekly swept roadways, and a 32 percent calculated effectiveness based on the San Francisco Bay trash TMDL technical report, *Trash Load Reduction Tracking Method* (Bay Area Stormwater Management Agencies Association [BASMAA], 2012), are used in determining reductions achieved.

Table 3-9: Summary of Trash Load Reduction Credits from BASMAA (2012)		
Alternative Practice	**Credit**	**Qualifiers**
Outreach to School-age Children or Youth	2%	Annual Reduction; Min. 8 events if >250,000 population
Media Relations (Use of free media)	1%	Annual Reduction
Community Outreach	2%	Annual Reduction; Min. 8 events if >250,000 population
Enhanced Street Sweeping	32%	Wet weather effectiveness based on >9 days between sweepings[2]; H-4.5/S
1. Source: *Trash Load Reduction Tracking Method* (BASMAA, 2012) 2. H = effectiveness, S = number of days between sweepings.		

Stormwater Management Facilities

MDE *Guidance for Developing Stormwater Wasteload Allocation Implementation Plans for Trash/Debris Total Maximum Daily Loads* lists structural stormwater controls as an allowable trash load reduction practice (MDE, 2014d). Regular maintenance, which includes trash collection, is performed on SW control structures.

Estimated reductions from SW control structures are calculated using the loading rates discussed in **Section E.4.b**, a 95 percent removal efficiency, as described in the Baltimore County Trash TMDL Implementation Plan (BA-EPS, 2016) and the Anacostia Watershed Implementation Plan (Biohabitats et al., 2012a), and drainage area land use acreages. SW control structures with trash collecting capabilities include:

- Bioretention
- Dry Extended Detention Pond
- Dry Pond
- ED Shallow Wetland
- Infiltration Basin
- Micro-Bioretention
- Micropool Extended Detention Pond
- Other Filtering
- Pond/Wetland System
- Shallow Marsh
- Submerged Gravel Wetland
- Wet Extended Detention Pond
- Wet Pond
- Wet Swale

Based on the methodology used in the PATMH trash TMDL, MDOT SHA can calculate reductions from SW control structures (pre- and post-baseline monitoring) and apply them towards the WLA reduction. The Anacostia River watershed trash TMDL does not allow MDOT SHA use SW control structures that were in place prior to the baseline year for reductions, but facilities constructed after the baseline year can provide trash reductions.

Media Relations (Use of Free Media)

The technical report cited in the Baltimore City trash implementation plan, *Trash Load Reduction Tracking Method* (BASMAA, 2012), provides methods to assign reduction efficiencies for several alternative practices including outreach, stream clean-up, and enhanced street sweeping as detailed in **Table 3-9**.

MDOT SHA has a robust media relations program. Besides continual contact with traditional media outlets (radio, TV/Cable) this program was recently enhanced to utilize multiple forms of social media. Additionally, the MDOT SHA 'We Live Here Too' campaign initiated in 2017 has brought attention to the problem of roadside litter and dumping.

Outreach

Outreach activities for both school aged/youth and communities will be pursued as needed to achieve trash load reductions. See Table 3-9 and the reverence technical report for details.

Stream Clean-ups

Described in **Part II.F.7**, stream cleanups include programmed cleanup activities as well as structural installations of trash traps at outfalls or in-stream. Implementation of these practices will provide a pound for pound reduction.

E.5. BACTERIA IMPLEMENTATION PLAN

E.5.a. Bacteria TMDLs Affecting MDOT SHA

There are four EPA approved bacteria TMDLs with MDOT SHA responsibility spanning five Maryland 8-Digit watersheds. The following TMDL documents for bacteria are addressed with this Plan:

- *Total Maximum Daily Loads of Bacteria for Impaired Recreational Areas in Marley Creek and Furnace Creek of Baltimore Harbor Basin in Anne Arundel County, Maryland*, approved by EPA March 10, 2011;
- *Total Maximum Daily Loads of Fecal Bacteria for Loch Raven Reservoir Watershed in Baltimore, Carroll and Harford Counties, Maryland*, approved by EPA December 3, 2009;
- *Total Maximum Daily Loads of Fecal Bacteria for Lower North Branch Patapsco River Watershed in Baltimore, Carroll, Anne Arundel, Howard Counties and Baltimore City, Maryland*, approved by EPA December 3, 2009; and
- *Total Maximum Daily Loads of Fecal Bacteria for the Patuxent River Upper Basin in Anne Arundel and Prince George's Counties, Maryland*, approved by EPA August 9, 2011.

Table 3-2 shows a summary of the reduction requirements and projected reduction benchmarks by target year for the current MDOT SHA bacteria TMDLs. Refer to the *MDOT SHA Restoration Modeling Protocol* (MDOT SHA, 2018) for modeling methods, **Figure 3-7E** for watersheds with bacteria TMDLs, and **Part IV** for detailed watershed level implementation plans.

E.5.b. Bacteria Sources

Fecal indicator bacteria (FIB) are used to identify the presence of fecal matter, which indicates potential presence of pathogens associated with fecal matter. FIBs are not pathogens. A pathogen is a bacterium, virus, or other microorganism that can cause disease. MDE identified the FIB for which MDOT SHA is responsible, including:

- *E. coli*, and
- *Enterococcus.*

For most of the bacteria TMDLs, MDE has included some type of Bacterial Source Tracking (BST), which is a method of estimating the source of the bacteria by matching DNA or RNA with a library of samples from known species. BST has been used to categorize the fraction of bacteria coming from four general sources:

- humans,
- domestic pets,
- wildlife, or
- livestock.

It is important to note that BST is performed on samples from the impaired water body, and thus the estimate of the fraction from each source is relative to the watershed, not from particular locations, jurisdictions, or permittees. The sources of bacteria in the four categories can be categorized in further detail, as shown in **Table 3-10**. These have been derived from MDE's stormwater WLA bacteria guidance (MDE, 2014e) and Watershed Protection Techniques Article 17 (Schueler, 2000), which describes the sources to be addressed for load reduction in an implementation plan.

Table: 3-10 Bacteria Sources

Sector	MS4 Point Source	Non-Point Source
Human	Sanitary sewer illicit discharge	Septic systems
	Sanitary sewer exfiltration	SSO
	Homeless populations	CSO
		Recreational boating
Domestic Pets	Pets, urban areas	Pets, rural areas
Wildlife	Urban wildlife	Non-urban wildlife
Livestock		Agriculture, hobby farms
		Concentrated Animal Feeding Operations (CAFOs)

The bacteria sources listed as MS4 sources are all diffuse sources that enter the storm drain system either through runoff or cross-connections. MDOT SHA, as a MS4 permittee, by definition only has point source discharges. These sources can be treated by stormwater practices or load reduction strategies. Loads from the non-point source list are either discrete sources, which can only be addressed through a load reduction approach, or diffuse rural sources that do not flow through storm drains.

The sources are significant in relation to permit conditions. The TMDL SW-WLA is the only load that must be addressed to meet the permit requirements, so that reduction of loads from livestock, sewer overflows, or septic systems would not be applicable to meet the permit requirement. Bacteria from these sources generally enter the receiving waters directly.

Bacteria concentrations in stormwater runoff are typically elevated above the primary contact recreation standards, regardless of the type of land use in the watershed (Clary et al., 2008). This type of pollution is significant because, unlike the water that goes down a sink or toilet in your home and is fed to a WWTP or septic system, stormwater runoff that is not intercepted by a BMP, is untreated and drains directly to lakes, rivers, and ultimately the Bay.

MDOT SHA Bacteria Loading Sources

The MDOT SHA-owned land is a small portion of each of the TMDL watersheds. Very few of the bacteria sources listed in **Table 3-10** exist within MDOT SHA land. However, there is some very limited potential for bacteria to originate from MDOT SHA ROW.

MDOT SHA owns only two septic systems in these watersheds; one at the Hereford shop in Loch Raven Reservoir watershed and one at a salt storage facility in Patapsco Lower North Branch watershed. The MDOT SHA Facility Maintenance Division (FMD) has standard operating procedures that includes regular inspections and maintenance for facilities with onsite septic systems. This helps to prevent sanitary overflows that may cause bacteria pollution.

The MDOT SHA does not own or maintain sanitary sewers, although some of these utilities may be present within the ROW. However, there is potential for a sewage leak from one of these utilities. The MDOT SHA has a program that conducts regular inspections and testing for any suspected illicit discharge within the drainage system. If an illicit discharge is confirmed, the MDOT SHA works with local jurisdictions to disconnect the discharge from the drainage system.

Potential for human or animal waste contamination from MDOT SHA runoff is minimal. There are no residents or livestock pasture lands in the ROW, so the only source of animal waste bacteria would be feral animals, adjacent residents walking pets along MDOT SHA roads, drainage washing from pasture lands, or homeless individuals. Wildlife sources are typically generated as a non-point source throughout the watershed, and are typically deterred from MDOT SHA ROW for safety reasons.

E.5.c. Bacteria Reduction Strategies

The MDOT SHA bacteria reduction strategy will be an iterative process to address bacteria sources with the greatest impact on water quality, while considering difficulty of implementation and cost. The MDOT SHA first started with using the Watershed Treatment Model (WTM). Next, MDOT SHA will develop local monitoring data of stormwater outfalls in the MDOT SHA drainage system. Then, the data from the outfall monitoring effort is analyzed to identify any BMP in which water flowing from or in the BMP are not meeting bacteriological WQSs set by MDE. Source elimination will follow the analysis of the local monitoring data. In the source elimination stage MDOT SHA will seek to remove the source of the bacteria.

Watershed Treatment Modeling

The WTM was used to better understand what bacteria load reduction MDOT SHA can capture using the portfolio of BMPs that will be used to meet the required 20 percent impervious restoration goal. The idea is to determine what impact the impervious surface restoration has on reducing bacteria in the local watersheds. The expectation is where fecal bacteria are transported through our MS4 conveyance system, stormwater BMPs implemented to control urban runoff should help in reducing fecal bacteria loads in the watershed. The results of the WTM are shown in **Table 3-2**.

Local Monitoring Effort

MDOT SHA will develop a protocol for monitoring stormwater outfalls and/or other BMPs that may have possible contaminated flow. This protocol is expected to be developed and approved by MDE by 2021. After the monitoring protocol is in place, MDOT SHA will start with sampling outfalls and BMPs in the watershed with a bacteria TMDL.

It is expected that during the local monitoring effort, MDOT SHA will be able to determine if there are any waters flowing from the MS4 drainage system where water quality is not meeting bacteriological WQSs. Once locations are identified, an effort to further investigate the source of the bacteria will be undertaken. The MDOT SHA will review MDE's BST data for the identified area and make a determination on what the potential source(s) of contaminate are. MDE's BST data tests microbial isolates collected from water samples and compares the isolates with a library from known sources to identify the host organism the bacteria came from. Once the BST data is examined a source can be identified and source elimination efforts can be focused.

Source Elimination

The effort to eliminate bacteria sources will focus on achieving load reductions for domestic pets, wildlife loads, and human waste. These actions may include but not be limited to:

- Eliminating illicit sewer discharges to stormwater conveyance systems;
- Addressing areas frequented by homeless populations in cooperation with local public health agencies; and
- Installing pet waste disposal bins within MDOT SHA ROW that have a high pet usage.

MARYLAND DEPARTMENT OF TRANSPORTATION

STATE HIGHWAY ADMINISTRATION

Part IV

MDOT SHA Watershed TMDL Implementation Plans







IV. MDOT SHA WATERSHED TMDL IMPLEMENTATION PLANS

A. ANACOSTIA RIVER WATERSHED

A.1. Watershed Description

The Anacostia River watershed encompasses 145 square miles across both Montgomery and Prince George's Counties, Maryland and an additional 31 square miles in Washington, DC. The watershed terminates in Washington, D.C. where the Anacostia River flows into the Potomac River, which ultimately conveys water to the Chesapeake Bay. The watershed is divided into 15 subwatersheds: Briers Mill Run, Fort Dupont Tributary, Hickey Run, Indian Creek, Little Paint Branch, Lower Beaverdam Creek, Northeast Branch, Northwest Branch, Paint Branch, Pope Branch, Sligo Creek, Still Creek, Upper Beaverdam Creek, Watts Branch, and the tidal river.

There are 1,815.3 centerline miles of MDOT SHA roadway located within the Anacostia River watershed. The associated ROW encompasses 4,861.6 acres, of which 2,329.2 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) weigh station, one (1) highway garage or shop, one (1) highway office or lab, three (3) park and ride facilities, and three (3) salt storage facilities. See **Figure 4-1** for a map of the watershed.

A.2. MDOT SHA TMDLs within Anacostia Watershed

TMDLs requiring reduction by MDOT SHA in the Anacostia River watershed include trash and PCBs as shown in **Table 3-2** (MDE, 2010a; MDE, 2011a). The allocated trash baseline for MDOT SHA is to be reduced by 100 percent (this does not mean that trash within the watershed will be reduced to zero). The allocation is divided into separate requirements for each County.

PCBs are to be reduced in certain subwatersheds of the Anacostia River watershed. The Anacostia River Northeast Branch subwatershed requires a 98.6 percent reduction and the Anacostia River Northwest Branch subwatershed requires a 98.1% reduction. The Anacostia River Tidal subwatershed requires a 99.9% reduction.

A.3. MDOT SHA Visual Inventory of ROW

The MS4 permit requires MDOT SHA perform visual assessments. **Part III, Coordinated TMDL Implementation Plan** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Anacostia River watershed is shown in **Figure 4-2** which illustrates that 90 grid cells have been reviewed, encompassing portions of 42 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 468 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- Three (3) new structural SW controls constructed or under contract.
- 247 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.

- 218 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 164 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 68 sites constructed or under contract.
- 15 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 81 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 81 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- 11 sites constructed or under contract.
- 21 additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- 49 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified seven (7) sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Four (4) new structural SW controls constructed or under contract.
- One (1) additional site deemed potentially viable for new structural SW controls and pending further analysis, may be a candidate for future restoration opportunities.
- Two (2) sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 219 outfalls potential for stabilization. Further analysis of these sites resulted in:

- Two (2) outfall sites constructed or under contract.
- 22 outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- 195 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 33 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of five (5) existing structural SW controls constructed or under contract.
- Seven (7) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 21 retrofit sites deemed not viable for future restoration opportunities and have been removed from consideration.

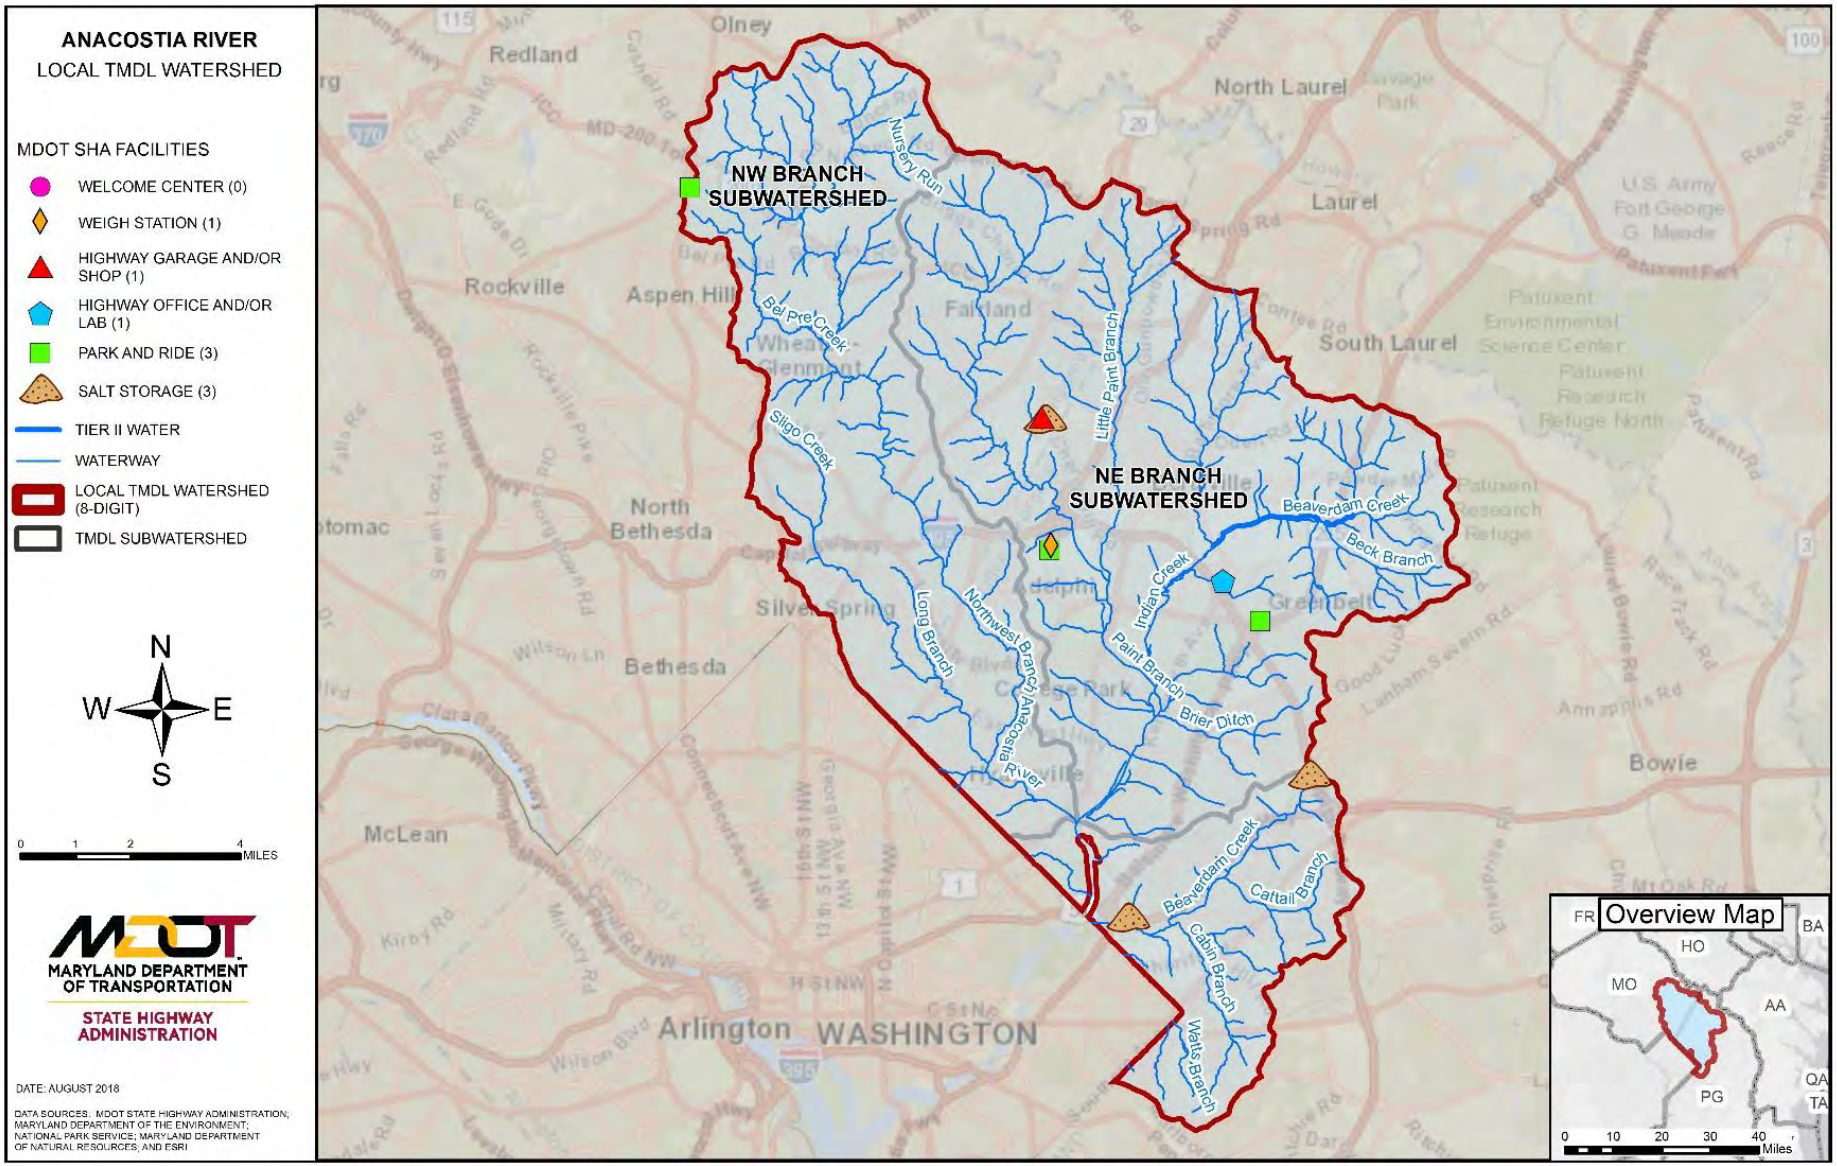


Figure 4-1: Anacostia River Watershed

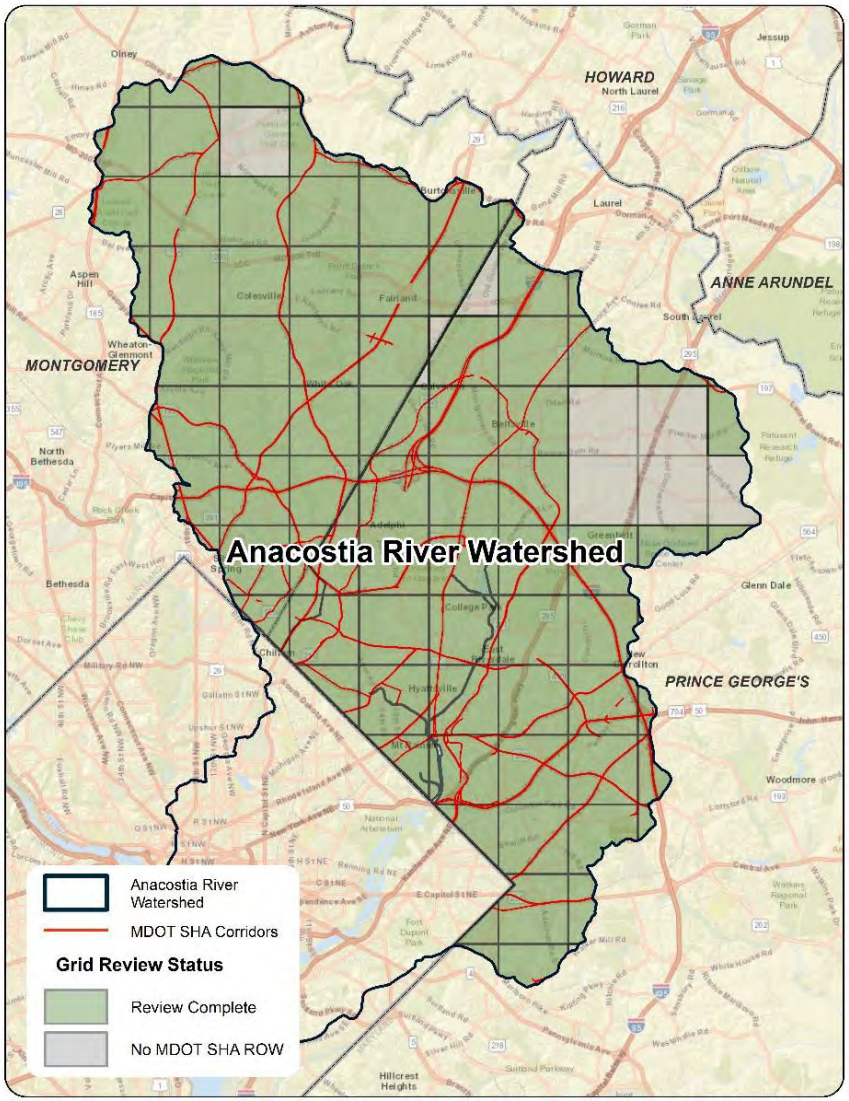


Figure 4-2: Anacostia River Site Search Grids

A.4. Summary of County Assessment Review

Waters within the Anacostia River watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Biochemical oxygen demand (BOD);
- Chlorides;
- Debris/Floatables/Trash;
- *Enterococcus;*
- Heptachlor Epoxide;
- Nitrogen (Total);
- PCB in Fish Tissue;
- Phosphorus (Total);
- PCBs;
- Sulfates; and
- TSS.

Both Montgomery and Prince George's Counties have conducted a watershed assessment for areas within the Anacostia River watershed. These include the 2012 *Anacostia Watershed Implementation Plan* produced for the Montgomery County Department of Environmental Protection and the 2015 *Implementation Plan for the Anacostia River Watershed Trash Total Maximum Load in Prince George's County* produced for the Prince George's County Department of the Environment (Biohabitats et al., 2012a; EA, 2015). Prince George's County also completed the *Restoration Plan for PCB-Impacted Waterbodies in Prince George's County* (Tetra Tech, 2015a) as well as the *Restoration Plan for the Anacostia River Watershed in Prince George's County* (Tetra Tech, 2015b) in 2015.

Many areas of the Anacostia River watershed were developed prior to modern SWM and erosion and sediment control regulations. Impervious land cover comprises a large portion of the watershed (24 percent). Montgomery County identified 6,917 acres (18 percent) with impervious cover. Likewise, the Restoration Plan for the Anacostia River watershed in Prince George's County identifies 15,435.3 acres

(28.5 percent) of impervious cover. In Montgomery County alone, impervious cover contributes 206,312 lbs. per year of nitrogen, 20,953 lbs. per year of phosphorus, and 7,682 tons per year of sediment, to the watershed.

The subwatersheds in Prince George's County were prioritized by ranking the necessary total load reductions for each TMDL parameter. Montgomery County mapped individual stream areas for restoration opportunity prior to 2012, but may have restored several already. Montgomery County noted that according to their testing parameters, Lower Paint Branch, Little Paint Branch, Northwest Branch, and Sligo Creek received consistent "poor" ratings, and should be targeted for restoration efforts.

From 2009-2013 benthic invertebrate surveys were conducted throughout Montgomery and Prince George's Counties. Of the sampled sites, 91 percent of Montgomery County sites were rated as "fair" or "poor," while approximately 50 percent of sites in the most recent round of sampling in Prince George's County were rated as "poor" or "very poor." As a result of the studies, both counties identified several similar restoration strategies for meeting pollution reduction and improvement goals within the watershed. These include:

- Stormwater retrofit;
- Stream restoration;
- Wetland creation/restoration;
- Fish blockage removal/modification;
- Riparian reforestation/street tree planting;
- Green roof;
- Dry water pond;
- Bioswales;
- Permeable pavements/sidewalks;
- Rain gardens and rain barrels;
- Street sweeping; and
- Downspout disconnection.

Additionally, trash reduction strategies are also discussed by both Counties. Trash loading within the watershed is categorized by land use. The trash reduction strategies have been broken into 4 categories including structural, educational, municipal, and enforcement. In both counties, 68 percent of this reduction will be addressed by structural BMPs and the rest (32 percent) from outreach and enforcement activities. All trash reduction efficiencies are a percent reduction from the loading rate of the area's land use. **Table 4-1** outlines Montgomery County's strategies and efficiencies for each.

Table 4-1: Montgomery County Preferred Trash Reduction Strategies and Efficiencies

BMP Program	Category	Unit Reduction Efficiency
SWM and ESD BMPs	Structural	95% of Drainage Area Loading Rate
Trash Interceptors	Structural	90% of Drainage Area Loading Rate
Land Use Change to Reduce Loading Rate	Municipal	Depends on Land Use
Anti-Littering Campaign	Educational	12% Reduction of Residential Land Use Loading Rate
Recycling Education and Enforcement	Educational, Municipal, and Enforcement	25% Reduction of Land Use Loading rate within Areas with Recycling Service
Plastic Bag Ban	Educational, Municipal, and Enforcement	30% of Total Load
Enforcement of Littering and Illegal Dumping	Enforcement	5% Reduction of Industrial and Commercial Land Use Loading Rate

Source: Biohabitats et al. (2012a)

Many of these strategies are not available to MDOT SHA since it is not a municipal entity with its own enforcement capacity. Also, MDOT SHA ROW only has a single land use category being transportation, so changes in land use categories would not be possible. Therefore, the

most suitable strategies that would apply to MDOT SHA include structural and educational strategies.

PCB Reduction

Part III, Coordinated TMDL Implementation Plan outlines strategies for PCB reduction. The primary strategy for additional and targeted PCB reduction is the development of a source tracking and elimination program that traces the contamination back to its source and removes it from the system. The source tracking program identifies areas where PCB sources have been documented or are likely to exist. These areas will be assessed to target BMPs (e.g., stormwater ponds) and waterways where PCBs are most likely to have been carried by stormwater. Sediments in these BMPs and waterways will then be sampled and analyzed to determine PCB concentrations. If present above the action level, the PCB-impacted sediments will be removed from the system and the County will take credit for the PCB load reduction. Ideally, the originating source of PCBs can be immediately identified and corrected during the source removal/remediation phase.

The ROW is public space that is owned and maintained either by the County or MDOT SHA. Some of these areas may have a high density of substations and transformers that could contain PCBs, particularly in industrial, commercial, and high-density urban areas. BMPs receiving runoff from such ROW areas will be a priority focus area if there are no access restrictions involved.

Superfund sites have high potential for PCB source pollution. Prince George's County Superfund sites and their known PCB presence are listed in **Table 4-2**.

As a whole, structural and nonstructural BMPs have been implemented by the County including permit compliance, TMDL WLAs, flood mitigation, and more. Prince George's County has also engaged in street sweeping, public outreach to promote environmental awareness, green initiatives and community involvement in protecting natural resources. Additionally, the County has initiated discussions with the board of education and the MDOT SHA to coordinate and take advantage of available land for BMP retrofits (Tetra Tech, 2015b).

Table 4-2: Prince George's County Superfund Sites

Site Name	City	Known PCBs
Andrews Air Force Base (AFB)	Andrews AFB	X
Beltsville Agriculture Research Center (BARC)	Beltsville	X
Brandywine Defense Reutilization and Marketing Office (DRMO)	Brandywine	X
Chillum Gasoline Release	Chillum	
Chillum Perchloroethylene (PERC)	Chillum	
Laurel Chlorine Cylinder	Laurel	
Nazcon Concrete	Beltsville	
Roger's Electric Company	Cheverly	X
Windsor Manor Road	Brandywine	

Source: Tetra Tech (2015a)

A.5. MDOT SHA Pollution Reduction Strategies

Proposed practices to meet PCB and trash reduction in the Anacostia River Northeast Branch, Northwest Branch, Tidal River Branch, Anacostia River Montgomery County portion, and Anacostia River Prince George's County portion of the watershed are shown in **Table 4-3**, **4-4**, **4-5, 4-6a,** and **4-6b** respectively. Projected PCB and Trash reductions using these practices are described in **Part III, Coordinated TMDL Implementation Plan** and are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs implemented before the baseline year. In this case the baseline for PCBs is 2005 and the baseline for trash is 2010;
- BMPs built after the baseline through fiscal year 2020; and

- BMPs implemented after fiscal year 2020 through fiscal year 2025: and

- Future BMPS to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the PCB TMDL for Anacostia River NE Branch, MDOT SHA will meet 5.1 percent of the MDE 98.6 percent load reduction requirement through implementation of BMPs shown in **Table 4-3**. MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in Part III Section E.

Estimated costs to design, construct, and implement annual practices such as inlet cleaning and street sweeping within the Anacostia River watershed total $6,239,000. These projected costs are based on an average cost per impervious acre treated that is derived from cost history for a group of completed projects for each BMP category. Please see **Table 4-7** for a BMP strategy breakdown.

Figure 4-3 shows a map of MDOT SHA's watershed restoration practices and includes those that are under design or construction. Inlet cleaning is not reflected on this map.

Table 4-3: Anacostia River NE Branch Restoration PCB BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	383.1	17.3	29.9	TBD	430.3
Retrofit	drainage area acres		25.9		TBD	25.9
Inlet Cleaning[1]	dry tons		12.4	9.1	TBD	21.5
Street Sweeping[1]	acres swept		32.6		TBD	32.6
Load Reductions	PCB g/yr.		0.23	0.40	7.78	
					Total Projected Reduction	**7.78**

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-4: Anacostia River NW Branch Restoration PCB BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	214.6			TBD	214.6
Retrofit	drainage area acres		35.0		TBD	35.0
Inlet Cleaning[1]	dry tons		22.7	53.0	TBD	75.7

Street Sweeping[1]	acres swept		17.6		TBD	17.6
Load Reductions	PCB g/yr.		0.36	0.36	7.55	
				Total Projected Reduction	**7.55**	
[1] Inlet cleaning and street sweeping are annual practices.						

Table 4-5: Anacostia River Tidal Branch Restoration PCB BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	165.5	1.5		TBD	167.0
Retrofit	drainage area acres		26.0		TBD	26.0
Inlet Cleaning[1]	dry tons		5.4	34.7	TBD	40.1
Street Sweeping[1]	acres swept		33.8		TBD	33.8
Load Reductions	PCB g/yr.		0.97	0.97	16.08	
				Total Projected Reduction	**16.08**	
[1] Inlet cleaning and street sweeping are annual practices.						

Table 4-6a: Anacostia River Watershed Montgomery County Trash & Debris Activities Implementation

BMP	Unit	Restoration BMPs			Total BMPs
		2020	2025	Future	
Stormwater BMP	drainage area acres	17		TBD	17
Stream Clean-Ups	pounds		1,000	TBD	1,000
Media Relations (Use of Free Media)	each			TBD	
Outreach: Community/School Children/ Youth	each		5	TBD	5
Inlet Cleaning[1]	No. Inlets	602		TBD	602
Street Sweeping[1]	acres	234	351	TBD	585
Load Reductions	lbs./yr.	3,273	4,764	6044	
			Total Projected Reduction	**6,044**	
[1] Inlet cleaning and street sweeping are annual practices.					

Table 4-6b: Anacostia River Watershed Prince George's County Trash & Debris Activities Implementation					
BMP	**Unit**	**Restoration BMPs**			**Total BMPs**
		2020	**2025**	**Future**	
Stormwater BMP	drainage area acres	518		N/A	518
Stream Clean-Ups	pounds		4,000	N/A	4,000
Media Relations (Use of Free Media)	each			N/A	
Outreach: Community/School Children/ Youth	each		5	N/A	5
Inlet Cleaning[1]	No. Inlets	813		N/A	813
Street Sweeping[1]	acres	429	644	N/A	1,073
Load Reductions	lbs./yr.	5,604	10,344	14,134	
			Total Projected Reduction	**14,134**	
[1] *Inlet cleaning and street sweeping are annual practices.*					

Table 4-7: Anacostia River Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$2,196,000		$2,196,000
Retrofits	$3,272,000		$3,272,000
Stream Clean Ups		TBD	TBD
Inlet cleaning	$184,000	$553,000	$737,000
Street Sweeping	$34,000		$34,000
Total			$6,239,000

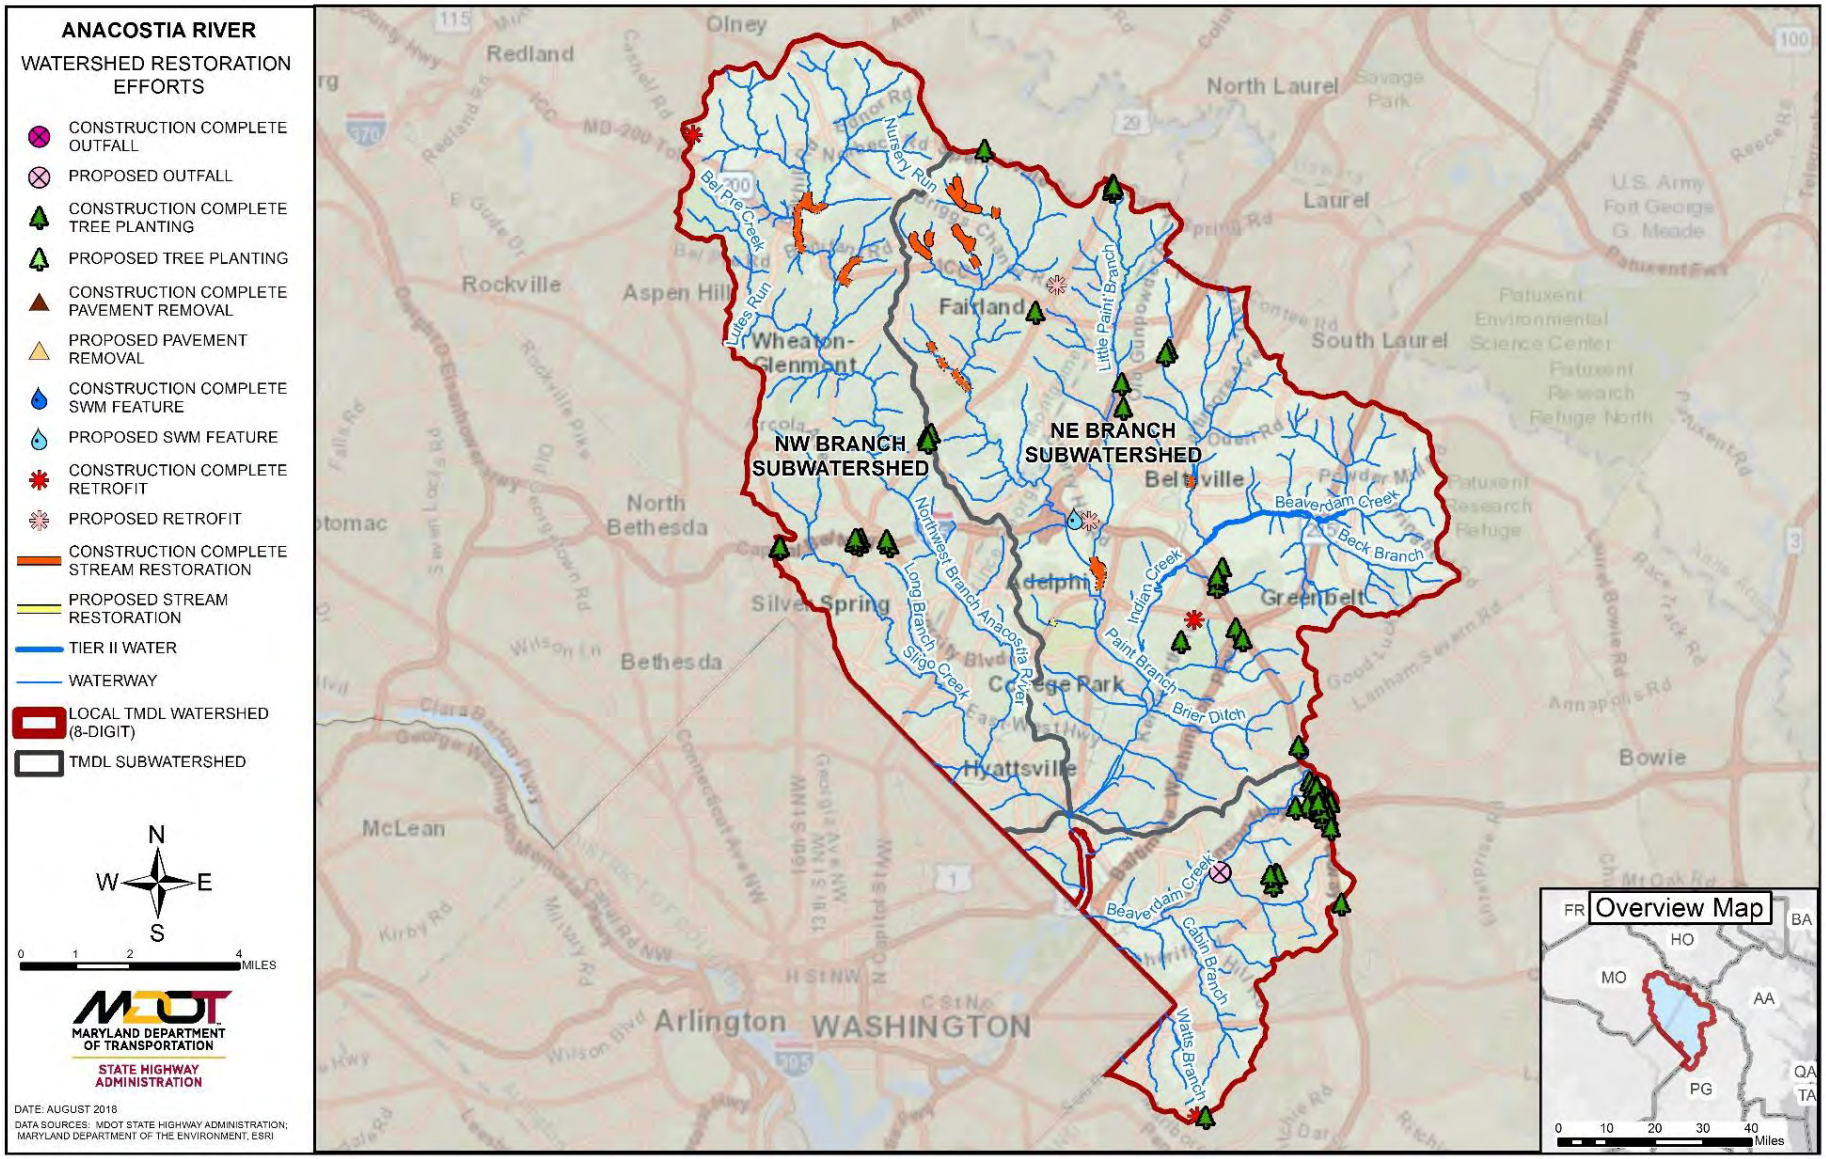


Figure 4-3: MDOT SHA Restoration Strategies within the Anacostia River Watershed

B. ANTIETAM CREEK WATERSHED

B.1. Watershed Description

The Antietam Creek watershed encompasses 290 square miles with 185 square miles in Maryland. Approximately 75 percent of this watershed occurs in Washington County with the remainder in Franklin and Adams Counties, Pennsylvania. Antietam Creek flows about 54 miles from its headwaters in Pennsylvania's Michaux State Forest to the Potomac River near Antietam, Maryland. Major tributary creeks and streams of the Antietam Creek watershed in Maryland include Little Antietam Creek, Beaver Creek, and Marsh Run.

There are 744.4 miles of MDOT SHA roadway located within the Antietam Creek watershed. The associated ROW encompasses 2,201.3 acres, of which 853.2 acres are impervious. MDOT SHA facilities located within the watershed consist of five (5) park and ride facilities, four (4) salt storage facilities, and two (2) highway garage or shop facilities. See **Figure 4-4** for a map of the watershed.

B.2. MDOT SHA TMDLs within Antietam Creek Watershed

TMDLs requiring reduction by MDOT SHA include phosphorus and sediment (TSS) (MDE, 2013a; MDE, 2008a). Phosphorus is to be reduced by 21.4 percent and sediment is to be reduced by 58.1 percent as shown in **Table 3-2**.

B.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Antietam watershed is shown in **Figure 4-5** which illustrates that 84 grid cells have been reviewed, encompassing portions of 684 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 1,215 locations as potential new structural SW control locations. Further analysis resulted in:

- 27 new structural SW controls constructed or under contract.
- 391 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 797 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 564 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 65 sites constructed or under contract.
- 60 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 439 sites deemed not viable for tree planting and have been removed from consideration.

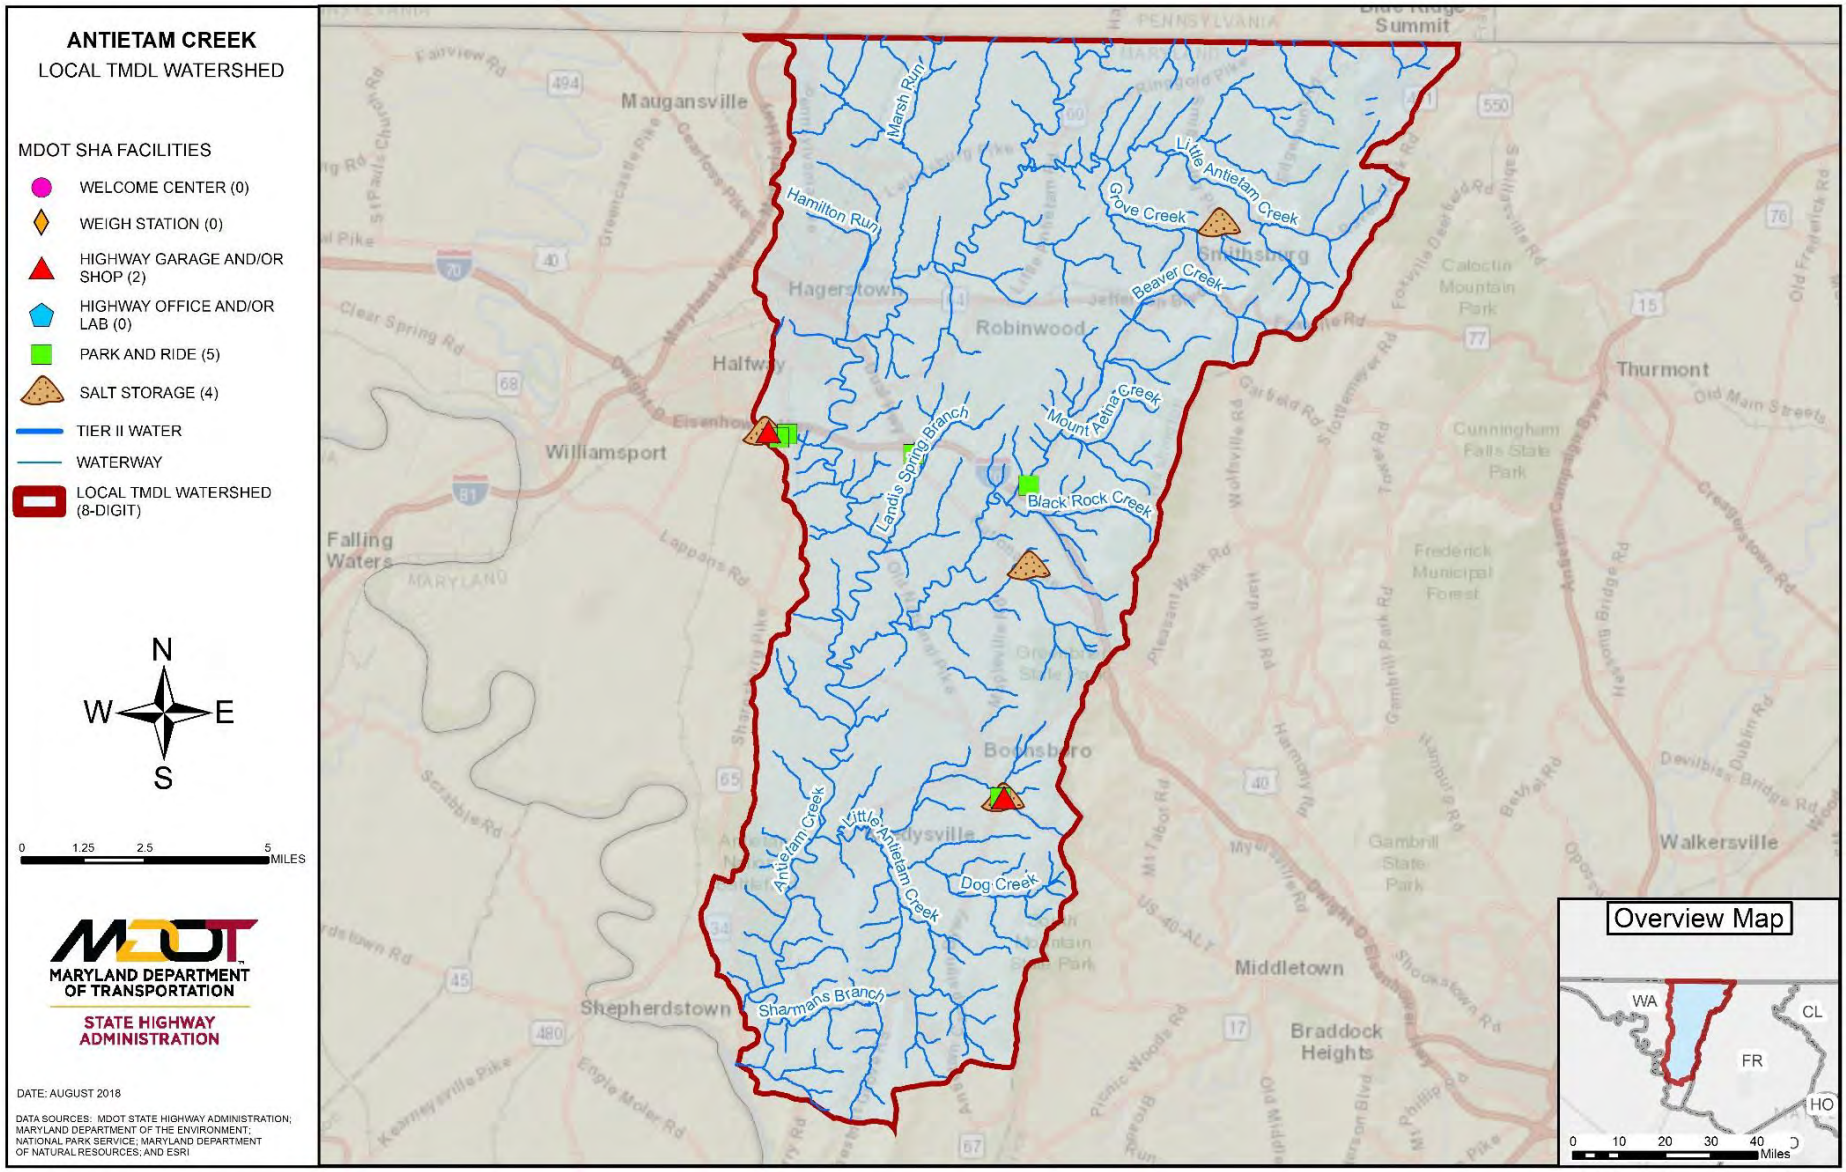


Figure 4-4: Antietam Creek Watershed

Stream Restoration

Preliminary evaluation identified 29 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Four (4) additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- 25 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 28 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Four (4) new structural SW controls constructed or under contract.
- One (1) additional site deemed potentially viable for new structural SW controls and pending further analysis, may be a candidate for future restoration opportunities.
- 23 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified six (6) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of one (1) existing structural SW control constructed or under contract.
- Five (5) retrofit sites deemed not viable for future restoration opportunities and have been removed from consideration.

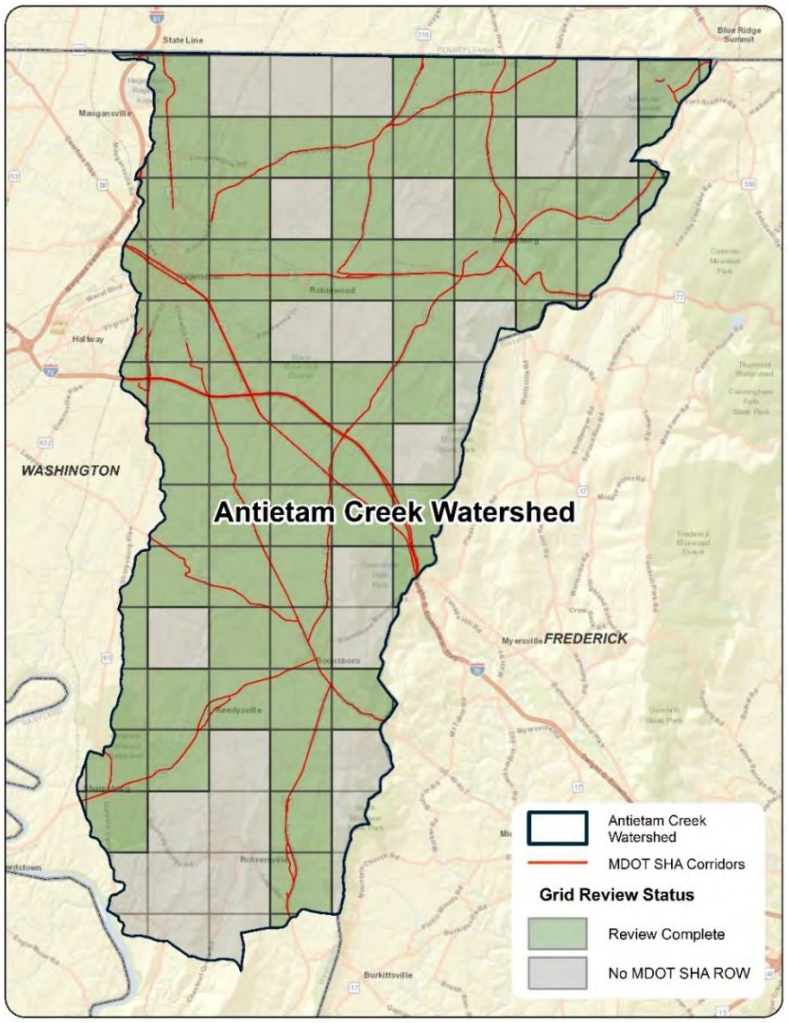


Figure 4-5: Antietam Creek Site Search Girds

B.4. Summary of County Assessment Review

Waters within the Antietam Creek watershed are subject to the following impairments as noted on MDE's 303(d) List:

- *Escherichia coli;*
- PCB in Fish Tissue
- Phosphorus (Total);
- Sulfates;
- Temperature, water; and
- TSS.

The 2012 *Antietam Creek Watershed Restoration Plan* was developed through a partnership (comprised of several organizations including MDE and led by the Washington County Soil Conservation District [WCSCD]) as a comprehensive summary of the issues impacting the watershed area (WCSCD et al., 2012). Antietam Creek currently has completed TMDLs for phosphorus, TSS, and *E. coli*. However, TMDLs are still necessary for PCB in fish tissue, sulfates, and temperature (water).

The watershed has been divided into nine subwatersheds. Approximately 59% of the stream miles were classified as having Fish Index of Biotic Integrity (FIBI) and/or Benthic Index of Biotic Integrity (BIBI) in the "poor" to "very poor" category. After review and evaluation, it was determined that three of the nine watersheds be targeted for pollutant reduction implementation: ANT0277, MRS0000, and BEC0001.

Because a significant portion of the watershed is agricultural land use (42 percent), there are separate BMPs listed for agricultural practices and urban areas. The suggested BMPs for watershed restoration are shown in **Table 4-8**.

Table 4-8: Suggested BMPs in the Antietam Creek Watershed

Agricultural BMPs	Urban BMPs
Pet Waste Runoff Campaign*	Bioretention/Rain Gardens*
Septic System Upgrades	Bio-Swale*
Grass Buffers*	Dry Detention Ponds*
Riparian Forest Buffers*	Dry Extended Detention Ponds*
Stream Protection with Fencing*	Forest Conservation (pervious only)*
Stream Protection without Fencing*	Impervious Urban Surface Reduction*
Livestock Stream Crossing	Permeable Pavement
Nutrient Management Planning*	Urban Forest Practices*
Runoff Control Systems*	Urban Filtering Practices*
Cover Crops	Urban Infiltration Practices*
Animals Waste Management	Street Sweeping*
Conservation Tillage	Urban Nutrient Management*
Retire Highly Erodible Lands	Vegetated Open Channel*
Natural Stream Designs/Armored Steam Banks*	Wet Ponds & Wetlands*
** Denotes practices that may be applicable to MDOT SHA's program*	
Source: WCSCD et al. (2012)	

B.5. MDOT SHA Pollutant Reduction Strategies

Antietam Creek has a TMDL for phosphorus and sediment with baseline years of 2009 and 2000 respectively. Proposed practices to meet the phosphorus and sediment reductions in this watershed are shown in **Table 4-9 and Table 4-10**. Projected phosphorus and sediment reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the BMP implementation tables below:

- BMPs implemented before the baseline year. In this case, the phosphorus baseline is 2009 and the sediment baseline is 2000;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL, MDOT SHA will meet 23.7 percent of the MDE 58.1 percent load reduction requirement through implementation of BMPs shown in **Table 4-10.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Antietam Creek watershed total $14,586,000. They are based on average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-11** for a summary of estimated BMP costs.

Figure 4-6 is a map of the MDOT SHA restoration practices and includes those that are under design or construction. Inlet cleaning and street sweeping are not shown.

Table 4-9: Antietam Creek Restoration Phosphorus BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	58.8	78.9	44.5	N/A	182.2
Retrofit	drainage area acres		28.8		N/A	28.8
Tree Planting	acres of tree planting	6.7	94.6		N/A	101.3
Stream Restoration	linear feet			2,033.6	N/A	2,033.6
Outfall Stabilization	linear feet			400.0	N/A	400.0
Inlet Cleaning[1]	dry tons			27.8	N/A	27.8
Street Sweeping[1]	acres swept		58.9		N/A	58.9
Load Reductions	TP EOS lbs./yr.		102	290	0	
				Total Projected Reduction	**290**	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-10: Antietam Creek Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2000)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	53.4	78.9	44.5	TBD	176.8
Retrofit	drainage area acres		28.8		TBD	28.8
Tree Planting	acres of tree planting		101.3		TBD	101.3
Stream Restoration	linear feet			2,033.6	TBD	2,033.6
Outfall Stabilization	linear feet			400.0	TBD	400.0
Inlet Cleaning[1]	dry tons			27.8	TBD	27.8
Street Sweeping[1]	acres swept		58.9		TBD	58.9
Load Reductions	TSS EOS lbs./yr.		108,098	238,281	1,007,480	
				Total Projected Reduction	**1,007,480**	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-11: Antietam Creek Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$2,128,000	$5,786,000	$7,914,000
Retrofits	$1,223,000		$1,223,000
Tree Planting	$3,098,000		$3,098,000
Stream Restoration		$1,358,000	$1,358,000
Outfall Stabilization		$787,000	$787,000
Inlet cleaning		$159,000	$159,000
Street Sweeping	$47,000		$47,000
Total			$14,586,000

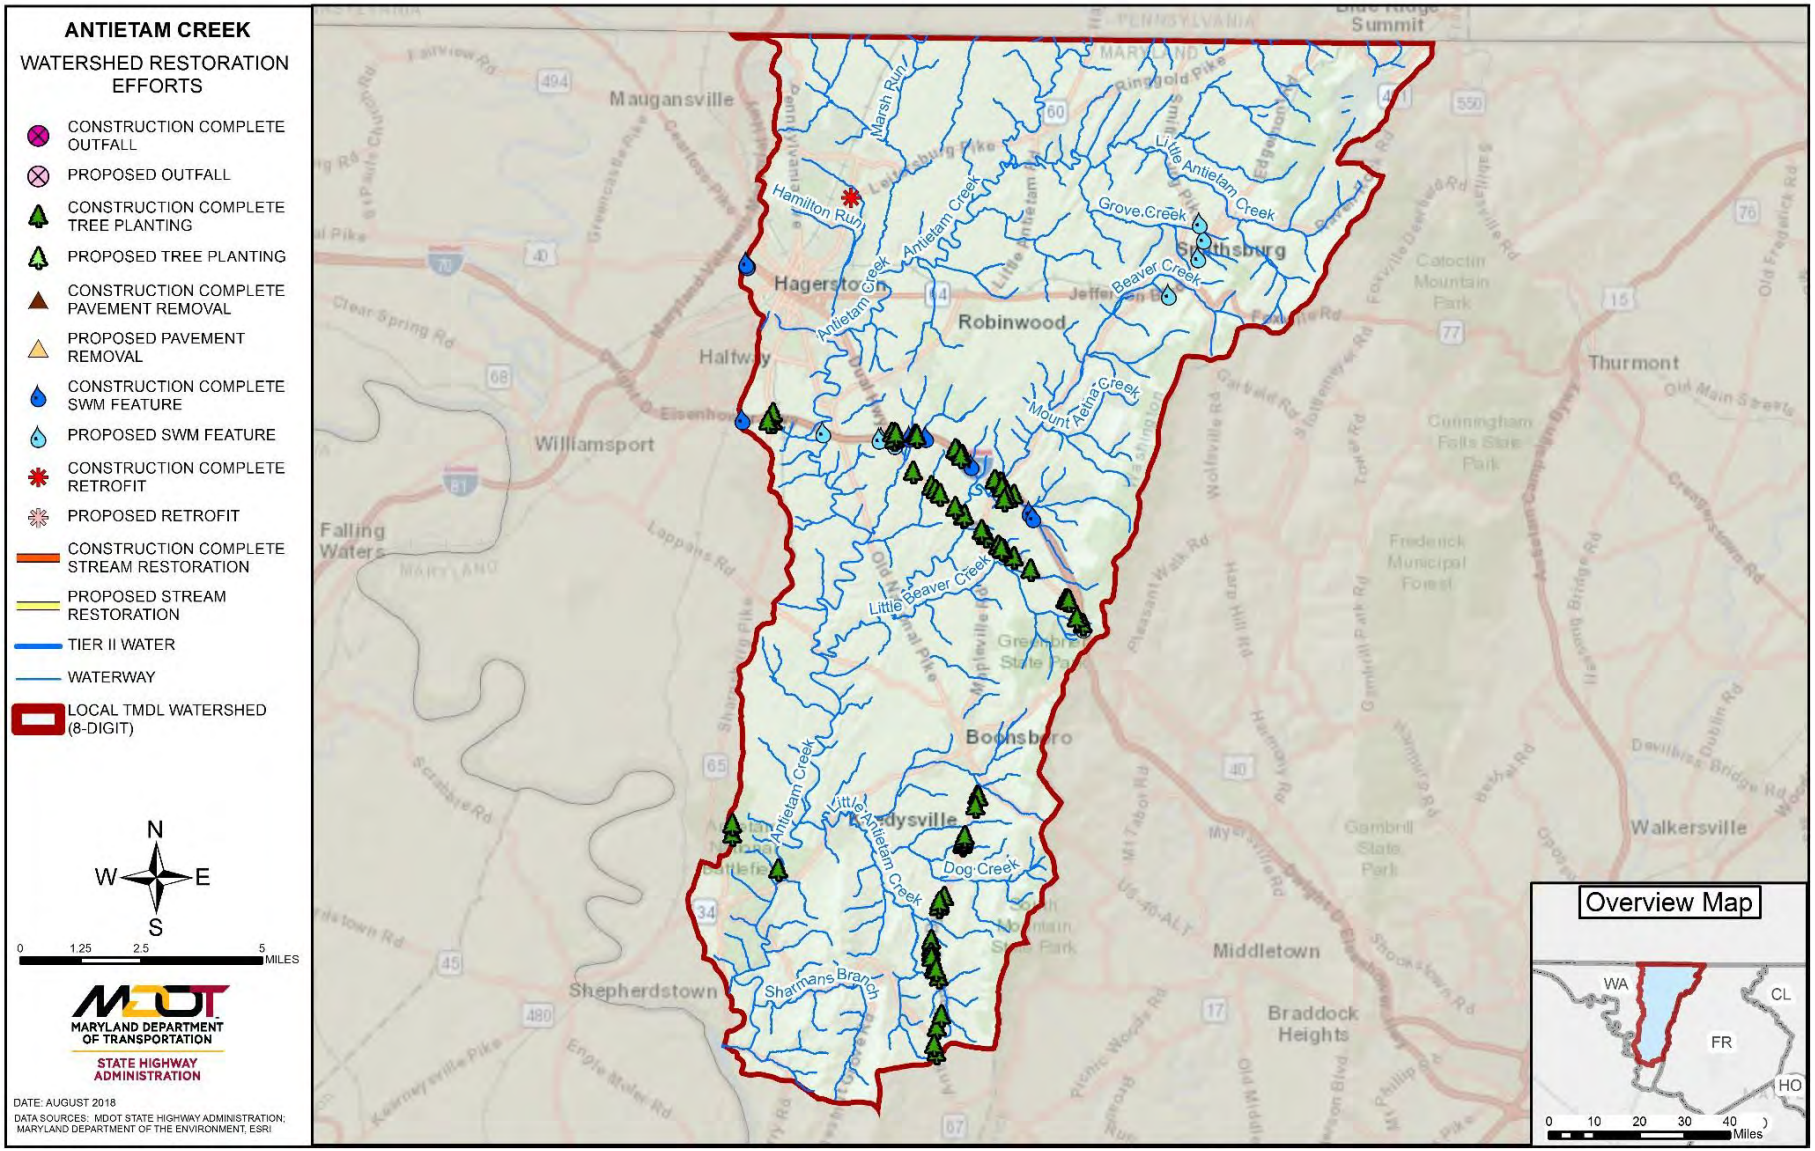


Figure 4-6: MDOT SHA Restoration Strategies within the Antietam Creek Watershed

C. BACK RIVER WATERSHED

C.1. Watershed Description

The Back River watershed encompasses 37 square miles in the western shore region of Maryland within City of Baltimore and Baltimore County. Back River drains into the Chesapeake Bay in Baltimore County. Major tributary creeks and streams of the Back River watershed include Armistead Run, Biddison Run, Bread and Cheese Creek, Brien's Run, Chinquapin Run, Deep Creek, Duck Creek, Herring Run, Moore's Run, Northeast Creek, Redhouse Run, Stemmers Run, and Tiffany Run. The Back River watershed is comprised of the Upper Back River (UBR) subwatershed and the Tidal Back River (TBR) subwatershed. The UBR subwatershed accounts for 78 percent of the Back River watershed and the TBR subwatershed accounts for the remaining 22 percent.

There are 869.3 miles of MDOT SHA roadway located within the Back River watershed. The associated ROW encompasses 1,532.3 acres, of which 718.4 acres are impervious. MDOT SHA facilities located within the Back River watershed consist of three (3) salt storage facilities, and two (2) highway garage or shop facilities. See **Figure 4-7** for a map of the watershed.

C.2. MDOT SHA TMDLs within Back River Watershed

MDOT SHA is included in the PCB TMDL (MDE, 2012a) with a reduction requirement of 53.4 percent, as shown in **Table 3-2.**

C.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Back River watershed is shown in **Figure 4-8** which illustrates that 31 grid cells have been reviewed, encompassing portions of 16 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 205 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 104 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 101 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 151 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 67 sites constructed or under contract.
- 13 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 71 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified seven (7) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Seven (7) sites deemed not viable for stream restoration.

Grass Swale Rehabilitation

Preliminary evaluation identified 101 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 23 new structural SW controls constructed or under contract.
- Two (2) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 76 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified six (6) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of two (2) existing structural SW controls constructed or under contract.
- Four (4) retrofit sites deemed not viable for retrofit and have been removed from consideration.

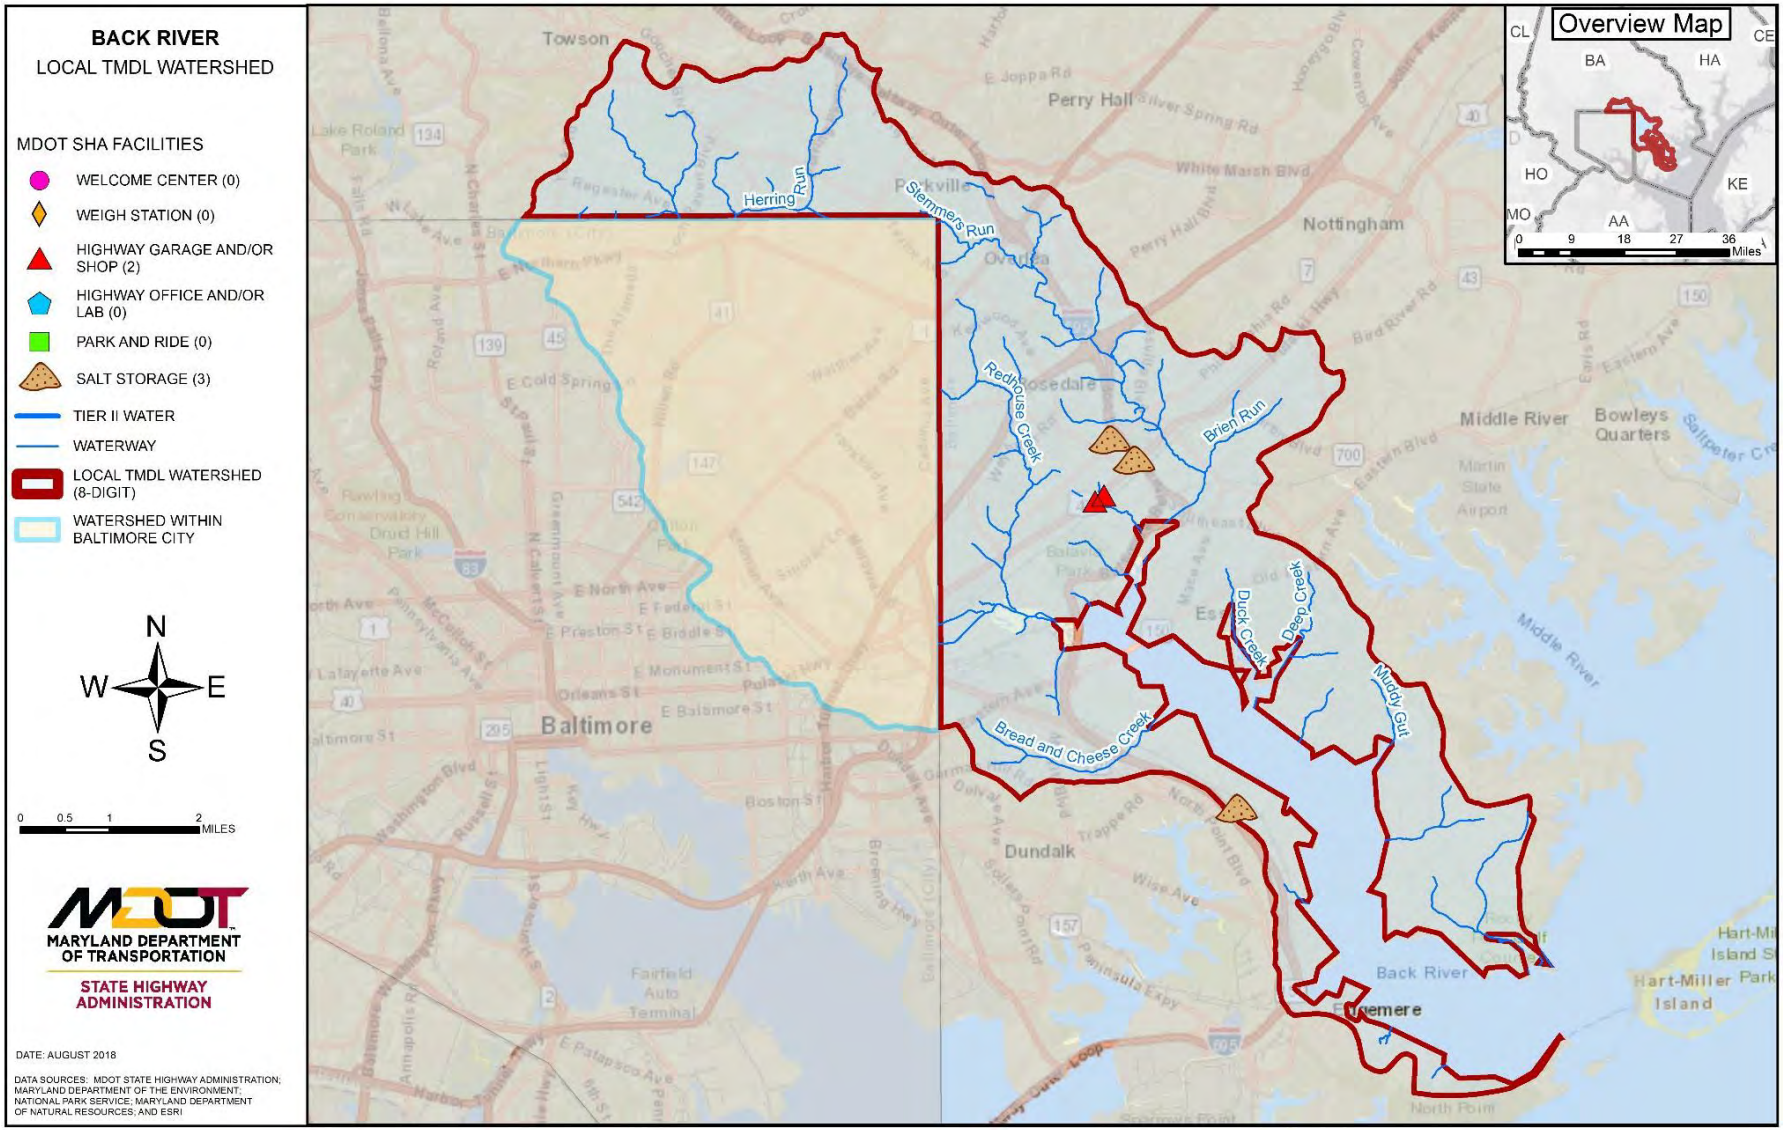


Figure 4-7: Back River Watershed

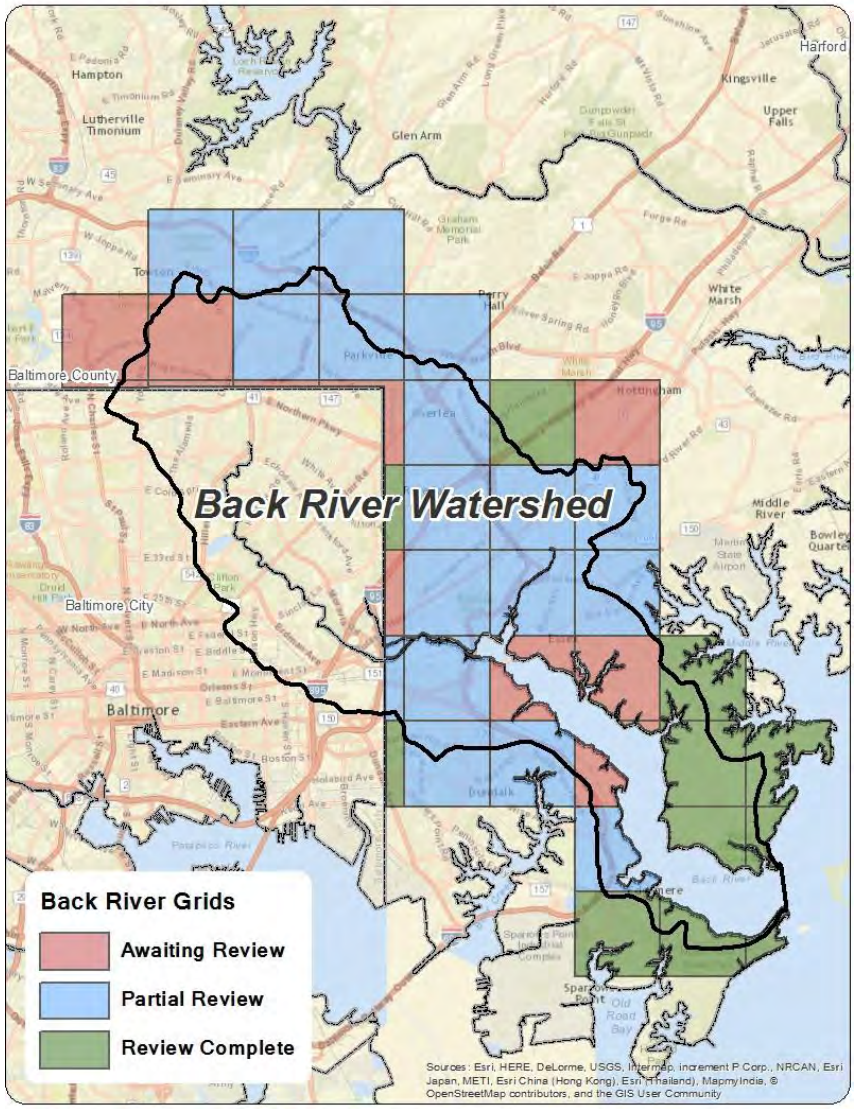


Figure 4-8: Back River Site Search Grids

C.4. County Assessment Review Summary

Waters within the Back River watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlordane;
- Chlorides;
- Fecal Coliform;
- Nitrogen (Total);
- PCB in Fish Tissue;
- Phosphorus (Total);
- PCBs;
- Sulfates; and
- TSS.

The Baltimore County completed Small Watershed Action Plans (SWAPs) for the UBR subwatershed in 2008 (BA-DEPRM, 2008a) and the TBR subwatershed in 2010 (Parsons Brinckerhoff [PB], 2010). Impervious land cover comprises 31 percent of the UBR subwatershed and 18 percent of the TBR subwatershed. Over 46 percent of soils within the UBR subwatershed and over 25 percent of soils within the TBR subwatershed are considered of high runoff potential.

Baltimore County estimates that impervious urban land use is responsible for contributing 314,619 lbs. of nitrogen and 40,182 lbs. of phosphorus in the UBR subwatershed per year (BA-DEPRM, 2008a) and 19,444 lbs. of nitrogen and 3,117 lbs. of phosphorus in the TBR watershed per year (PB, 2010). Back River currently has completed TMDLs for nitrogen, phosphorus, TSS, chlordane, and PCBs in the Chesapeake Bay tidal segment and fecal coliform in the river mainstem (Herring Run). Back River also has Category Five impairment listings (i.e., TMDL required) for sediment, chlorides, and sulfates in 1st through 4th order streams.

The County SWAPs prioritized subwatersheds within the UBR and TBR subwatersheds based on ranking criteria in order to identify which

subwatersheds have the greatest need and potential for restoration. For the UBR subwatershed, Chinquapin Run, Tiffany Run, Herring Run Mainstem, Armistead Run, Biddison Run, Moore's Run, and Redhouse Run were rated "very high" and West Branch Herring Run, East Branch Herring Run, and an unnamed tributary were rated "high" in terms of restoration need and potential (BA-DEPRM, 2008a). For the TBR subwatershed, Deep Creek, Duck Creek, and Bread and Cheese Creek were rated "very high" and Lynch Point Cove, Back River-G, and Muddy Gut were rated "high" in terms of restoration need and potential. In the UBR subwatershed, all sites assessed by Baltimore City (42) and County (25) had BIBI scores in the "poor" or "very poor" categories (PB, 2010).

For the purposes of planning, the County SWAPS suggest the following generalized restoration strategies to aid in meeting restoration goals within the Back River watershed:

- SWM for new development and redevelopment;
- Existing SWM facility conversions;
- SWM retrofits;
- Stream restoration;
- Street sweeping and storm drain inlet cleaning;
- Illicit connection detection and disconnection program and hotspot remediation;
- Sanitary sewer consent decrees;
- Downspout disconnection;
- Citizen awareness (fertilizer application and pet waste); and
- Reforestation and tree planting.

The County identified numerous potential restoration sites within each subwatershed by conducting neighborhood source assessments, hotspot site investigations, institutional site investigations, and pervious area assessments. The County also identified multiple potential stormwater conversions within each subwatershed: 91 for the UBR subwatershed and three for the TBR subwatershed. Detailed information on site locations can be found in the SWAPs.

The following potential stream restoration sties were identified within the Back River watershed in **Table 4-12**. An additional six sites were also identified in the UBR subwatershed for SWM retrofit on County-owned property.

Table 4-12: Potential Stream Restoration Sites in Back River Watershed

Subwatershed	Reach	Number of Sites	Total Linear Feet	Conditions
UBR	Herring Run	24	12,675	-
UBR	Stemmers Run	30	23,488	-
UBR	Brien's Run	10	8,603	-
TBR	Bread and Cheese Creek	4	2,600	Erosion, dumping, and inadequate buffers
TBR	Duck Creek	3	80	Severe dumping, inadequate buffers, and invasive vegetation
TBR	Muddy Gut	2	-	Severe dumping and disturbance (all-terrain vehicle [ATV] trails)
TBR	Deep Creek	4	1,315	Concrete channels, inadequate buffers, severe channel alterations, severe erosion (scouring), and severe fish barrier

Sources: BA-DEPRM (2008a); PB (2010)

C.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet PCB reductions in the Back River watershed are shown in **Table 4-13**. Projected PCB reduction using these practices are shown in **Table 3-2**. Four timeframes are included in the BMP implementation tables below:

- BMPs built before the TMDL baseline. In this case, the baseline is 2001;
- BMPs built after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025,
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the PCB TMDL, MDOT SHA will meet 4.4 percent of the MDE 53.4 percent load

reduction requirement through implementation of BMPs shown in **Table 4-13.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement practices within the Back River watershed to address the PCB TMDL total $2,157,000. These projected costs are based on an average cost per impervious acre treated that is derived from cost history for a group of completed projects for each BMP category. Please see **Table 4-14** for a BMP strategy breakdown.

Figure 4-9 shows a map of MDOT SHA's restoration practices in the watershed and includes those that are under design or constructed. Inlet cleaning is not reflected on this map.

Table 4-13: Back River Restoration PCB BMP Implementation

BMP	Unit	Baseline (Before 2001)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	117.5	7.0	14.7	TBD	139.2
Retrofit	drainage area acres		12.3		TBD	12.3
Inlet Cleaning[1]	dry tons		17.5		TBD	17.5
Street Sweeping[1]	acres swept		31.1		TBD	31.1
Load Reductions	PCB g/yr.		0.36	0.45	10.31	
				Total Projected Reduction	**10.31**	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-14: Back River Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$509,000	$1,118,000	$1,627,000
Retrofits	$399,000		$399,000
Inlet cleaning	$84,000		$84,000
Street Sweeping	$47,000		$47,000
Total			$2,157,000

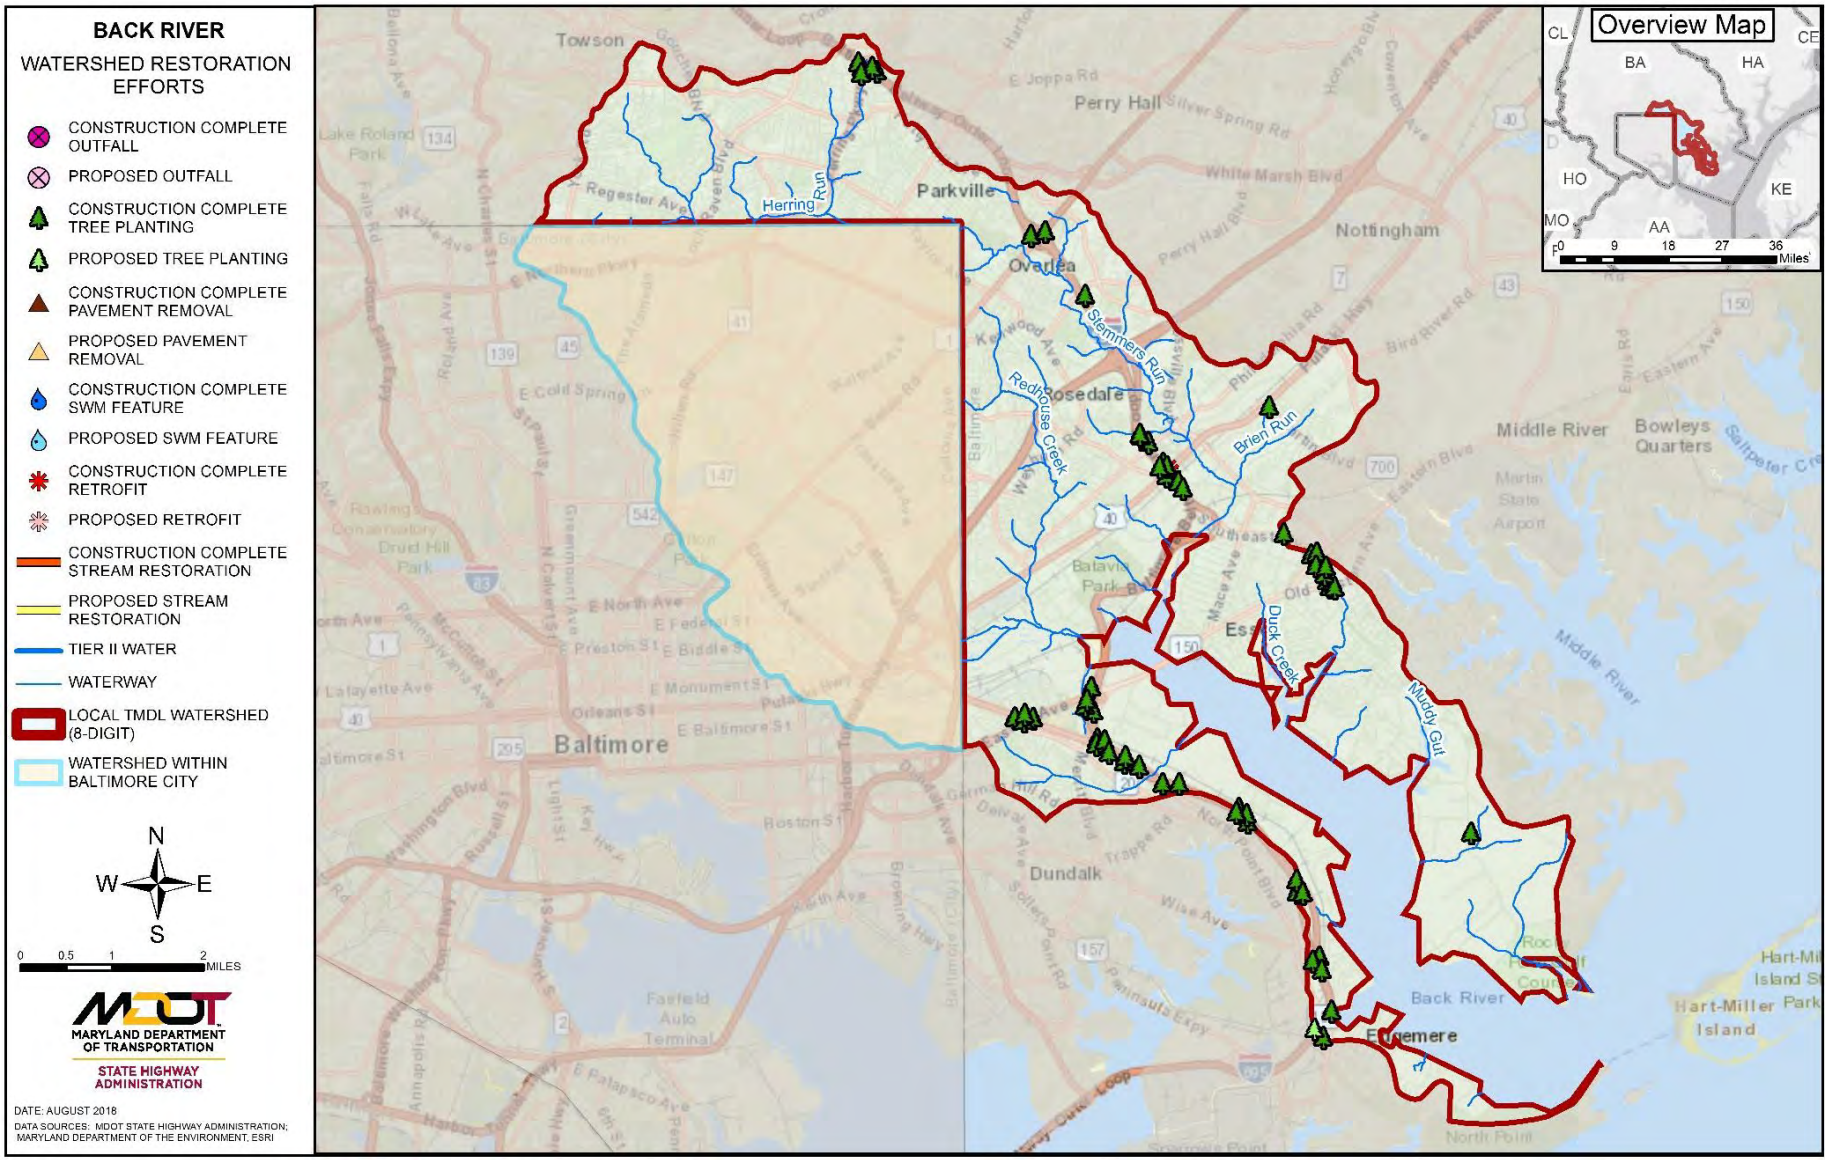


Figure 4-9: MDOT SHA Restoration Strategies within the Back River Watershed

D. BALTIMORE HARBOR WATERSHED

D.1. Watershed Description

The Baltimore Harbor watershed encompasses 90 square miles within Anne Arundel County, Baltimore County, and Baltimore City. The watershed is located in the Western Shore region of Maryland south of the Back River watershed and ultimately drains into the Chesapeake Bay. Tributaries of the Baltimore Harbor watershed include Gwynns Falls, Jones Falls, Bear Creek, and Curtis Bay/Creek. The areas of focus for the TMDLs in this watershed are within the subwatersheds of Baltimore Harbor Embayment, Bear Creek, Curtis Creek, Furnace Creek, and Marley Creek in Baltimore and Anne Arundel counties.

There are 1,258 miles of MDOT SHA roadway located within the Baltimore Harbor watershed. The associated ROW encompasses 2,374 acres, of which 1,031 acres are impervious. MDOT SHA facilities located within the watershed consist of two (2) salt storage facilities, one (1) highway garage or shop, one (1) highway office or lab, and one (1) weigh station located outside of the MDOT SHA MS4 Permit coverage area. See **Figure 4-10** for a map of the 8-digit Baltimore Harbor watershed with MDOT SHA facilities indicated.

D.2. MDOT SHA TMDLs within Baltimore Harbor Watershed

MDOT SHA is included in both PCBs (MDE, 2012b) and bacteria (MDE, 2011b) TMDLs. PCBs are to be reduced by 91.1% in the Baltimore Harbor Embayment, Anne Arundel County, 91.4 percent in the Baltimore Harbor Embayment, Baltimore County, 93.5 percent in the Curtis Creek subwatershed, and 91.5 percent in the Bear Creek subwatershed as shown in **Table 3-2**. Bacteria must be reduced by 75.8 percent in the Marley Creek subwatershed and 77.8 percent in the Furnace Creek subwatershed as shown in **Table 3-3**.

D.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Baltimore Harbor watershed is shown in **Figure 4-11** which illustrates that 42 grid cells have been reviewed, encompassing portions of 30 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 236 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 26 new structural SW controls constructed or under contract.
- 79 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 131 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 158 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 69 sites constructed or under contract.
- Three (3) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 86 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified five (5) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Five (5) sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 114 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 37 new structural SW controls constructed or under contract.
- Three (3) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 74 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 163 outfalls potential for stabilization. Further analysis of these sites resulted in:

- Six (6) outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- 157 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 26 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of three (3) existing structural SW controls constructed or under contract.
- One (1) retrofit site deemed potentially viable for retrofit and pending further analysis may be a candidate for future restoration opportunities.
- 22 retrofit sites deemed not viable for retrofit and have been removed from consideration.

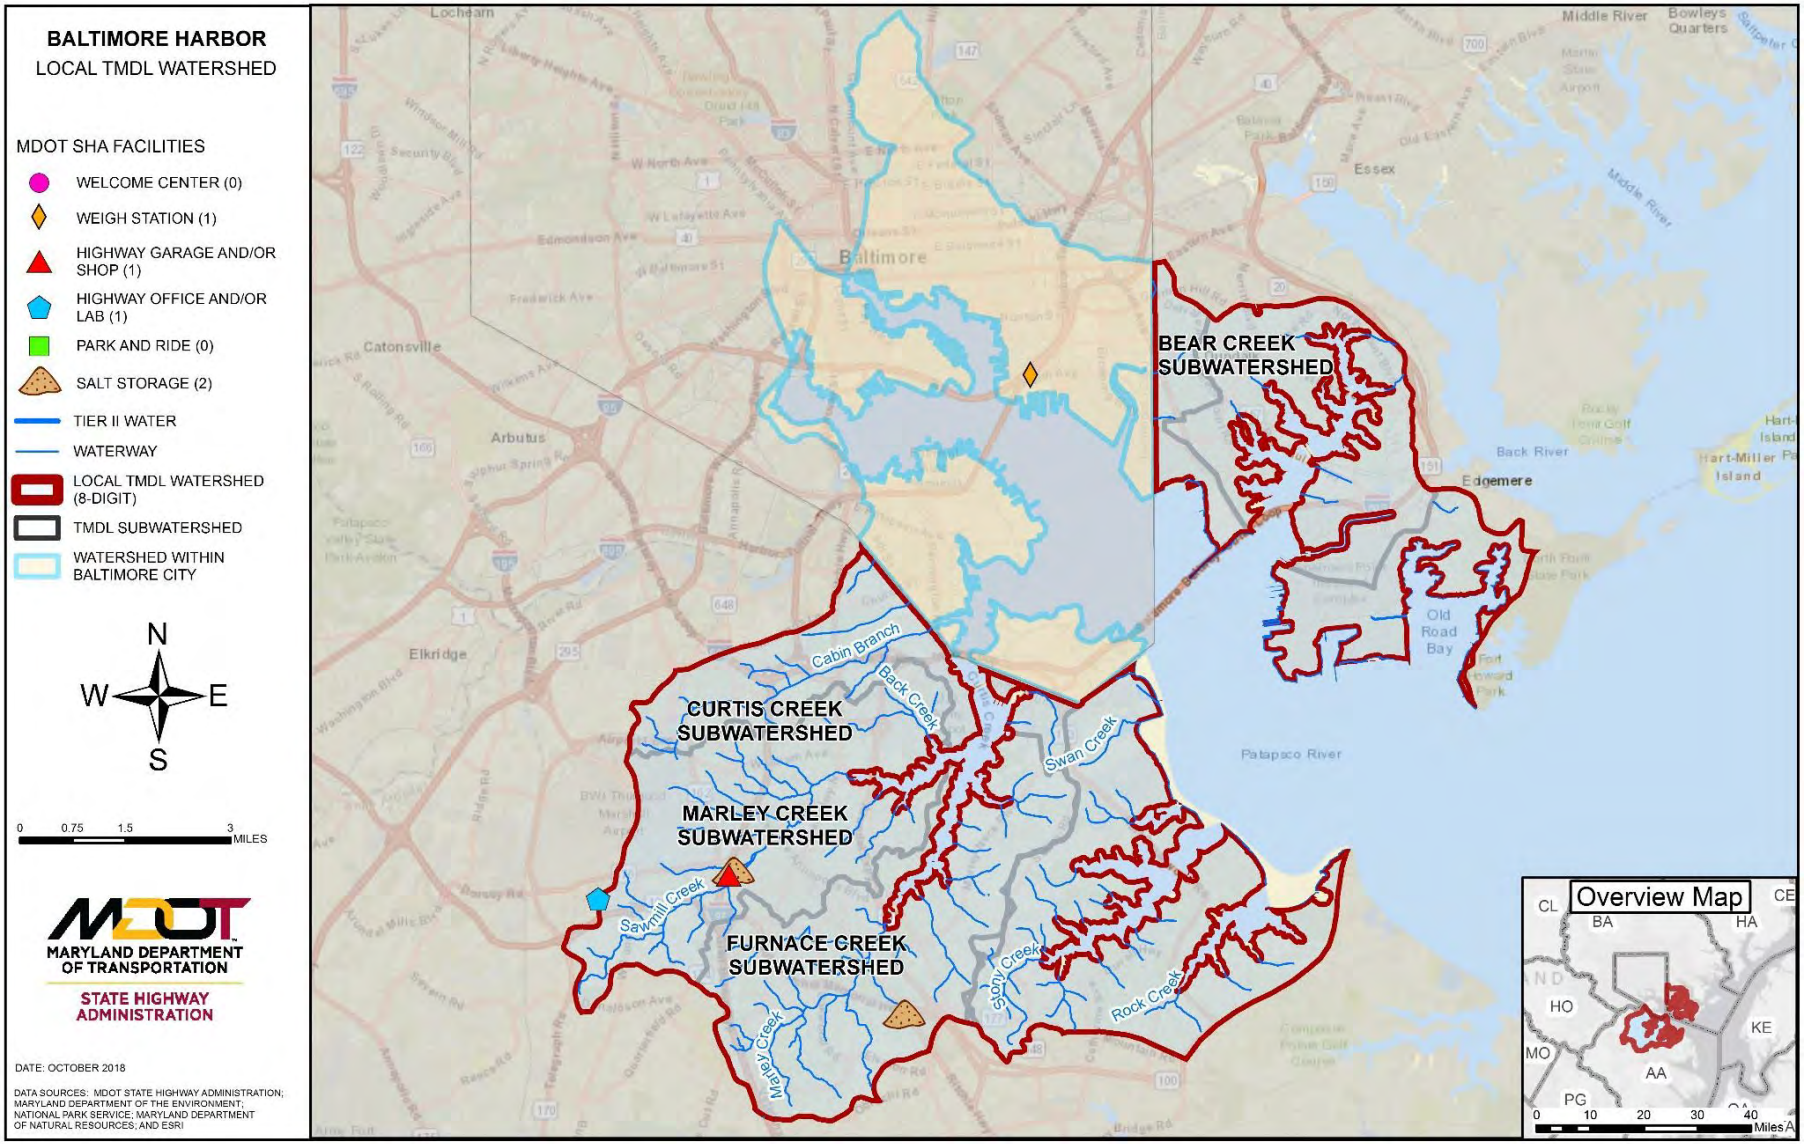


Figure 4-10: Baltimore Harbor Watershed

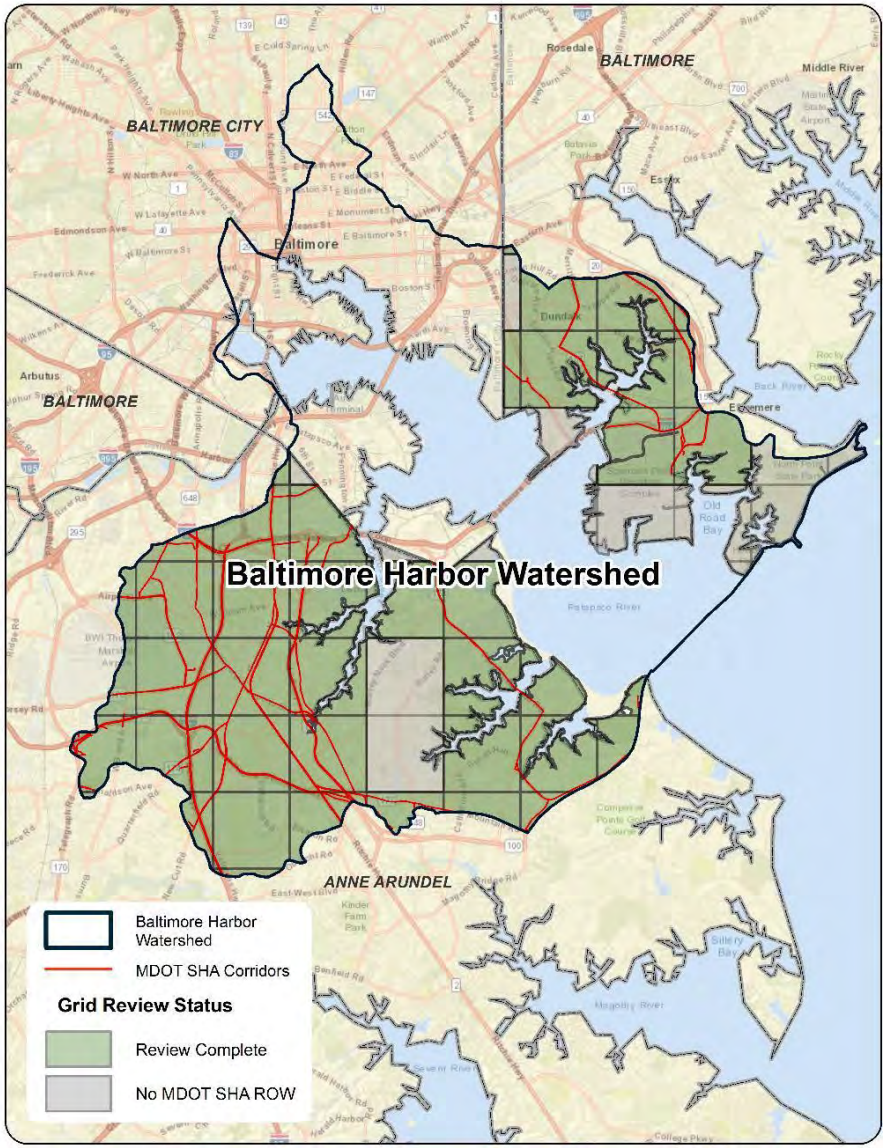


Figure 4-11: Baltimore Harbor Site Search Grids

D.4. Summary of County Assessment Review

Waters within the Baltimore Harbor watershed are subject to the following impairments as noted on MDE's 303(d) List.

- Chlordane;
- Chlorides;
- Chromium;
- Copper;
- Cyanide;
- Debris/Floatables/Trash;
- Enterococcus;
- Lead (sediments);
- Nitrogen;
- PCB in Fish Tissue;
- PCBs – Sediment and Fish Tissue;
- Phosphorus (Total);
- Sulfates;
- TSS; and
- Zinc (sediments).

In 2012, the Baltimore County Department of Environmental Protection and Sustainability published the *Bear Creek/Old Road Bay Small Watershed Action Plan* (PB, 2012). Within the Bear Creek subwatershed, Sparrows Point and the area immediately surrounding Colgate Creek and Peach Orchard Cove received a "very high" prioritization ranking for restoration. Out of these three areas, Sparrows Point ranked first in need of prioritization because it is almost entirely comprised of industrial land uses and because the EPA and MDE has documented contamination issues there. Colgate Creek and Peach Orchard Cove areas were ranked second and third, respectively, in terms of priority for restoration in part because both areas include environmental justice areas of concern (PB, 2012). In this SWAP, the County discusses and provides maps of all restoration

opportunities in the Bear Creek subwatershed that are most likely to limit pollution sources and help implement pollution reduction. The types of restoration opportunities identified include downspout redirect, tree planting, street sweeping, parking lot/alley retrofits, and bayscaping (PB, 2012).

Anne Arundel County's Department of Public Works participated in a collaborative effort to prepare the *Patapsco Tidal and Bodkin Creek Watershed Assessment* (LimnoTech & Versar, 2012). The assessment determines the condition and prioritizes watershed management activities for areas within the Baltimore Harbor watershed. Bodkin Creek watershed is also included in the County's assessment, but is not part of the Baltimore Harbor 8-digit watershed area.

The majority of soils within the Patapsco Tidal subwatersheds are highly erodible (58 percent). Residential land cover dominates the Patapsco Tidal watershed (40 percent), attributing to 30 percent impervious area over the entire watershed.

Both Patapsco Tidal and Bodkin Creek watersheds fall within the Patapsco River Mesohaline segmentshed which has Chesapeake Bay TMDLs for phosphorus, nitrogen, and TSS and a Baltimore Harbor (Anne Arundel, Baltimore, Carroll, and Howard Counties and Baltimore City) TMDL for nitrogen and phosphorus. The Patapsco River Mesohaline segmentshed also has a Category Five impairment listing (i.e., TMDL required) for *Enterococcus* in tidal waters upstream of the Harbor Tunnel. Approximately 16 percent of the streams evaluated in the Patapsco Tidal watershed were classified as "severely degraded" by the Maryland Physical Habitat Index. Three subwatersheds were identified to have the highest percentages of stream reaches that were either "degraded" or "severely degraded": Cabin Branch 2, Marley Creek 1, and Cabin Branch.

The County identified five subwatersheds within the Patapsco Tidal watershed with more than one-third of their perennial streams rated as "high" or "medium high" for restoration need: Cabin Branch (PT3), Cabin Branch 2 (PT2), Marley Creek 1 (PT8), Marley Creek 3 (PTF), and Sawmill Creek 1 (PT7). Six subwatersheds were identified in Patapsco Tidal for BMP implementation: Marley Creek 3 (PTF), Furnace Creek (PT5), Cabin Branch (PT3), Sawmill Creek 1 (PT7), Back Creek (PTC), and Marley Creek 2 (PTE).

The County suggests the following BMPs for the Patapsco Tidal and Bodkin Creek watersheds:

- Outfall retrofits – all major outfalls characterized by the IMD as impaired;
- Stormwater pond retrofits – all ponds constructed prior to 2002 with a drainage area greater than 10 acres;
- Stream restoration – targeting degraded and severely degraded reaches;
- Street Sweeping – all closed curbed County roads;
- Inlet cleaning – vacuum cleaning stormwater curb inlets and catch basins;
- Public land reforestation; and
- ESD retrofit to the MEP – including green roofs, permeable pavement, bioretention, etc.

The County ranked several stream reaches based on priority for restoration as shown in **Table 4-15**, with the value one being the highest priority:

Table 4-15: Anne Arundel County Identified Priority Areas for Treatment

Priority	Watershed	Subwatershed	Reach
1	Patapsco Tidal	Marley Creek 3	PTF016
3	Patapsco Tidal	Rock Creek	PTB048
4	Patapsco Tidal	Cabin Branch 2	PT2026
4	Patapsco Tidal	Cabin Branch	PT3039
10	Patapsco Tidal	Marley Creek 4	PTG086
10	Patapsco Tidal	Cabin Branch	PT3010

Source: LimnoTech & Versar (2012), Map 4.1

D.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet PCB reduction in the Baltimore Harbor Embayment, Bear Creek, and Curtis Creek/Bay subwatersheds are shown in **Tables 4-16**, **4-17**, and **4-18**, respectively. Proposed practices to meet bacteria reduction in the Furnace Creek and Marley Creek subwatersheds are shown in **Table 4-19** and **Table 4-20.** Projected reductions are shown in **Table 3-2**. Four timeframes are included in the tables:

- BMPs implemented before the baseline year. In this case, the PCB baseline is 2004 and the bacteria baseline is 2006;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Baltimore Harbor watershed total $12,399,000. They are based on average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-21** for a summary of estimated BMP costs.

Figure 4-12 shows a map of MDOT SHA's restoration practices in the watersheds and includes those that are under design or construction. Inlet cleaning is not reflected on this map.

Table 4-16: Baltimore Harbor Embayment Restoration PCB BMP Implementation

BMP	Unit	Baseline (Before 2004)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	6.1			TBD	6.1
Inlet Cleaning[1]	dry tons		1.2	70.0	TBD	71.2
Street Sweeping[1]	acres swept		4.4		TBD	4.4
Load Reductions	PCB g/yr.		1.36	1.36	5.65	
				Total Projected Reduction	**5.65**	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-17: Bear Creek Restoration PCB BMP Implementation						
BMP	**Unit**	**Baseline (Before 2004)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	10.1			TBD	10.1
Inlet Cleaning[1]	dry tons		4.6	26.8	TBD	31.4
Street Sweeping[1]	acres swept		11.0		TBD	11.0
Load Reductions	PCB g/yr.		0.64	0.64	5.79	
				Total Projected Reduction	**5.79**	
[1] Inlet cleaning and street sweeping are annual practices.						

Table 4-18: Curtis Creek/Bay Restoration PCB BMP Implementation						
BMP	**Unit**	**Baseline (Before 2004)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	1,299.7	32.2		TBD	1,331.9
Retrofits	drainage area acres		191.2		TBD	191.2
Inlet Cleaning[1]	dry tons		5.3	1.3	TBD	6.6
Load Reductions	PCB g/yr.		1.39	1.39	29.26	
				Total Projected Reduction	**29.26**	
[1] Inlet cleaning is an annual practice.						

Table 4-19: Baltimore Harbor – Furnace Creek Restoration Bacteria BMP Implementation						
BMP	**Unit**	**Baseline (Before 2004)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	453.0	1.0	6.9	TBD	460.9
Retrofits	drainage area acres		46.4		TBD	46.4
Load Reductions	Enterrococci Billion counts/ day		1,300	1,300	3226,525	
					Total Projected Reduction	**26,525**

Table 4-20: Baltimore Harbor – Marley Creek Restoration Bacteria BMP Implementation						
BMP	**Unit**	**Baseline (Before 2006)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	562.0	1.6		TBD	563.6
Retrofits	drainage area acres		109.3		TBD	109.3
Load Reductions	Enterrococci Billion counts/ day		3,050	3,050	15,678	
				Total Projected Reduction	**15,678**	

Table 4-21: Baltimore Harbor Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$3,815,000		$3,815,000
Retrofits	$7,944,000		$7,944,000
Inlet cleaning	$56,000	$560,000	$616,000
Street Sweeping	$24,000		$24,000
Total			$12,399,000

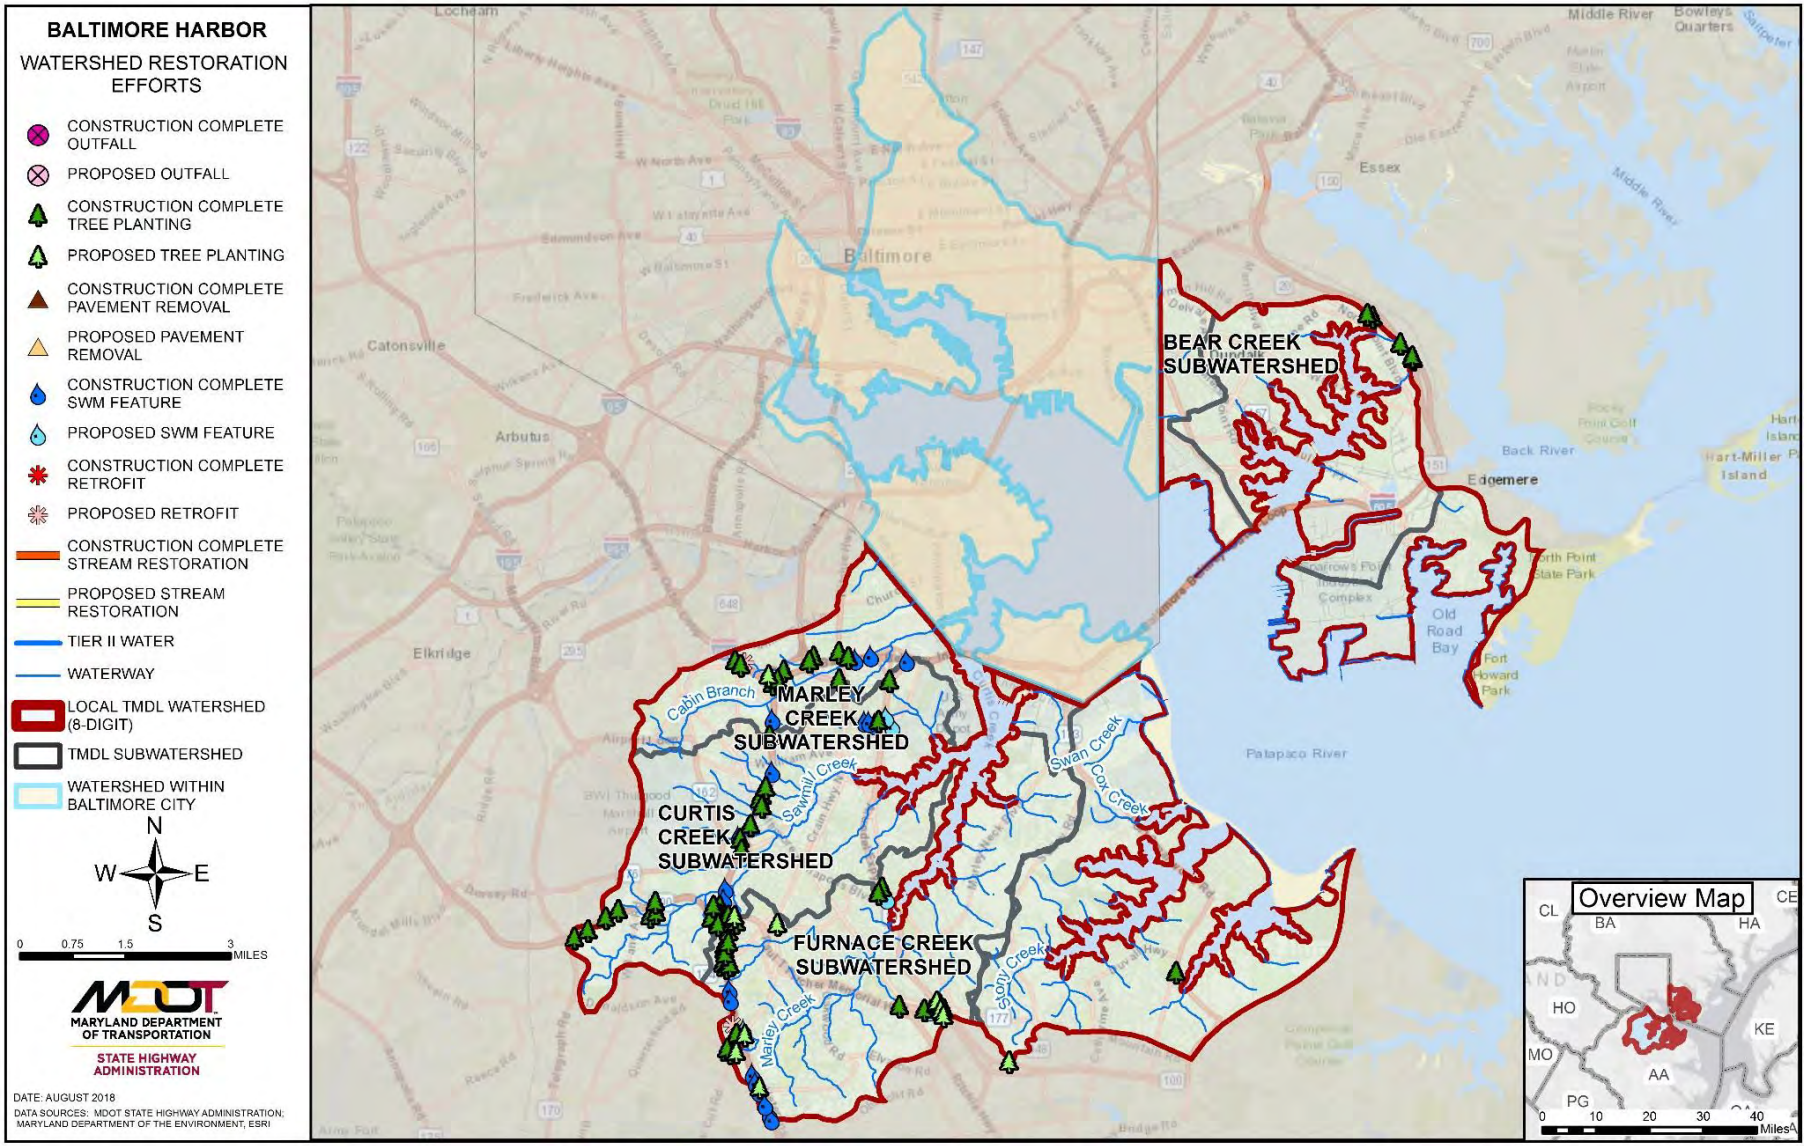


Figure 4-12: MDOT SHA Restoration Strategies within the Baltimore Harbor Watershed

E. BUSH RIVER SEGMENTSHED IMPLEMENTATION PLAN

E.1. Segmentshed Description

Areas draining to the Bush River Oligohaline Segment will be referred to as the Bush River segmentshed. The Bush River Oligohaline Segment will be hereinafter referred to as the Bush River. The Bush River is an estuary that extends south from the community of Riverside for approximately nine miles to the Chesapeake Bay. Three 8-digit watersheds compose the Bush River segmentshed: Winters Run watershed (the Atkisson Reservoir watershed and the Lower Winters Run watershed are collectively known as the Winters Run watershed), Bynum Run watershed, and Bush River watershed (excludes the Romney Creek drainage area). The Bush River segmentshed is located entirely within Harford County, Maryland and encompasses approximately 130 square miles. Tributaries of the Bush River segmentshed include Winters Run, Bynum Run, Broad Run, James Run, Grays Run, and Cranberry Run.

There are 228 centerline miles of MDOT SHA roadway located within the Bush River segmentshed. The associated ROW encompasses 1,843 acres, of which 796 are impervious. MDOT SHA facilities located within the Bush River segmentshed consist of one (1) welcome center, two (2) salt storage facilities and eight (8) park and ride facilities. See **Figure 4-13** for a map of MDOT SHA facilities with the Bush River segmentshed.

E.2. MDOT SHA TMDLs within Bush River Segmentshed

MDOT SHA is included in the PCB TMDL (MDE, 2016d) with a reduction requirement of 62 percent, as shown in **Table 3-2**.

E.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan, Section C** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Bush River watershed is shown in **Figure 4-14** which illustrates that 65 grid cells have been reviewed, encompassing portions of nine (9) state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 343 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- Five (5) new structural SW controls constructed or under contract.
- 46 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 292 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 25 locations as potential tree planting locations. Further analysis of these locations resulted in:

- Seven (7) sites constructed or under contract.

- Four (4) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 14 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified one (1) site as a potential stream restoration location. Further analysis of this location resulted in:

- One (1) site deemed not viable for stream restoration and has been removed from consideration.

Grass Swale Rehabilitation

No grass swale rehabilitation sites were identified within this watershed for potential restoration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified six (6) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Six (6) retrofit sites deemed not viable for retrofit and have been removed from consideration.

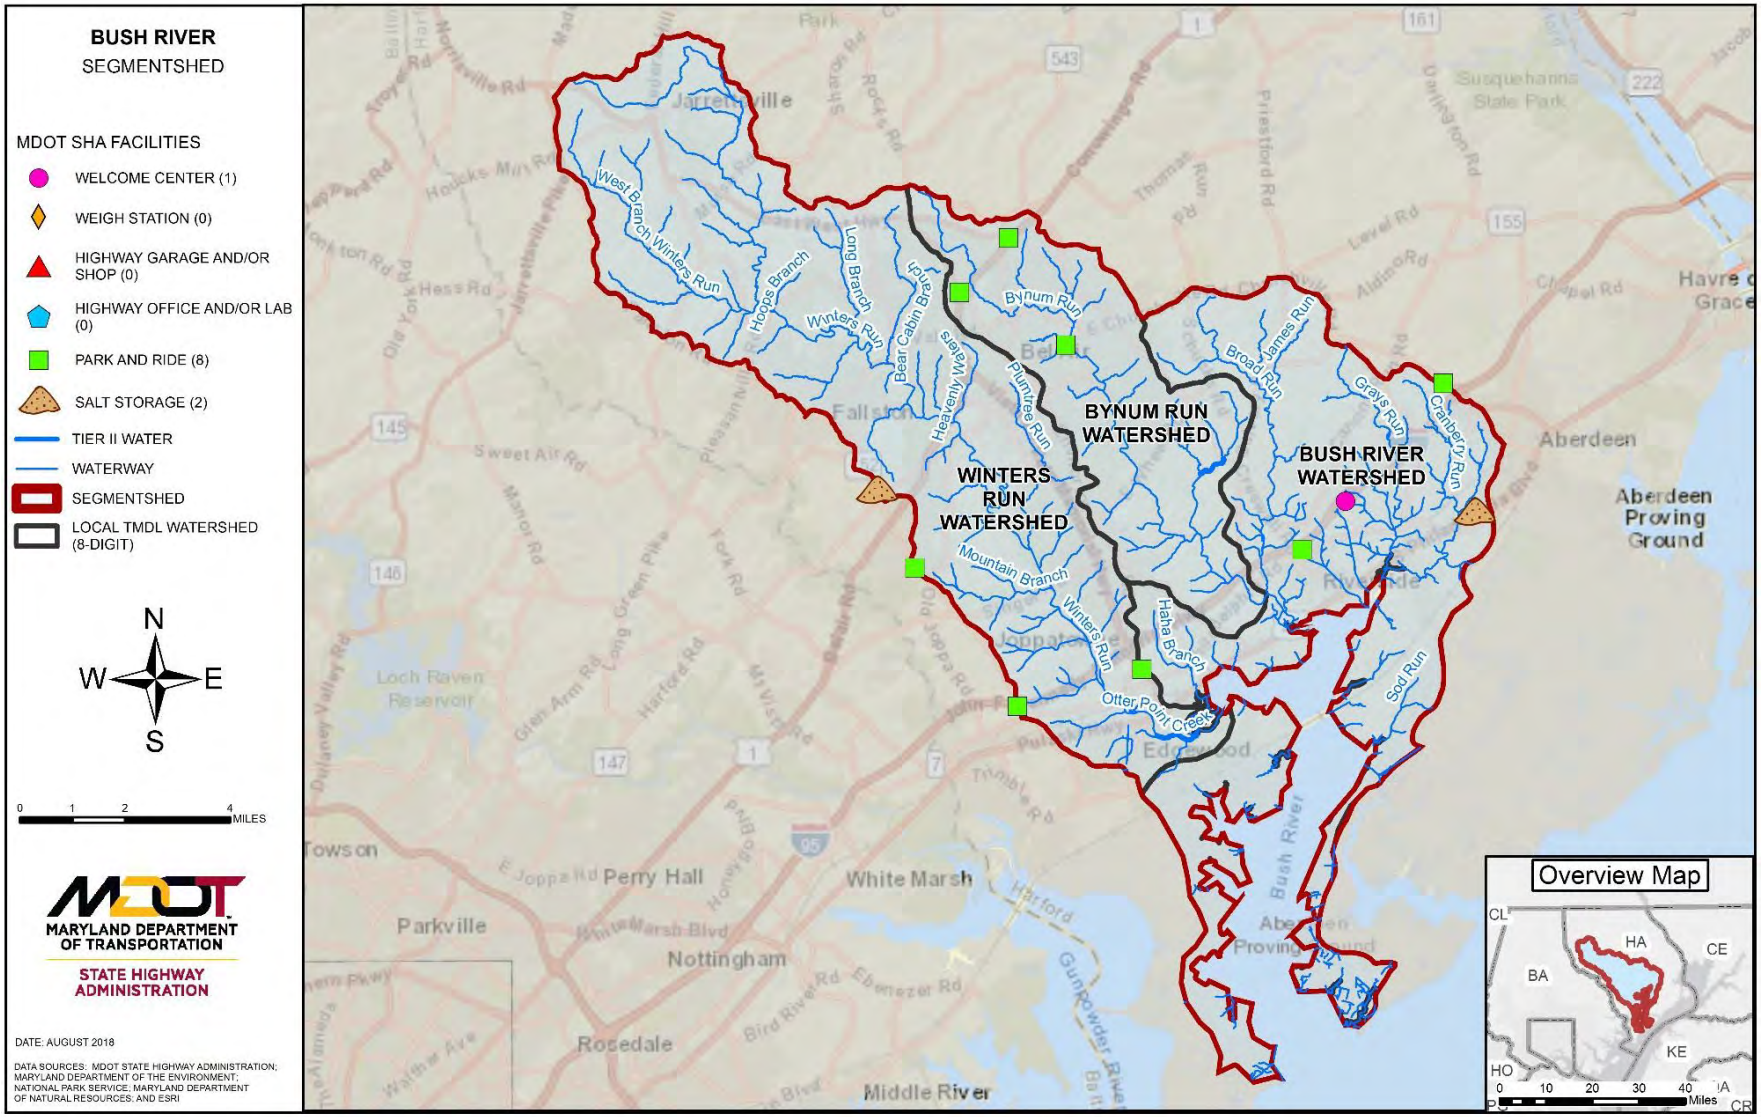


Figure 4-13: Bush River Segmentshed

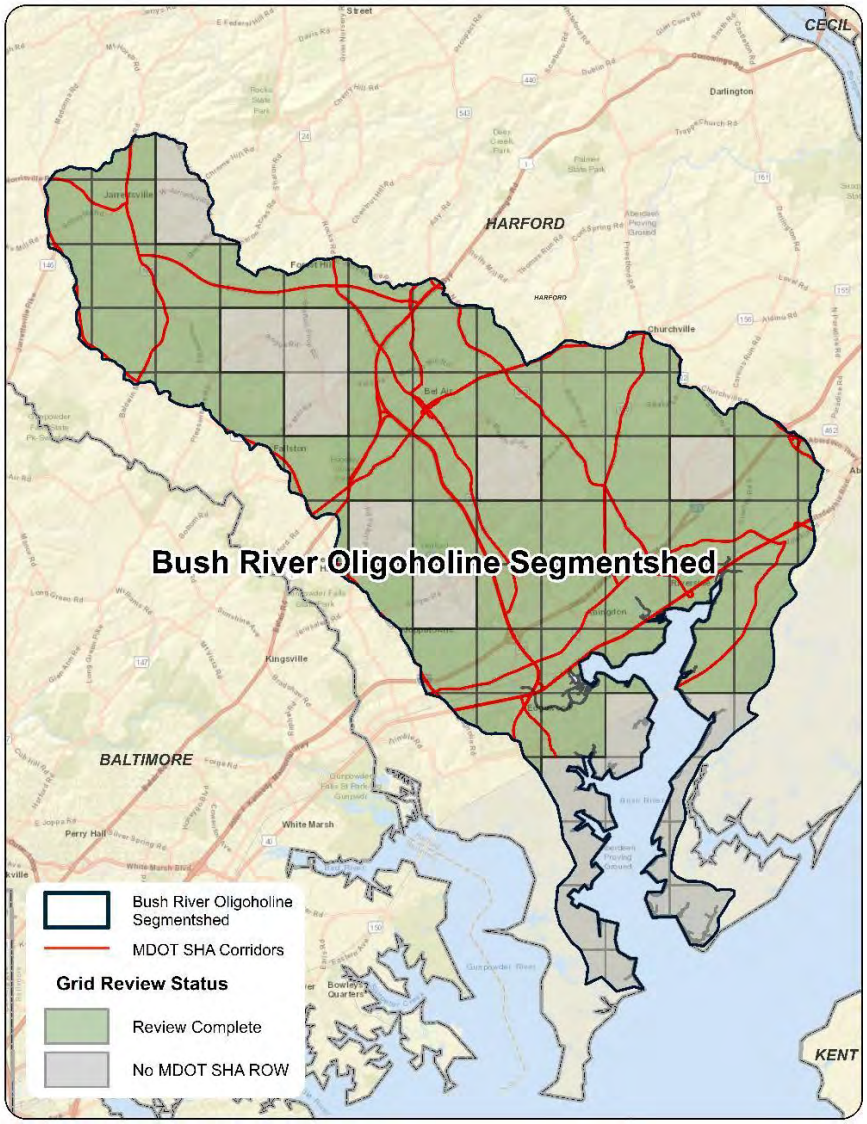


Figure 4-14: Bush River Segmentshed Site Search Grids

E.4. Summary of County Assessment Review

The designated use of the waters of the Bush River (8-digit Basin Code: 02130701) is Use II – Support of Estuarine and Marine Aquatic Life and Shellfish Harvesting (MDE, 2016d). Waters within the Bush River segmentshed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- Nitrogen (Total);
- PCB in Fish Tissue;
- Phosphorus (Total);
- Sulfates; and
- TSS.

Prepared by the Center for Watershed Protection (CWP) for the Harford County Department of Public Works, the 2003 *Bush River Watershed Management Plan* (WAMP) (hereinafter referred to as the "Bush River WAMP") serves as Harford County's overall assessment of the Bush River segmentshed (CWP, 2003). While the Bush River WAMP contained analysis on all three 8-digit watersheds (Winters Run, Bynum Run, and Bush River) within the Bush River segmentshed, the study area did not extend along the Bush River to the Chesapeake Bay. More recently, Harford County published the *Bush River Watershed Total Maximum Daily Load (TMDL) Restoration Plan for PCBs* (HA-DPW, 2017)—hereinafter the "Bush River PCBs Restoration Plan"—in response to the 2016 Bush River Oligohaline Segment PCBs TMDL (MDE, 2016d). The following is a summary of both documents, beginning with the Bush River WAMP.

The Bush River WAMP was developed using a watershed "vulnerability analysis," a tool that is often used when assessing large watersheds. The vulnerability analysis is designed to identify subwatersheds that are most vulnerable to current and future land development and management problems. Accordingly, the CWP worked with Harford County staff to delineate the study area into 19

subwatersheds for analysis and assessment. The delineations generally aligned with distinct land uses within the study area. This method was particularly helpful because the area serves a wide range of diverse land uses such as urban, agriculture, forest, and wetlands. The complexity of the Bush River segmentshed is further evidenced by its location within two Maryland physiographic regions (Piedmont Plateau and Coastal Plain), its inclusion of both tidal and non-tidal waters, and its susceptibility to development pressures. Overall, the Bush River segmentshed impairments generally involve excess nutrients, poor habitat quality, and channel instability.

Regarding the impact of development, the Bush River WAMP emphasized the impact of increased development and urbanization on the area, noting that a significant portion is within the "development envelope." The "development envelope" refers to Harford County's highly developed residential and industrial area that follows the Route 40/I-95 corridor and extends northward to include the Route 24/Bel Air corridor. According to the Bush River WAMP, an increase in development will exacerbate current problems such as the delivery of large amounts of sediment, nutrients, and bacteria from the Winters Run and Bynum Run tributaries to Bush River. Because urbanization and development is expected to increase, a main goal of the Bush River WAMP is to identify which subwatersheds should be evaluated for protection against future development.

Of the 19 subwatersheds within the Bush River WAMP study area, nine are in the Winters Run watershed (West Branch, East Branch, Bear Cabin, Upper Winters Direct Drainage [DD], Middle Winters DD, Lower Winters DD, Mountain Branch, Plumtree Run, Otter Point DD), four are in the Bynum Run watershed (Upper Bynum, Middle Bynum, Lower Bynum, Little East Bynum), and six are in the Bush River watershed (James Run, Grays Run, Cranberry Run, Church Creek DD, Bush Creek DD, Haha Branch).

The existing data, impervious cover calculations, and several field verifications (evaluations of stream habitat, contiguous forest, and wetlands) determined that there are four different subwatershed types (also known as subwatershed "management categories") within the Bush River segmentshed: 1) Sensitive, 2) Impacted, 3) Rurally Impacted, and 4) Impacted Special Resource. The Bush River WAMP provided the following definitions for these four subwatershed types/management categories (CWP, 2003):

- **Sensitive:** Subwatersheds that have an impervious cover of 0 to 10 percent. Streams in these subwatersheds are of high quality (i.e., stable channels, excellent habitat structure, good to excellent water quality, diverse communities of aquatic species). The primary goal for these subwatersheds is to maintain predevelopment stream biodiversity and channel stability.

- **Impacted:** Subwatersheds that have an impervious cover ranging from 11 to 25 percent and show obvious signs of degradation due to watershed urbanization. Greater storm flows have started to alter stream geometry and both erosion and channel widening are readily apparent. Stream banks are unstable and there is noticeably less physical habitat and biodiversity in the streams.

- **Rurally Impacted:** Subwatersheds that have an impervious cover of 0 to 10 percent, but may have a degraded riparian zone and isolated stream bank erosion due to livestock access and grazing/cropping practices. The streams, however, tend to recover once the riparian management improves.

- **Impacted Special Resource:** Subwatersheds that have an impervious cover ranging from 11 to 25 percent, but also have notable natural resource areas such as tidal waters, contiguous forest, and high quality wetlands. The primary goal for these subwatersheds is to maintain the present status of these significant natural resource areas through conservation, restoration, and stormwater retrofits.

When these definitions were applied to the 19 subwatersheds, the three watersheds within the Bush River segmentshed contained the following subwatershed types/management categories:

The Winters Run watershed had:

- 4 Sensitive subwatersheds (East Branch, Bear Cabin, Upper Winters DD, Mountain Branch);
- 3 Impacted subwatersheds (Middle Winters DD, Lower Winters DD, Plumtree Run);
- 1 Rurally Impacted subwatershed (West Branch); and
- 1 Impacted Special Resource subwatershed (Otter Point DD).

The Bynum Run watershed had:

- 3 Impacted subwatersheds (Upper Bynum, Middle Bynum, Lower Bynum); and
- 1 Rurally Impacted subwatershed (Little East Bynum).

The Bush River watershed had:

- 2 Sensitive subwatersheds (Grays Run, James Run);
- 1 Impacted subwatershed (Cranberry Run); and
- 3 Impacted Special Resource subwatersheds (Church Creek DD, Bush Creek DD, Haha Branch).

After all types/management categories were determined, the subwatersheds were prioritized. Priority was given to the most vulnerable subwatersheds so that Harford County can concentrate its resources on the subwatersheds that need immediate restoration and/or preservation actions. Out of the 19 subwatersheds, 10 priority subwatersheds were identified by the County: Grays Run, Little East Bynum, West Branch, Middle Bynum, Lower Bynum, Plumtree Run, Otter Point DD, Church Creek DD, Bush Creek DD, and Haha Branch (See **Table 4-22**). **Table 4-23** presents County-suggested BMPs for the entire Bush River segmentshed.

Table 4-22: County Identified Priority Areas for Treatment in the Bush River Segmentshed

Subwatershed Management Category	Priority Subwatershed	Watershed (within the Bush River Segmentshed)
Sensitive	Grays Run	Bush River
Impacted	Middle Bynum	Bynum Run
	Lower Bynum	Bynum Run
	Plumtree Run	Winters Run
Rurally Impacted	West Branch	Winters Run
	Little East Bynum	Bynum Run
Impacted Special Resource	Otter Point DD	Winters Run
	Bush Creek DD	Bush River
	Church Creek DD	Bush River
	Haha Branch	Bush River

Source: CWP (2003)

Table 4-23: County Suggested BMPs for the Bush River Segmentshed

Subwatershed Management Category	Recommendation
Sensitive	Preserve Contiguous Forests in all Sensitive Subwatersheds
Sensitive	Enhance Existing Riparian Buffer in all Sensitive Subwatersheds
Sensitive	Grays Run Contiguous Forest Preservation
Sensitive	Grays Run Stream Buffer Enhancement
Sensitive	Maintain Grays Run Sensitive Status
Sensitive	Field Verify and Prioritize Contiguous Forest Areas for Preservation
Impacted	Educate Residents on Watershed Stewardship in Impacted Subwatersheds
Impacted	Implement Stormwater Retrofits in Impacted Subwatersheds
Impacted	Conduct Stream Clean-ups in Lower and Middle Bynum
Impacted	Preserve Contiguous Forest in Lower Winters DD and Cranberry Run
Impacted	Investigate Other Stormwater Retrofit Opportunities in Impacted Subwatersheds
Rurally Impacted	Preserve Farmlands in Rurally Impacted Subwatersheds
Rurally Impacted	Restore Riparian Buffer in Rurally Impacted Subwatersheds
Rurally Impacted	Reduce Livestock Access in Little East Bynum
Rurally Impacted	Agricultural Practices Assessment in Rurally Impacted Subwatersheds
Rurally Impacted	Septic System Education in Rurally Impacted Subwatersheds
Impacted Special Resource	Preserve Large Wetland Tracts in Impacted Special Resource Subwatersheds
Impacted Special Resource	Implement Stormwater Retrofits in Impacted Special Resource Subwatersheds
Impacted Special Resource	Streambank Stabilization in Haha and Otter Point Subwatersheds
Impacted Special Resource	Develop a Heightened Plan Review in Impacted Special Resource Subwatersheds
Watershed-Wide	Establish an Implementation Committee
Watershed-Wide	Foster the Development of Bush River Watershed Association
Watershed-Wide	Create Watershed Stewardship Website
Watershed-Wide	Implement Recommendations of Harford County Site Planning Roundtable
Watershed-Wide	Establish an Adopt-a-Pond Program
Watershed-Wide	Improve ESC Implementation, Inspection, and Enforcement

Source: CWP (2003) (Recommendations reprinted from Table E1 in CWP (2003)

In 2017, Harford County took a closer look at the Bush River watershed with regard to PCBs in the Bush River PCBs Restoration Plan (HA-DCW, 2017). In this document, the County proposes to target TSS reductions as a surrogate to reducing PCBs directly since reduction of sediments has been shown to result in reduction of PCBs. For this effort, Harford County will focus on the Bynum Run watershed as it is the most urbanized watershed draining to Bush River (HA-DCW, 2017).

E.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet the PCB reduction in the Bush River segmentshed are shown in **Table 4-24**. Projected PCB reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the TMDL baseline. In this case, the baseline is 2010;
- BMPs built after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025,
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the PCB TMDL, MDOT SHA will meet 5.6 percent of the MDE 62.0 percent load reduction requirement through implementation of BMPs shown in **Table 4-24**. MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in Part III Section E.

Estimated Capital Budget costs to design and construct practices within the Bush River segmentshed total $ 5,346,000. These projected costs are based on an average cost per impervious acre treated that is derived from cost history for a group of completed projects for each BMP category. Please see **Table 4-25** for a BMP strategy cost breakdown.

Figure 4-15 shows a map of MDOT SHA's restoration practices in the segmentshed and includes those that are under design or construction. Inlet cleaning is not reflected on this map.

Table 4-24: Bush River Segmentshed Restoration PCB BMP Implementation						
BMP	**Unit**	**Baseline (Before 2010)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	564.0	41.6	16.6	TBD	622.2
Retrofit	drainage area acres		27.7		TBD	27.7
Inlet Cleaning[1]	dry tons		100.2	7.0	TBD	107.2
Load Reductions	PCB g/yr.		0.34	0.39	6.85	
				Total Projected Reduction	**6.85**	
[1] Inlet cleaning is an annual practice.						

Table 4-25: Bush River Segmentshed Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$3,756,000	$395,000	$4,151,000
Retrofits	$605,000		$605,000
Inlet cleaning	$550,000	$40,000	$590,000
Total			$5,346,000

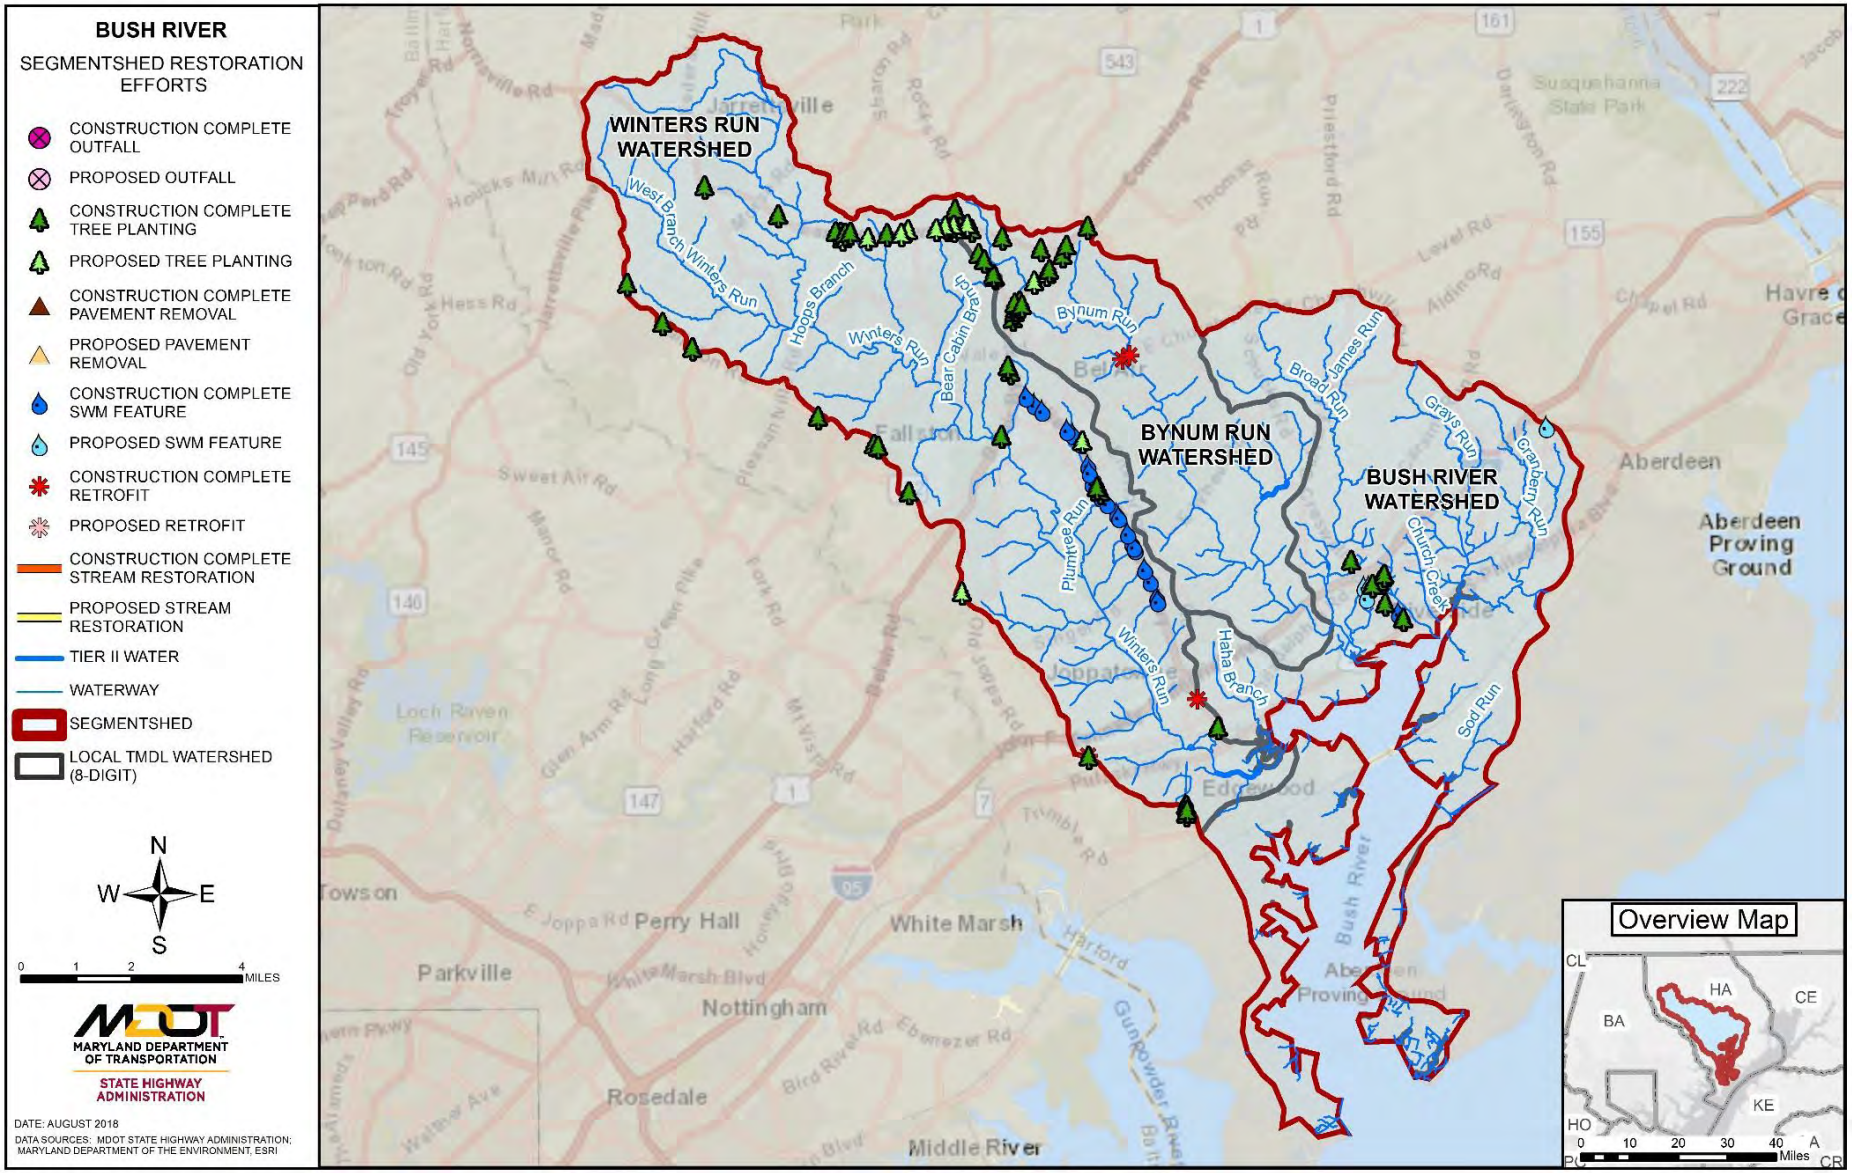


Figure 4-15: MDOT SHA Restoration Strategies within the Bush River Segmentshed

F. BYNUM RUN WATERSHED

F.1. Watershed Description

The Bynum Run watershed encompasses 23 square miles solely within Harford County, Maryland. Bynum Run is a stream that originates in the town of Forest Hill and flows 14 miles in a southeasterly direction until it empties into the tidally influenced Bush River. The Bush River ultimately flows into the Chesapeake Bay.

There are 220.2 miles of MDOT SHA roadway located within the Bynum Run watershed. The associated ROW encompasses 473.8 acres, of which 211.9 acres are impervious. MDOT SHA facilities located within the watershed consist of three (3) park and ride facilities. See **Figure 4-16** for a map of the watershed.

F.2. MDOT SHA TMDLs within Bynum Run Watershed

MDOT SHA is included in the sediment (TSS) TMDL (MDE, 2011c) with a reduction requirement of 19.3 percent as shown in **Table 3-2**.

F.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Bynum Run watershed is shown in **Figure 4-17** which illustrates that 21 grid cells have been reviewed, encompassing portions of nine (9) state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 145 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 58 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 87 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 60 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 26 sites constructed or under contract.
- Eight (8) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 26 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 10 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- 10 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified nine (9) sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Nine (9) sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

- No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 10 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of two (2) existing structural SW controls constructed or under contract.
- Five (5) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- Three (3) retrofit sites deemed not viable for retrofit and have been removed from consideration.

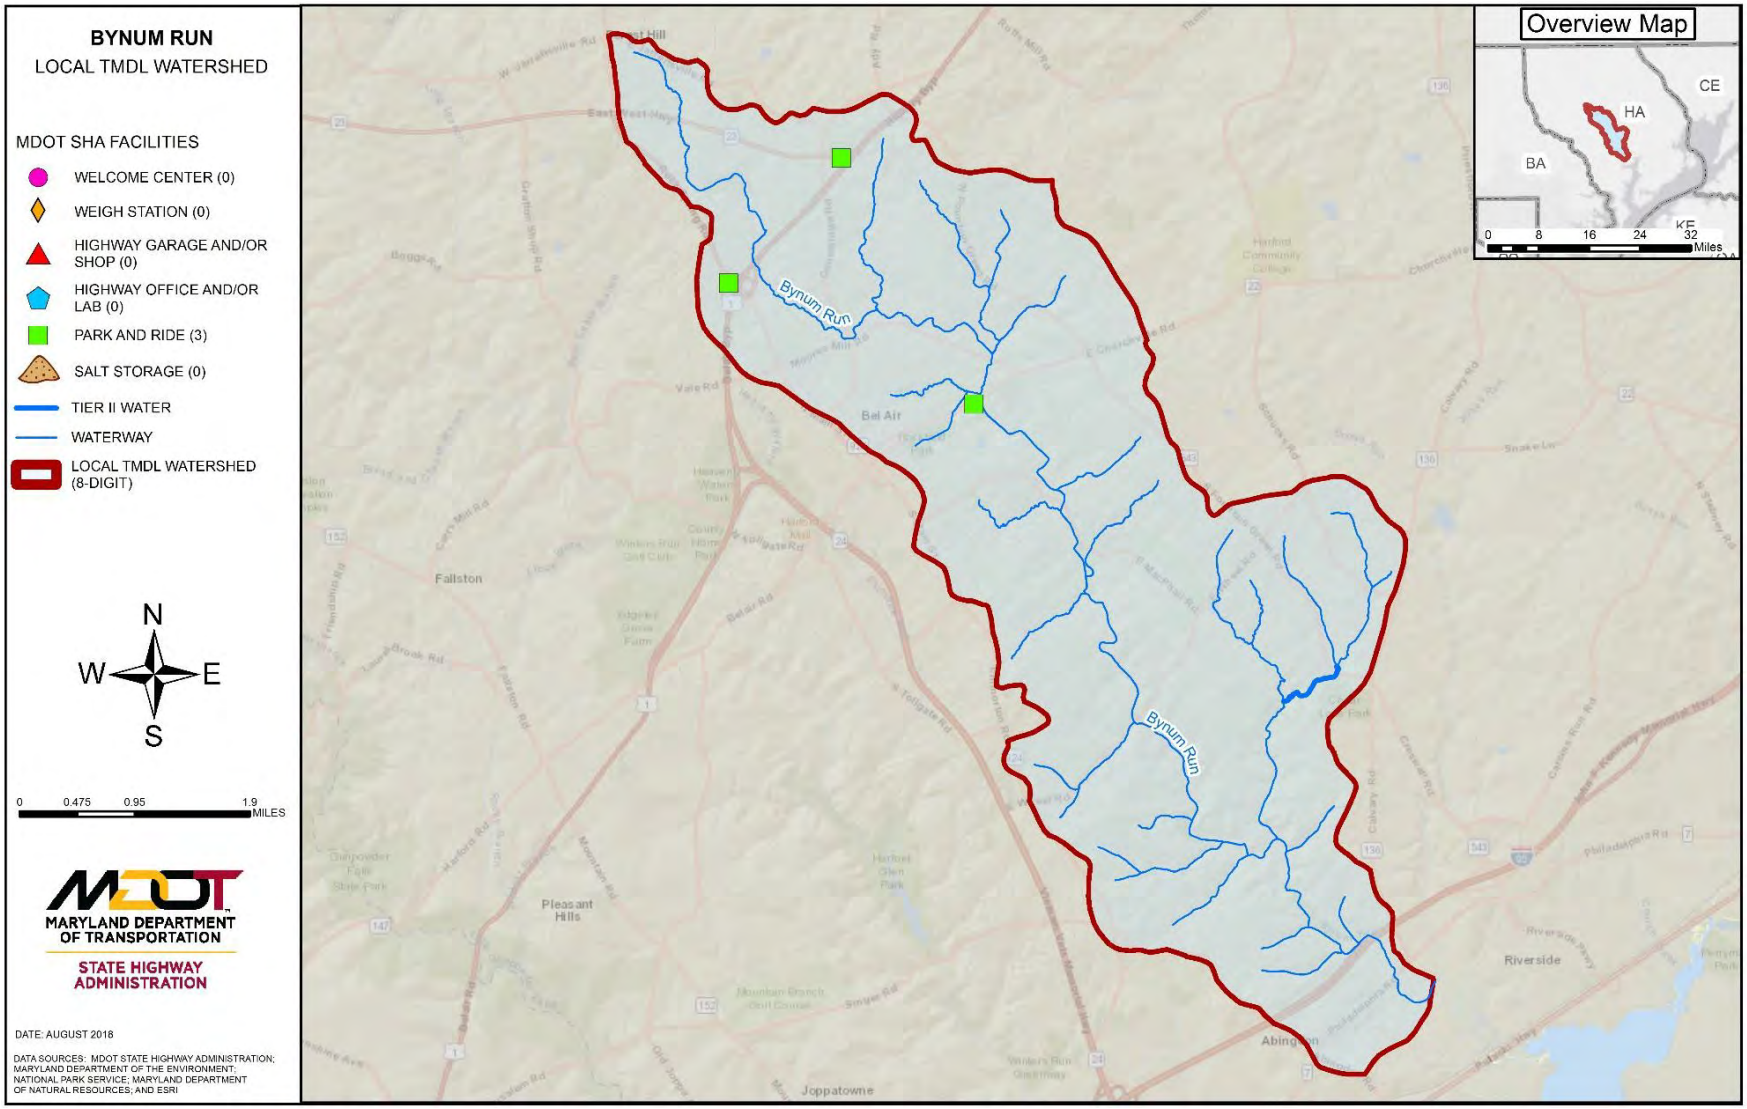


Figure 4-16: Bynum Run Watershed

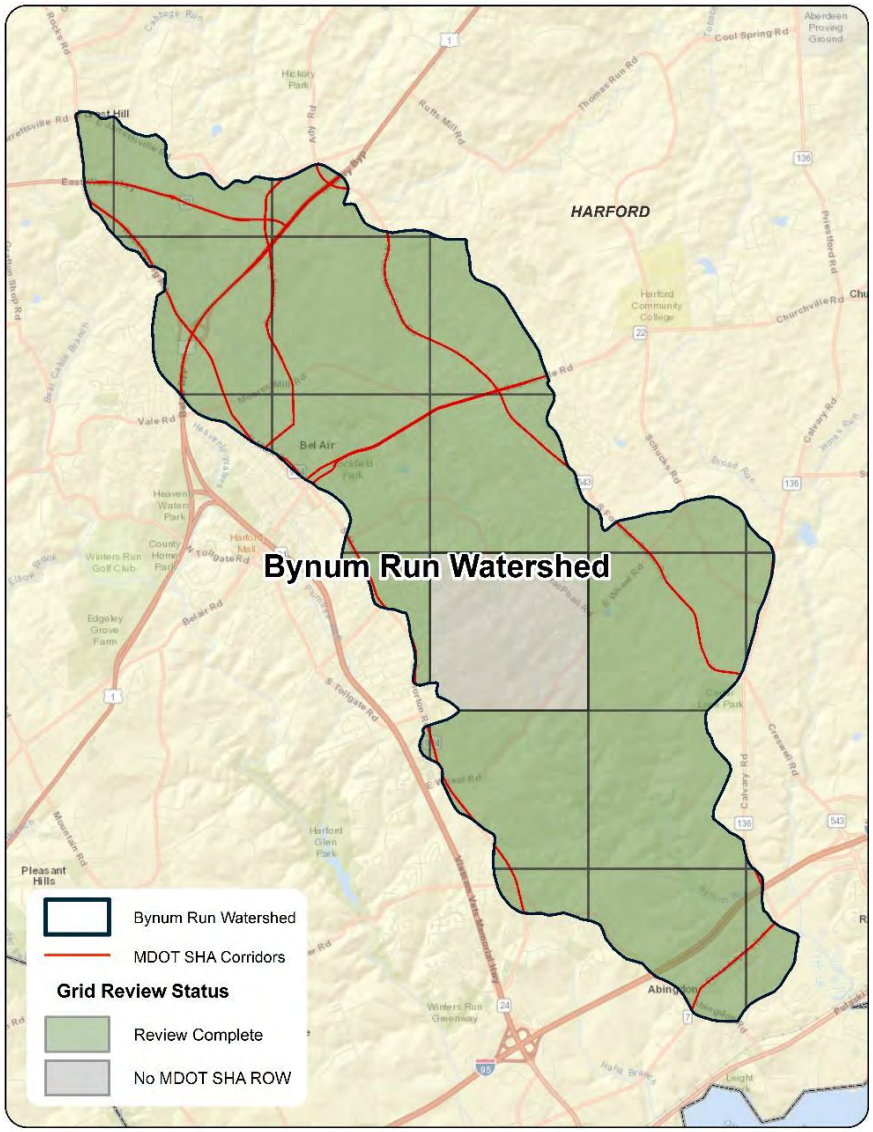


Figure 4-17: Bynum Run Site Search Grids

F.4. Summary of County Assessment Review

The waters within the Bynum Run watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Temperature, water; and
- TSS.

Overall, the Bynum Run watershed was studied and included in the 2003 Bush River WAMP (CWP, 2003); the Bush River WAMP was previously summarized herein in the above Bush River Oligohaline Segmentshed Plan. After the Bush River WAMP was published, the County responded to the 2011 Bynum Run Sediment TMDL (MDE, 2011c) with the 2016 *Bynum Run Watershed Total Maximum Daily Load Restoration Plan for Sediment* (URS, 2016), hereinafter the "Bynum Run Sediment Restoration Plan."

The Bynum Run watershed is the most urban watershed in Harford County, containing approximately 50% of the Town of Bel Air and 21% impervious surface (URS, 2016). Harford County considered proposed structural BMP projects identified on County-owned properties as "high priority." The Bynum Run Sediment Restoration Plan provides descriptions and locations of the proposed high priority projects. In addition to structural BMPs, alternative urban BMPs such as urban tree planting are also considered high priority (URS, 2016). Approximately 14 acres of open area are available for urban tree planting; locations of the Harford County properties within the watershed that are available for tree planting are included in Appendix A of the Bynum Run Sediment Restoration Plan (URS, 2016).

The Harford County Department of Public Works has also prepared the *Declaration Run and Riverside Watersheds Small Watershed Action Plan* (URS, 2014a) Declaration Run is within the Bynum Run watershed, and Riverside watershed is outside the Bynum Run watershed. The County has suggested implementing the following means to achieve watershed improvements using structural BMPs:

- Stream Restoration;
- Structural Projects;
- Wetland;
- Bioretention;
- Bioswale;
- Step pool conveyance system;
- Micropool;
- Green roofs;
- Green street bump out;
- Tree box filters; and
- Upgrade infiltration basin.

Nonstructural BMPs include:

- Public education and outreach;
- Preserving existing forested areas, especially stream buffers;
- Tree planting;
- Downspout disconnection;
- Reduction of impervious surfaces; and
- Curbcuts to direct stormwater runoff to open areas.

Although field observations determined there were no stormwater hotspots within the Declaration Run subwatershed, the County suggested the following specific project sites for additional SWM. BMP implementation and retrofits shown in **Tables 4-26**, **4-27**, and **4-28**. These sites have been prioritized based on the following criteria:

- Property ownership;
- Access to project site;
- Drainage area;
- Contributing impervious area;
- Cost;
- Utility impacts; and
- Environmental impacts.

Table 4-26: Declaration Run Priority Restoration Stream Restoration Projects

Stream Reach ID	Proposed Project	Location	Project Priority
Declaration Run Reach 1	Remediate headcuts with riffle grade control structures or step pools	Upstream Baneberry	High
Tributary DR5	Correct minor headcut with grade control structures; Remediate slope failure at storm drain outfall	Downstream of Baneberry Drive and north of and between Arabis Court and Germander Drive	High
Declaration Run Reach 2	Outfall stabilization	Downstream of Baneberry Drive and west of Arabis Court and Foxglove Court	High
Tributary DR9 Reach 1 and 2	Stream bank stabilization; Remove failed instream SWM feature; Remediate headcuts; Remediate storm drain outfall	Downstream of Riverside Parkway and east of Church Creek Elementary School toward Church Creek Road; Downstream of Church Creek Elementary School and upstream of Church Creek Road	High

Source: URS (2014a)

Table 4-27: Declaration Run Priority Restoration Structural Projects

Project ID	Proposed Project	Location	Project Priority
D-ES-2	Wetland	End of Oreganum Court	High
D-ES-5	Bioretention	North end of Foxglove Court	Low
D-ES-6	Bioretention	Germander Drive	Medium
D-ES-7	Bioswale and Bioretention	Germander Drive and Church Creek Road	High
D-ES-8	Wetland and Step pool conveyance system	Baneberry Drive	High
D-ES-12	Micropool and Wetland	End of Marigold Lane	Medium
D-ES-15	Bioretention	Procedure Way	High
D-NS-3	Green roofs	Liriope Court	Low
D-NS-4	Green street bump out	Church Creek Road	Medium
D-NS-7	Step pool conveyance system	Foxglove Court	Low
D-NS-8	Bioretention	Dalmation Place	High
D-NS-9	Tree box filters	Golden Rod Court	Low
D-NS-12	Bioretention or Tree box filters	Church Creek Elementary School	High
D-NS-13	Green street bump out	Church Creek Road	High
D-SWM0110 (ES-1)	Upgrade infiltration basin	Church Creek Elementary School	High

Source: URS (2014a)

Table 4-28: Declaration Run Priority Restoration Non-Structural Projects

Project ID	Proposed Project	Location	Project Priority
D-NS-1	Downspout disconnection	Golden Rod Court Neighborhood	NA
D-NS-2	Impervious surface reduction	Wide residential driveways on Marigold Lane	NA
D-NS-5	Curb cuts in parking lots to direct stormwater runoff to open areas	Sedum Square, Horner Lane, Downs Square, Baylis Court	NA
D-NS-6	Curb cuts in parking lots to direct stormwater runoff to open areas	Magness Court, Hampton Hall Court, Talbots Square	NA

Source: URS (2014a)

F.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reduction in the Bynum Run watershed are shown in **Table 4-29**. Projected sediment reduction using these practices is described in **Part III, Coordinated TMDL Implementation Plan** and is shown in **Table 3-2**. Three timeframes are included in the table below:

- BMPs built before the TMDL baseline. In this case, the baseline is 2005;
- BMPs built after the baseline through fiscal year 2018; and

- BMPs built after fiscal year 2018 through 2030, the projected target date. MDOT SHA will accomplish the projected reduction to be achieved as a percent of the baseline load presented in **Table 3-2**. The reduction is expected to meet MDE's 19.3% load reduction requirement.

Estimated Capital Budget costs to design and construct practices within the Bynum Run watershed total $ 1,862,000. These projected costs are based on an average cost per impervious acre treated that is derived from cost history for a group of completed projects for each BMP category. Please see **Table 4-30** for a BMP strategy cost breakdown.

Figure 4-18 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or constructed. Inlet cleaning is not reflected on this map.

Table 4-29: Bynum Rum Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	123.7	0.7	4.6	N/A	129.0
Retrofit	drainage area acres		11.5		N/A	11.5
Tree Planting	acres of tree planting		25.1	0.8	N/A	25.9
Stream Restoration	linear feet			246.0	N/A	246.0
Outfall Stabilization	linear feet			307.5	N/A	307.5
Inlet Cleaning[1]	dry tons		30.2			30.2
Load Reductions	TSS EOS lbs/yr.		16,469	43,240	0	
				Total Projected Reduction	**43,240**	

[1] *Inlet cleaning is an annual practice.*

Table 4-30: Bynum Run Restoration BMP Cost

BMP	Progress (2005 – FY18)	2025	Total
New Stormwater		$34,000	$34,000
Retrofits	$100,000		$100,000
Tree Planting	$768,000	$25,000	$793,000
Stream Restoration		$164,000	$164,000
Outfall Stabilization		$605,000	$605,000
Inlet cleaning	$166,000		$166,000
Total			$1,862,000

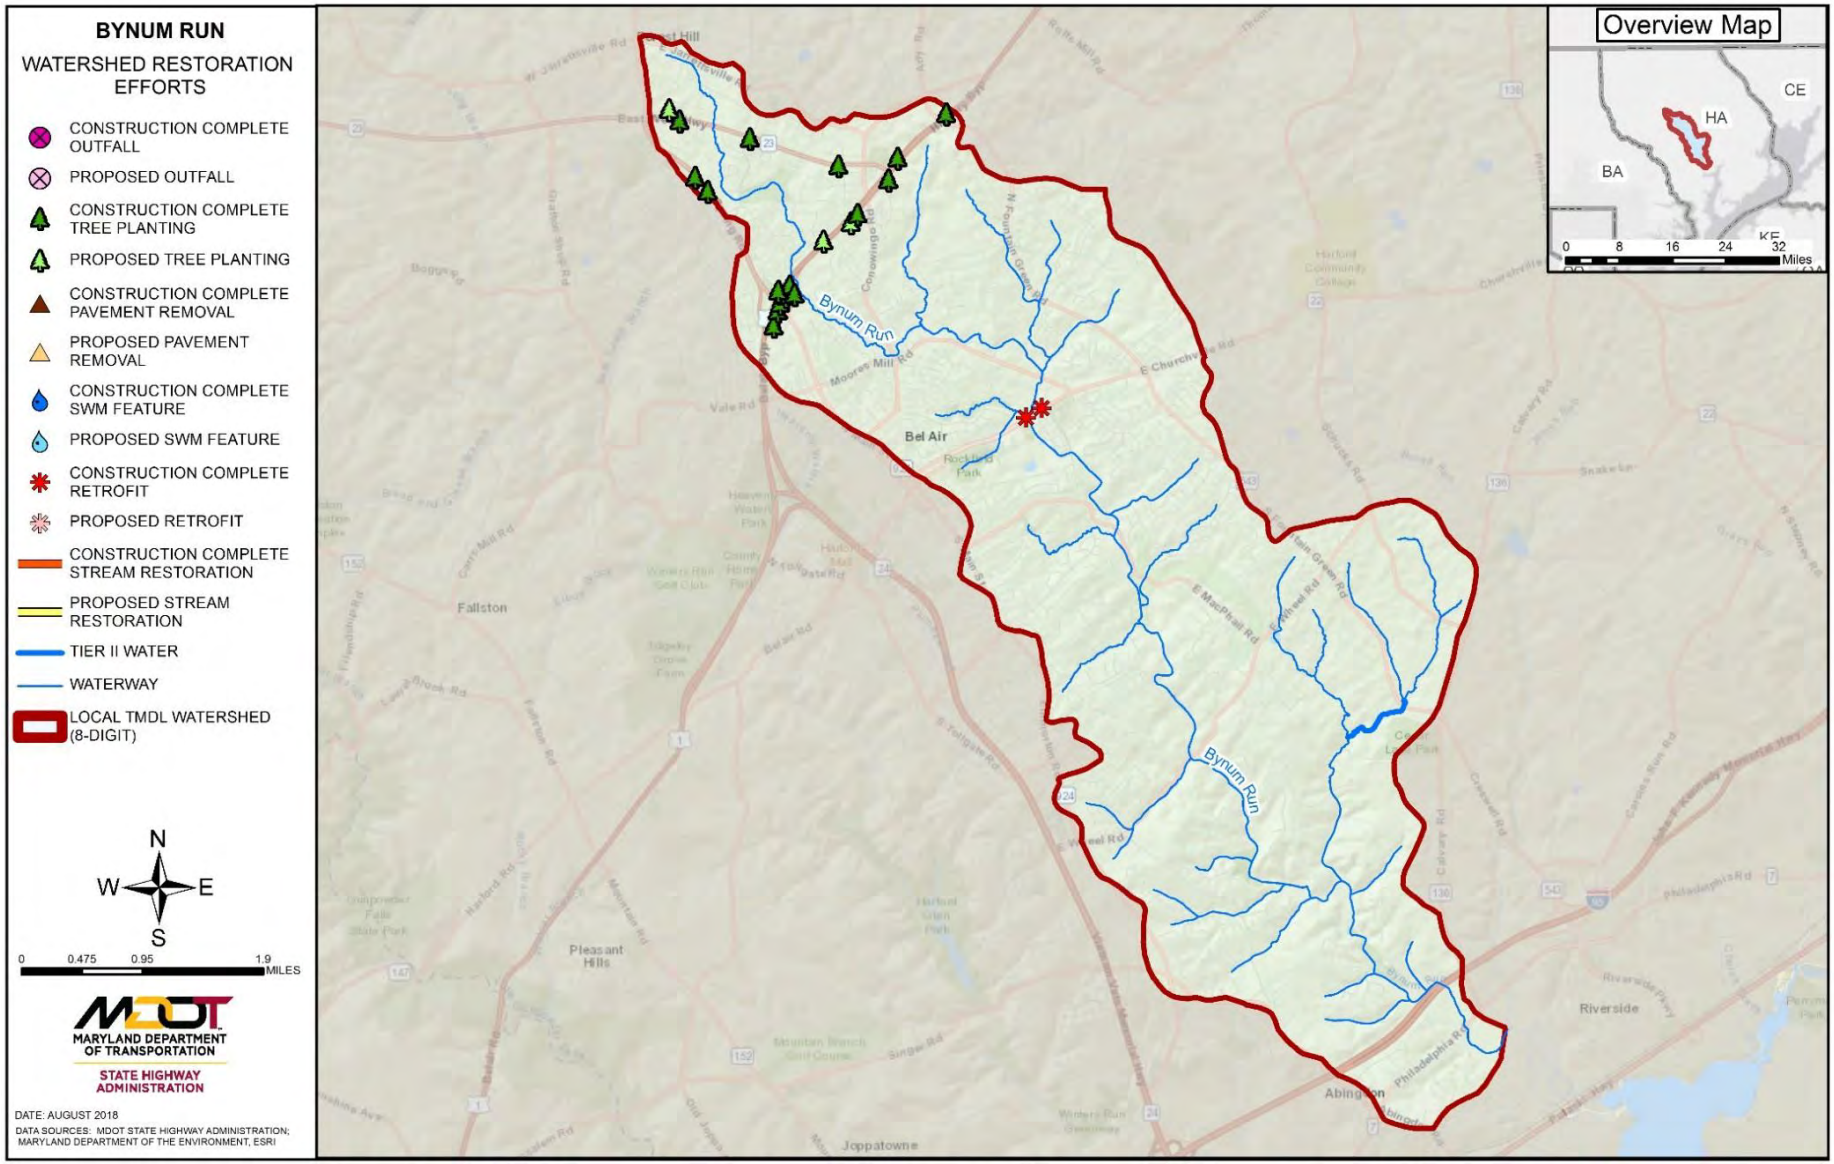


Figure 4-18: MDOT SHA Restoration Strategies within the Bynum Run Watershed

G. CABIN JOHN CREEK WATERSHED

G.1. Watershed Description

The Cabin John Creek watershed encompasses 26 square miles solely within southern Montgomery County, Maryland. Cabin John Creek originates in the City of Rockville and flows south approximately ten miles to its confluence with the Potomac River near Cabin John and Glen Echo. Major tributary creeks and streams of the Cabin John Creek watershed include Bogley Branch, Booze Creek, Buck Branch, Congressional Branch, Ken Branch, Old Farm Branch, Snakeden Branch, and Thomas Branch.

There are 353.1 miles of MDOT SHA roadway located within the Cabin John Creek watershed. The associated ROW encompasses 862.6 acres, of which 484.8 acres are impervious. There are no MDOT SHA facilities located within the Cabin John Creek watershed. See **Figure 4-19** for a map of the watershed.

G.2. MDOT SHA TMDLs within Cabin John Creek Watershed

MDOT SHA is included in the sediment (TSS) TMDL (MDE, 2011d) and has a reduction requirement of 22.9 percent as shown in **Table 3-2**.

G.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Cabin John Creek watershed is shown in **Figure 4-20** which illustrates that 21 grid cells have been reviewed, encompassing portions of 12 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 57 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 43 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 14 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 22 locations as potential tree planting locations. Further analysis of these locations resulted in:

- Eight (8) sites constructed or under contract.
- One (1) additional site deemed potentially viable for tree planting and pending further analysis, may be a candidate for future restoration opportunities.
- 13 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified six (6) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Two (2) additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- Four (4) sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

No grass swale rehabilitation sites were identified within this watershed for potential restoration.

Outfall Stabilization

Preliminary evaluation identified three (3) outfalls potential for stabilization. Further analysis of these sites resulted in:

- Three (3) outfall sites constructed or under contract.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified nine (9) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of two (2) existing structural SW controls constructed or under contract.
- Seven (7) retrofit sites deemed not viable for retrofit and have been removed from consideration.

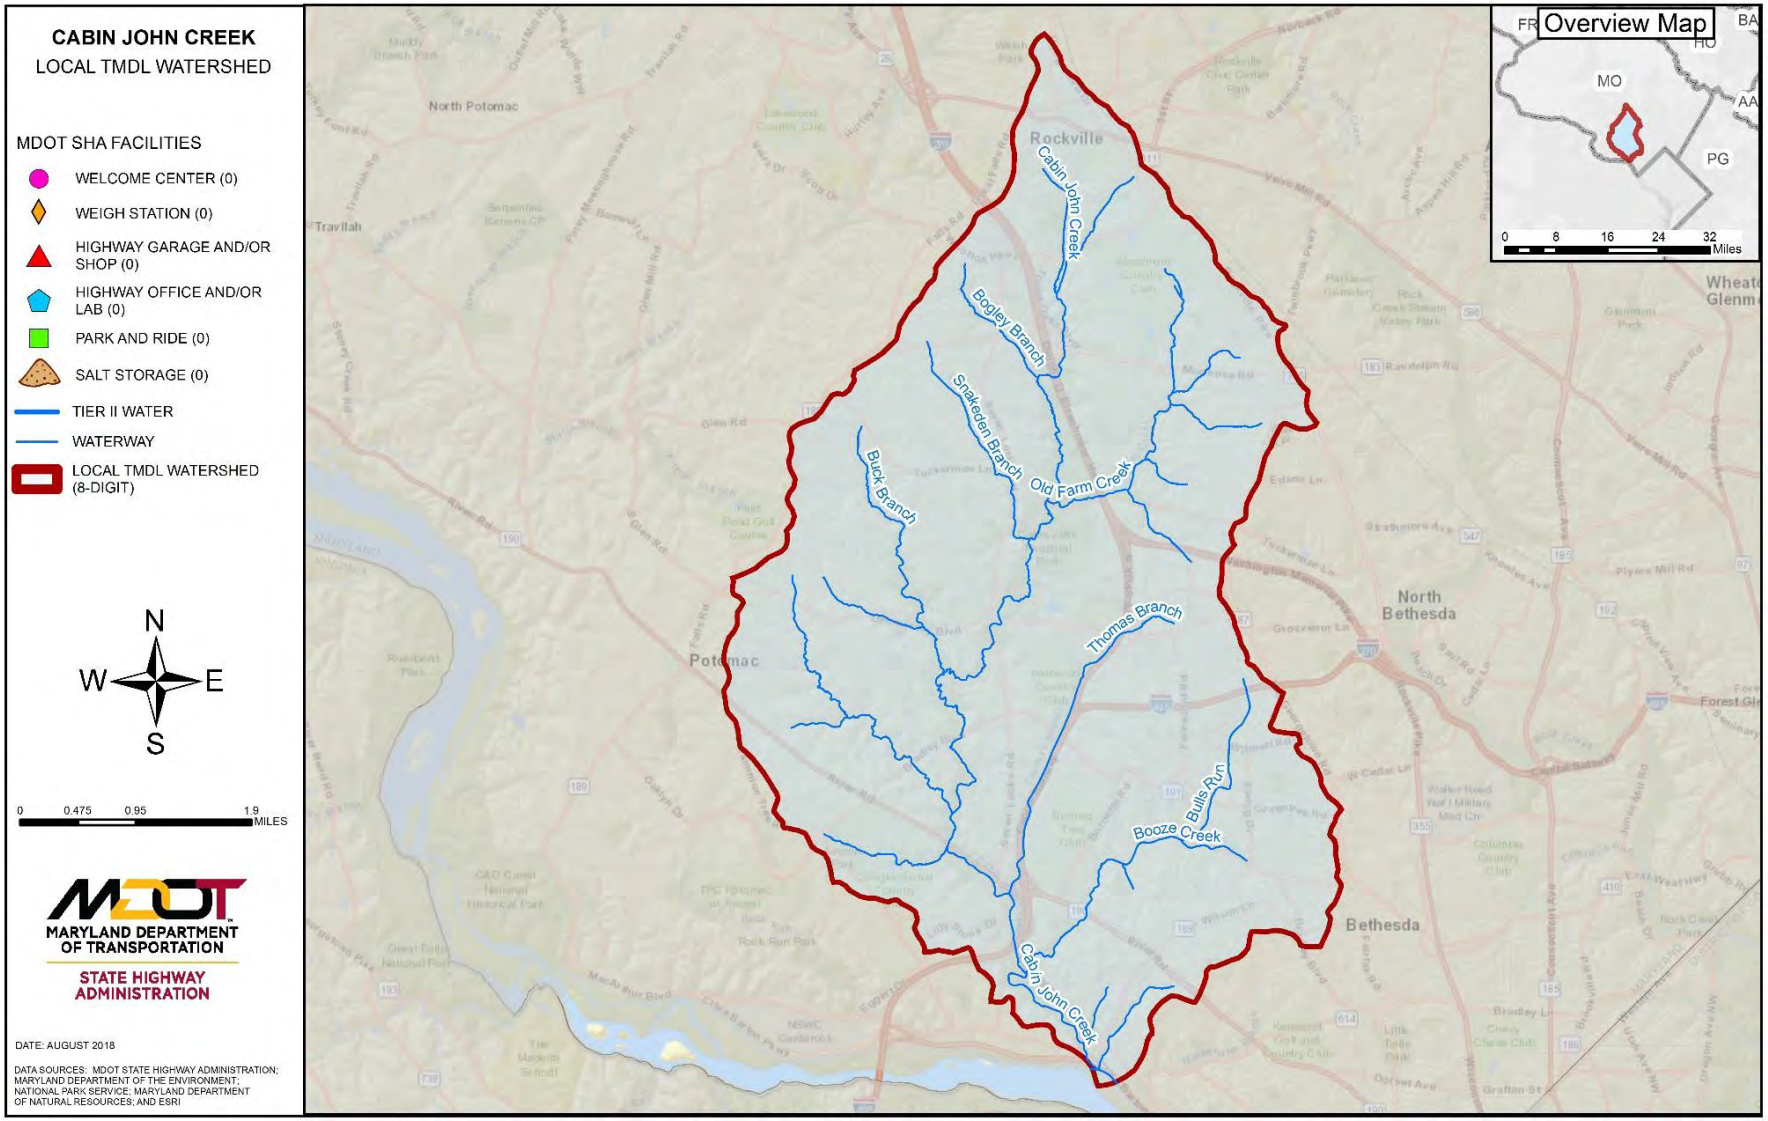


Figure 4-19: Cabin John Creek Watershed

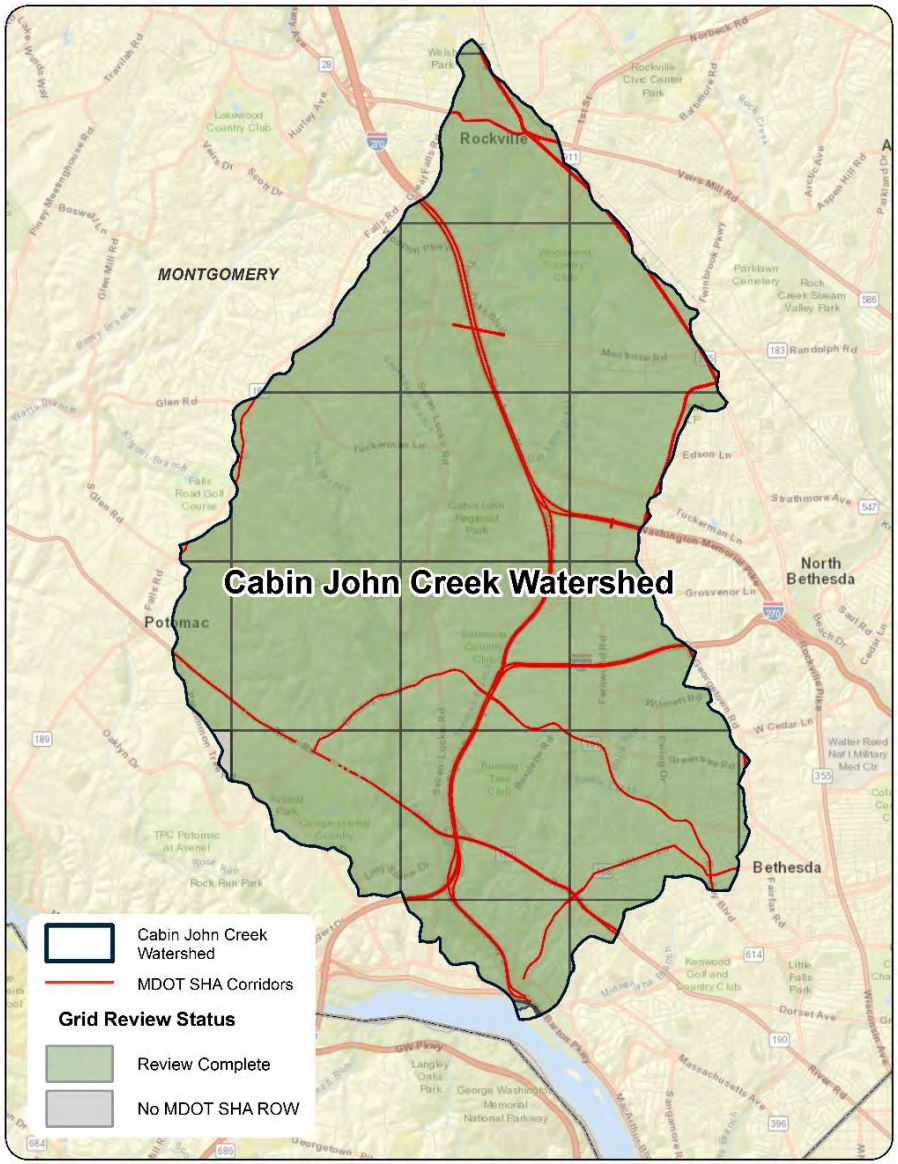


Figure 4-20: Cabin John Creek Site Search Grids

G.4. Summary of County Assessment Review

Waters within the Cabin John Creek watershed are subject to the following impairments as noted on MDE's 303(d) List:

- *Escherichia coli*;
- Chlorides;
- Sulfates; and
- TSS.

The *Cabin John Creek Implementation Plan* (Versar et al., 2012a) prepared by the Montgomery County Department of Environmental Protection, was adopted in January 2012. The implementation plan provides a comprehensive approach for watershed restoration targeting bacteria reduction, sediment nutrient reduction, runoff management, and trash management.

The Cabin John Creek watershed comprises primarily residential land use, covering about 70 percent of the watershed. Municipal/institutional comprises 13 percent and roadway comprise approximately 7 percent. Approximately 5 percent is identified as forest, open water, or bare ground. The majority of the stream resource conditions in Cabin John Creek were assessed as "Fair" (82.5 percent) (Cabin John Creek, Buck Branch, Bogley Branch, Old Farm Creek), the remaining 17.5 percent were assessed as "Poor" (Thomas Branch, Bills Run, Boole Creek). Zero stream miles were assessed as "Good" or "Excellent."

MDE developed TMDLs for fecal bacteria and sediment within the Cabin John Creek watershed and nutrient WLAs for the Bay-wide TMDL. BMPs implemented by the county proposed within Cabin John Creek watershed are estimated to result in 41.9 percent load reductions for total nitrogen, 41.7 percent for total phosphorus, and 29.5 percent for TSS.

Montgomery County is focusing on county-owned land for restoration projects, and has not addressed needs on MDOT SHA ROW. Projects

identified include two new stormwater ponds (Cabin John Shopping Center, Tuckerman I) and four stormwater pond retrofits (Executive Blvd, Fox Hills of Potomac, Pine Knolls, Washington Science Center). Impervious area restoration is also proposed for various sites within the watershed.

G.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reduction in the Cabin John Creek watershed are shown in **Table 4-31**. Projected sediment reduction using these practices is described in **Part III, Coordinated TMDL Implementation Plan** and is shown in **Table 3-2**. Four timeframes are included in the BMP implementation table:

- BMPs implemented before the baseline year. In this case, the sediment baseline is 2005;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL MDOT SHA will meet 42.3 percent of the MDE 22.9 percent load reduction through implementation BMPs shown in table **4-31.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Cabin John Creek watershed total $ 4,368,000. They are based on an average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-32** for a summary of estimated BMP costs.

Figure 4-21 shows a map of MDOT SHA's restoration practices in the watershed and includes those that are under design or constructed. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-31: Cabin John Creek Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	197.0	2.6	3.1	TBD	202.7
Retrofit	drainage area acres		14.1		TBD	14.1
Tree Planting	acres of tree planting		3.6	0.5	TBD	4.2
Stream Restoration	linear feet		971.0	166.4	TBD	1,137.4
Outfall Stabilization	linear feet		36.4	207.9	TBD	244.3
Inlet Cleaning[1]	dry tons		9.8	31.9	TBD	41.7
Street Sweeping[1]	Acres swept		31.5		TBD	31.5

Load Reductions	TSS EOS lbs/yr.		79,327	98,008	231,907	
				Total Projected Reduction	**231,907**	
[1] *Inlet cleaning and street sweeping are annual practices.*						

Table 4-32: Cabin John Creek Restoration BMP Cost

BMP	2020	2025	Future	Total
New Stormwater	$87,000	$2,182,000		$2,270,000
Retrofits	$493,000			$493,000
Tree Planting	$111,000	$17,000		$128,000
Stream Restoration	$648,000	$111,000		$760,000
Outfall Stabilization	$71,000	$409,000		$480,000
Inlet cleaning	$41,000	$182,000		$223,000
Street Sweeping	$14,000			$14,000
Total				$4,368,000

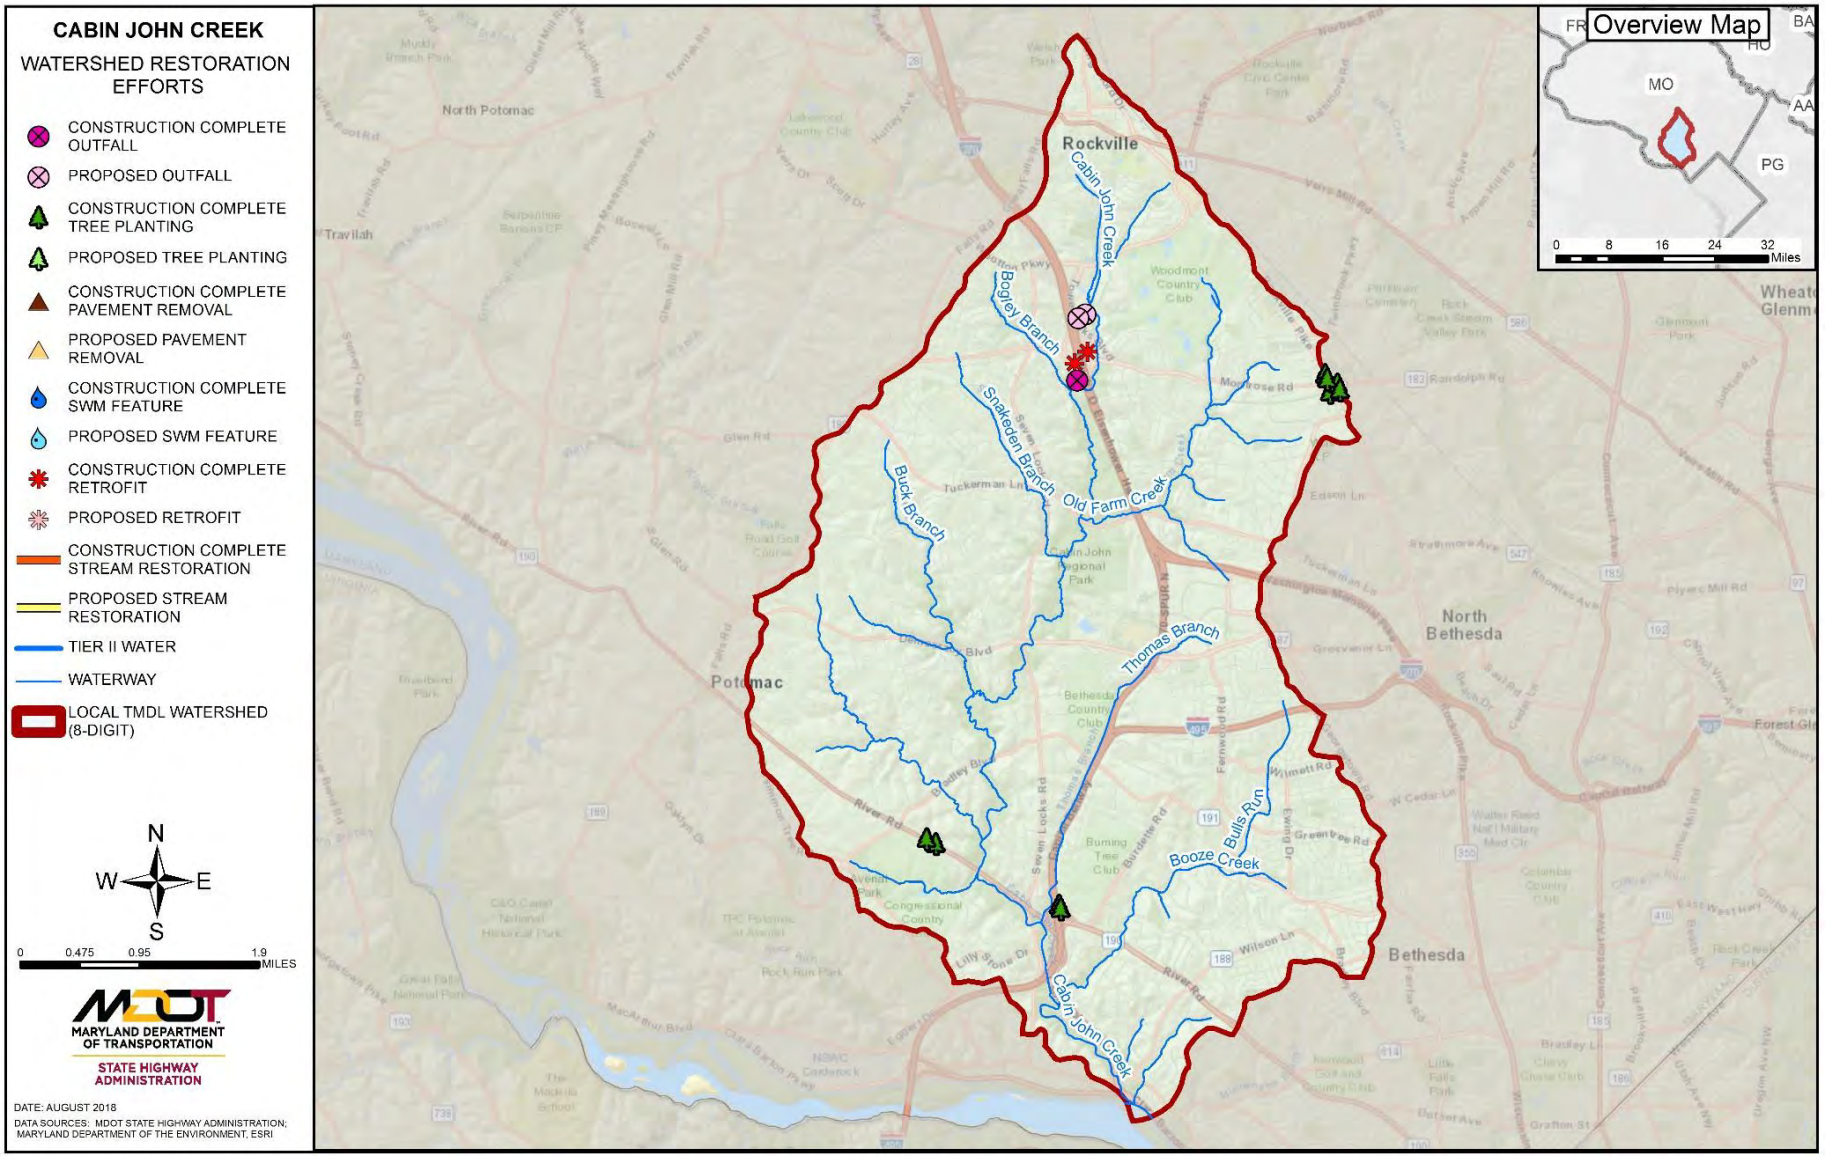


Figure 4-21: MDOT SHA Restoration Strategies within the Cabin John Creek Watershed

H. CATOCTIN CREEK WATERSHED

H.1. Watershed Description

The Catoctin Creek watershed is located within the Middle Potomac River subbasin in Frederick County, Maryland. The Catoctin Creek watershed drains an area of 120 square miles, which includes areas of forested mountain slopes, agricultural valleys, and small areas of urban development. There is a significant amount of agriculture within the watershed, which consists mostly of row crop, but also includes pasture. The largest urban centers within the watershed are the towns of Myersville and Middletown. According to the CBP's Phase 5.2 Model, the land use distribution in the watershed is approximately 43 percent agricultural, 42 percent forest/herbaceous, and 15 percent urban.

Tributary creeks and streams of the Catoctin Creek watershed include Bolivar Branch, Broad Run, Burkitts Run, Cone Branch, Deer Springs Branch, Dry Run, Grindstone Run, Harman Branch, Hollow Road Creek, Lewis Mill Branch, Little Catoctin Creek, Middle Creek, and Spruce Run.

There are 359.6 centerline miles of MDOT SHA roadway located within the Catoctin Creek watershed. The associated ROW encompasses 1,300 acres, of which 428.7 acres are impervious. MDOT SHA facilities located within the watershed consist of two (2) welcome centers, two (2) park and ride facilities, and two (2) salt storage facilities. See **Figure 4-22** for a map of the watershed.

H.2. MDOT SHA TMDLs within Catoctin Creek Watershed

MDOT SHA is included in both the phosphorus and sediment TMDLs (MDE, 2013b; MDE, 2009b) with reduction requirements of 9.0 percent and 49.1 percent, respectively, as shown in **Table 3-2**.

H.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Catoctin Creek watershed is shown in **Figure 4-23** which illustrates that 57 grid cells have been reviewed, encompassing portions of nine (9) state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 816 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 579 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 237 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 210 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 93 sites constructed or under contract.
- One (1) additional site deemed potentially viable for tree planting and pending further analysis, may be a candidate for future restoration opportunities.
- 116 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified eight (8) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Two (2) sites constructed or under contract.
- Six (6) sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 57 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Six (6) new structural SW controls constructed or under contract.
- 15 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 36 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified three (3) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Three (3) retrofit sites deemed not viable for retrofit and have been removed from consideration.

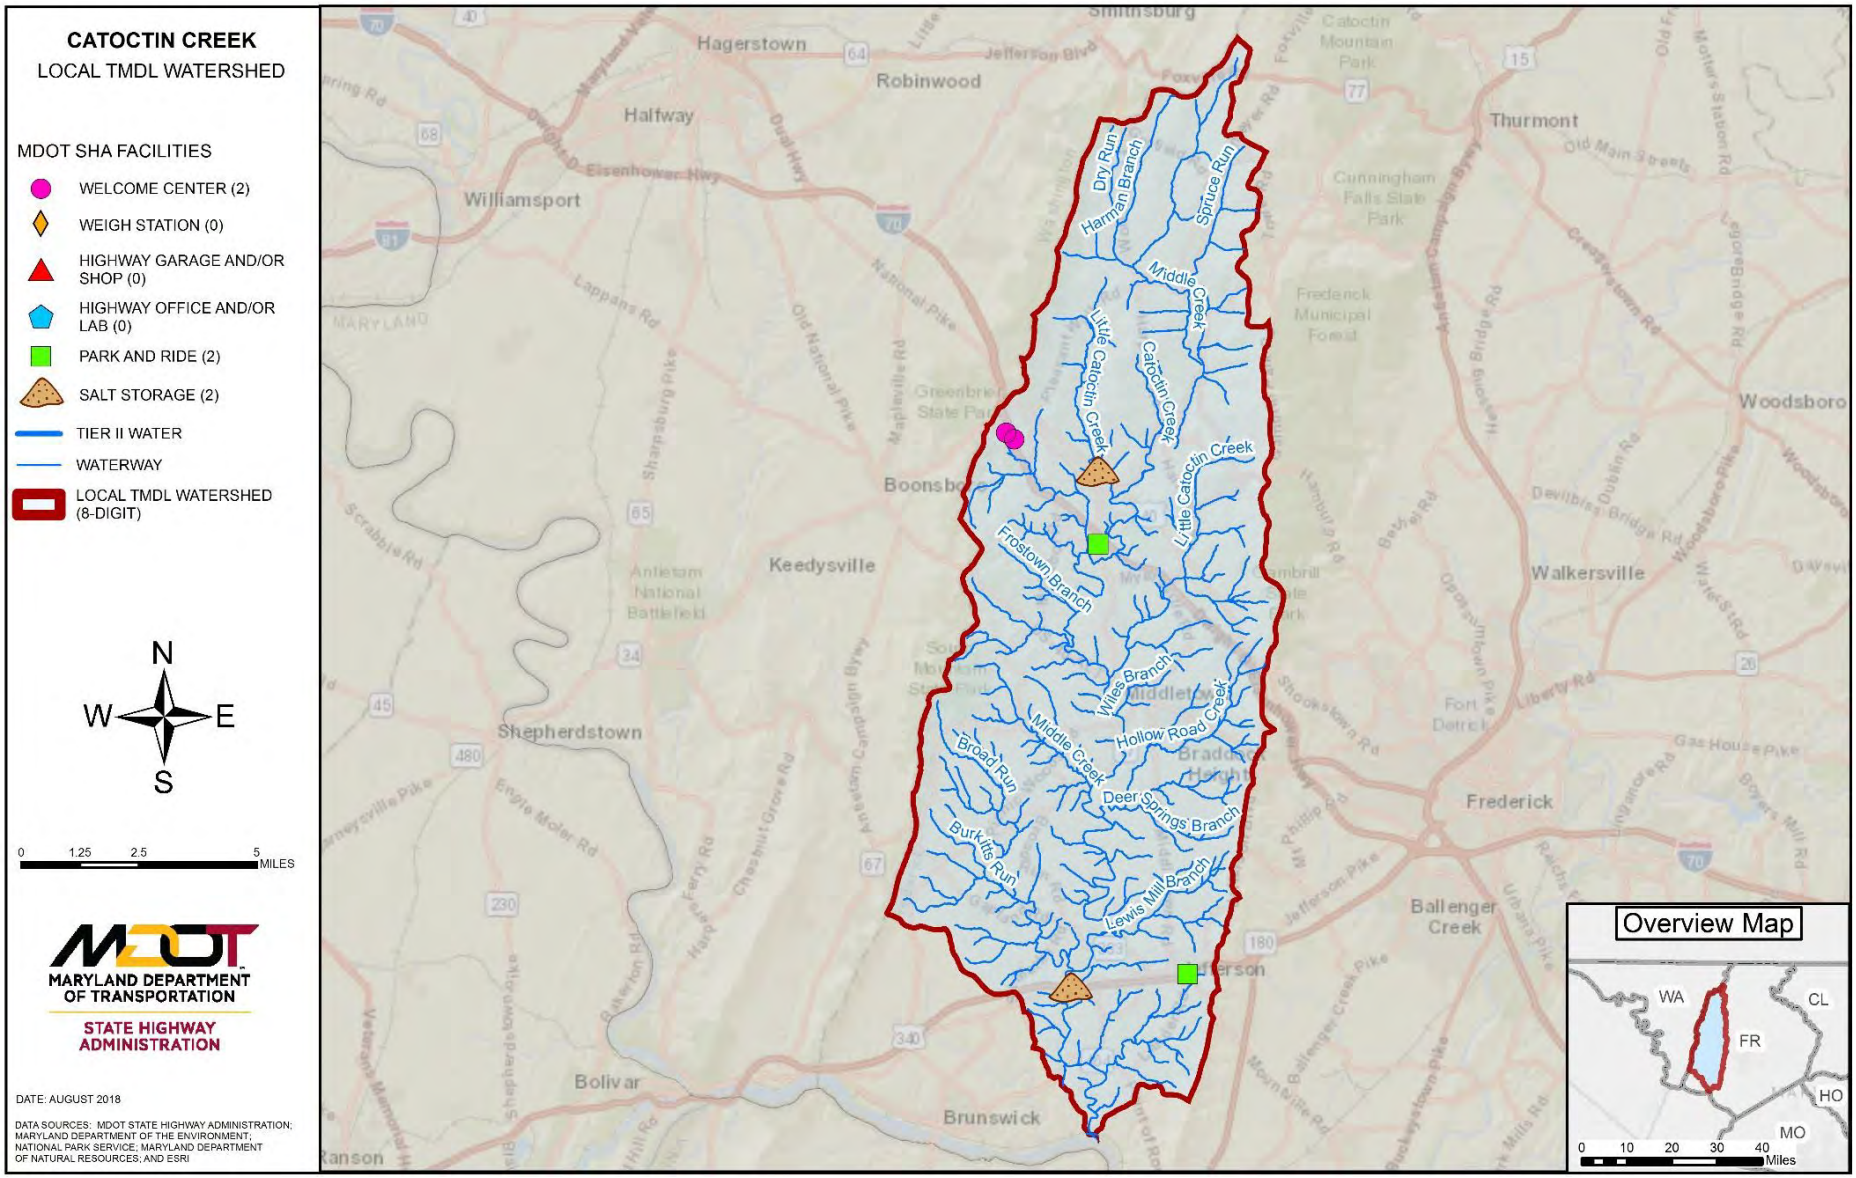


Figure 4-22: Catoctin Creek Watershed

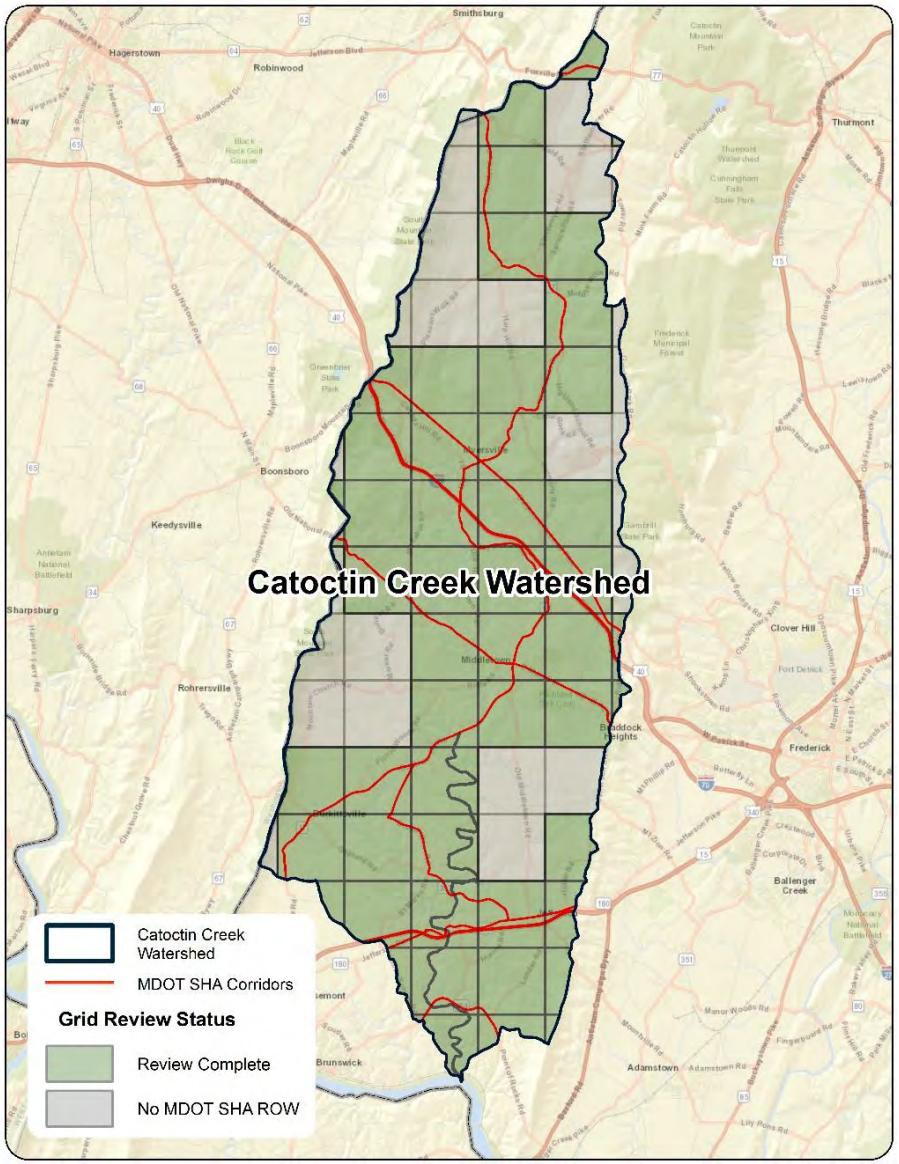


Figure 4-23: Catoctin Creek Site Search Grids

H.4. Summary of County Assessment Review

Waters within the Catoctin Creek watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Phosphorus (Total);
- Temperature, water; and
- TSS.

MDE prepared the *Watershed Report for Biological Impairment of the Catoctin Creek Watershed in Frederick County, Maryland Biological Stressor Identification Analysis Results and Interpretation* in 2012 (MDE, 2012c, pgs. 18 and 26). The following excerpts from the Biological Stressor Identification (BSID) describe land use throughout the watershed and associated potential pollutant sources:

> *Agricultural land use is an important source of pollution when rainfall carries fertilizers, manure, and pesticides into streams. The three major nutrients in fertilizers are nitrogen, phosphorus, and potassium. High concentrations of nutrients in agricultural streams were correlated with inputs from fertilizers and manure used for crops and from livestock wastes.*
>
> *The BSID analysis identified pasture/hay land use as significant in the riparian buffer zone (92%). Pasture/hay land use within the riparian buffer often results in increased incidences of livestock being allowed direct access to streams, and one of the primary sources of nutrients and ammonia to surface waters is livestock waste. The agricultural land uses in the Catoctin Creek watershed are potential sources for the elevated levels of nitrogen, phosphorus, orthophosphate, and ammonia.*
>
> *The lack of a riparian buffer has resulted in a stream ecosystem that eliminates large woody debris and*

allochthonous input in streams, which results in loss of optimal habitat. Loss of riparian buffers also allows increased terrestrial inputs of nutrients from agricultural sources. Due to the increased proportions of agricultural land use in Catoctin Creek, the watershed has experienced an increase of nutrients that can potentially be extremely toxic to aquatic organisms. The combined AR for riparian habitat stressors and water chemistry stressors is approximately 83 percent, suggesting that altered riparian habitat and water chemistry stressors adequately account for the biological impairment in Catoctin Creek (MDE, 2012c).

As stated in the Catoctin Creek sediment TMDL (MDE, 2009b, p.30):

Potential best management practices for reducing sediment loads and resulting impacts can be grouped into three general categories. The first is directed toward agricultural lands, the second to urban (developed) land, and the third applies to all land uses.

In agricultural areas comprehensive soil conservation plans can be developed that meet criteria of the USDA-NRCS Field Office Technical Guide. Soil conservation plans help control erosion by modifying cultural practices or structural practices. Cultural practices may change from year to year and include changes to crop rotations, tillage practices, or use of cover crops. Structural practices are long-term measures that include, but are not limited to, the installation of grass waterways (in areas with concentrated flow), terraces, diversions, sediment basins, or drop structures. In addition, livestock can be controlled via stream fencing and rotational grazing.

Sediment from urban areas can be reduced by stormwater retrofits, impervious surface reduction, and stream restoration. Stormwater retrofits include modification of existing stormwater structural practices to address water quality.

All non-forested land uses can benefit from improved riparian buffer systems. A riparian buffer reduces the effects of upland sediment sources through trapping and filtering. Riparian buffer efficiencies vary depending on type (grass or forested), land use (urban or agriculture), and physiographic region.

H.5. MDOT SHA Pollutant Reduction Strategies

Catoctin Creek is listed for both phosphorus and sediment with each TMDL having a different baseline year; 2000 for sediment and 2009 for phosphorus. Proposed practices to meet phosphorus and sediment reductions in the Catoctin Creek watershed are shown in **Table 4-33** and **Table 4-34**, respectively. Projected phosphorus and sediment reductions using these practices are described in **Part III, Coordinated TMDL Implementation Plan** and are shown in **Table 3-2**. Four timeframes are included in the tables below:

- BMPs implemented before the phosphorus and sediment TMDL baseline. In this case, the phosphorus baseline is 2009 and the sediment baseline is 2000;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL, MDOT SHA will meet 85.7 percent of the MDE 49.1 percent load reduction requirement through implementation of BMPs shown in **Table 4-34.** MDOT SHA will work to increase expected

reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Catoctin Creek watershed total $ 11,808,000. They are based on average cost per impervious acre treated derived from a cost history for each BMP type. Please see **Table 4-35** for a summary of estimated BMP costs.

Figure 4-24 shows a map of MDOT SHA's watershed restoration strategies throughout the Catoctin Creek watershed. The practices shown only include those that are under design or constructed.

Table 4-33: Catoctin Creek Restoration Phosphorus BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	55.1		38.6	N/A	93.7
Impervious Surface Elimination	acres removed		0.2		N/A	0.2
Tree Planting	acres of tree planting	16.0	71.8	49.5	N/A	137.3
Stream Restoration	linear feet	719.0	4,965.0	3,965.2	N/A	9,649.2
Outfall Stabilization	linear feet			400.0	N/A	400.0
Inlet Cleaning[1]	dry tons		0.1	13.5	N/A	13.7
Load Reductions	TP EOS lbs./yr.		393	759	0	
				Total Projected Reduction	**759**	

[1] *Inlet cleaning is an annual practice.*

Table 4-34: Catoctin Creek Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2000)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	54.9		38.6	TBD	93.5
Impervious Surface Elimination	acres removed		0.2		0.0	0.2
Tree Planting	acres of tree planting		87.8	49.5	TBD	137.3
Stream Restoration	linear feet		5,684.0	3,965.2	TBD	9,649.2
Outfall Stabilization	linear feet			400.0	TBD	400.0
Inlet Cleaning[1]	dry tons		0.1	13.5	TBD	13.7
Load Reductions	TSS EOS lbs./yr.		280,379	509,359	594,338	
					Total Projected Reduction	**594,338**

[1] *Inlet cleaning is an annual practice.*

Table 4-35: Catoctin Creek Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater		$257,000	$257,000
Impervious surface Elimination	$43,000		$43,000
Tree Planting	$2,685,000	$1,514,000	$4,200,000
Stream Restoration	$3,796,000	$2,648,000	$6,443,000
Outfall Stabilization		$787,000	$787,000
Inlet cleaning	$1,000	$77,000	$78,000
Total			$11,808,000

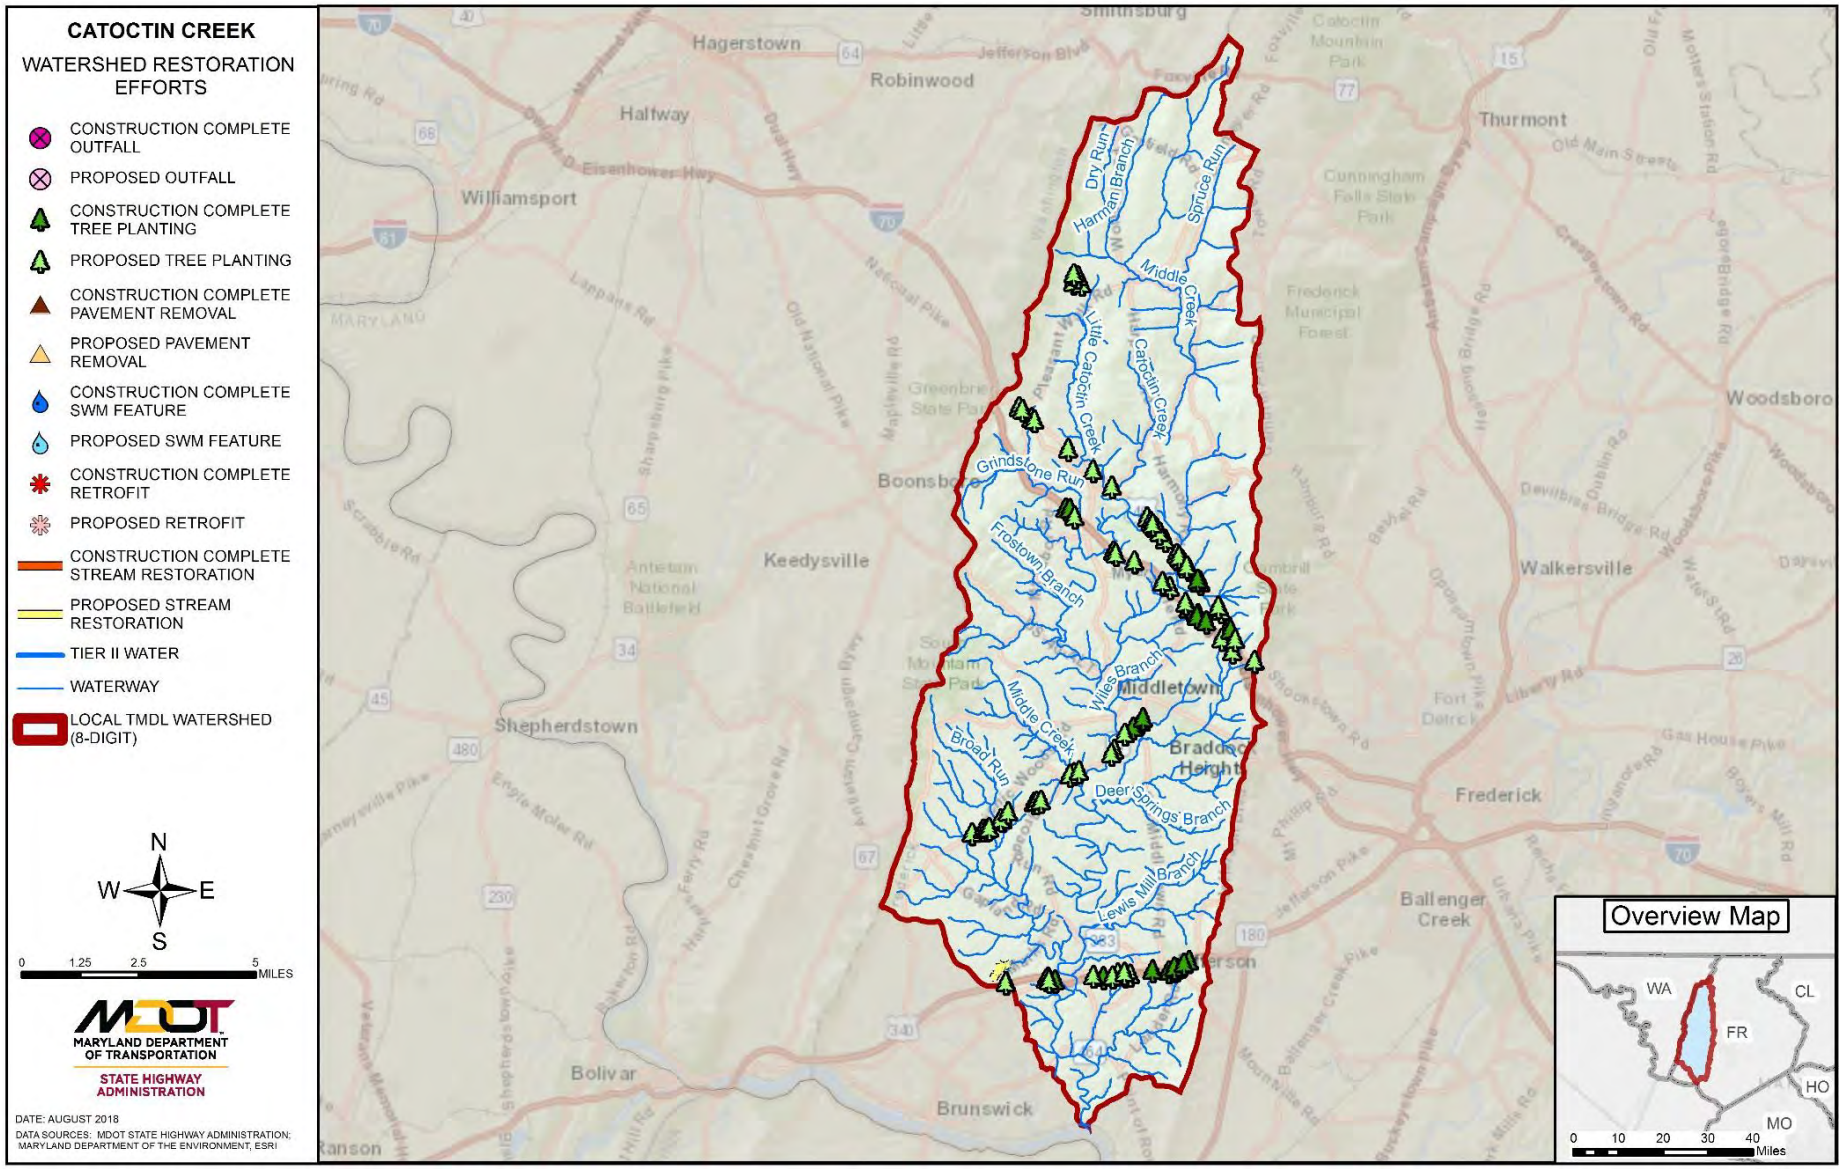


Figure 4-24: MDOT SHA Restoration Strategies within the Catoctin Creek Watershed

I. CONOCOCHEAGUE CREEK WATERSHED

I.1. Watershed Description

The Conococheague Creek watershed encompasses 65 square miles within Washington County, Maryland. The entire watershed is approximately 566 square miles, most of which is located in Pennsylvania. Conococheague Creek flows 80 miles south from its headwaters in Pennsylvania to the Potomac River near Williamsport, Maryland. Tributary creeks and streams of the Conococheague Creek watershed, within Maryland, include Meadow Brook, Rockdale Run, Rush Run, Semple Run, and Toms Run.

There are 285.6 centerline miles of MDOT SHA roadway located within the Conococheague Creek watershed. The associated ROW encompasses 1,428.3 acres, of which 489.6 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) park and ride facility and one (1) salt storage facility. See **Figure 4-25** for a map of the watershed.

I.2. MDOT SHA TMDLs within Conococheague Creek

MDOT SHA is included in the sediment (TSS) TMDL (MDE, 2008b) and has a reduction requirement of 45.3 percent as shown in **Table 3-2**.

I.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Conococheague watershed is shown in **Figure 4-26** which illustrates that 37 grid cells have been reviewed, encompassing portions of 13 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 507 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 25 new structural SW controls constructed or under contract.
- 229 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 253 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 205 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 22 sites constructed or under contract.
- 32 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 151 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 17 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- 17 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 88 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 12 new structural SW controls constructed or under contract.
- Five (5) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 71 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified three (3) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of two (2) existing structural SW controls constructed or under contract.
- One (1) retrofit site deemed not viable for retrofit and has been removed from consideration.

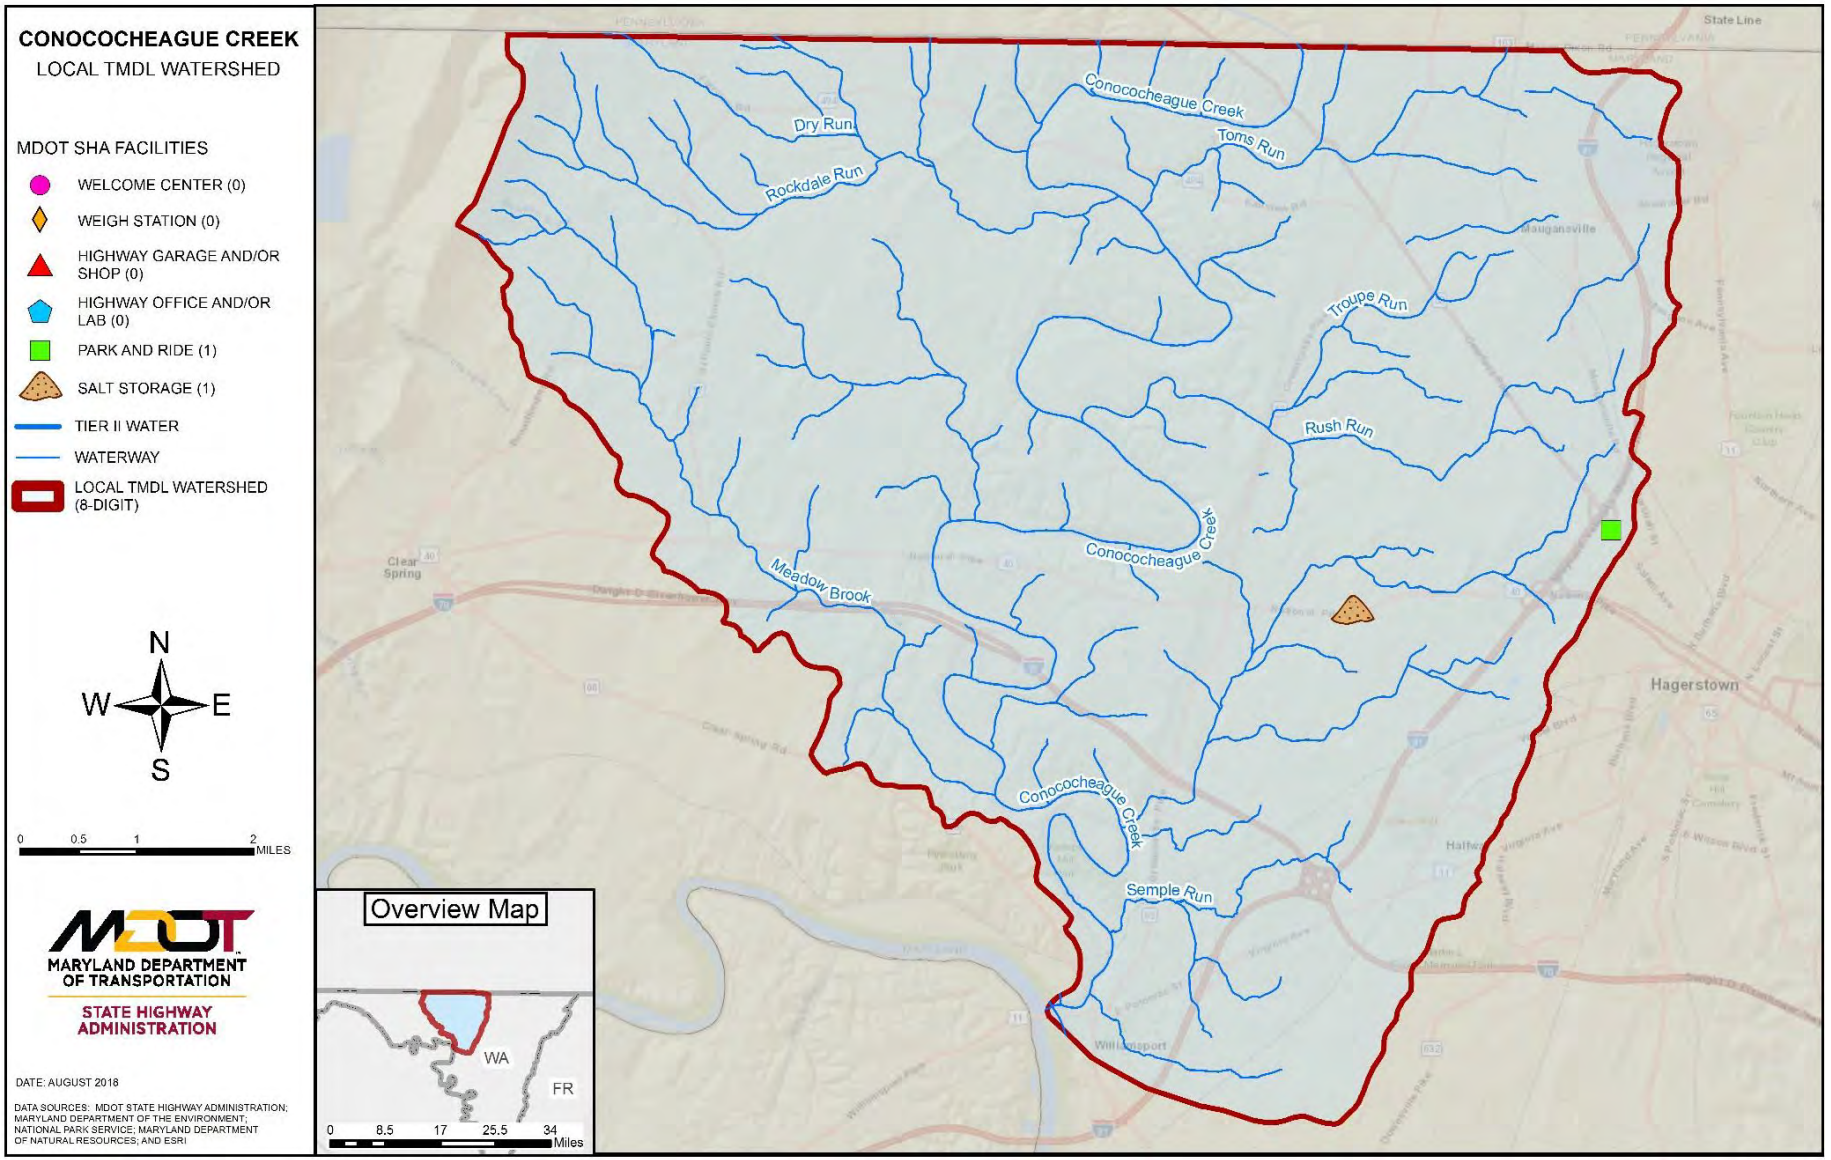


Figure 4-25: Conococheague Creek Watershed

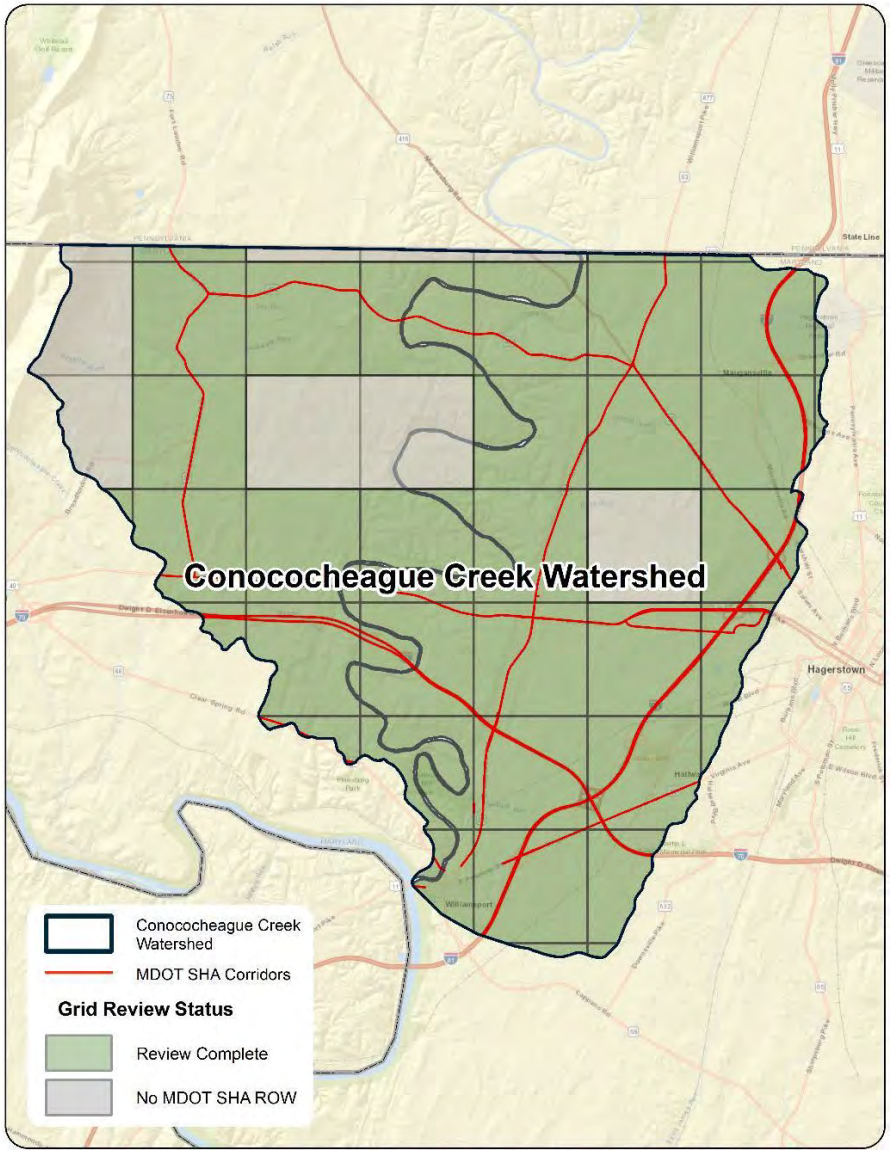


Figure 4-26: Conococheague Creek Site Search Grids

I.4. Summary of County Assessment Review

Waters within the Conococheague Creek watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- *Escherichia coli;*
- Mercury in Fish Tissue;
- PCB in Fish Tissue;
- pH, High;
- Phosphorus (Total);
- Sulfates; and
- TSS.

According to the 2014 Washington County NPDES MS4 Annual Report (WA-DPW, 2014), a restoration plan for the Conococheague Creek watershed was expected to be completed in 2015, but as of September 2018, this report was not yet available online.

I.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reduction in the Conococheague Creek watershed are shown in **Table 4-36**. Projected sediment reduction using these practices is described in **Part III, Coordinated TMDL Implementation Plan** and is shown in **Table 3-2**. Four timeframes are included in the table:

- BMPs implemented before the TMDL baseline. In this case, the baseline is 2000;

- BMPs implemented after the baseline through fiscal year 2020; and

- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL, MDOT SHA will meet 19.3 percent of the MDE 45.3 percent load reduction requirement through implementation of BMPs shown in **Table 4-36.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct and implement BMPs within the Conococheague Creek watershed total $6,511,000. They are based average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-37** for a summary of estimated BMP costs.

Figure 4-27 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or constructed. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-36: Conococheague Creek Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2000)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	101.6	22.3	15.2	TBD	139.1
Retrofit	drainage area acres		12.7		TBD	12.7
Tree Planting	acres of tree planting		57.6		TBD	57.6
Stream Restoration	linear feet			694.4	TBD	694.4
Outfall Stabilization	linear feet			400.0	TBD	400.0
Inlet Cleaning[1]	dry tons			8.6	TBD	8.6
Street Sweeping[1]	Acres swept		11.6			11.6
Load Reductions	TSS EOS lbs/yr.		43,821	100,574	**522,122**	
					Total Projected Reduction	**522,122**	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-37: Conococheague Creek Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$2,843,000	$52,000	$2,895,000
Retrofits	$545,000		$545,000
Tree Planting	$1,762,000		$1,762,000
Stream Restoration		$464,000	$464,000
Outfall Stabilization		$787,000	$787,000
Inlet cleaning		$49,000	$49,000
Street Sweeping	$9,000		$9,000
Total			$6,511,000

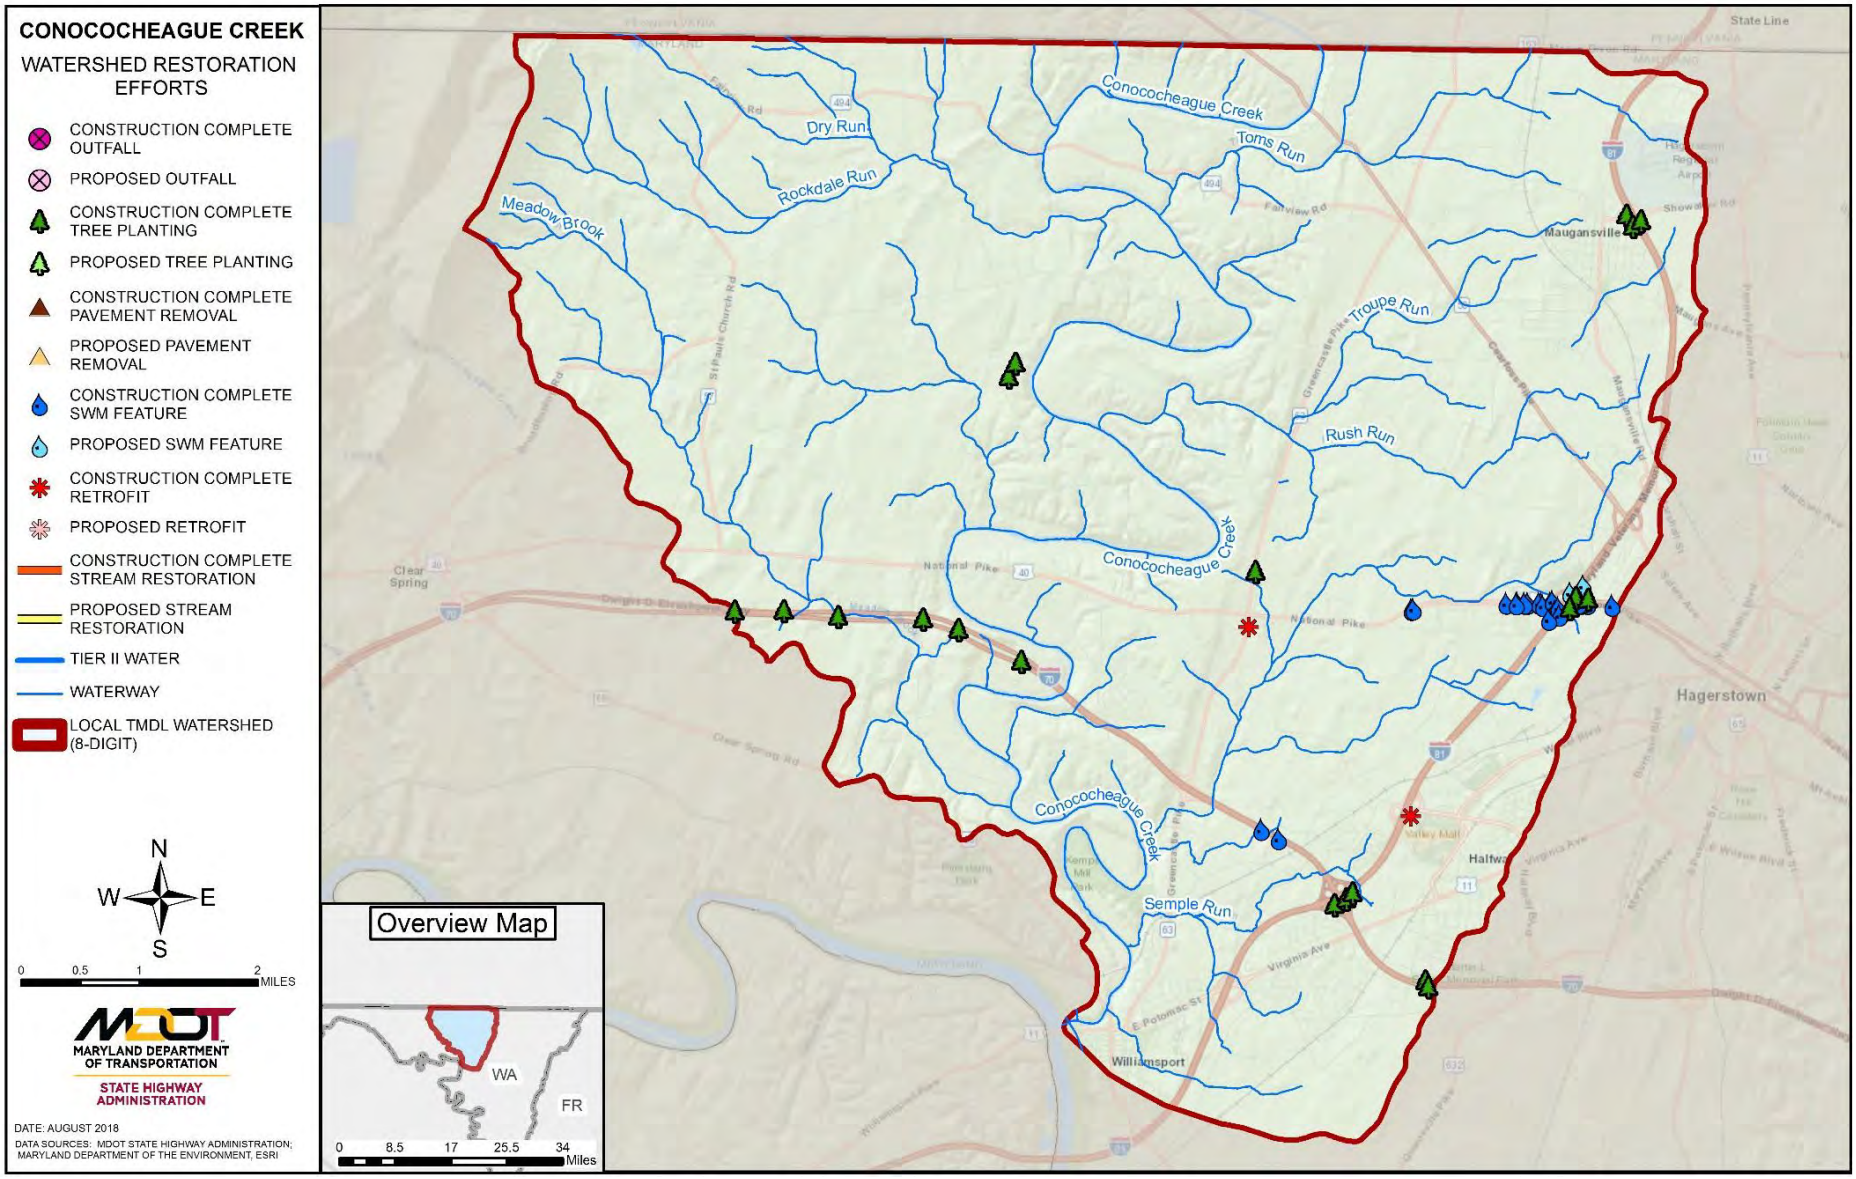


Figure 4-27: MDOT SHA Restoration Strategies within the Conococheague Creek Watershed

J. DOUBLE PIPE CREEK WATERSHED

J.1. Watershed Description

The Double Pipe Creek watershed encompasses 193 square miles spanning Carroll and Frederick Counties, and is composed of Big Pipe Creek, which makes up 58 percent of the watershed, and Little Pipe Creek, which makes up the remaining 42 percent. The portion of the watershed within Carroll County is approximately 86 percent of the watershed, with 14 percent within Frederick County. This watershed drains into the Monocacy River, which is a State-designated Scenic River. The headwaters of Double Pipe Creek originate in Westminster and Manchester, and flows west toward Rocky Ridge, into the Monocacy River and ultimately into the Middle Potomac River near the town of Dickerson. Tributary creeks and streams of the Double Pipe Creek watershed include Bear Branch, Big Pipe Creek, Cherry Branch, Deep Run, Dickenson Run, Little Pipe Creek, Meadow Branch, Prisetland Branch, Sams Creek, Silver Run, Turkeyfoot Run, and Wolf Pit Creek.

There are 545.2 centerline miles of MDOT SHA roadway located within the Double Pipe Creek watershed. The associated ROW encompasses 1,107.1 acres, of which 420.2 acres are impervious. MDOT SHA facilities located within the Double Pipe Creek watershed consist of one (1) park and ride facility, and one (1) salt storage facility. See **Figure 4-28** for a map of the watershed.

J.2. MDOT SHA TMDLs within Double Pipe Creek

MDOT SHA is included in the phosphorus TMDL (MDE, 2013c) and sediment (TSS) TMDL (MDE, 2009c) and has reduction requirements of 46.8 percent for sediment and 66 percent for phosphorus in Carroll and Frederick Counties, respectively as shown in **Table 3-2**.

J.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Double Pipe Creek watershed is shown in **Figure 4-29** which illustrates that 84 grid cells have been reviewed, encompassing portions of 16 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 416 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 247 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 169 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 232 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 70 sites constructed or under contract.
- 24 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 138 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 13 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Three (3) sites constructed or under contract.
- 10 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified two (2) sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Two (2) sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified two (2) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Two (2) retrofit sites deemed not viable for retrofit and have been removed from consideration.

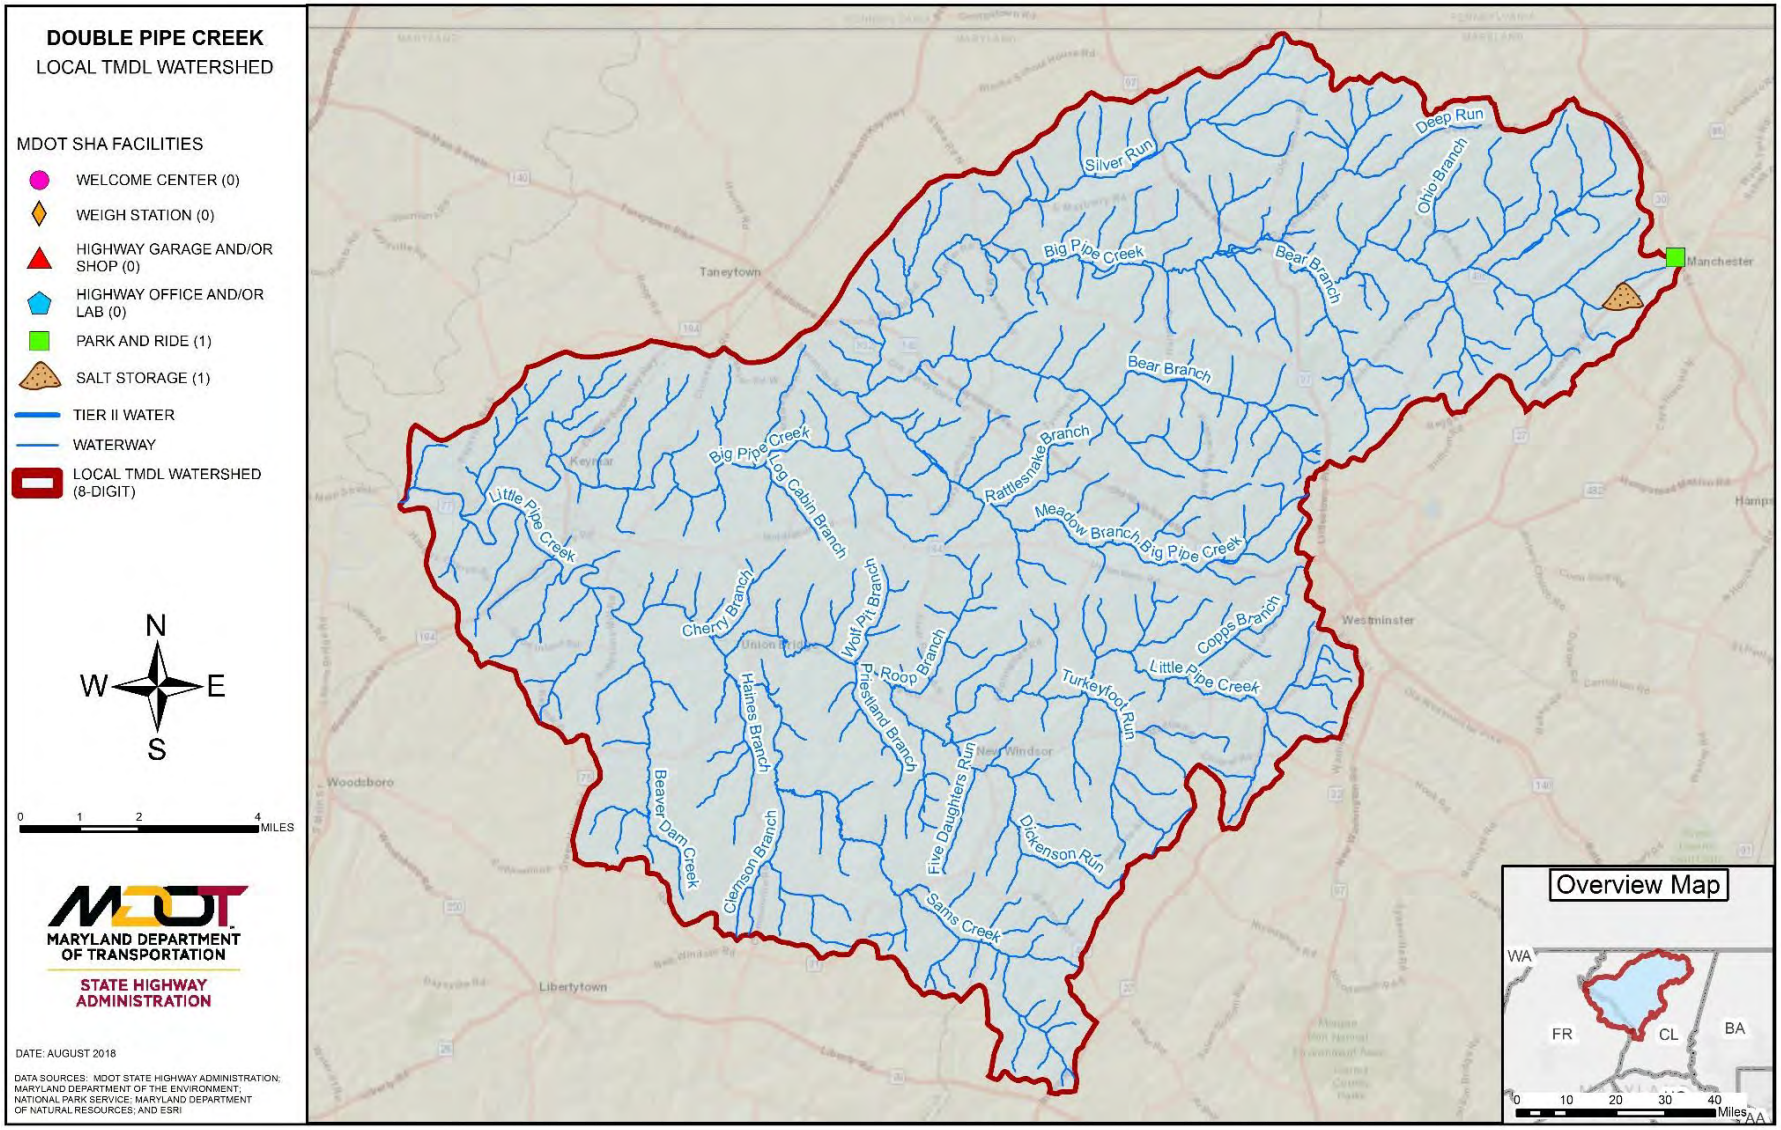


Figure 4-28: Double Pipe Creek Watershed

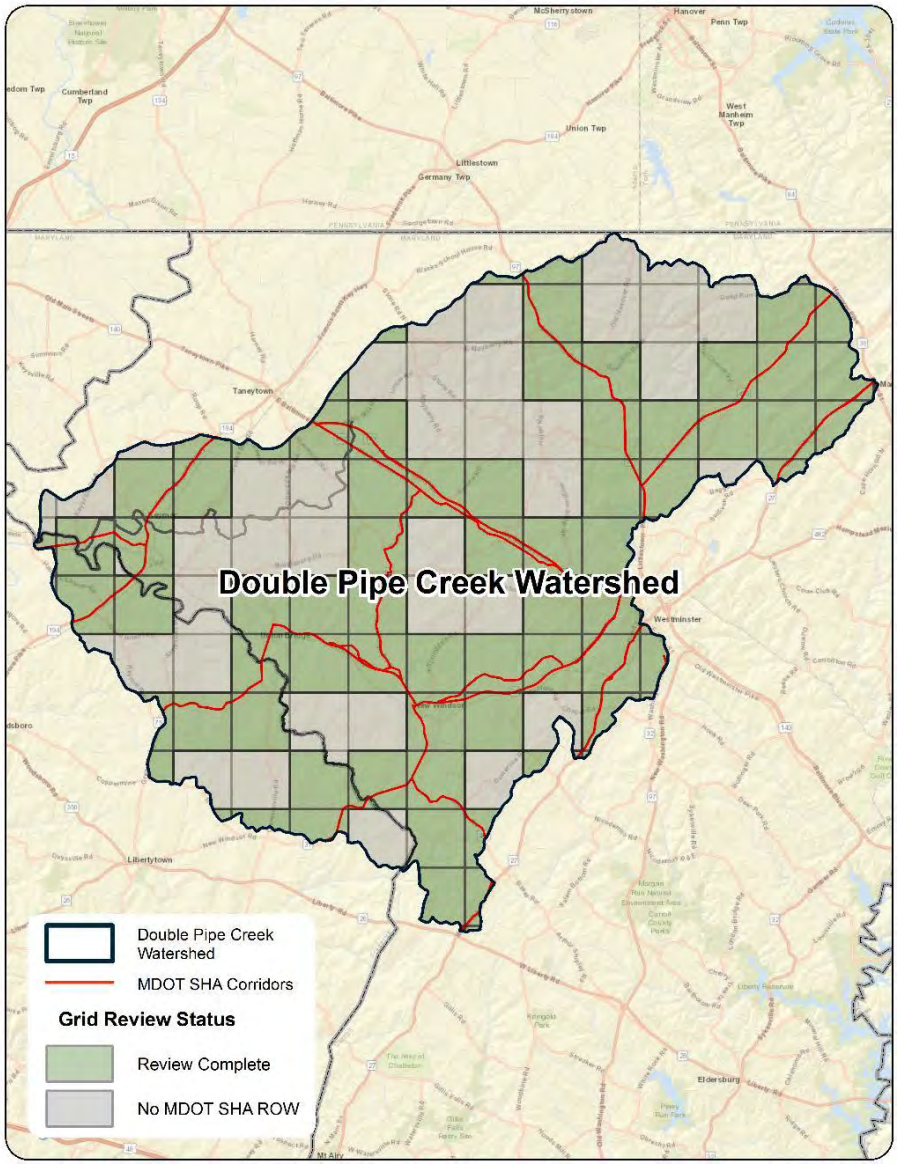


Figure 4-29: Double Pipe Creek Site Search Grids

J.4. Summary of County Assessment Review

Waters within the Double Pipe Creek watershed are subject to the following impairments as noted on MDE's 303(d) List:

- *Escherichia coli;*
- Phosphorus (Total); and
- TSS.

In 2006, MDE completed a report on *Prioritizing Sites for Wetland Restoration, Mitigation, and Preservation in Maryland* (MDE, 2006). Impervious land cover comprises 2.5% of the Frederick County portion of the Double Pipe Creek watershed. According to MDE (2006), regulated impervious developed land comprises 2.04% in the Frederick County portion, and 2.14% in the Carroll County portion. The predominant soils in this watershed are considered moderately erodible. Double Pipe Creek currently has completed TMDLs for sediment (TSS), fecal bacteria, and phosphorus. Double Pipe Creek also has a Category Five impairment listing (i.e., TMDL required) for PCBs in fish tissue.

Although Carroll County has not yet published an implementation plan for its portion of the Double Pipe Creek watershed, it has completed the preliminary watershed characterization plan that will help inform and direct the future implementation plan, namely 2016's *Double Pipe Creek Watershed Characterization Plan* (CL-BRM, 2016a). According to this characterization plan, the current impairments within the Double Pipe Creek watershed are bacteria, phosphorus, and sediment (CL-BRM, 2016a). The Double Pipe Creek watershed is mostly rural with mixed urban uses accounting for less than three percent of the total land use; agriculture is the dominant land use with the Double Pipe Creek watershed (CL-BRM, 2016a). Within the watershed, the Little Pipe Creek subwatershed has the highest percentage (10.6%) of total impervious area for the entire watershed (Little Pipe Creek subwatershed contains a large portion of the City of Westminster) (CL-BRM, 2016a).

The Frederick County Office of Sustainability and Environmental Resources conducted Stream Corridor Assessments (SCAs) between 2013 and 2016 that included Frederick County's portion of the Double Pipe Creek watershed (Versar, 2017a). According to Versar (2017a), land use within Frederick County's portion of the Double Pipe Creek watershed is agricultural (80.7%), forested (12.31%), and urban (6.99%); impervious surface constitutes 3.1%. The BIBI and PHI scores for the Double Pipe Creek watershed fell in the "Poor/Degraded" condition class (Versar, 2017a).

Information on water quality, erosion, physical habitat, and BIBI scores for several sites within Little Pipe Creek can be found in the SCA reports; however, detailed location information is not provided.

J.5. MDOT SHA Pollutant Reduction Strategies

Double Pipe Creek is listed for both sediment and phosphorus with each TMDL having a different baseline year; 2000 for sediment and 2009 for phosphorus. Proposed practices to meet the sediment and phosphorus reduction in the Double Pipe Creek watershed are shown in **Table 4-38 and 4-39**. Projected sediment and phosphorus reductions using these practices are described in **Part III, Coordinated TMDL Implementation Plan** and are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs implemented before the phosphorus and sediment TMDL baseline. In this case, the phosphorus baseline is 2009 and the sediment baseline is 2000;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

MDOT SHA will meet the required reductions.

Estimated costs to design, construct, and implement BMPs within the Double Pipe Creek watershed total $ 21,105,000. They are based on average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-40** for a summary of estimated BMP costs.

Figure 4-30 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or construction. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-38: Double Pipe Creek Restoration Phosphorus BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	Total
New Stormwater	drainage area acres	32.7	18.5	92.4	N/A	143.6
Impervious Surface Elimination	acres removed		0.1		N/A	0.1
Tree Planting	acres of tree planting		108.5	16.2	N/A	124.7
Stream Restoration	linear feet		7,569.0	11,275.2	N/A	18,844.2
Outfall Stabilization	linear feet			800.0	N/A	800.0
Inlet Cleaning[1]	dry tons			0.2	N/A	0.2
Street Sweeping[1]			10.1		N/A	10.1
Load Reductions	TP EOS lbs./yr.		585	1,514	0	
					Total Projected Reduction	
					1,514	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-39: Double Pipe Creek Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	Total
New Stormwater	drainage area acres	19.7	18.5	92.4	N/A	130.6
Impervious Surface Elimination	acres removed		0.1		N/A	0.1
Tree Planting	acres of tree planting		108.5	16.2	N/A	124.7
Stream Restoration	linear feet		7,569.0	11,275.2	N/A	18,844.2
Outfall Stabilization	linear feet			800.0	N/A	800.0
Inlet Cleaning[1]	dry tons			0.2	N/A	0.2
Street Sweeping[1]			10.1		N/A	10.1
Load Reductions	TP EOS lbs./yr.		371,013	959,856	0	
					Total Projected Reduction	
					959,856	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-40: Double Pipe Creek Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$582,000	$2,508,000	$3,090,000
Impervious surface Elimination	$24,000		$24,000
Tree Planting	$3,321,000	$496,000	$3,817,000
Stream Restoration	$5,055,000	$7,529,000	$12,584,000
Outfall Stabilization		$1,574,000	$1,574,000
Inlet cleaning		$1,000	$1,000
Street Sweeping	$15,000		$15,000
Total			$21,105,000

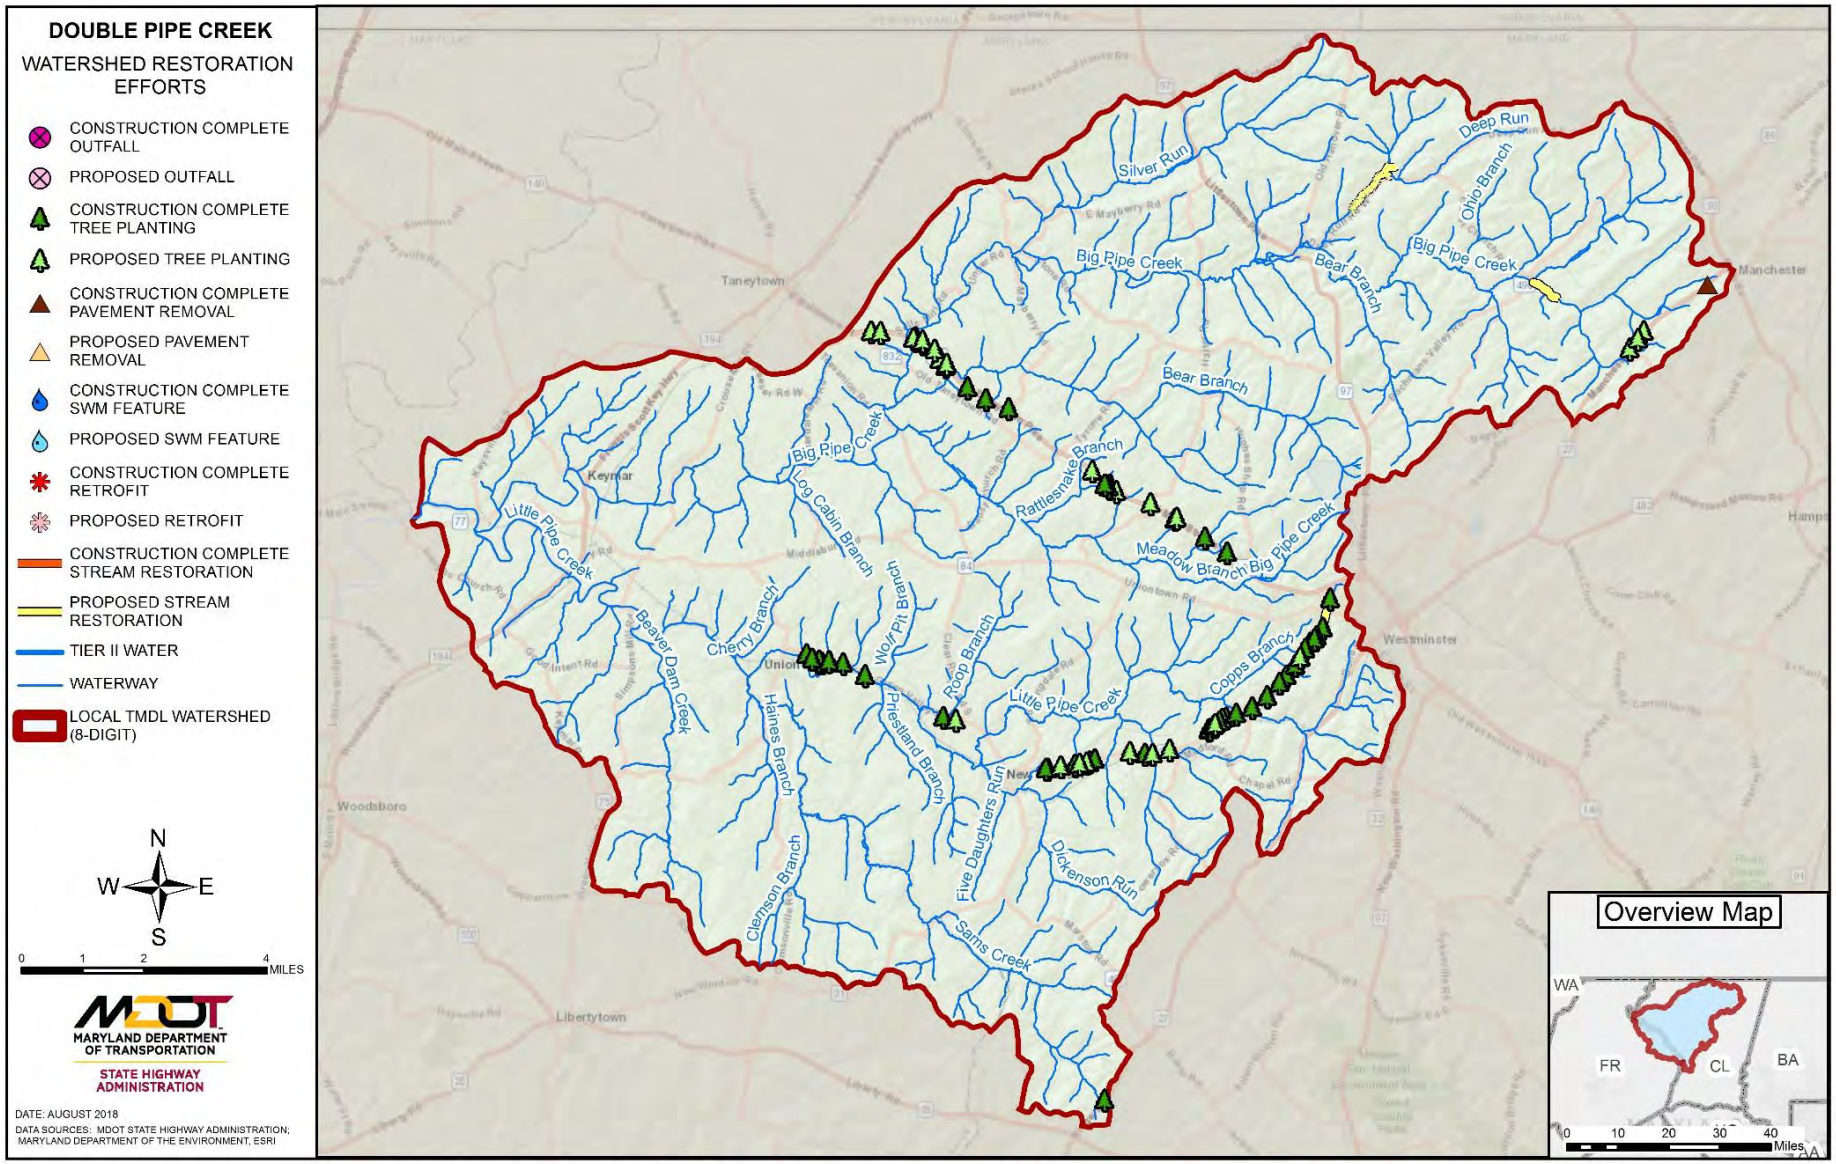


Figure 4-30: MDOT SHA Restoration Strategies within the Double Pipe Creek Watershed

K. GUNPOWDER RIVER & BIRD RIVER SUBSEGMENTS

K.1. Subsegments Description

The Gunpowder River Oligohaline Segment is one of the 92 tidal water body segments of the Chesapeake Bay and its tributaries. The Gunpowder River Oligohaline Segment includes both the Gunpowder River subsegment (hereinafter “Gunpowder River”) and the Bird River subsegment (hereinafter “Bird River”).

The Gunpowder River is a 6.8-mile-long (10.9 km) tidal inlet on the western side of the Chesapeake Bay in Baltimore and Harford Counties. The Gunpowder River is formed by the convergence of two freshwater tributaries: Gunpowder Falls (often referred to locally as "Big Gunpowder Falls") and Little Gunpowder Falls. Gunpowder River is surrounded by the Gunpowder River watershed (8-digit Basin Code: 02130801, excluding the Seneca Creek portion) in Harford County to the east and Baltimore County to the west. The total area of the Gunpowder River watershed is approximately 20 square miles. Major tributaries of the Gunpowder River watershed include Foster Branch and Emmord Branch.

The Bird River is located above the Baltimore County portion of the Gunpowder River watershed and is approximately 7 miles (11.3 km) in length. The Bird River watershed (8-digit Basin Code: 02130803) encompasses approximately 26 square miles solely within Baltimore County, Maryland. The Bird River flows east into the Gunpowder River; accordingly, both the Gunpowder River watershed and the Bird River watershed drain into the Gunpowder River. The Gunpowder River ultimately flows into the Chesapeake Bay. Major tributaries of the Bird River watershed include Whitemarsh Run, Honeygo Run, and Windlass Run.

There are 46 centerline miles of MDOT SHA roadway located within the Gunpowder River watershed; the associated ROW encompasses 530 acres, of which 246 acres are impervious.

There are no MDOT SHA facilities located within the Gunpowder River and the Bird River watersheds (**Figure 4-31**).

K.2. MDOT SHA TMDLs in the Gunpowder River & Bird River Subsegments

MDOT SHA is included in the PCBs TMDL (MDE, 2016c) and has reduction requirements of 70 percent in the Bird River watershed and 0 percent in the Gunpowder River watershed, as shown in **Table 3-2**. Because MDOT SHA does not have a reduction requirement in the Gunpowder River watershed, **Section K.3.**, **Section K.4.**, and **Section K.5.** below only pertain to the Bird River watershed.

K.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan, Section C** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Bird River subsegment is shown in **Figure 4-32** which illustrates that 21 grid cells have been reviewed, encompassing portions of nine (9) state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 66 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 41 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 25 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 26 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 12 sites constructed or under contract.
- Five (5) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- Nine (9) sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified one (1) site as a potential stream restoration location. Further analysis of this location resulted in:

- One (1) site deemed not viable for stream restoration and has been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 27 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Two (2) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 25 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified two (2) outfalls potential for stabilization. Further analysis of these sites resulted in:

- One (1) outfall site constructed or under contract.
- One (1) outfall site deemed potentially viable for outfall stabilization efforts and pending further analysis, may be a candidate for future restoration opportunities.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 21 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of two (2) existing structural SW controls constructed or under contract.
- One (1) retrofit site deemed potentially viable for retrofit and pending further analysis may be a candidate for future restoration opportunities.
- 18 retrofit sites deemed not viable for retrofit and have been removed from consideration.

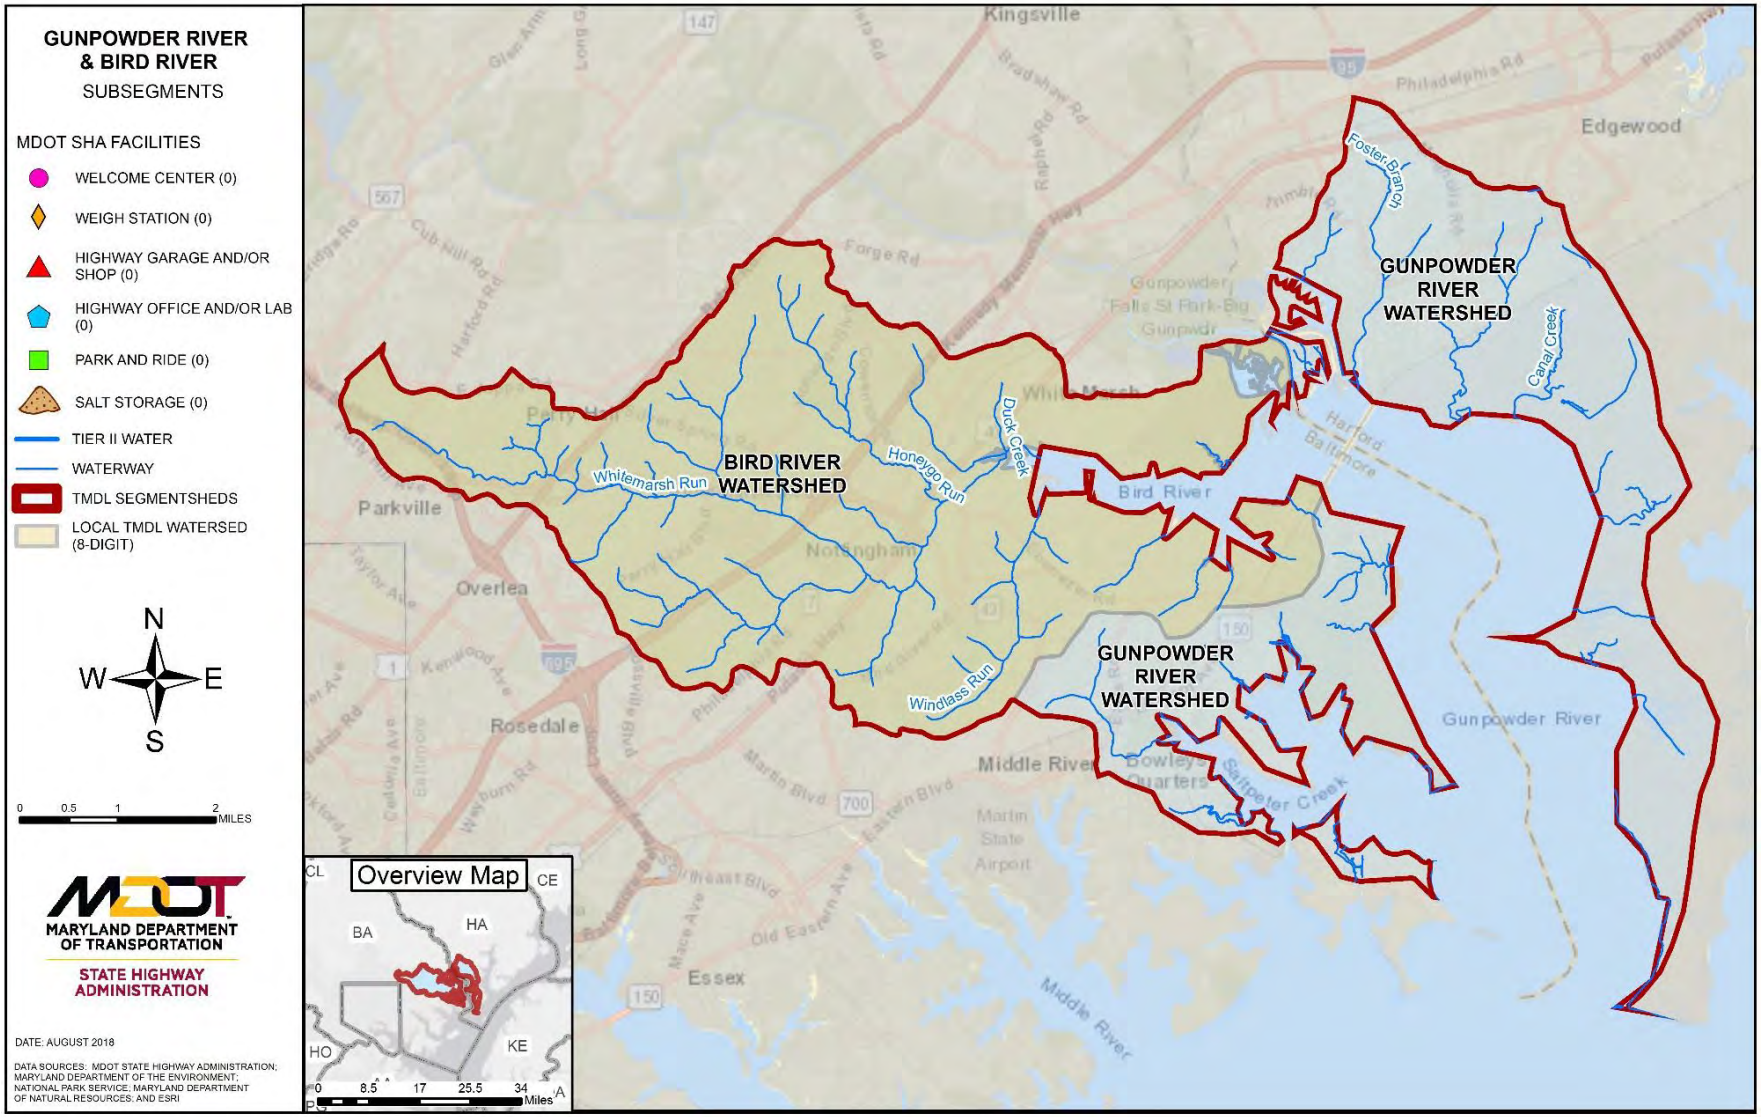


Figure 4-31: Gunpowder River & Bird River Subsegments of Gunpowder River Oligohaline Segmentshed

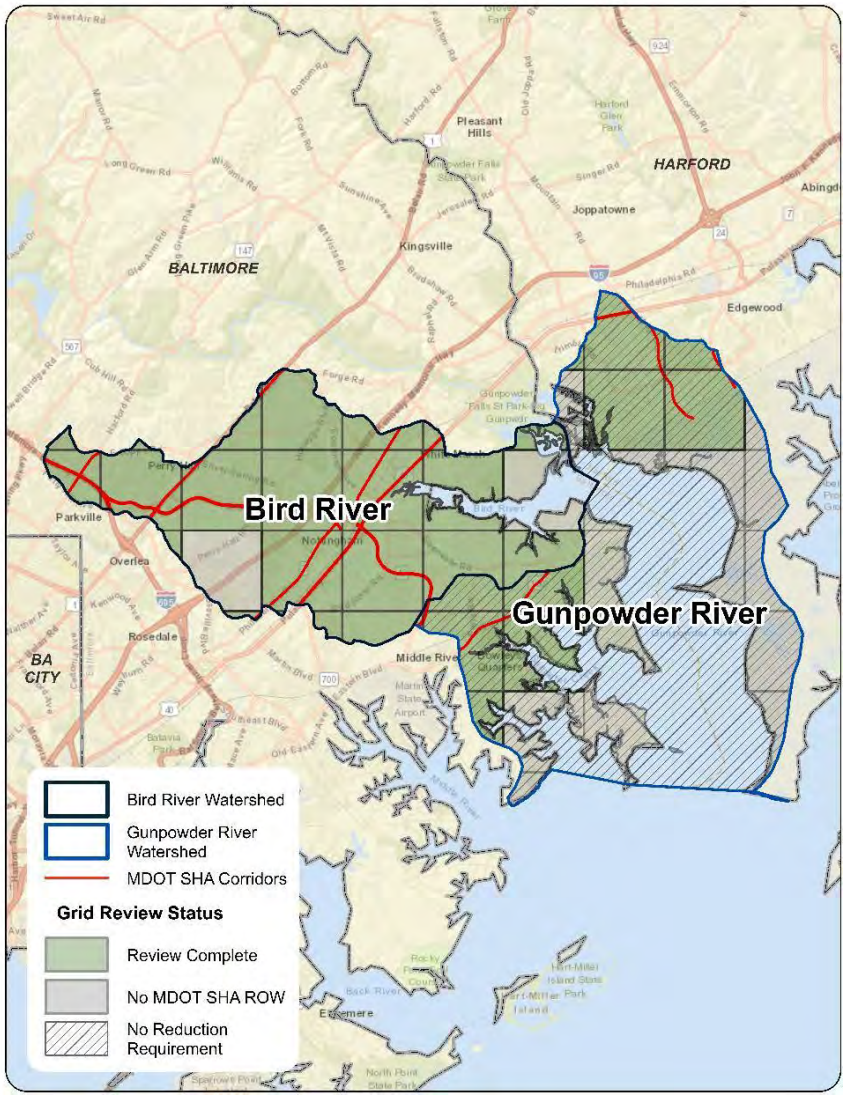


Figure 4-32: Gunpowder River & Bird River Subsegments Site Search Grids

K.4. Summary of County Assessment Review

The designated use of the waters of the Bird River (8-digit Basin Code: 02130803) is Use II – Support of Estuarine and Marine Aquatic Life and Shellfish Harvesting (MDE, 2016c). The Bird River is subject to the following impairments as noted on MDE's 303(d) List:

- PCB in Fish Tissue

The Baltimore County Department of Environmental Protection and Sustainability completed a SWAP for the Bird River watershed (Versar et al., 2014). The Bird River SWAP provides guidance on the restoration of the Bird River watershed. It includes strategies and project prioritizations for watershed restoration and management for each of the eight subwatersheds within the Bird River watershed, namely Whitemarsh Run, Whitemarsh Run (N. Fork), Whitemarsh Run (S. Fork), Honeygo Run, Windlass Run, Bird River-D, Bird River-B, and Railroad Creek_Bird River-A. Maryland Route 43 predominantly runs through the "Whitemarsh Run" subwatershed and separates the "Whitemarsh Run (N. Fork)" and "Whitemarsh Run (S. Fork)" subwatersheds: Whitemarsh Run (N. Fork) is located above MD Route 43 and Whitemarsh Run (S. Fork) is located below MD Route 43. "Bird River-D" and "Bird River-B" surround Bird River: Bird River-D is predominantly the drainage area directly above Bird River and Bird River-B is predominantly the drainage area directly below Bird River. The "Railroad Creek_Bird River-A" subwatershed surrounds Railroad Creek.

Land use/land cover within the Bird River watershed is predominantly urbanized (approximately 50 percent) and forested (approximately 29 percent). Impervious urban land cover comprises 3,058 acres (18.6

percent) of the watershed, and approximately 12 percent of the soils within the watershed are considered as high runoff potential.

The County estimates that impervious urban land use is responsible for contributing 28,269 lbs. of nitrogen, 4,260 lbs. of phosphorus, and 1,729,028 lbs. of sediment in the Bird River watershed each year. Stormwater runoff was identified as the primary contributor of nutrient (nitrogen and phosphorus) and sediment inputs to the Bird River watershed. Trash is another significant source of impairment; the Bird River SWAP states, "Trash is one of the most noticeable pollutants in the Bird River" (Versar et al., 2014, p. 2-3).

Restoration actions are needed throughout the entire Bird River watershed to meet environmental goals and requirements. However, using ranking criteria to prioritize the eight subwatersheds within the Bird River watershed, Baltimore County supports a focused framework to identify which subwatersheds have the greatest need and potential for restoration.

The Bird River SWAP describes the ranking methodology used to prioritize the subwatersheds as follows: The subwatersheds were represented by an overall prioritization score on a scale of 48, based on a set of 12 criteria (listed below) each worth a maximum of four points. A total score of 0 means the subwatershed has the least significant impacts to water quality and a total score of 48 corresponds to a subwatershed with the greatest water quality improvement potential. The total prioritization score for each of the Bird River subwatersheds was determined using the following 12 ranking criteria:

- Phosphorus Loads;
- Nitrogen Loads;
- Impervious Surfaces;
- Neighborhood Restoration Opportunity/Pollution Source Indexes;
- Neighborhood Downspout Disconnection;
- Institutional Site Investigations;
- Pervious Area Assessments;
- Municipal Street Sweeping;
- Municipal Stormwater Conversions;
- Illicit Discharge Data;
- Stream Buffer Improvement; and
- Stream Restoration Potential.

The scoring resulted in the Whitemarsh Run and Honeygo Run subwatersheds being rated as "very high" and the Whitemarsh Run (N. Fork) and Whitemarsh Run (S. Fork) subwatersheds being rated as "high" in terms of restoration need and potential. **Table 4-41** shows the total score of each watershed and its corresponding ranking and prioritization for treatment category.

Table 4-41: County Identified Priority Areas for Treatment in the Bird River Watershed

Rank	Subwatershed	Total Score	Prioritization Category
1	Whitemarsh Run	41	Very High
2	Honeygo Run	31	Very High
3	Whitemarsh Run (N. Fork)	28	High
4	Whitemarsh Run (S. Fork)	28	High
5	Bird River-D	24	Medium
6	Railroad Creek_Bird River-A	17	Medium
7	Bird River-B	14	Low
8	Windlass Run	11	Low

Source: Versar et al. (2014)

The subwatersheds were also ranked by protection priorities (**Table 4-42**). This was done to highlight the importance of protecting areas that are in good condition from any degradation that could occur. This ranking was established by reversing the subwatershed restoration

prioritization as listed in **Table 4-41**. Therefore, Windlass Run and Bird River-B were listed as "very high," while Railroad Creek_Bird River-A and Bird River-D were listed as "high" in terms of protection priority.

Table 4-42: County Identified Priority Areas for Protection in the Bird River Watershed

Rank	Subwatershed	Total Score	Protection Category
1	Windlass Run	11	Very High
2	Bird River-B	14	Very High
3	Railroad Creek_Bird River-A	17	High
4	Bird River-D	24	High
5	Whitemarsh Run (N. Fork)	28	Medium
6	Whitemarsh Run (S. Fork)	28	Medium
7	Honeygo Run	31	Low
8	Whitemarsh Run	41	Low

Source: Versar et al. (2014)

Table 4-43 presents Baltimore County-suggested BMPs to aid in meeting the restoration goals within the Bird River watershed. The recommended BMPs are separated out by applicable BMPs for developed and agricultural areas. Several other BMP suggestions such as citizen awareness activities are applicable to all areas of the watershed. The Bird River SWAP indicates that the Bird River-B and Windlass Run watersheds have the most agricultural land (cropland). The largest area of commercial and industrial land use is concentrated around the White Marsh Mall and The Avenue at White Marsh within the Whitemarsh Run watershed.

Table 4-43: County Suggested BMPs for the Bird River Watershed

Developed Areas	All Areas
• Stormwater Management Upgrades – conversions (ponds # 883 & # 1633 in the Whitemarsh Run, pond # 951 in Whitemarsh Run (N. Fork), and pond # 1166 in Whitemarsh Run (S. Fork) subwatersheds were recommended for conversion because water quality benefits could be significantly increased in these ponds with minimal effort) – retrofits • Stream Corridor Restoration – stream restoration (data from SCAs indicates that a total of 6,924 linear feet of stream in the Bird River-D, Honeygo Run, and Whitemarsh Run subwatersheds are in need of restoration due to significant erosion and channel alteration) – buffer restoration – wetland creation • Trash and Recycling – single stream recycling – household hazardous waste collection – waterway trash boom • Reforestation • Street Sweeping • Inlet Cleaning • Illicit Discharge Detection and Elimination (IDDE) Program • Waterway Dredging • Land Development Review (including follow-up inspections post construction)	• Citizen Awareness Activities – Stormwater Runoff – Pet Waste/Bacteria Awareness – Fertilizer Reduction – Trash and Recycling (compost bins, stewardship projects, Baltimore County's Reuse Directory, and the Re-source Newsletter) – Environmental Awareness and Education • Volunteer Restoration Programs – Downspout Disconnection – Bayscaping – Tree Canopy Improvement – Fertilizer Reduction/Education – Stream Watch Program – Open Space Trees • Institutional Initiatives – Parking Lot Retrofits – Open Space Planting • Land Preservation – Maryland and County Rural Legacy Programs – Maryland Environmental Trust and Local Land Trusts – Maryland Agricultural Land Preservation Foundation – Baltimore County Agricultural Land Preservation Program
Agricultural Areas	
• Farm Conservation Plans – Cover Crop – Nutrient Management – Integrated Pest Management – Residue and Tillage Management – Conservation Crop Rotation – Stripcropping • Nutrient Management Plans	

Source: Versar et al. (2014)

The Bird River SWAP also established restoration strategies for each subwatershed as presented in **Table 4-44**. These strategies were based on the individual conditions and needs of each subwatershed.

Table 4-44: County Suggested BMPs for Subwatersheds within the Bird River Watershed

Subwatershed	Recommended Actions												
	Remove Impervious Cover	Stormwater Retrofit	Rain Barrels	Rain Gardens	Storm Drain Marking	Bayscaping	Tree Planting	Downspout Disconnection	Pet Waste Education	Trash Management	Stream Buffer Improvement	Parking Lot/Alley Retrofit	Street Sweeping
Bird River-B			✓	✓		✓	✓				✓	✓	
Bird River-D		✓	✓	✓	✓	✓	✓	✓			✓		
Honeygo Run			✓	✓	✓	✓	✓	✓			✓		
Railroad Creek_Bird River-A			✓	✓	✓	✓	✓		✓		✓		
Whitemarsh Run	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Whitemarsh Run (N. Fork)	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓		
Whitemarsh Run (S. Fork)		✓	✓	✓	✓	✓	✓	✓		✓	✓	✓	✓
Windlass Run		✓	✓		✓	✓	✓	✓		✓			

Source: Versar et al. (2014)

K.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet the PCB reductions in the Bird River watershed are shown in **Table 4-45**. Projected PCB reductions using these practices are shown in **Table 3-2**.Four timeframes are :

- BMPs built before the TMDL baseline. In this case, the baseline is 2010;
- BMPs built after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025, and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the PCB TMDL, MDOT SHA will meet 7.4 percent of the MDE 70 percent load reduction requirement through implementation of BMPs shown in **Table 4-45**. MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in Part III Section E.

Estimated capital budget costs to design, construct, and implement annual practices such as inlet cleaning and street sweeping within the Bird River watershed total $1,083,000. These projected costs are based on an average cost per impervious acre treated that is derived from cost history for a group of completed projects for each BMP category. Please see **Table 4-46** for a BMP strategy cost breakdown

Figure 4-33 shows a map of MDOT SHA's restoration practices in the segmentshed and includes those that are under design or construction. Inlet cleaning is not reflected on this map.

Table 4-45: Bird River PCB BMP Implementation

BMP	Unit	Baseline (Before 2010)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	209.6	2.1	9.8	TBD	221.5
Retrofit	drainage area acres		11.2		TBD	11.2
Inlet Cleaning[1]	dry tons		9.5	25.7	TBD	35.2
Load Reductions	PCB g/yr.		0.08	0.09	0.88	
					Total Projected Reduction	**0.88**

[1] Inlet cleaning and street sweeping are annual practices.

Table 4-46: Bird River Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$96,000	$387,000	$483,000
Retrofits	$408,000		$408,000
Inlet cleaning	$45,000	$147,000	$192,000
Total			$1,083,000

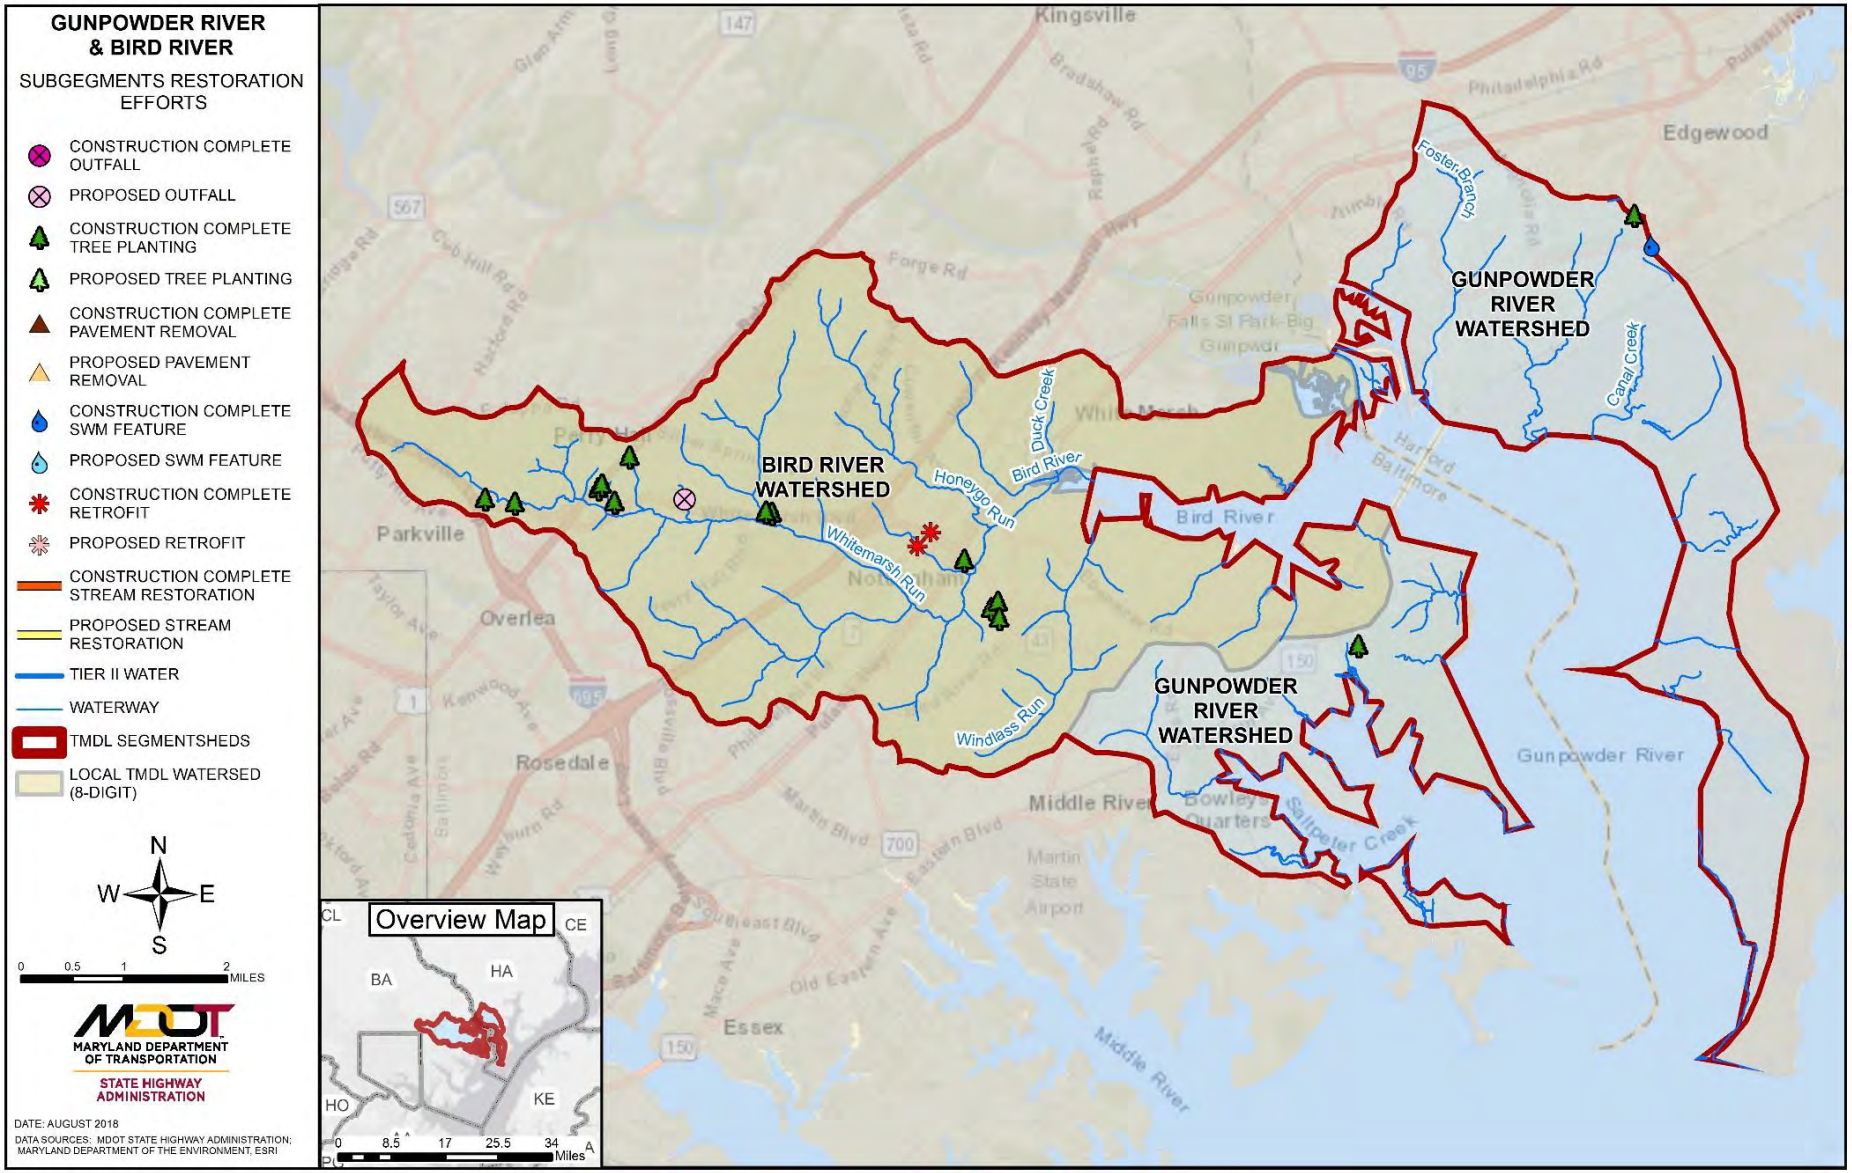


Figure 4-33: MDOT SHA Restoration Strategies within the Gunpowder River & Bird River Subsegments

L. GWYNNS FALLS WATERSHED

L.1. Watershed Description

The Gwynns Falls watershed encompasses 43 square miles within Baltimore County and the City of Baltimore. The Gwynns Falls flows from Baltimore County for 25 miles in a southeasterly direction to City of Baltimore where it empties into the Patapsco River, which runs into the Chesapeake Bay. Tributary creeks and streams of the Gwynns Falls include Dead Run, Horsehead Ranch, Maidens Choice Run, Powder Mill Branch, Red Run, and Scotts Level Run.

There are 1,055.7 centermiles of MDOT SHA roadway located within the Gwynns Falls watershed. The associated ROW encompasses 1,515.7 acres, of which 892.5 acres are impervious. MDOT SHA facilities located within the Gwynns Falls watershed consist of one (1) park and ride facility, one (1) highway garage or shop facility and two (2) salt storage facilities. See **Figure 4-34** for a map of the watershed.

L.2. MDOT SHA TMDLs within Gwynns Falls Watershed

MDOT SHA is included in the sediment (TSS) TMDL (MDE, 2010b) and has a reduction requirement of 36.4 percent within Baltimore County as shown in **Table 3-2.**

The Gwynns Falls is also included in the Middle Branch and Northwest Branch Patapsco TMDL for Trash (MDE, 2015c). The allocated trash baseline for MDOT SHA is to be reduced by 100% (this does not mean that trash within the watershed will be reduced to zero).

L.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Gwynns Falls watershed is shown in **Figure 4-35** which illustrates that 34 grid cells have been reviewed, encompassing portions of 13 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 177 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 140 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 37 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 108 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 56 sites constructed or under contract.
- 18 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.

- 34 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified five (5) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Five (5) sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 57 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Two (2) new structural SW controls constructed or under contract.
- 55 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 12 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Three (3) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- Nine (9) retrofit sites deemed not viable for retrofit and have been removed from consideration.

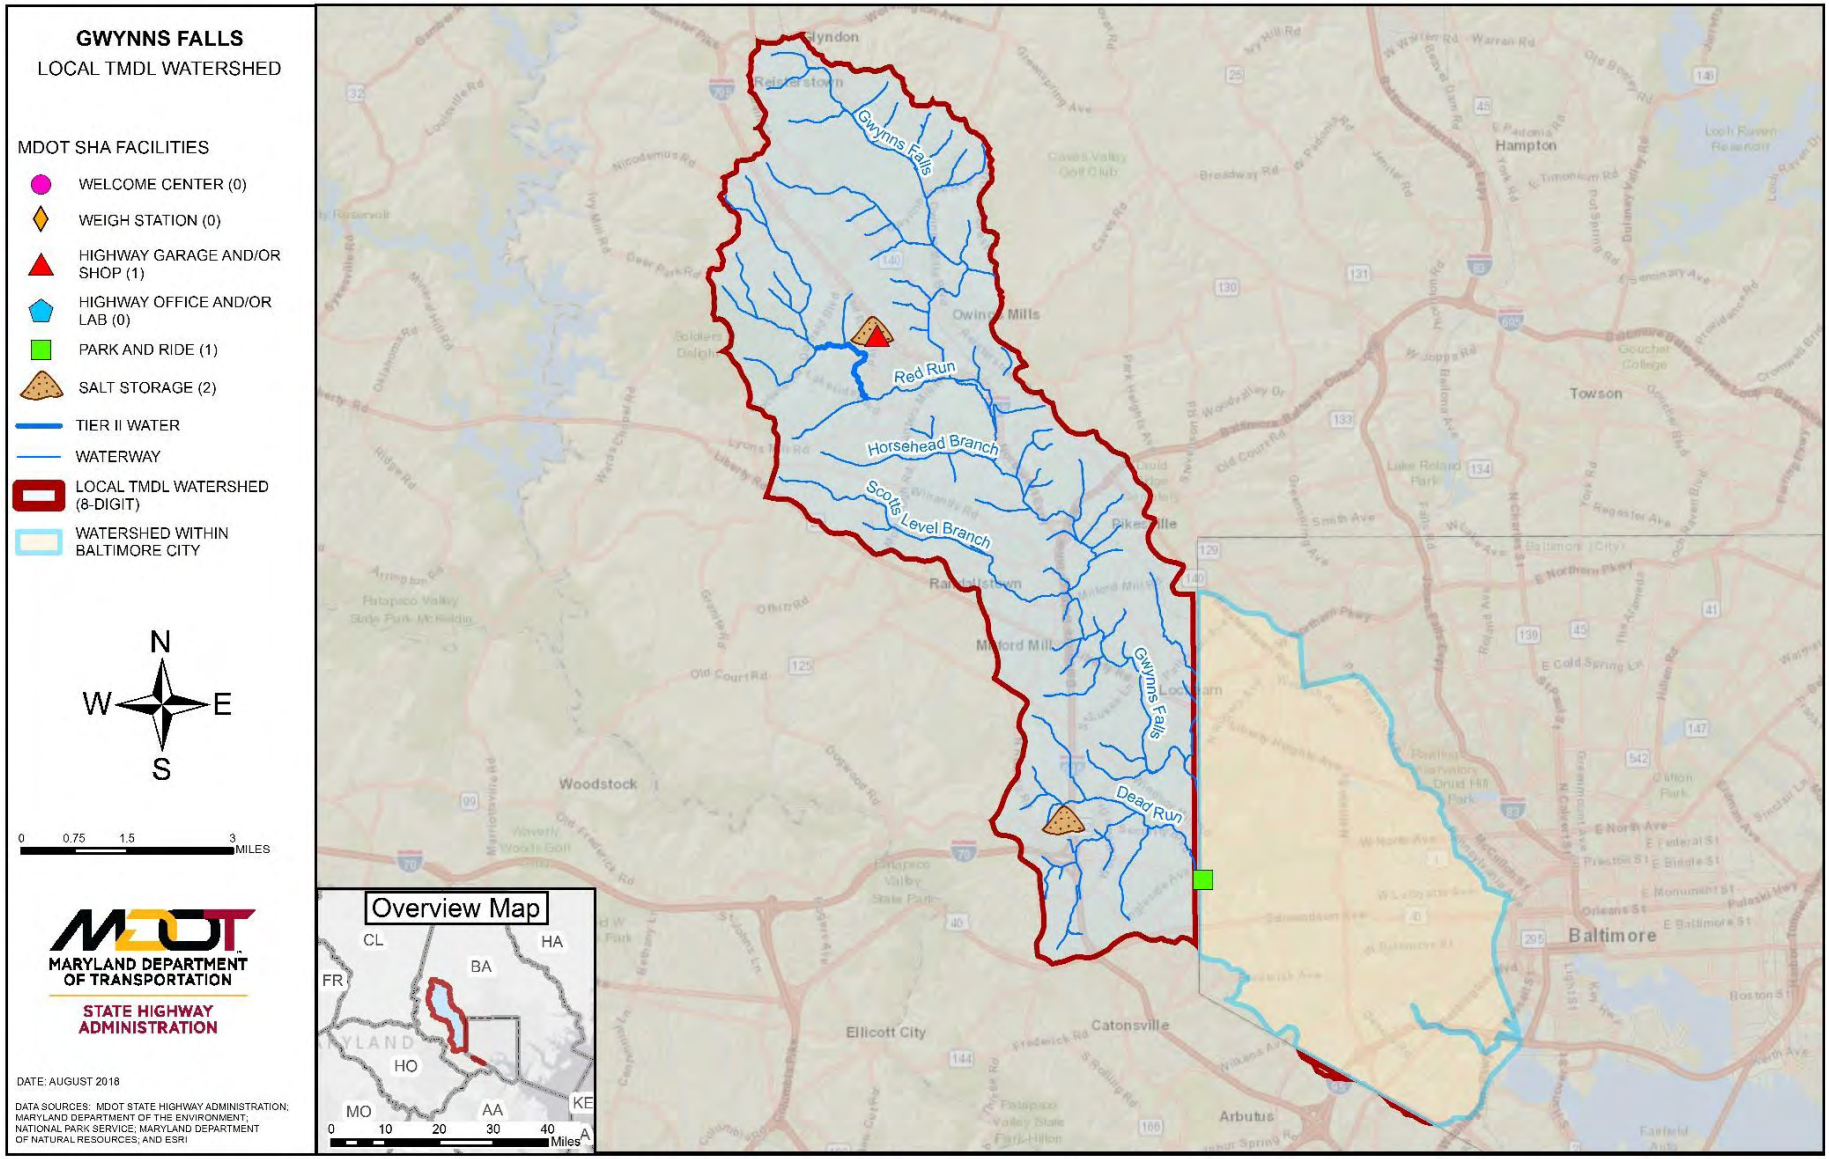


Figure 4-34: Gwynns Falls Watershed

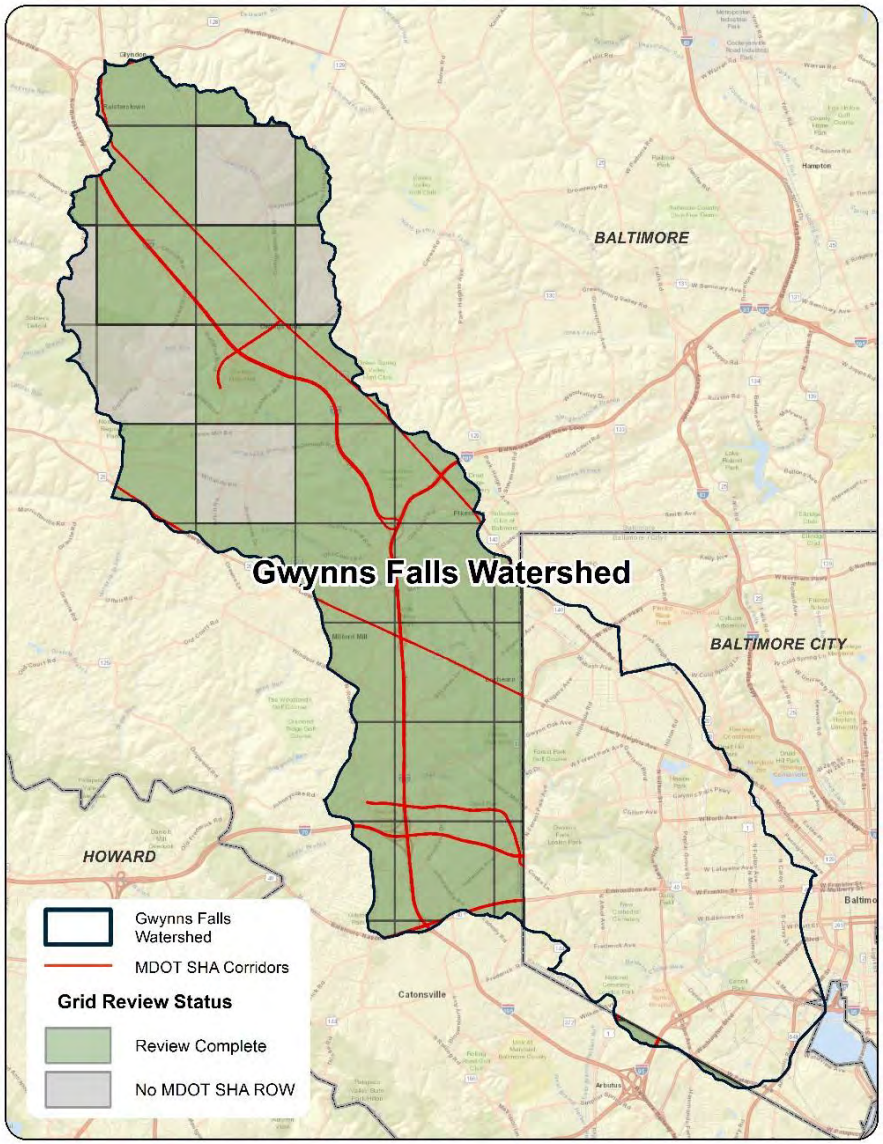


Figure 4-35: Gwynns Falls Site Search Grids

L.4. Summary of County Assessment Review

Waters within the Gwynns Falls watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- Fecal Coliform;
- PCB in Fish Tissue;
- Temperature, water; and
- TSS.

The Baltimore County Department of Environmental Protection and Sustainability completed SWAPs for the Gwynns Falls watershed's Upper Gwynns Falls (UGF) subwatershed (A. Morton Thomas and Associates, Inc. [AMT, Inc.], 2011) and the Middle Gwynns Falls (MGF) subwatershed (PB, 2013), hereinafter referred to as the "UGF watershed" and "MGF watershed," respectively. Impervious land cover makes up 20 percent of the UGF watershed and 29 percent of the MGF watershed. Approximately 11 percent of soils within the UGF watershed and over 30 percent of the soils within the MGF watershed are considered of high runoff potential. The County estimates that impervious urban land use is responsible for contributing 39,029 lbs. of nitrogen and 6,256 lbs. of phosphorus in the UGF watershed per year and 74,468 lbs. of nitrogen, 6,502 lbs. of phosphorus, and 8,833,323 lbs. of sediment in the MGF watershed per year.

There are 28 NPDES-permitted facilities within the UGF watershed, including a MDOT SHA maintenance yard. There are five process water sources with explicit sediment limits within the watershed. The total sediment load from all process water sources within the watershed is estimated at 213.2 tons per year (AMT, Inc., 2011).

The County prioritized subwatersheds within the UGF and MGF watersheds based on ranking criteria to identify which subwatersheds have the greatest need and potential for restoration. For the UGF

watershed, the "UGF-D" subwatershed was rated "very high" and the "UGF-B" and "Roche's Run" subwatersheds were rated "high" in terms of restoration need and potential (AMT, Inc., 2011). For the MGF watershed, the "Dead Run" subwatershed was rated "very high" and the "Gwynns Falls" subwatershed was rated "high" in terms of restoration need and potential (PB, 2013).

For the purposes of planning, the County selected the following generalized restoration strategies to aid in meeting restoration goals within the Gwynns Falls watershed:

- Using present SWM facilities;
- Converting SWM facilities;
- SWM retrofits;
- Impervious cover removal;
- Stormwater education and outreach;
- Stream restoration;
- Community Reforestation Program (CRP);
- Street sweeping;
- Illicit connection detection/disconnection;
- Sanitary sewer consent decree;
- MS4 retrofits;
- Credits for Fertilizer Act of 2011;
- Increased State owned property restoration;
- Redevelopment of urban areas;
- Reforestation;
- Downspout disconnection; and
- Urban nutrient management.

The County identified numerous potential restoration sites within each subwatershed by conducting neighborhood source assessments, hotspot site investigations, institutional site investigations, and pervious area assessments. The County also identified multiple potential stormwater conversions within each watershed: 28 for the UGF watershed (AMT, Inc., 2011) and 15 for the MGF watershed (PB, 2013). Detailed information on site locations can be found in the SWAPs.

The County identified 42 proposed project sites for stream restoration and stabilization. Additionally, the County proposed 15 "large projects" (>$300,000) in the UGF watershed. Details on project type and site location for potential restoration projects in the UGF watershed are not included in the SWAP.

The following sites were identified as high priorities for stream restorations in the MGF watershed as shown in **Table 4-47** below.

Table 4-47: County Identified Potential Stream Restoration Sites in Gwynns Falls Watershed

Reach	Number of Sites	Total Linear Feet	Conditions
Gwynns Falls	14	6,000	Severe bank erosion, severe buffer erosion, concrete channels, inadequate buffers, unstable aprons, unstable banks, unstable outfalls
Powder Mill Run	3	5,000	Erosion, unstable banks, inadequate buffers
Maiden Choice Run	2	2,100	Concrete channels, absent floodplains, unstable banks
Scotts Level	3	8,100	Concrete channels, absent floodplains, unstable banks

Source: PB (2013)

L.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet the sediment and trash reductions in the Gwynns Falls watershed are shown in **Table 4-48** and **Table 4-49**. Projected reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the table:

- BMPs implemented before the baseline year. In this case, the baseline for sediment is 2005 and the baseline for trash is 2010;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL, MDOT SHA will meet 22.1 percent of the MDE 36.4 percent load reduction requirement through implementation of BMPs shown in **Table 4-48.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Gwynns Falls watershed total $4,482,000. They are based on average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-50** for a summary of estimated BMP costs.

Figure 4-36 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or constructed. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-48: Gwynns Falls Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	66.4	3.6	17.1	TBD	87.1
Tree Planting	acres of tree planting		59.4	3.0	TBD	62.5
Stream Restoration	linear feet			912.8	TBD	912.8
Outfall Stabilization	linear feet		1.8	400	TBD	401.8
Inlet Cleaning[1]	dry tons		23.0	36.8	TBD	59.8
Load Reductions	TSS EOS lbs./yr.		37,415	110,058	498,014	
					Total Projected Reduction	**498,014**

[1] *Inlet cleaning is an annual practice.*

Table 4-49: Patapsco-Gwynns Falls Trash & Debris Activities Implementation					
BMP	**Unit**	**Restoration BMPs**			**Total BMPs**
		2020	**2025**	**Future**	
Stormwater BMP	drainage area acres	5		N/A	5
Stream Clean-Ups	pounds			N/A	
Media Relations (Use of Free Media)	each	4		N/A	4
Outreach: Community/School Children/ Youth	each			N/A	
Inlet Cleaning[1]	No. Inlets	257	200	N/A	457
Street Sweeping[1]	acres	109	164	N/A	273
Load Reductions	lbs./yr.	2,499	2,511	2,511	
			Total Projected Reduction	**2,511**	
[1] *Inlet cleaning and street sweeping are annual practices.*					

Table 4-50: Gwynns Falls Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$200,000	$580,000	$780,000
Tree Planting	$1,818,000	$92,000	$1,910,000
Stream Restoration		$610,000	$610,000
Outfall Stabilization		$791,000	$791,000
Inlet cleaning	$154,000	$210,000	$364,000
Street Sweeping	$11,000	$16,000	$27,000
Total			$4,482,000

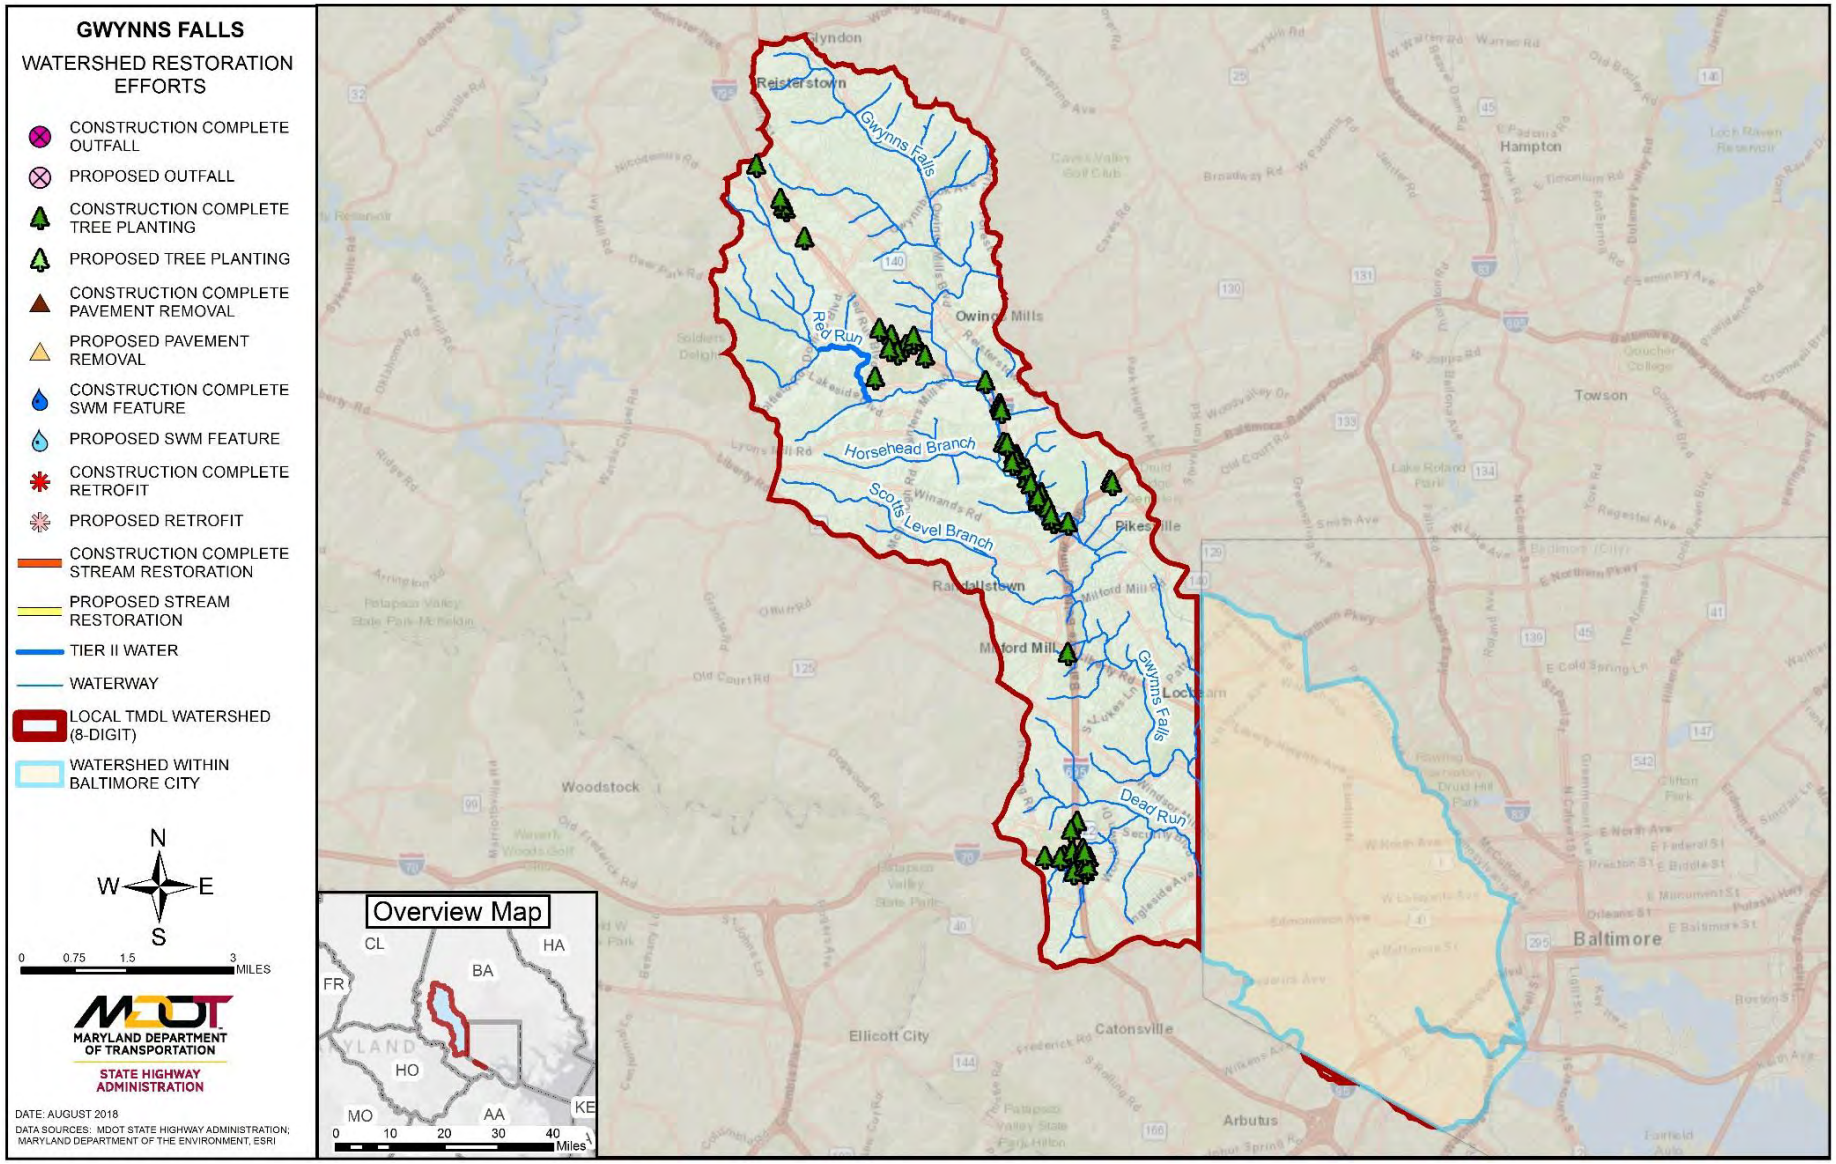


Figure 4-36: MDOT SHA Restoration Strategies within the Gwynns Falls Watershed

M. JONES FALLS WATERSHED

M.1. Watershed Description

The Jones Falls watershed encompasses 77 square miles within Baltimore County and the City of Baltimore. The headwaters of the Jones Falls are located near Garrison in Greenspring Valley, from which it flows east until it reaches Lake Roland, where it is impounded. From Lake Roland, the river merges with eastern tributaries and then continues south through the City of Baltimore to the Inner Harbor. The Jones Falls watershed is comprised of the Upper Jones Falls (UJF) watershed, Northeastern Jones Falls (NJF) watershed, and Lower Jones Falls (LJF) watershed. The UJF watershed makes up approximately 36 percent of the watershed, the NJF watershed makes up 19 percent of the watershed, and the LJF Watershed makes up the lower 45 percent of the watershed. Tributary creeks and streams of the Jones Falls watershed include Moores Branch, Roland Run, Towson Run, Western Run, and Stoney Run.

There are 790.9 centerline miles of MDOT SHA roadway located within the Jones Falls watershed. The associated ROW encompasses 857.9 acres, of which 583.2 acres are impervious. MDOT SHA facilities located within the Jones Falls watershed consist of one (1) salt storage facility and one (1) highway office or lab facility that is located outside of the MDOT SHA MS4 Permit coverage area. See **Figure 4-37** for a map of the watershed.

M.2. MDOT SHA TMDLs within Jones Falls Watershed

MDOT SHA is included in the sediment (TSS) TMDL (MDE, 2011e) and has a reduction requirement of 21.7 percent within Baltimore County as shown in **Table 3-2.**

The Jones Falls is also included in the Middle Branch and Northwest Branch Patapsco TMDL for Trash (MDE, 2015c). The allocated trash baseline for MDOT SHA is to be reduced by 100 percent (this does not mean that trash within the watershed will be reduced to zero).

The Lake Roland subwatershed within the Jones Falls watershed has a TMDL for PCBs (MDE, 2014f) with a reduction requirement of 29.3 percent as shown in **Table 3-2**.

M.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Jones Falls watershed is shown in **Figure 4-38** which illustrates that 29 grid cells have been reviewed, encompassing portions of 13 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 172 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 149 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 23 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 65 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 35 sites constructed or under contract.
- Three (3) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 27 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified seven (7) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- One (1) site constructed or under contract.
- Six (6) sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 54 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Six (6) new structural SW controls constructed or under contract.
- Seven (7) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 41 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 42 outfalls potential for stabilization. Further analysis of these sites resulted in:

- 42 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified six (6) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- One (1) retrofit site deemed potentially viable for retrofit and pending further analysis may be a candidate for future restoration opportunities.
- Five (5) retrofit site deemed not viable for retrofit and have been removed from consideration.

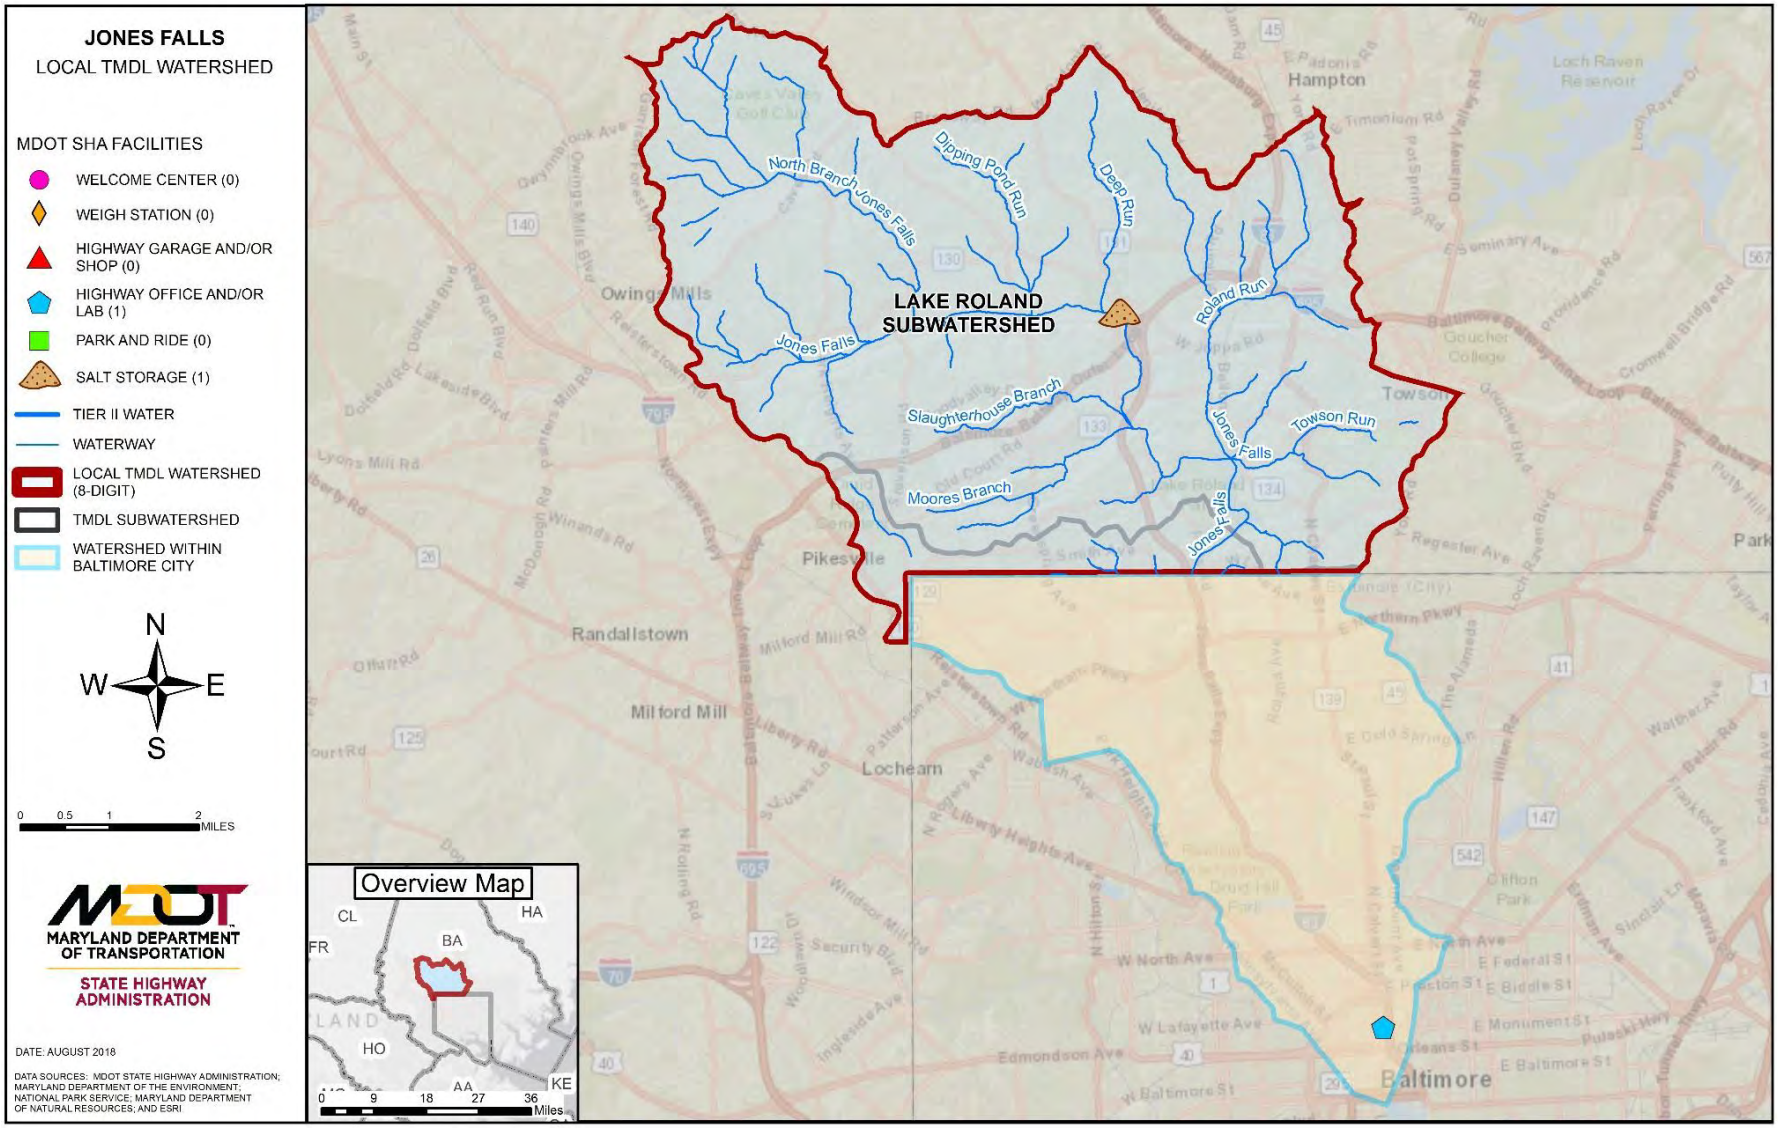


Figure 4-37: Jones Falls Watershed

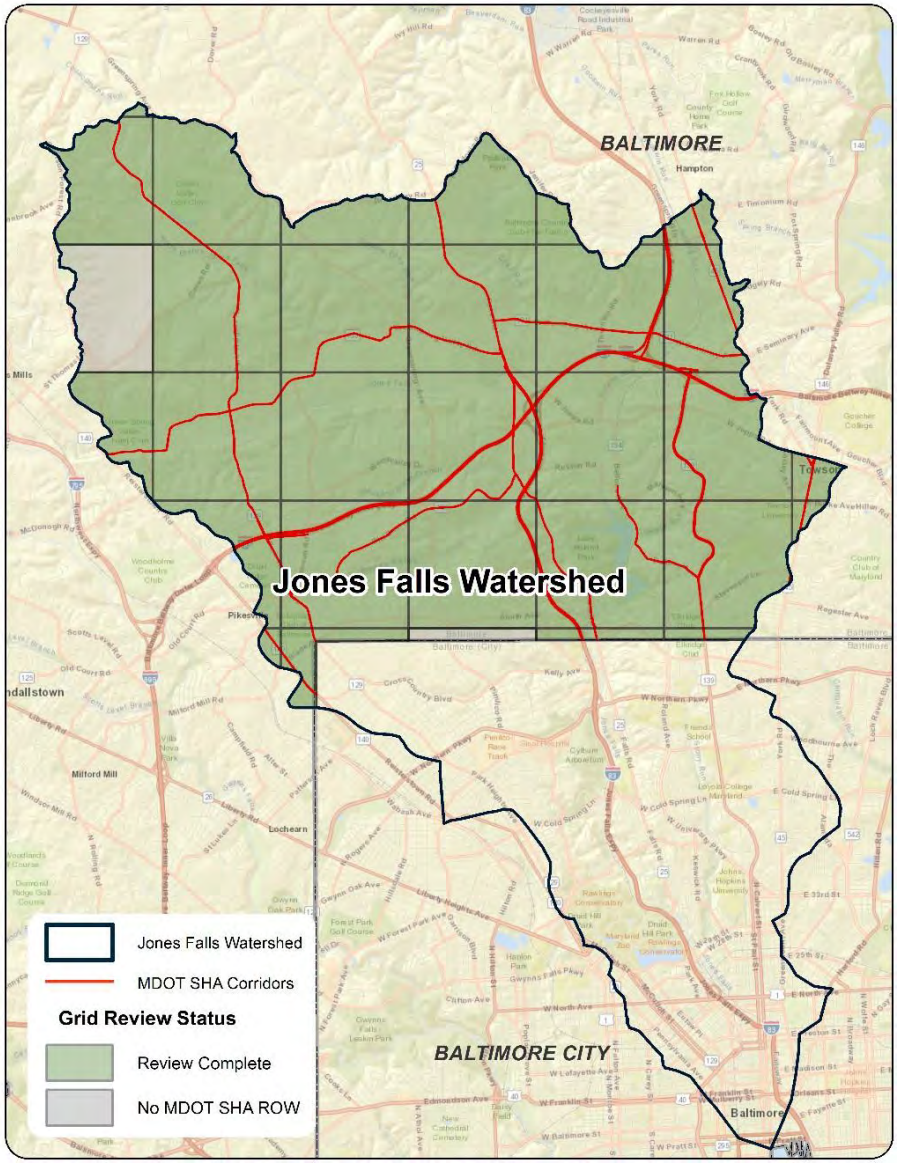


Figure 4-38: Jones Falls Site Search Grids

M.4. Summary of County Assessment Review

Waters within the Jones Falls watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- Fecal Coliform;
- PCB in Fish Tissue;
- Sulfates;
- Temperature, water; and
- TSS.

The Baltimore County Department of Environmental Protection and Sustainability completed SWAPs for the UJF watershed (CWP et al., 2015), the NJF watershed (BA-EPS, 2012), and the LJF watershed (CWP, 2008b). Impervious land cover comprises 9% of the UJF watershed, 25 percent of the NJF watershed, and 32 percent of the LJF watershed. Approximately 7 percent of the soils within the UJF watershed, 9 percent of the soils within the NJF watershed, and 60 percent of the soils within the LJF watershed are considered of high runoff potential. Urban impervious and cropland are the land uses responsible for the greatest nitrogen, phosphorus, and sediment loads within the UJF and NJF watersheds.

Jones Falls currently has completed TMDLs for sediment and fecal coliform in the mainstem and PCBs in an impoundment (Lake Roland). Jones Falls also has Category Five impairment listings (i.e., TMDL required) for chlorides and sulfates in the mainstem and temperature in the Slaughterhouse Branch and two unknown tributaries. The Jones Falls watershed also falls within the Patapsco River Mesohaline segment-shed of the Chesapeake Bay, which has TMDLs for nitrogen, phosphorus, and sediment and Category Five impairment listings for zinc and lead in the Northwest Branch and trash and Enterococcus in the Middle Branch/Northwest Harbor.

The County prioritized subwatersheds within the UJF and NJF watersheds based on ranking criteria in order to identify which subwatersheds have the greatest need and potential for restoration. For the UJF watershed, Jones Falls was the only subwatershed rated "high" in terms of restoration potential. For the NJF watershed, Roland Run was rated "very high" and Towson Run was rated "high" in terms of restoration need and potential. For the LJF watershed, the SCA identified Moore's Branch as the most impacted subwatershed based on stream erosion and inadequate buffer. In the NJF watershed, 20 of the 22 sites assessed by the County had BIBI scores in the "poor" or "very poor" categories. In the LJF watershed, 31 of the 32 sites assessed by the City and 13 of the 15 sites assessed by the County had BIBI scores in the "poor" or "very poor" categories.

For the purposes of planning, the County has selected the following generalized restoration strategies to aid in meeting restoration goals within the Jones Falls watershed:

- SWM for new development and redevelopment;
- Existing SWM facility conversions;
- SWM retrofits;
- Stream corridor restoration;
- Street sweeping and storm drain inlet cleaning;
- Illicit connection detection and disconnection program and hotspot remediation;
- Sanitary sewer consent decrees;
- Downspout disconnection;
- Citizen awareness (fertilizer application and pet waste);
- Pervious Area Restoration (reforestation and tree planting); and
- Agricultural BMPs (stream protection via fencing and conservation tillage).

The County identified numerous potential restoration sites within each subwatershed by conducting neighborhood source assessments, hotspot site investigations, institutional site investigations, and pervious area assessments. The County also identified multiple potential stormwater retrofits and conversions within each watershed: Thirteen in the UJF watershed, 16 in the NJF watershed, and 43 in the LJF watershed. Detailed information on site locations can be found in the SWAPs. The County identified five potential stormwater dry pond conversions in the NJF watershed as "high" priorities for improving water quality. The County also identified 18 potential stream restoration project sites in the NJF watershed, however, location information for these sites is not included in the SWAP.

The following potential stream restoration sites within the Jones Falls watershed are identified in the SWAPs as shown in **Table 4-51.**

Table 4-51: County Identified Potential Stream Restoration Sites in Jones Falls Watershed

Watershed	Reach	Number of Sites	Total Linear Feet	Conditions
UJF	Deep Run	1	-	Fish Barrier
UJF	Dipping Pond Run	10	2,214	Severe erosion, fish barrier, unstable outfalls, inadequate buffers
NJF	Towson Run	1	-	Inadequate buffers, requires naturalization
LJF	Jones Falls	1	-	Inadequate buffers, requires naturalization
LJF	Western Run	1	-	Runoff of I-695
LJF	Lower Jones Falls	1	-	Runoff from upstream urbanization

Sources: CWP et al. (2015); BA-EPS (2012); and CWP (2008b)

M.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment, PCB, and trash reduction in the Jones Falls watershed are shown in **Table 4-52, Table 4-53,** and **Table 4-54** respectively. Projected sediment, PCB, and trash reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the table:

- BMPs built before the TMDL baseline. In this case, the baseline for sediment is 2005 and the PCB and trash baseline are both 2010;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025;
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the PCB TMDL, MDOT SHA will meet 6.3 percent of the MDE 29.3 percent load reduction requirement through implementation of BMPs shown in **Table 4-53.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated Capital Budget costs to design, construct, and implement trash reduction activities within the Jones Falls watershed total $5,206,000. These projected costs are based on an average cost per impervious acre treated that is derived from cost history for a group of completed projects for each BMP category. Please see **Table 4-55** for a BMP strategy cost breakdown.

Figure 4-39 shows a map of MDOT SHA's restoration practices throughout the Jones Falls Watershed. The practices shown include those that are under design or constructed. Inlet cleaning is not reflected on this map.

Table 4-52: Jones Falls Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	106.3	3.2	14.7	N/A	124.2
Tree Planting	acres of tree planting		18.2	2.6	N/A	20.8
Stream Restoration	linear feet		1264.0	1,982.4	N/A	3,246.4
Outfall Stabilization	linear feet		1.6	400.0	N/A	401.6
Inlet Cleaning[1]	dry tons		11.9		N/A	11.9
Load Reductions	TSS EOS lbs./yr.		64,214	175,689	0	
					Total Projected Reduction	**175,689**	

[1] *Inlet cleaning is an annual practice.*

Table 4-53: Lake Roland Restoration PCB BMP Implementation						
BMP	**Unit**	**Baseline (Before 2010)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	107.6	3.2	14.7	TBD	125.5
Inlet Cleaning[1]	dry tons		10.6	14.6	TBD	25.2
Load Reductions	PCB g/yr.		0.22	0.30	4.71	
				Total Projected Reduction	**4.71**	
[1] *Inlet cleaning is an annual practice.*						

Table 4-54: Patapsco-Jones Falls Trash & Debris Activities Implementation					
BMP	**Unit**	**Restoration BMPs**			**Total BMPs**
		2020	**2025**	**Future**	
Stormwater BMP	drainage area acres	243		N/A	243
Stream Clean-Ups	pounds			N/A	
Media Relations (Use of Free Media)	each	4		N/A	4
Outreach: Community/School Children/ Youth	each			N/A	
Inlet Cleaning[1]	No. Inlets	209		N/A	209
Street Sweeping[1]	acres	218	328	N/A	546
Load Reductions	lbs./yr.	1,679	1,895	0	
			Total Projected Reduction	**1,895**	
[1] *Inlet cleaning and street sweeping are annual practices.*					

Table 4-55: Jones Falls Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$198,000	$1,152,000	$1,350,000
Tree Planting	$555,000	$80,000	$635,000
Stream Restoration	$828,000	$1,340,000	$2,168,000
Outfall Stabilization		$790,000	$790,000
Inlet cleaning	$125,000	$83,000	$208,000
Street Sweeping	$22,000	$33,000	$55,000
Total			$5,206,000

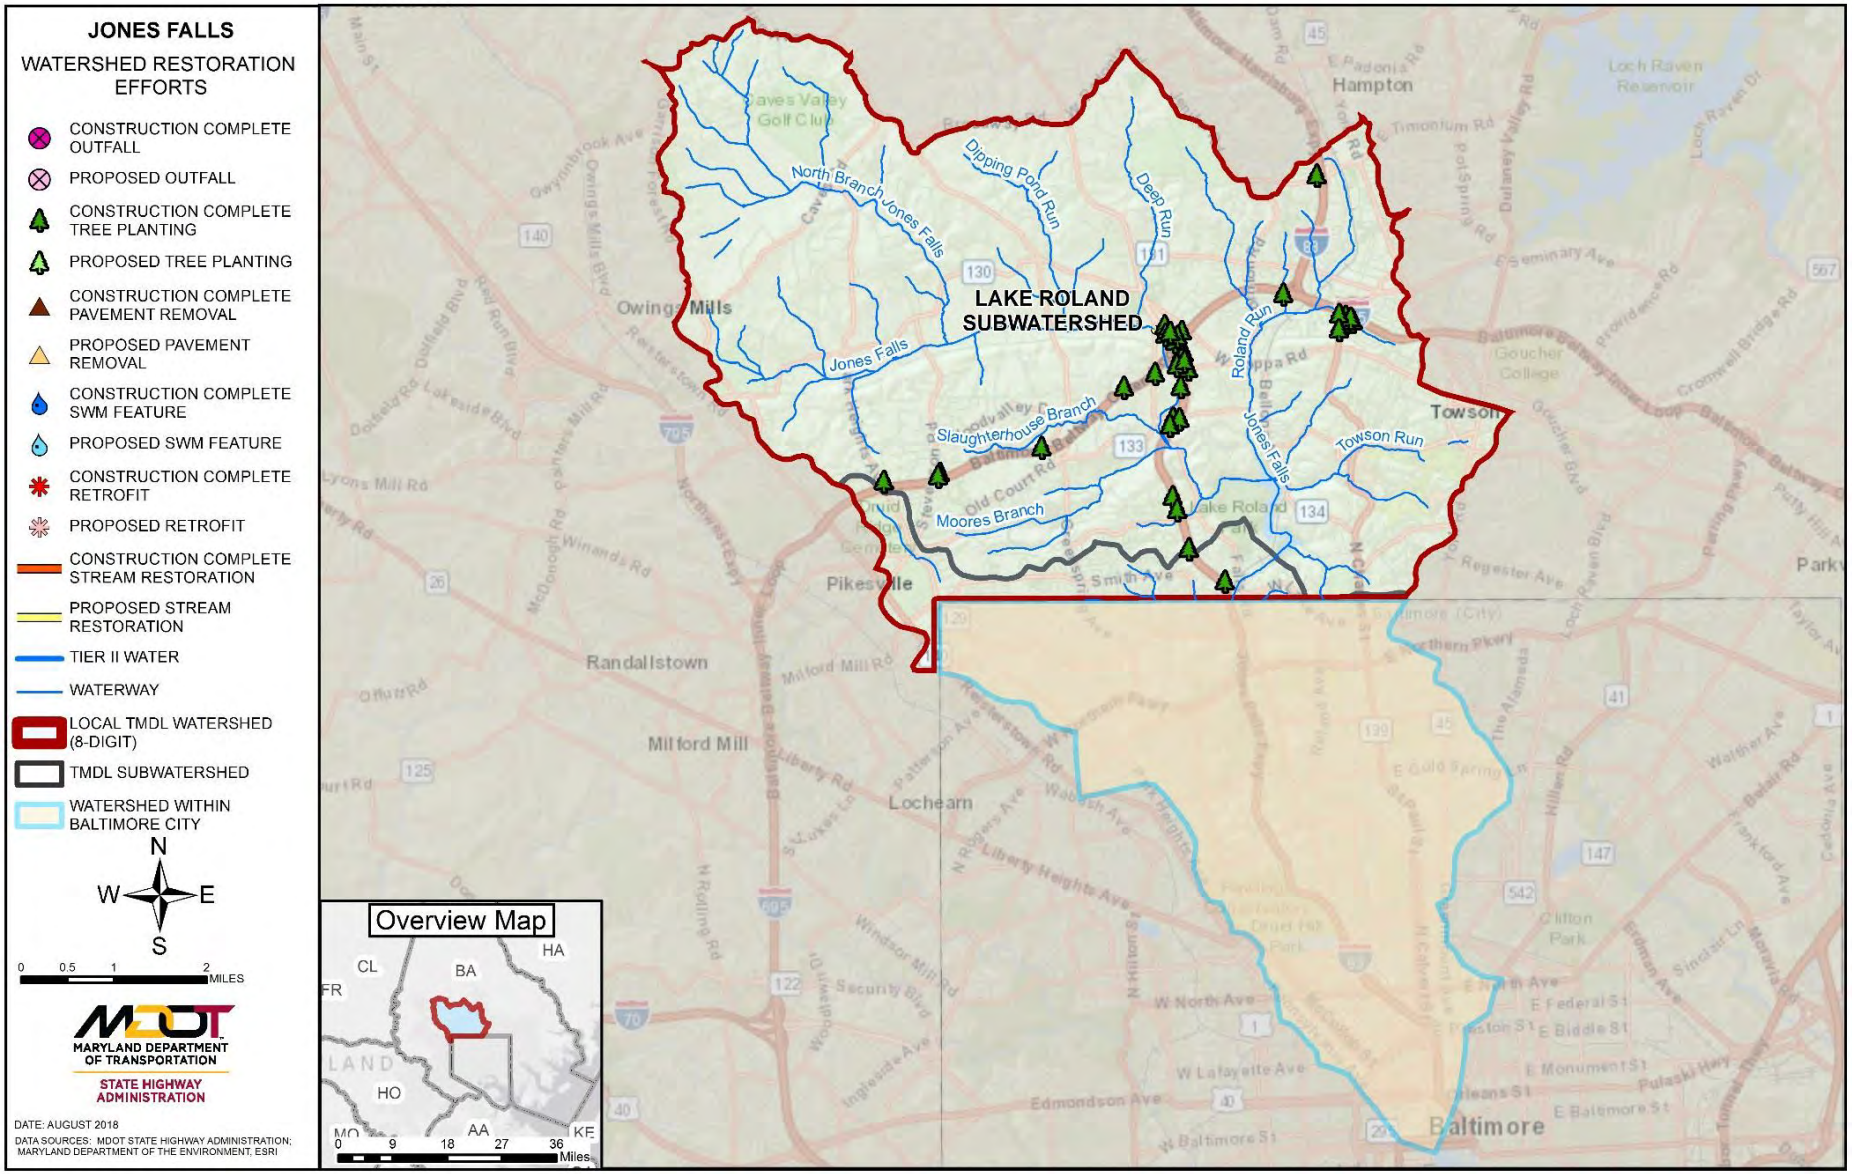


Figure 4-39: MDOT SHA Restoration Strategies within the Jones Falls Watershed

N. LIBERTY RESERVOIR WATERSHED

N.1. Watershed Description

The Liberty Reservoir watershed encompasses 164 square miles within eastern Carroll County and western Baltimore County. The North Branch Patapsco River is the main tributary flowing into the watershed, which empties in the Lower Patapsco River watershed. Liberty Reservoir itself is located to the south of the watershed. Tributary creeks and streams of the Liberty Reservoir watershed include Aspen Run, Beaver Run, Cooks Branch, Deep Run, East Branch North Branch Patapsco, Little Morgan Run, Middle Run, Morgan Creek, Morgan Run, North Branch Patapsco, Norris Run, and Roaring Run.

There are 621.2 centerline miles of MDOT SHA roadway located within the Liberty Reservoir watershed. The associated ROW encompasses 1,979.0 acres, of which 633.1 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) highway garage or shop facility, two (2) park and rides, and two (2) salt storage facilities. See **Figure 4-40** for a map of the watershed.

N.2. MDOT SHA TMDLs within Liberty Reservoir Watershed

MDOT SHA is included in the phosphorus and sediment TMDL (MDE, 2014f) with a reduction requirement of 45.0 percent for both pollutants as shown in **Table 3-2**.

N.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Liberty Reservoir watershed is shown in **Figure 4-41** which illustrates that 75 grid cells have been reviewed, encompassing portions of 17 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 895 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- One (1) new structural SW control constructed or under contract.
- 518 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 376 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 179 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 29 sites constructed or under contract.
- 70 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.

- 80 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 24 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- One (1) site constructed or under contract.
- 23 sites deemed not viable for stream restoration.

Grass Swale Rehabilitation

Preliminary evaluation identified 47 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 10 new structural SW controls constructed or under contract.
- 37 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified four (4) outfalls potential for stabilization. Further analysis of these sites resulted in:

- Four (4) outfall sites constructed or under contract.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified seven (7) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Four (4) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- Three (3) retrofit sites deemed not viable for retrofit and have been removed from consideration.

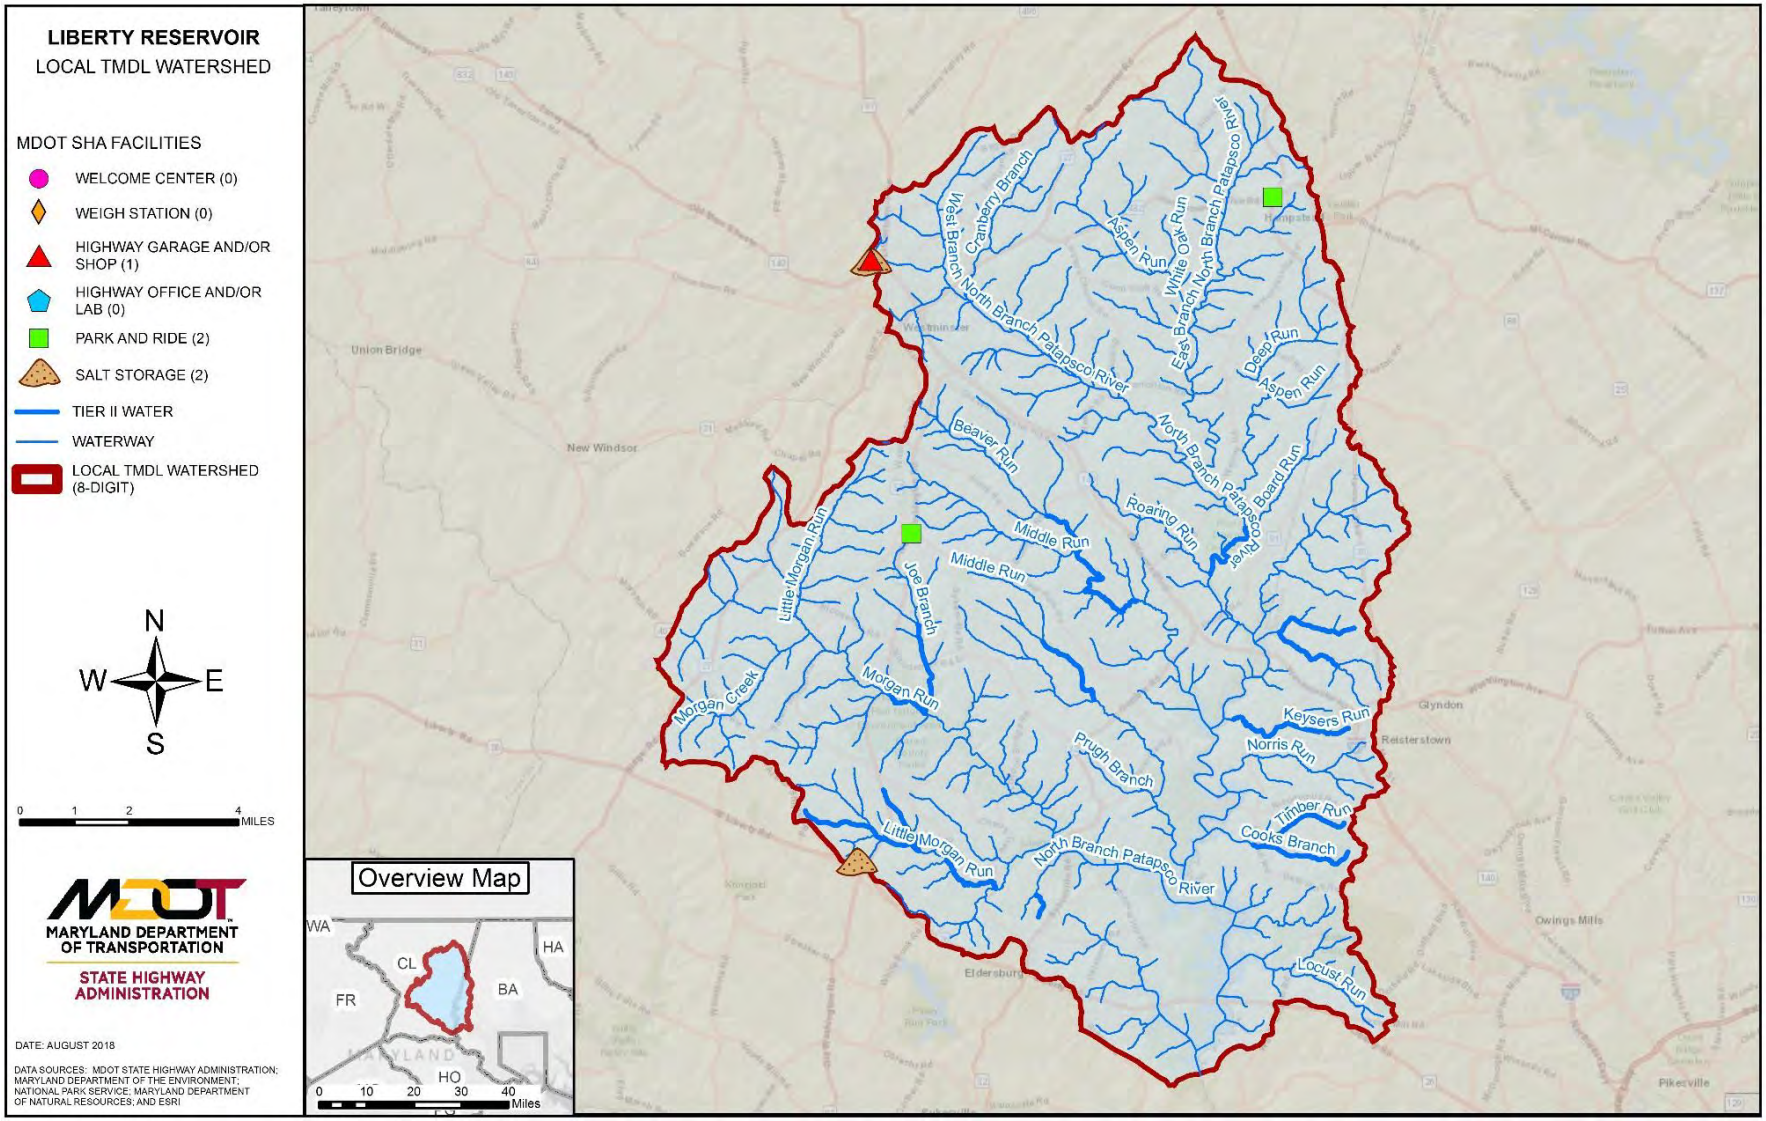


Figure 4-40: Liberty Reservoir Watershed

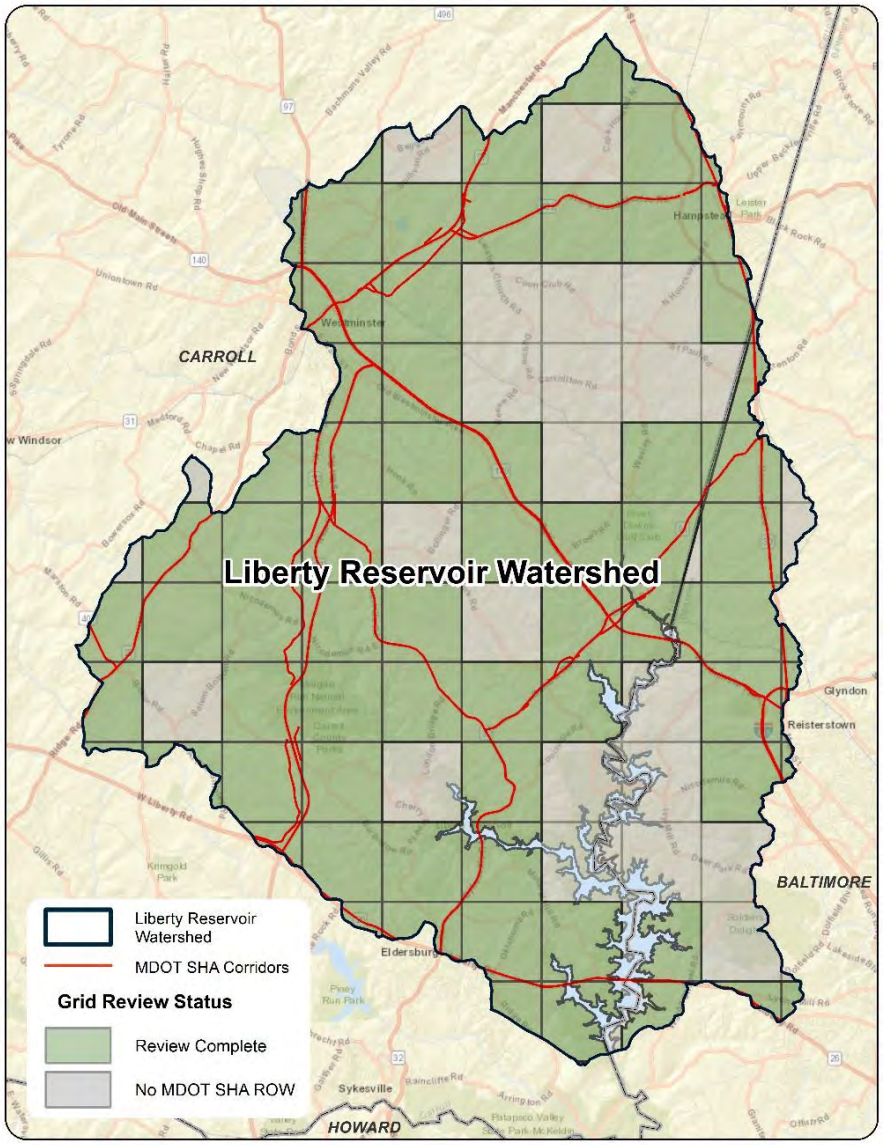


Figure 4-41: Liberty Reservoir Site Search Grids

N.4. Summary of County Assessment Review

Waters within the Liberty Reservoir watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- *Escherichia coli;*
- Phosphorus (Total);
- Sedimentation/siltation; and
- Temperature, water.

The Liberty Reservoir watershed is ranked by the Clean Water Action Plan Technical Workgroup (CWAPTW) in the *Maryland Clean Water Action Plan* as both a "Category 1 Priority" and a "Selected Category 3" (CWAPTW, 1998, p. 31). A Category 1 Priority classification indicates that a watershed needs restoration because it is not meeting clean water and other natural resource goals (CWAPTW, 1998, p. 3). A Selected Category 3 designation means that a watershed has four or more indicators related to the condition of the water (e.g., water chemistry, quality and quantity of physical habitat available for aquatic species, etc.) that meet the Category 3 classification of "pristine or sensitive" watershed needing "an extra level of protection" (CWAPTW, 1998, pp. 3-4, 22). Due to having both a Category 1 Priority and a Selected Category 3 listing, Liberty Reservoir also received the highest priority for restoration and protection under the *Maryland Clean Water Action Plan* (CWAPTW, 1998, p. 32). Six stream segments within this watershed are classified as Tier II waters, which are high quality waters with catchments under regulatory anti-degradation protection that exceed minimum WQSs (MDE, 2012d). Two Tier II segments are located in both Glenn Falls Run and Timber Run, with one in both Keyser Run and Cooks Branch. Impervious land cover comprises 6.3 percent of the watershed on average (DNR, 2002b). Approximately 43 percent of streams in the Liberty Reservoir lack tree buffers (DNR, 2002b).

The BA-EPS completed a SWAP for the Liberty Reservoir watershed (PB, 2015a), and the Carroll County Bureau of Resource Management (CL-BRM) released the *Liberty Reservoir Watershed Steam Corridor Assessment* (CL-BRM, 2012). Carroll County assessments were conducted in 17 subwatersheds, and found 286 inadequate buffer sites, 447 erosion sites, and 151 fish passage barriers, for a total of 93,992 feet of erosion, and 304,986 feet of inadequate buffers (linear footage includes both banks). Site locations were not specified—only included as points on maps in the Liberty Reservoir SCA (CL-BRM, 2012). Most recently, in 2015, Carroll County completed the *Liberty Reservoir Watershed Characterization Plan* (CL-BRM, 2015). According to this characterization plan, the current impairments within the Liberty Reservoir watershed are bacteria, phosphorus, and sediment (CL-BRM, 2015). The Liberty Reservoir watershed is mostly rural with mixed urban uses accounting for less than five percent of the total land use; agriculture is the dominant land use with the Liberty Reservoir watershed (CL-BRM, 2015). Within the watershed, the West Branch Patapsco subwatershed has the highest percentage (21.8 percent) of total impervious area for the entire watershed (West Branch Patapsco subwatershed originates with the city limits of Westminster) (CL-BRM, 2015).

Baltimore County assessments were conducted in three subwatersheds (Cliffs Branch, Keyser Run, and Norris Run), and found 91 inadequate buffer sites, 314 erosion sites, and 78 fish passage barriers, for a total of 26,561 ft. of erosion and 39,680 ft. of inadequate buffer (PB, 2015a). **Table 4-56** lists potential stream restoration sites that were identified by the Baltimore County SWAP, limited to those rated as “Moderate,” “Severe,” or “Very Severe” (PB, 2015a):

Table 4-56: Potential Stream Restoration Sites in Liberty Reservoir, Baltimore County

Subwatershed	Reach ID	Length (ft.)	Impact(s)	Severity
Cliffs Branch	039A1 21-ES	26	Stage I Incision	Moderate
Cliffs Branch	039A1 40-ES	78	Stage I Incision	Moderate
Cliffs Branch	039A1 48-ES	612	Stage I Incision	Moderate
Cliffs Branch	039A1 02-ES	69	Stage II Widening	Severe
Cliffs Branch	039A1 32-ES	18	Stage II Widening	Moderate
Cliffs Branch	031A2 02-ES	44	Stage I Incision	Severe
Cliffs Branch	031A2 03-ES	29	Stage I Incision	Severe
Cliffs Branch	031A2 12-ES	166	Stage I Incision	Moderate
Cliffs Branch	031A2 13-ES	107	Stage I Incision	Moderate
Cliffs Branch	031C3 07-ES	24	Stage I Incision	Moderate
Cliffs Branch	031C2 08-ES	246	Stage I Incision	Very Severe
Cliffs Branch	031C2 09-ES	238	Stage I Incision	Very Severe
Cliffs Branch	031C2 10-ES	257	Stage I Incision	Severe
Cliffs Branch	031C2 11-ES	257	Stage I Incision	Severe
Cliffs Branch	031C2 13-ES	106	Stage I Incision	Moderate
Cliffs Branch	031C2 14-ES	59	Stage I Incision	Moderate
Cliffs Branch	031C2 14-ES	24	Stage I Incision	Moderate
Cliffs Branch	031C2 13-ES	71	Stage I Incision	Moderate
Cliffs Branch	031C2 14-ES	53	Stage I Incision	Moderate
Cliffs Branch	031C2 14-ES	36	Stage I Incision	Moderate
Cliffs Branch	03182 58-ES	106	Stage I Incision	Moderate
Cliffs Branch	03182 57-ES	106	Stage I Incision	Moderate

Table 4-56: Potential Stream Restoration Sites in Liberty Reservoir, Baltimore County

Subwatershed	Reach ID	Length (ft.)	Impact(s)	Severity
Cliffs Branch	03182 54-ES	148	Stage I Incision	Moderate
Cliffs Branch	03182 55-ES	153	Stage I Incision	Moderate
Cliffs Branch	03183 03-ES	192	Stage II Widening	Moderate
Keyser Run	047C2 12-ES	86	Stage II Widening	Moderate
Keyser Run	048a2 52-ES	58	Stage II Widening	Moderate
Keyser Run	048a2 53-ES	83	Stage II Widening	Moderate
Keyser Run	048a2 61-ES	110	Stage II Widening	Moderate
Keyser Run	048a2 03-ES	39	Stage I Incision	Moderate
Keyser Run	048a2 04-ES	28	Stage I Incision	Moderate
Keyser Run	04881 07-ES	112	Stage I Incision	Severe
Keyser Run	04881 08-ES	120	Stage I Incision	Severe
Keyser Run	04881 10-ES	121	Stage I Incision	Moderate
Keyser Run	04881 09-ES	201	Stage I Incision	Moderate
Cliffs Branch	03981 09-FB	--	Fish passage block	Moderate
Cliffs Branch	03182 01-FB	--	Fish passage block – road crossing	Moderate
Cliffs Branch	03981 39-FB	--	Fish passage block – debris dam	Moderate
Cliffs Branch	03182 19-FB	--	Fish passage block – road crossing	Severe
Cliffs Branch	031A3 32-FB	--	Fish passage block	Moderate
Cliffs Branch	031C3 11-FB	--	Fish passage block – road crossing	Moderate
Cliffs Branch	03182 48-FB	--	Fish passage block – channelized	Moderate
Keyser Run	047C1 06-FB	--	Fish passage block – road crossing	Moderate
Keyser Run	047C2 10-FB	--	Fish passage block – road crossing	Very Severe
Keyser Run	048A2 27-FB	--	Fish passage block – road crossing	Severe
Keyser Run	048A2 57-FB	--	Fish passage block – dam	Severe
Keyser Run	048A2 62-FB	--	Fish passage block – natural falls	Moderate
Keyser Run	048A2 34-FB	--	Fish passage block – road crossing	Moderate
Keyser Run	048A2 36-FB	--	Fish passage block – debris dam	Moderate
Keyser Run	048B1 27-FB	--	Fish passage block – natural falls	Moderate
Keyser Run	078B1 30-FB	--	Fish passage block – natural falls	Moderate
Norris Run	047C2 02-FB	--	Fish passage block – road crossing	Moderate
Norris Run	048B3 17-FB	--	Fish passage block – debris dam	Severe
Norris Run	048A3 05-FB	--	Fish passage block - channelized	Moderate
Norris Run	048B3 33-FB	--	Fish passage block – debris dam	Moderate
Norris Run	048B3 34-FB	--	Fish passage block – debris dam	Moderate

Source: PB (2015a), Vol. II

N.5. MDOT SHA Pollutant Reduction Strategies

Liberty Reservoir is listed for both phosphorus and sediment with each TMDL having a baseline year of 2009. Proposed practices to meet the phosphorus and sediment reductions in the Liberty Reservoir watershed are shown in **Table 4-57**. Projected phosphorus and sediment reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the phosphorus and sediment TMDL baseline. In this case, the phosphorus and the sediment baseline is 2009;
- BMPs built after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025,

Estimated costs to design, construct, and implement annual practices such as inlet cleaning and street sweeping within the Liberty Reservoir watershed total $21,840,000. These projected costs are based on an average cost per impervious acre treated that is derived from cost history for a group of completed projects for each BMP category. Please see **Table 4-58** for a BMP strategy cost breakdown.

Figure 4-42 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or construction. Inlet cleaning is not reflected on this map.

Table 4-57: Liberty Reservoir Restoration Phosphorus and Sediment BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs Total
			2020	2025	Future	
New Stormwater	drainage area acres	240.5	145.1	77.7	N/A	463.3
Impervious Surface Elimination	acres removed		0.2		N/A	0.2
Tree Planting	acres of tree planting		122.8	13.6	N/A	136.4
Stream Restoration	linear feet			9,759.6	N/A	9,759.6
Outfall Stabilization	linear feet		1.0	1,037	N/A	1,038.0
Inlet Cleaning[1]	dry tons			2.3	N/A	2.3
Street Sweeping[1]	acres swept		51.2		N/A	51.2
Load Reductions	TP EOS lbs./yr.		82	891	0	
Load Reductions	TSS EOS lbs./yr.		68,649	575,302	0	
				Phosphorus Total Projected Reduction	**891**	
				Sediment Total Projected Reduction	**575,302**	

[1] *Inlet cleaning and Street Sweeping are annual practices.*

Table 4-58: Liberty Reservoir Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$7,618,000	$1,354,000	$8,972,000
Impervious Surface Elimination	$47,000		$47,000
Tree Planting	$3,757,000	$417,000	$4,174,000
Stream Restoration		$6,517,000	$6,517,000
Outfall Stabilization	$2,000	$2,040,000	$2,042,000
Inlet cleaning			$11,000
Street Sweeping	$77,000		$77,000
Total			$21,840,000

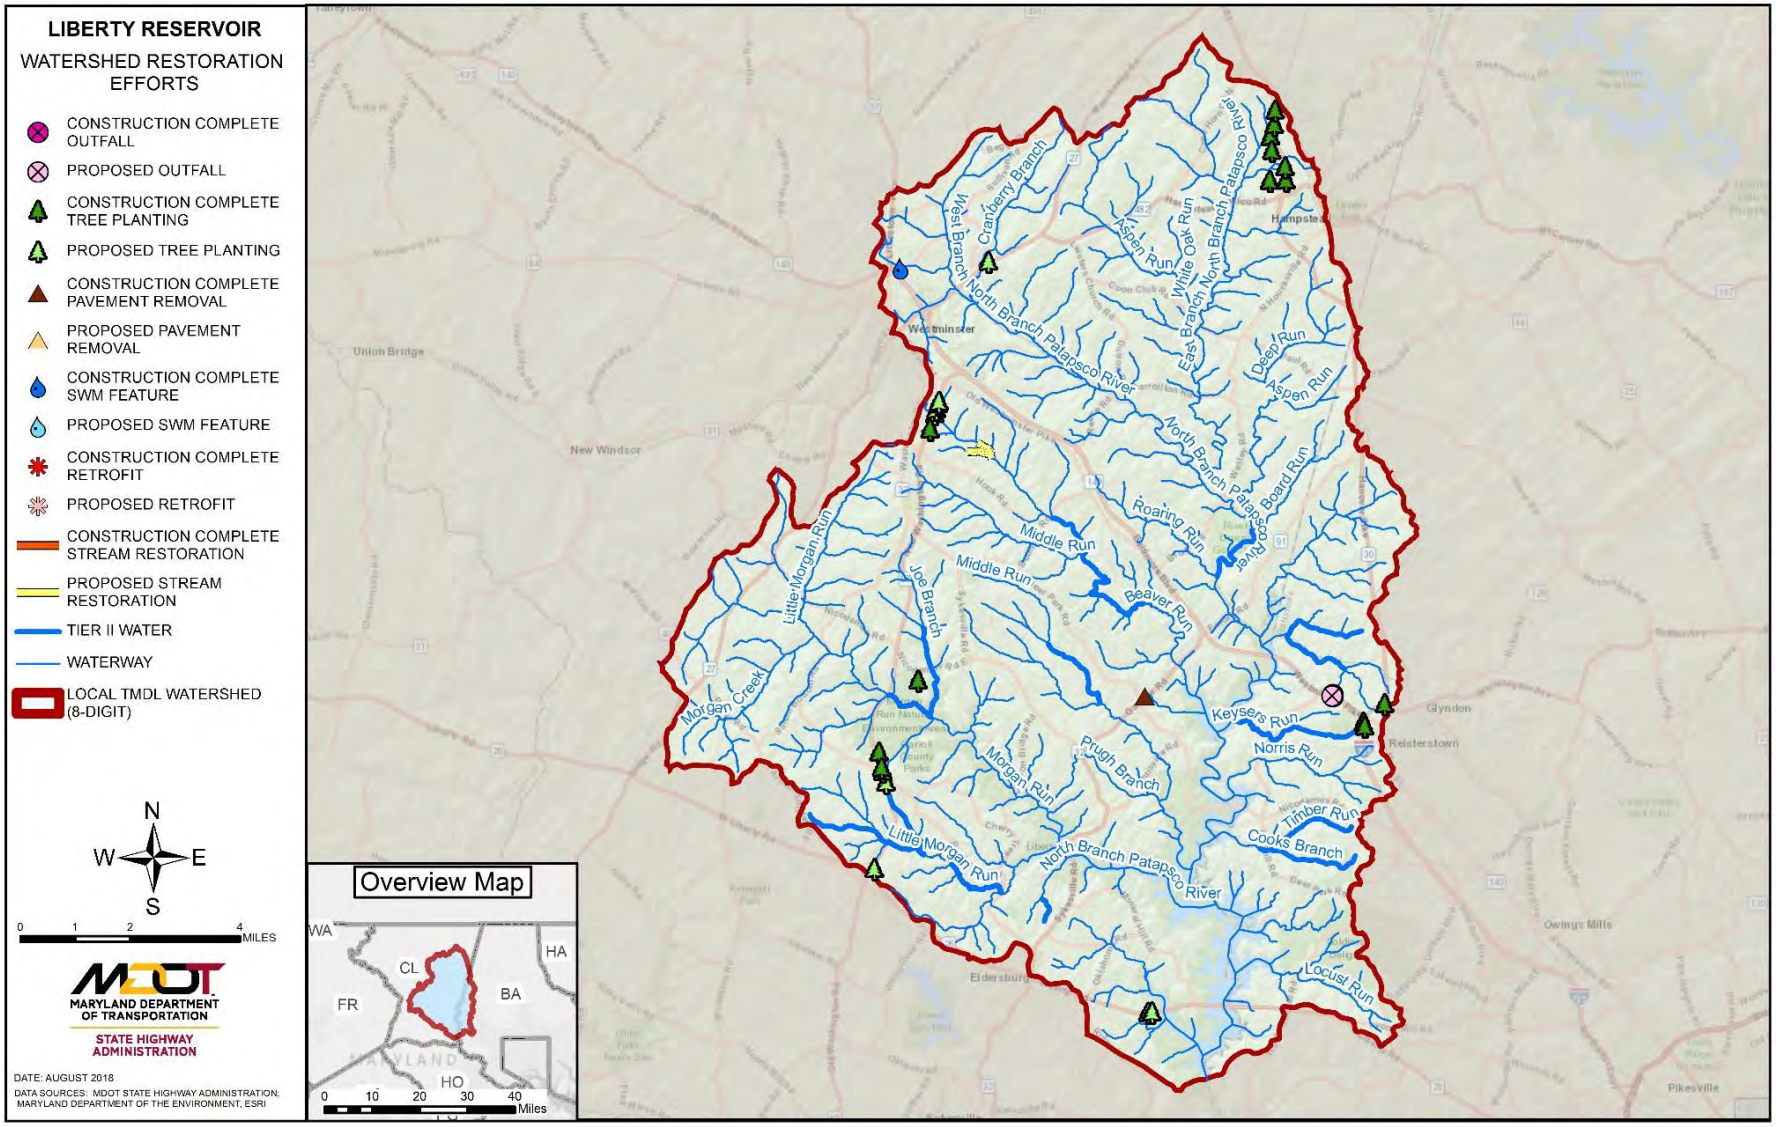


Figure 4-42: MDOT SHA Restoration Strategies within the Liberty Reservoir Watershed

O. LITTLE PATUXENT RIVER WATERSHED

O.1. Watershed Description

The Little Patuxent River watershed encompasses 103 square miles within Anne Arundel and Howard Counties. The Little Patuxent River begins near the Howard County Landfill north of Route 70. Little Patuxent River joins the Patuxent River between the towns of Bowie and Crofton, southeast of the Patuxent Research Refuge. Major tributaries of the Little Patuxent River include Hammond Branch and Midway Branch.

There are 857.9 centerline miles of MDOT SHA roadway located within the Little Patuxent River watershed. The associated ROW encompasses 3,427.4 acres, of which 1,262.9 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) salt storage facility, and five (5) park and ride facilities. See **Figure 4-43** for a map of the watershed.

O.2. MDOT SHA TMDLs within Little Patuxent River Watershed

MDOT SHA is included in the sediment TMDL (MDE, 2011f) with a reduction requirement of 36.1 percent, as shown in **Table 3-2**.

O.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Little Patuxent River watershed is shown in **Figure 4-44** which illustrates that 70 grid cells have been reviewed, encompassing portions of 27 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 472 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 36 new structural SW controls constructed or under contract.
- 250 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 186 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 274 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 94 sites constructed or under contract.
- 30 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 150 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 28 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Four (4) sites constructed or under contract.
- Two (2) additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- 22 sites deemed not viable for stream restoration.

Grass Swale Rehabilitation

Preliminary evaluation identified 103 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 26 new structural SW controls constructed or under contract.
- Four (4) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 73 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 95 outfalls potential for stabilization. Further analysis of these sites resulted in:

- Two (2) outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- 93 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 44 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of four (4) existing structural SW controls constructed or under contract.
- 12 retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 28 retrofit sites deemed not viable for retrofit and have been removed from consideration.

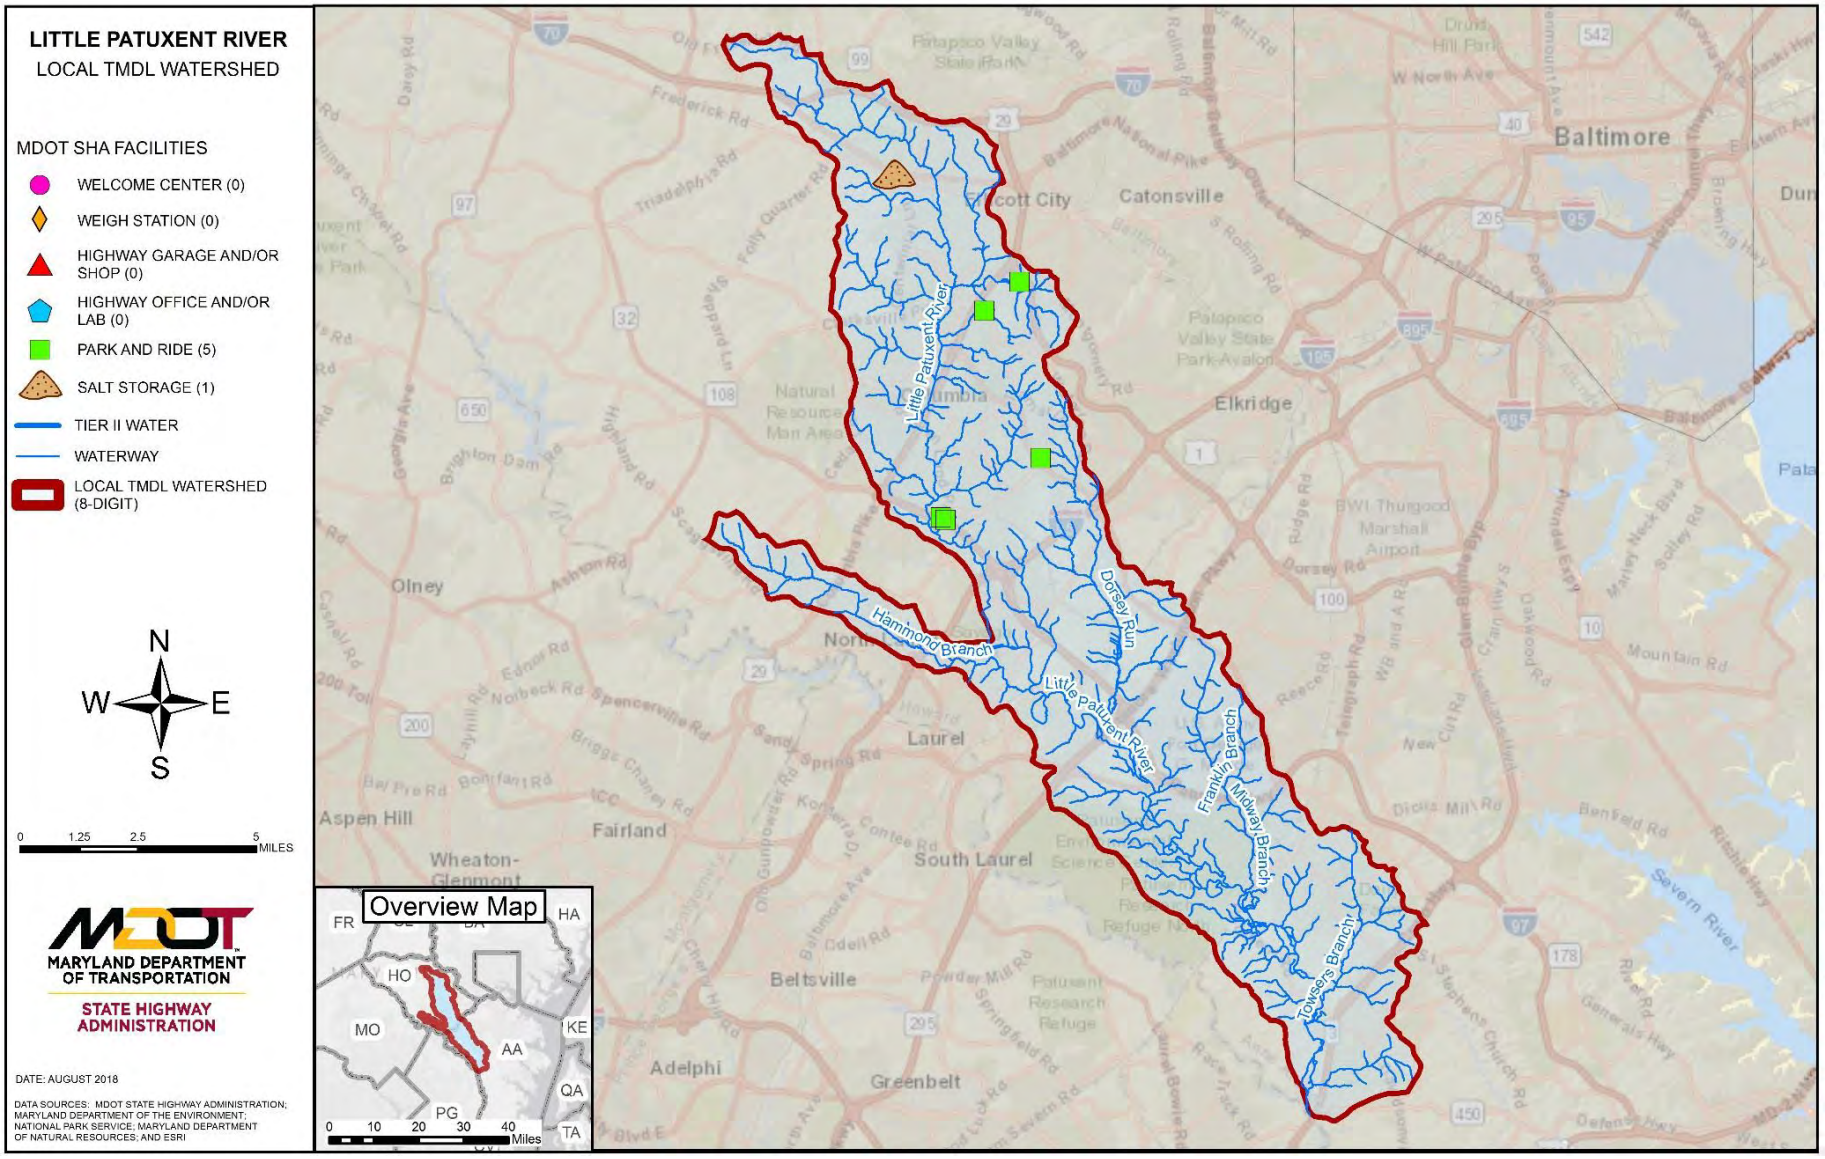


Figure 4-43: Little Patuxent River Watershed

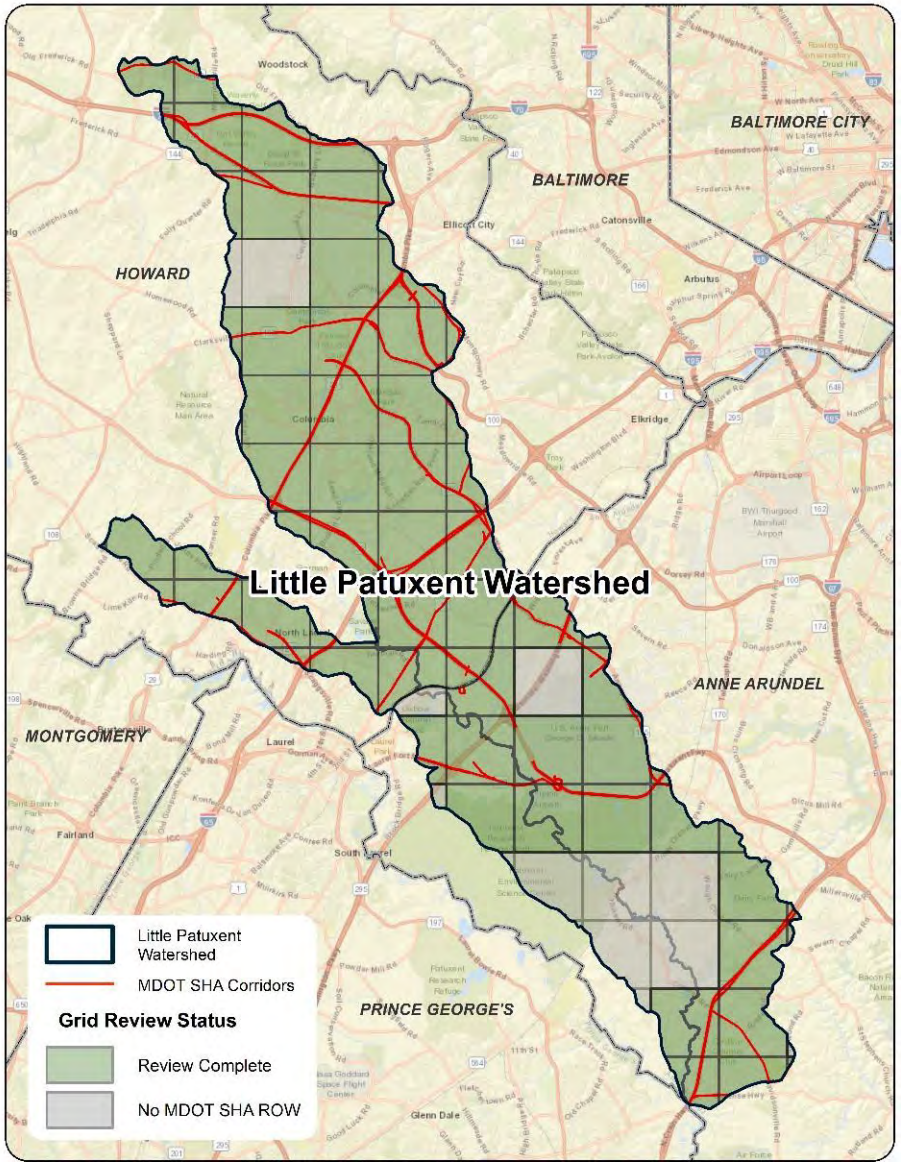


Figure 4-44: Little Patuxent River Site Search Grids

O.4. Summary of County Assessment Review

Waters within the Little Patuxent watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- Phosphorus (Total);
- Sedimentation/Siltation; and
- TSS.

In 2015, Howard County Department of Public Works prepared the *Little Patuxent River Watershed Assessment* (Versar, 2015a). In 2016, the Anne Arundel County Department of Public Works completed the *Little Patuxent Watershed Assessment Comprehensive Summary Report* (LimnoTech & Versar, 2016) in an effort to assess the conditions in the Little Patuxent watershed and to rate and prioritize restoration and protection activities.

Howard County Assessment

Howard County conducts biological monitoring at randomly selected stations in its Countywide monitoring program, which began in 2001. The Little Patuxent watershed consists of the Lower Little Patuxent, Middle Little Patuxent, and Upper Little Patuxent subwatersheds, as well as Dorsey Run and Hammond Branch. With the exception of Hammond Branch and Dorsey Run, which were last sampled in 2009, the watershed was sampled most recently in 2013 (Versar, 2015a).

Of the 281 sites in Little Patuxent watershed identified by Howard County, only 10 (4 percent) were in "good" condition, 31 (11 percent) were rated "fair," 79 (28 percent) were rated "poor," and 160 (57 percent) rated "very poor." Some "good" sites were found in the Upper Little Patuxent subwatershed and upper reaches of Hammond Branch. However, most sites in Lower Little Patuxent subwatershed and Dorsey Run were in "poor" to "very poor" condition. Stream habitat

condition was also evaluated by Howard County using EPA's Rapid Bioassessment Protocol (RBP) for habitat assessment. Of the 124 sites assessed, only one site (less than 1%) was rated as "comparable to reference" condition (the highest scoring category). Seventeen (14 percent) sites were rated as "supporting," 48 (39 percent) as "partially supporting," and 58 (47 percent) as "not supporting" (the lowest scoring category), indicating that many streams in the Little Patuxent watershed show evidence of habitat degradation (Versar, 2015a).

In 2014-2015, Howard County's Stormwater Management Division sponsored an assessment of the Little Patuxent watershed within Howard County in order to assess current conditions and recommend watershed restoration opportunities. Employing GIS and field investigations, the project team recommended a suite of opportunities including upgrades to existing stormwater BMPs, new BMPs, tree plantings, stream restoration, and stabilization of stormwater outfalls. In all, this assessment yielded 760 potential projects and produced concept plans for 109 of the top-ranked opportunities identified (Versar, 2015a).

While stream conditions vary across the County, degradation is more prevalent in the heavily developed urban areas. This reflects the history of urban and suburban development prior to effective SWM regulations. Watershed condition is generally better in the more rural parts of the county, but stream degradation still occurs in these areas as a result of large lot development and agricultural impacts. By reducing the adverse effects of stormwater runoff throughout the county, the process of watershed assessment, restoration planning, and implementation of prioritized BMPs should improve the water quality condition in Little Patuxent watershed over time (Versar, 2015a).

For the purpose of planning, the County has developed the following project concepts within the Little Patuxent watershed:

- 15 BMP Conversions;
- Ten New BMPs;
- 19 Tree Plantings;
- 20 Outfall Stabilizations; and
- 45 Stream Restorations.

Howard County listed several stream reaches recommended for restoration due to active erosion, threatened infrastructure and limited habitat. Overall, 14 stream reaches in the Northern Middle Patuxent watershed and 13 stream reaches in the Dorsey Run watershed have high stream restoration potential. Of these high priority reaches, those with the most potential are listed below:

- DOR-SR-F906 is a heavily incised and actively eroding channel which is currently threatening private property as the stream continues to erode and meander.
- DOR-SR-F909, DOR-SR-F910, and DOR-SR-F911 are experiencing moderate to severe erosion, an abundance of depositional areas, and pools filled with fine sediment (primarily silt) indicating large sediment loads upstream.
- DOR-SR-F912 has moderate to severe erosion throughout including degradation and lateral migration. Restoration could include outfall stabilization and BMPs in several locations and the length may be extended further downstream.
- NMP-SR-F133, NMP-SR-F136, and NMP-SR-F145 have severe bank erosion, numerous tree falls, lack of riparian vegetation, and moderate bar deposition.
- NMP-SR-F135 has moderate to severe erosion including headcuts and is highly sinuous.

- NMP-SR-F152 is experiencing severe active erosion along the left bank. Homeowners mow to top of bank, but expressed interest in the County planting a stream buffer.

- NMP-SR-F168 and NMP-SR-F-169 are the mainstem of the Northern Middle Patuxent and a large tributary to the mainstem, both experiencing severe erosion throughout. This is likely a more expensive restoration opportunity than lower order streams.

Anne Arundel County Assessment

The Little Patuxent subwatersheds were assessed in the spring of 2012 to determine the conditions of the watershed and prioritize watershed management activities. A small fraction of soils within the Little Patuxent subwatersheds is highly erodible (10 percent), with most being low in erodibility (37 percent). Thirty-five percent of streams assessed had more than 25 percent impervious cover, with 33 percent of streams with 0-10 percent impervious cover (LimnoTech & Versar, 2016).

The County assessed 304 perennial stream reaches in the Little Patuxent River watershed. Out of the 304 reaches, 7 were rated at "High" priorities for restoration. ranked several stream reaches based on priority for restoration, with the value one being the highest priority as shown below in **Table 4-59** (LimnoTech & Versar, 2016).

Table 4-59: Anne Arundel County High Priority Stream Restoration Projects in Little Patuxent Watershed

Priority Rank	Supbwatershed Code	Subwatershed Name	Reach
1	LP3	Towsers Branch 1	LP3044
2 (tie)	LPC	Towsers Branch 3	LPC048
2 (tie)	LPE	Piney Orchard	LPE006
4 (tie)	LPG	Crofton Golf	LPG030
4 (tie)	LPC	Towsers Branch 3	LPC041
6 (tie)	LP3	Towsers Branch 1	LP3051
6 (tie)	LPC	Towsers Branch 3	LPC049

Source: LimnoTech & Versar (2016), Table 4.2 and Map 4.1

O.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reduction in the Little Patuxent River watershed are shown in **Table 4-60**. Projected sediment reduction using these practices are shown in **Table 3-2**. Four timeframes are included in the table:

- BMPs built before the TMDL baseline. In this case, the baseline is 2005;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

MDOT SHA will accomplish the projected reduction to be achieved as a percent of the baseline load presented in **Table 3-2**.

Estimated costs to design, construct, and implement BMPs within the Little Patuxent River watershed total $25,689,000. These projected costs are based on an average cost per impervious acre treated derived from a cost history for each BMP type. Please see **Table 4-61** for a summary of estimated BMP costs.

Figure 4-45 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or construction. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-60: Little Patuxent River Restoration Sediment BMP Implementation						
BMP	**Unit**	**Baseline (Before 2005)**	**Restoration BMPs**			**Total BMPs Total**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	1,086.8	48.5	56.9	N/A	1192.2
Retrofit	drainage area acres		39.1		N/A	39.1
Impervious Surface Elimination	acres removed		0.3		N/A	0.3
Tree Planting	acres of tree planting		93.9	13.0	N/A	106.9
Stream Restoration	linear feet		13,581.0	3,033.2	N/A	16,614.2
Outfall Stabilization	linear feet			800.0	N/A	800.0
Inlet Cleaning[1]	dry tons		3.0		N/A	3.0
Street Sweeping[1]	acres swept		55.8		N/A	55.8
Load Reductions	TSS EOS lbs/yr.		687,501	885,242	0	
					Total Projected Reduction	885,242	
[1] *Inlet cleaning and street sweeping are annual practices.*						

Table 4-61: Little Patuxent River Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$5,093,000	$2,627,000	$7,720,000
Retrofits	$1,834,000		$1,834,000
Impervious Surface Elimination	$95,000		$95,000
Tree Planting	$2,873,000	$398,000	$3,271,000
Stream Restoration	$9,069,000	$2,026,000	$11,095,000
Outfall Stabilization		$1,574,000	$1,574,000
Inlet cleaning	$8,000		$8,000
Street Sweeping	$92,000		$92,000
Total			$25,689,000

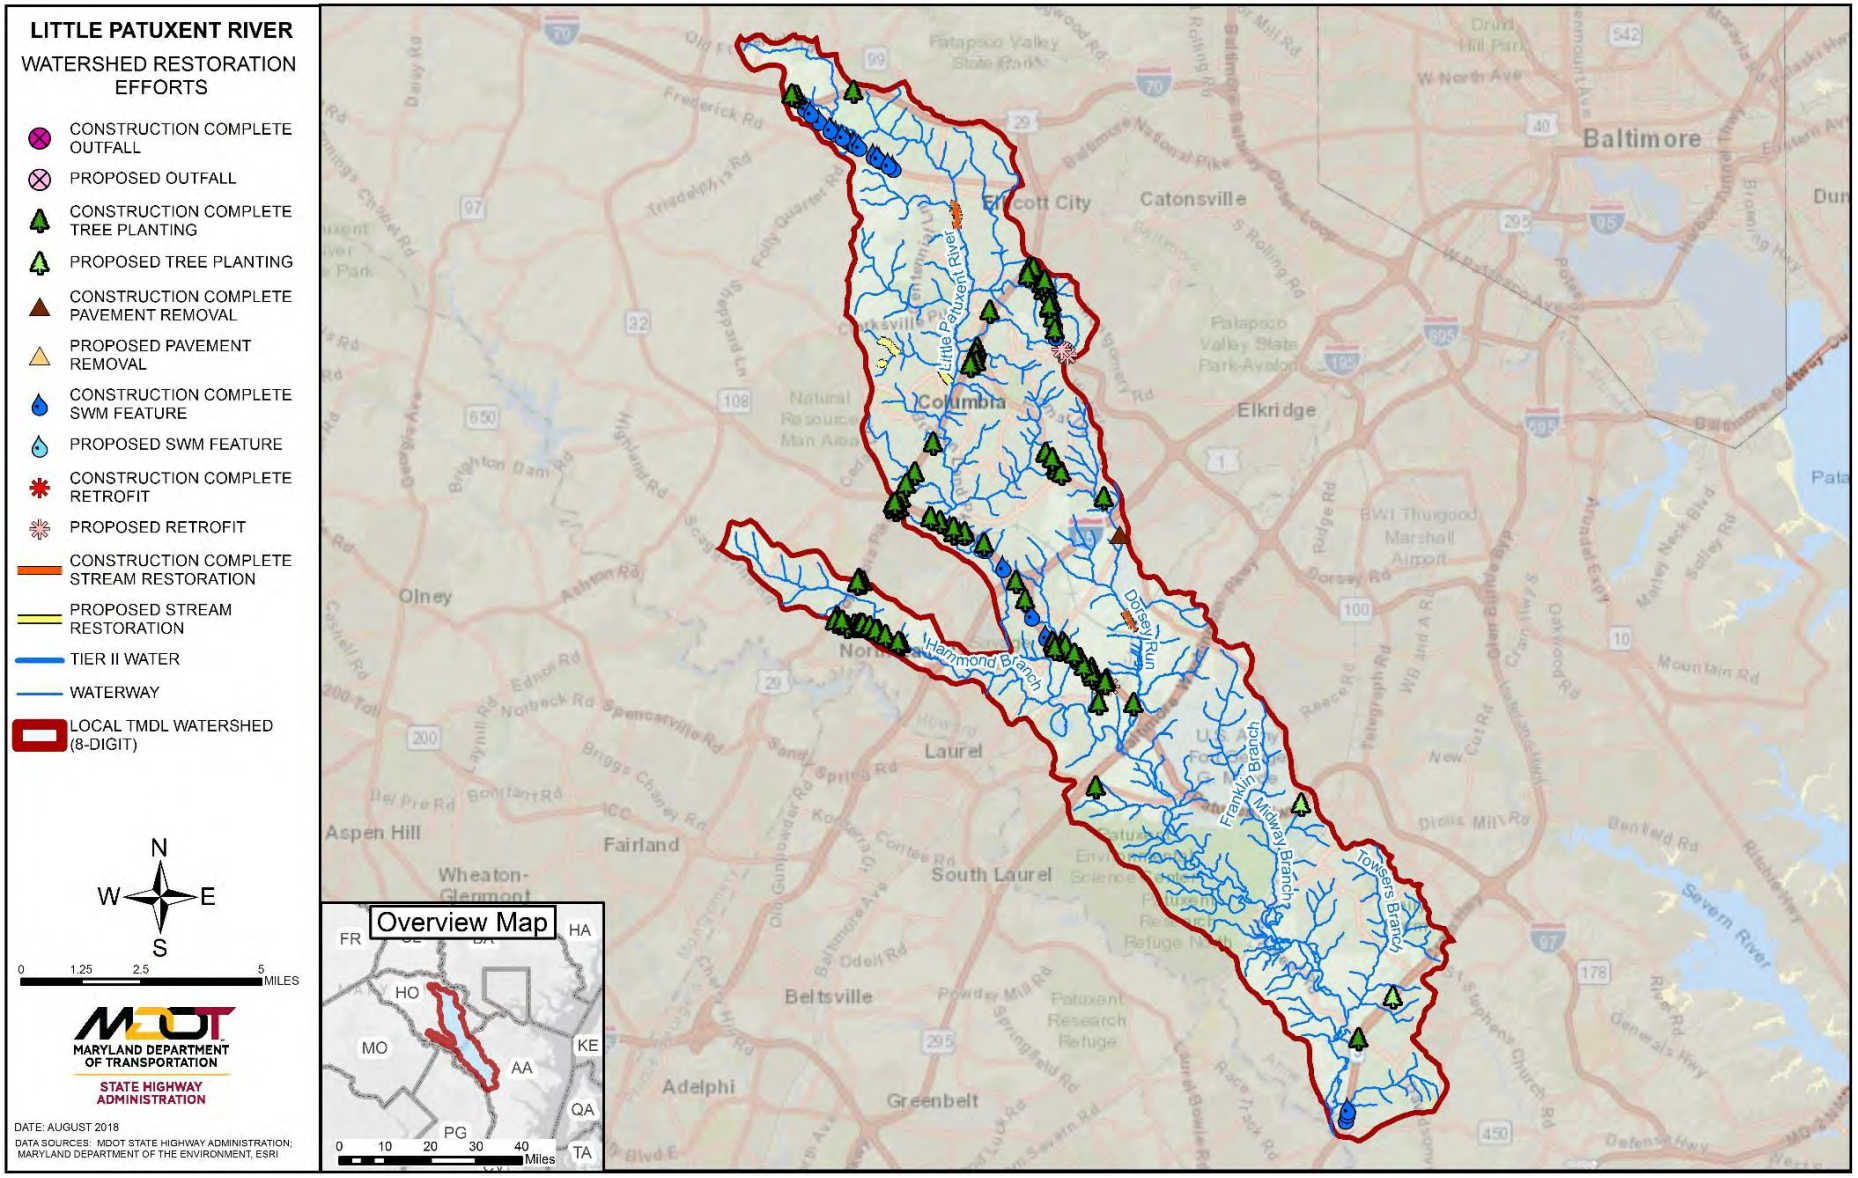


Figure 4-45: MDOT SHA Restoration Strategies within the Little Patuxent River Watershed

P. LOCH RAVEN RESERVOIR WATERSHED

P.1. Watershed Description

The Loch Raven Reservoir watershed encompasses 220 square miles within Maryland and Pennsylvania. In Maryland, the watershed is primarily located within Baltimore County, with small areas in Carroll and Harford Counties. Tributary creeks and streams of the Loch Raven Reservoir watershed include Beaverdam Run, Beetree Run, Blackrock Run, First Mine Branch, Gunpowder Falls, Little Falls, McGill Run, Piney Run, Second Mine Branch, Third Mine Branch, and Western Run.

There are 792.1 centerline miles of MDOT SHA roadway located within the Loch Raven Reservoir watershed. The associated ROW encompasses 1,581.0 acres, of which 825.7 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) highway garage or shop, one (1) highway office or lab, one (1) salt storage facility, one (1) weigh station, and four (4) park and ride facilities. See **Figure 4-46** for a map of the watershed.

P.2. MDOT SHA TMDLs within Loch Raven Reservoir Watershed

MDOT SHA is included in the bacteria TMDL (MDE, 2009d) with a reduction requirement of 87.6 percent, as shown in **Table 3-3**.

P.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Loch Raven watershed is shown in **Figure 4-47** which illustrates that 90 grid cells have been reviewed, encompassing portions of 20 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 361 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 20 new structural SW controls constructed or under contract.
- 246 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 95 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 93 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 51 sites constructed or under contract.
- Eight (8) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 34 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 20 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Three (3) sites constructed or under contract.
- 17 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 128 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 47 new structural SW controls constructed or under contract.
- Three (3) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 78 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 223 outfalls potential for stabilization. Further analysis of these sites resulted in:

- Seven (7) outfall sites constructed or under contract.
- 13 outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- 203 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 15 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of two (2) existing structural SW controls constructed or under contract.
- Two (2) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 11 retrofit sites deemed not viable for retrofit and have been removed from consideration.

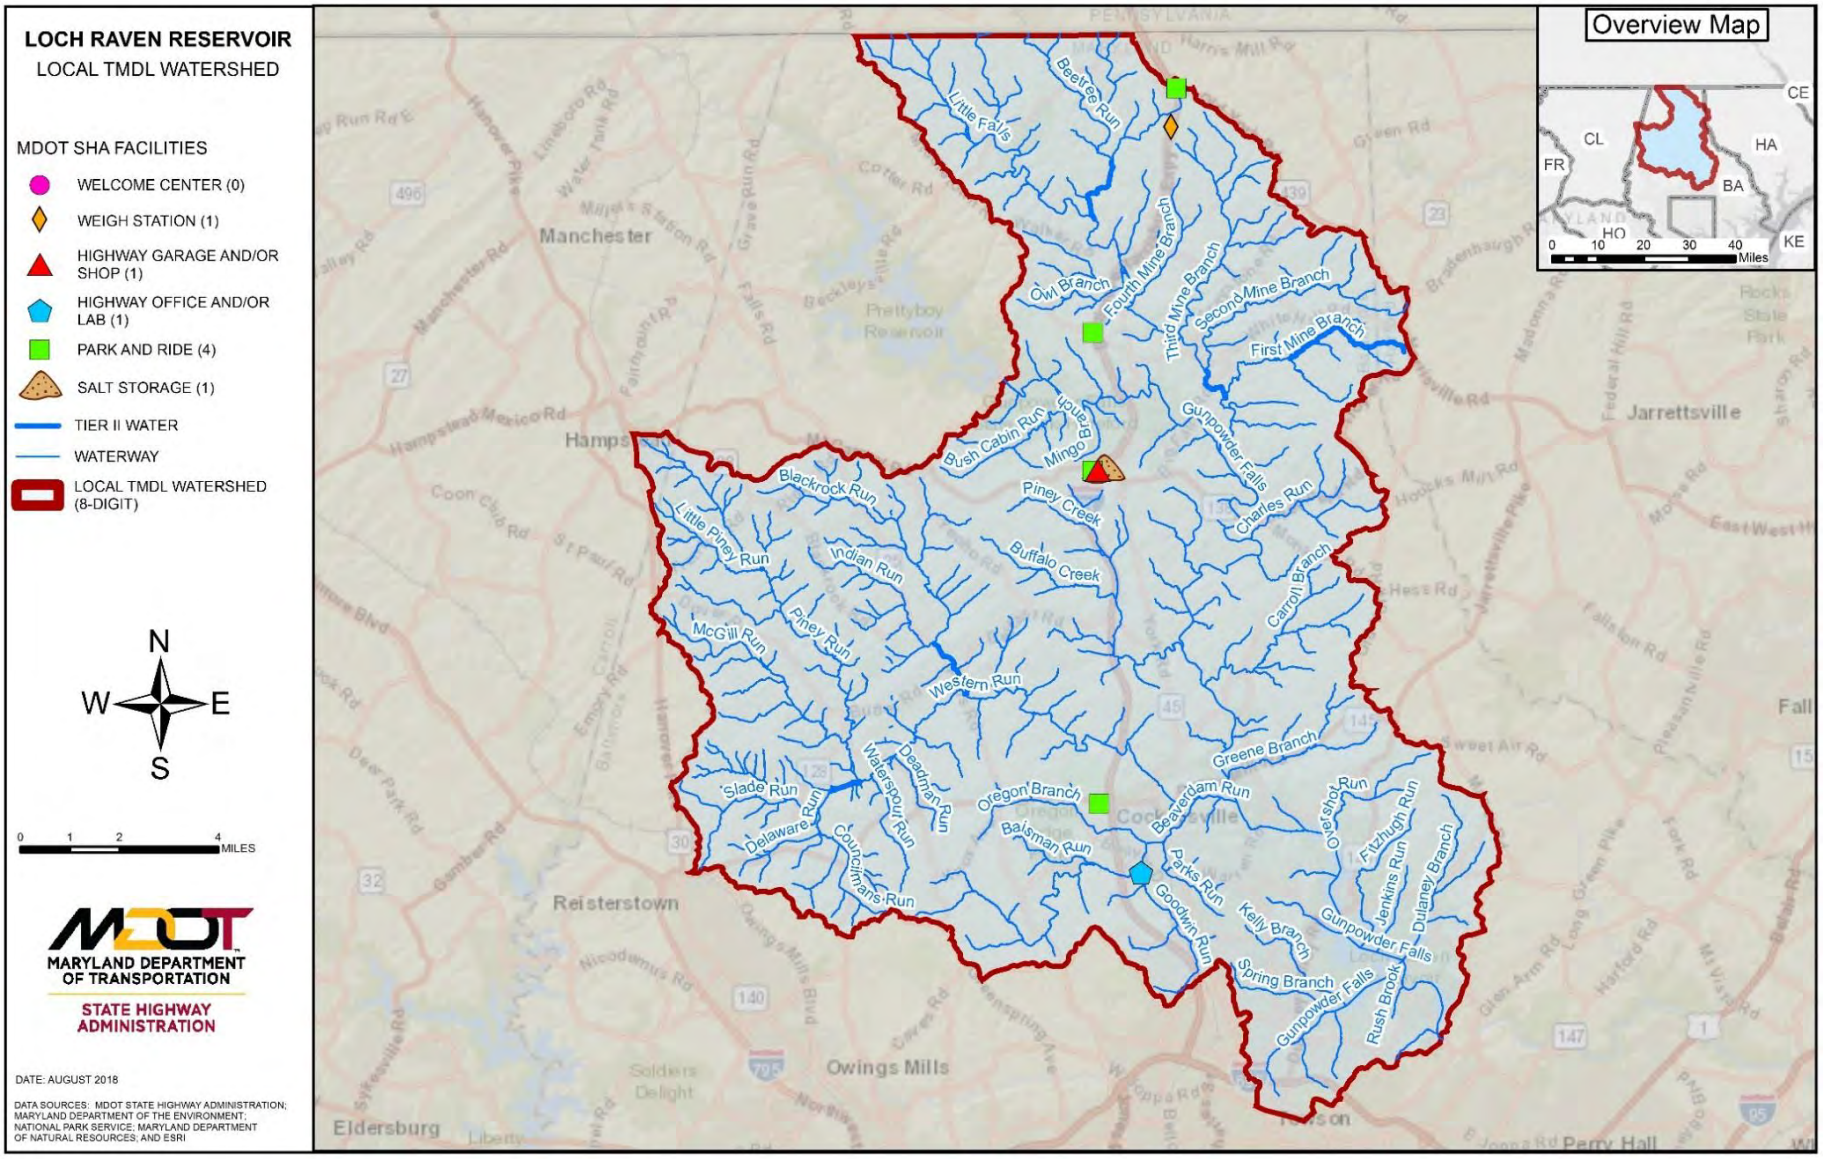


Figure 4-46: Loch Raven Reservoir Watershed

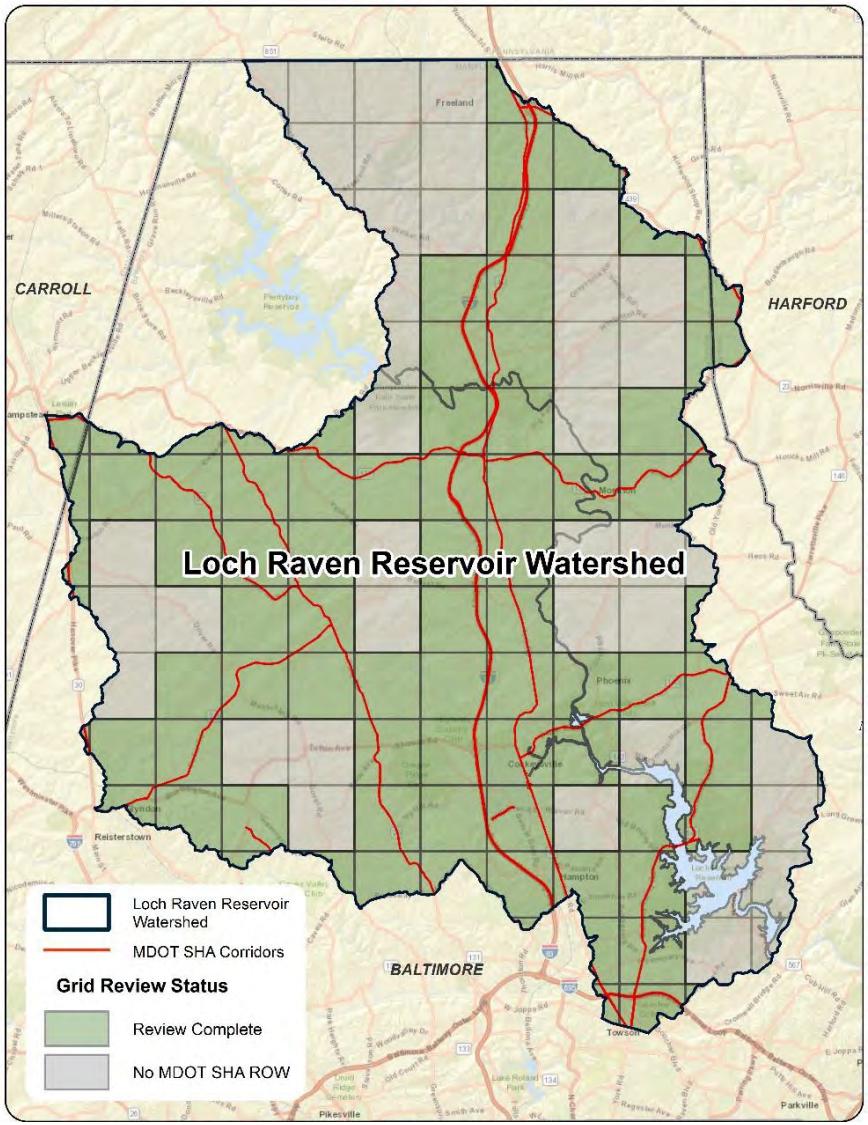


Figure 4-47: Loch Raven Reservoir Site Search Grids

P.4. Summary of County Assessment Review

Waters within the Loch Raven Reservoir watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- *Escherichia coli*;
- Mercury in Fish Tissue;
- Phosphorus (Total);
- Sedimentation/siltation;
- Sulfates; and
- Temperature, water.

As previously mentioned, the Loch Raven Reservoir watershed is predominantly located in Baltimore County; however, there are small areas that cross into Carroll and Harford Counties. In the Spring of 2016, Carroll County published the *Loch Raven Reservoir Watershed Characterization Plan* (CL-BRM, 2016b); the County will use this plan as a tool to develop a future watershed implementation plan for the Loch Raven Reservoir portion within Carroll County.

According to a notice posted on Harford County's "Restoration Plans" webpage, Harford County has a 0% reduction requirement under the Loch Raven Reservoir bacteria TMDL (MDE, 2009d); therefore, no restoration plan is required for this impairment (HA-DPW, 2016).

The Baltimore County Department of Environmental Protection and Sustainability completed SWAPs for the Loch Raven West subwatershed in 2017 (WSP, 2017); Loch Raven North subwatershed in 2015 (PB, 2015b); Beaverdam Run, Baisman Run, and Oregon Branch subwatersheds in 2011 (CWP et al., 2011); Loch Raven East subwatershed in 2014 (CWP et al., 2014); and the Spring Branch subwatershed (SB) in 2008 (BA-DEPRM, 2008b).

The Beaverdam Run, Baisman Run, and Oregon Branch subwatersheds (BBO) makes up approximately 6 percent of the drainage area to the Loch Raven Reservoir watershed. The Loch Raven East subwatershed (LRE) makes up approximately 8 percent of the Loch Raven Reservoir watershed drainage area. The SB makes up less than 1 percent of the Loch Raven Reservoir watershed drainage area (CWP et al., 2011).

Impervious land cover comprises 6.5 percent of the BBO subwatersheds, 4.8 percent of the LRE subwatershed, and 18.6 percent of the SB subwatershed. 16.6 percent of the soils within the BBO subwatershed, 14.8 percent within the LRE subwatershed, and 25.9 percent of the soils within the SB subwatershed are considered highly erodible. Impervious urban, livestock, and cropland are the land uses responsible for the greatest phosphorus loads within the BBO and SB subwatersheds, while cropland and stream channel scour are responsible for the greatest sediment loads. Impervious urban, livestock, and cropland are the land uses responsible for the greatest nitrogen, phosphorus, and sediment loads within the LRE subwatershed (CWP et al., 2011).

The BBO SWAP identified many moderate environmental problems, and several severe problems in Beaverdam Run, Baisman Run, and Oregon Branch based on channel alterations, erosion, and fish blockages (CWP et al., 2011). The LRE SWAP identified eight stream areas in Dulaney Valley Branch, totaling 5,381 feet of erosion, and 34 fish barriers, ten of which are categorized as “very severe” and “severe”. Biological assessments showed a generally unimpaired community in the BBO subwatersheds. While the majority of BIBI scores in the LRE subwatersheds were “good,” the majority of FIBI scores were “poor” (CWP et al., 2014).

For the purposes of planning, the various Loch Raven Reservoir SWAPs indicate that Baltimore County has selected the following generalized restoration strategies to aid in meeting restoration goals within the Loch Raven Reservoir watershed:

- SWM for new development and redevelopment;
- Existing SWM facility conversions;
- SWM retrofits;
- Stream corridor restoration;
- Illicit connection detection and disconnection program and hotspot remediation;
- Downspout disconnection;
- Citizen awareness (bayscaping, fertilizer application, and pet waste); and
- Pervious area restoration (reforestation and tree planting).

Baltimore County identified numerous potential restoration sites within each subwatershed, with the exception of SB where assessments were not completed. The County also identified 13 stormwater retrofit or conversion projects, seven of which fell in the BBO subwatersheds, and the remaining six within the LRE subwatersheds. Detailed information on site locations can be found in the SWAPs. Some of the potential stream restoration sites with very severe to severe erosion in the Loch Raven Reservoir watershed are shown in **Table 4-62**:

Table 4-62: Potential Stream Restoration Sites in Loch Raven Reservoir Watershed

Subwatershed	Site #	Erosion Length (ft)	Conditions
Dulaney Valley Branch	053A1-138ES	163	Stage I Incision caused by land use change
Dulaney Valley Branch	044A3-28ES	41	Stage I Incision
Dulaney Valley Branch	044A3-29ES	26,400	Stage I Incision
Beaverdam Run	BV050A1-ES12-1	852	Erosion with downcutting
Baisman Run	BS041B3-ES14-1	2,606	Erosion with downcutting

Sources: CWP et al. (2011), Vol. 2; CWP et al. (2014), Vol. 2

P.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet the bacteria reduction in the Loch Raven Reservoir watershed are shown in **Table 4-63**. Projected bacteria reduction using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the TMDL baseline. In this case, the baseline is 2004;
- BMPs built after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2202 through fiscal year 2025,
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the PCB TMDL, MDOT SHA will meet 1.6 percent of the MDE 87.6 percent load reduction requirement through implementation of BMPs shown in **Table 4-63**. MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in Part III Section E.

Estimated Capital Budget costs to design, construct, and implement annual practices such as inlet cleaning and street sweeping within the Loch Raven Reservoir watershed total $3,298,000. These projected costs are based on an average cost per impervious acre treated that is derived from cost history for a group of completed projects for each BMP category. Please see **Table 4-64** for a BMP strategy cost breakdown.

Figure 4-48 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or construction.

Table 4-63: Loch Raven Restoration Bacteria BMP Implementation

BMP	Unit	Baseline (Before 2004)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	62.2	38.8		TBD	101
Retrofits	drainage area acres		4.9		TBD	4.9
Load Reductions	Enterrococci Billion counts/ day		3,050	3,050	15,678	
					Total Projected Reduction	**15,678**

Table 4-64: Loch Raven Reservoir Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$3,012,000		$3,012,000
Retrofits	$286,000		$286,000
Total			$3,298,000

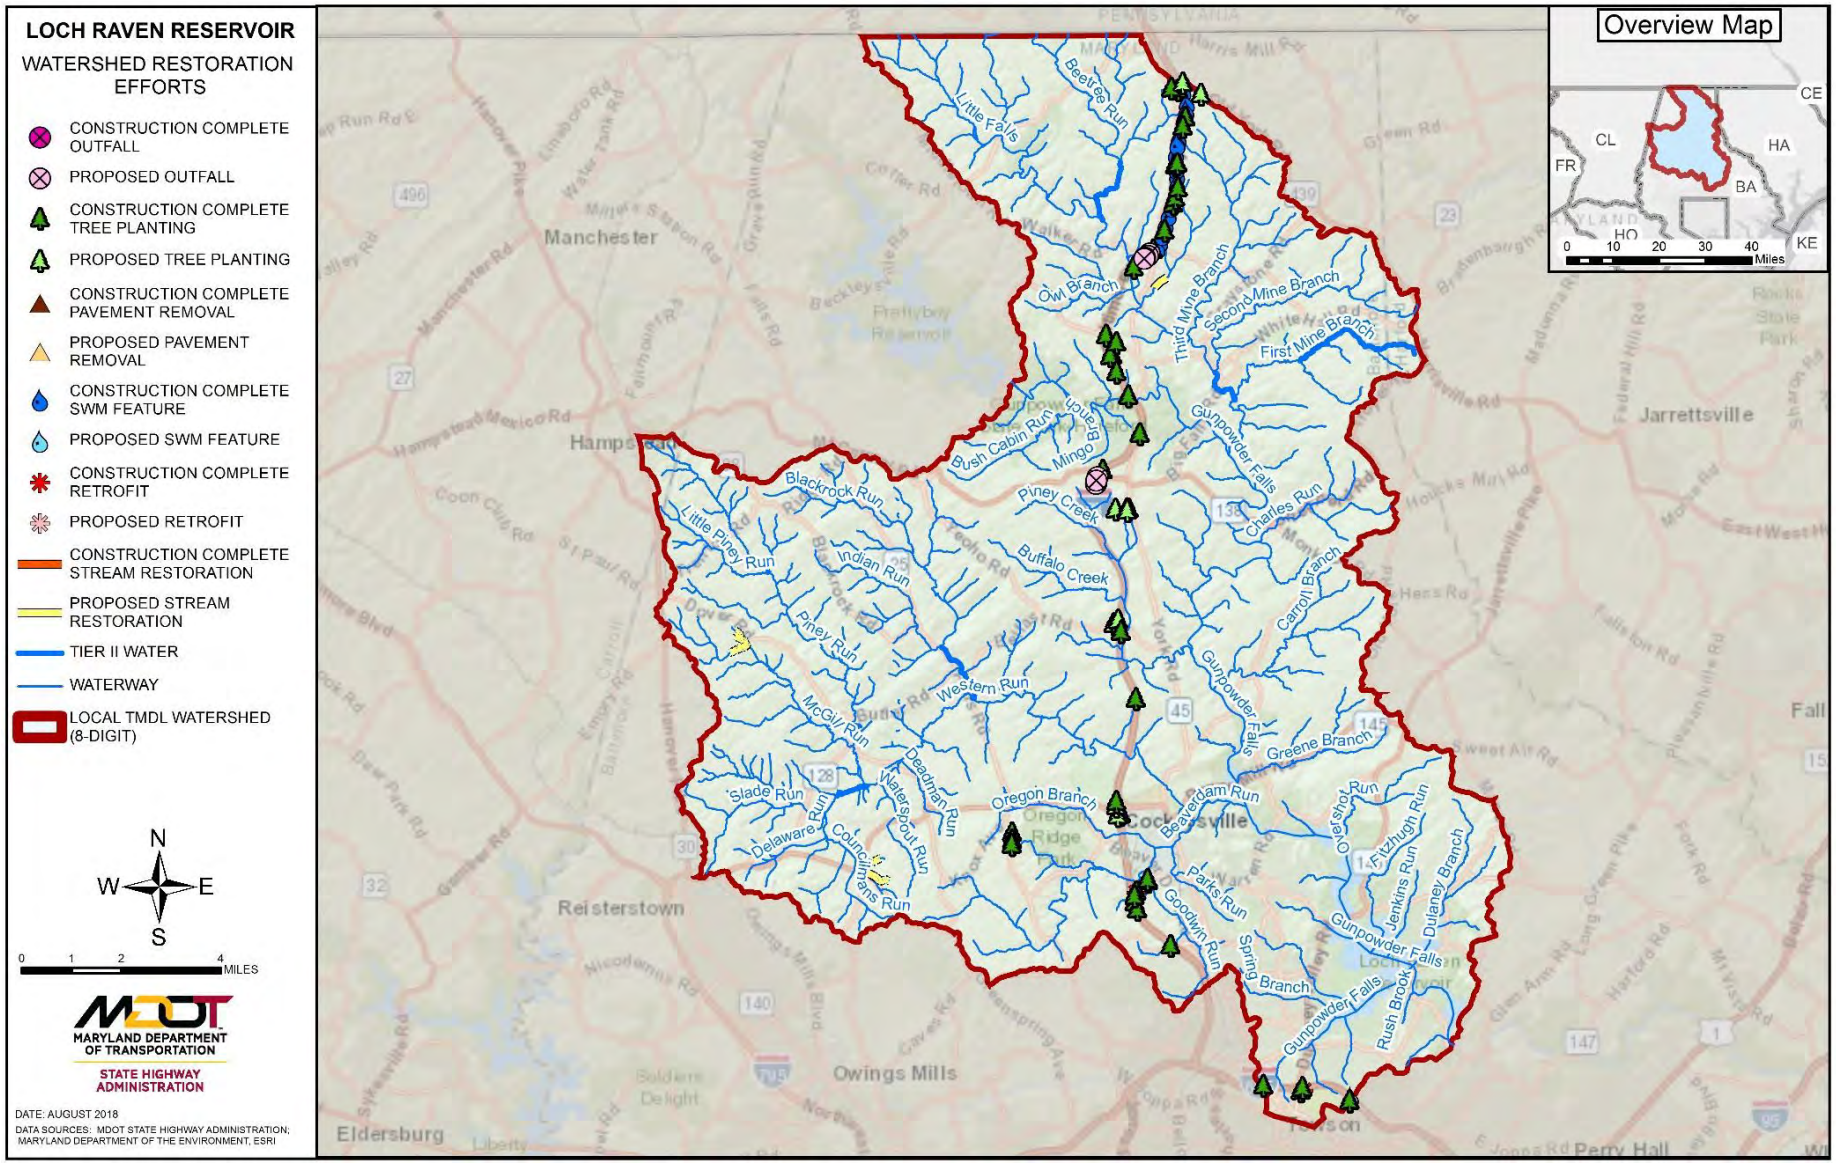


Figure 4-48: MDOT SHA Restoration Strategies within the Loch Raven Reservoir Watershed

Q. LOWER GUNPOWDER FALLS WATERSHED

Q.1. Watershed Description

Located entirely within the central eastern portion of Baltimore County, Maryland, the Lower Gunpowder Falls watershed (Maryland 8-digit Basin Code: 02130802) generally drains eastward toward the tidal portions of the Gunpowder River. The Gunpowder River is formed by the joining of two major tributaries: Little Gunpowder Falls and the mainstem or "Big" Gunpowder Falls (hereinafter referred to as the "mainstem Gunpowder Falls"). Streams within the Lower Gunpowder Falls watershed drain to the mainstem Gunpowder Falls, which joins the Little Gunpowder Falls before flowing into the Gunpowder River. The Gunpowder River, in turn, ultimately flows into the Chesapeake Bay.

The designated use of the non-tidal portion of the Lower Gunpowder Falls is a combination of Use Class I – Water Contact Recreation and Protection of Nontidal Warmwater Aquatic Life; Use Class III – Nontidal Coldwater Aquatic Life; and Use Class IV – Recreational Trout Waters (MDE, 2017b).

The Lower Gunpowder Falls watershed is approximately 46 square miles (29,000 acres), not including water/wetlands. The water/wetlands within the Lower Gunpowder Falls watershed comprises approximately 0.1 square miles (80 acres). While the lower portion of the watershed extends slightly into Maryland's Coastal Plain geologic province, the majority of the Lower Gunpowder Falls watershed lies within the Eastern Piedmont province. In addition to the mainstem Gunpowder Falls, other major tributaries in the watershed include Cowen Run, Long Green Creek, Haystack Branch, Sweathouse Run, Minebank Run, Jennifer Branch, and Bean Run.

There are 25.93 centerline miles of MDOT SHA roadway located within the Lower Gunpowder Falls watershed. The associated ROW encompasses approximately 222 acres, of which approximately 126 acres are impervious. MDOT SHA facilities located within the Lower Gunpowder Falls watershed consist of three (3) park and ride facilities.

See **Figure 4-49** for a map of MDOT SHA facilities within the Lower Gunpowder Falls watershed.

Q.2. MDOT SHA TMDLs within Lower Gunpowder Falls Watershed

Waters within the Lower Gunpowder Falls watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- Sulfates; and
- TSS.

MDOT SHA is included in the sediment TMDL (MDE, 2017b), with a reduction requirement of 67 percent, as shown in **Table 3-2**. This TMDL only applies to the non-tidal portion of the Lower Gunpowder Falls watershed. There are no other pollutants with TMDLs and MDOT SHA WLAs for this watershed.

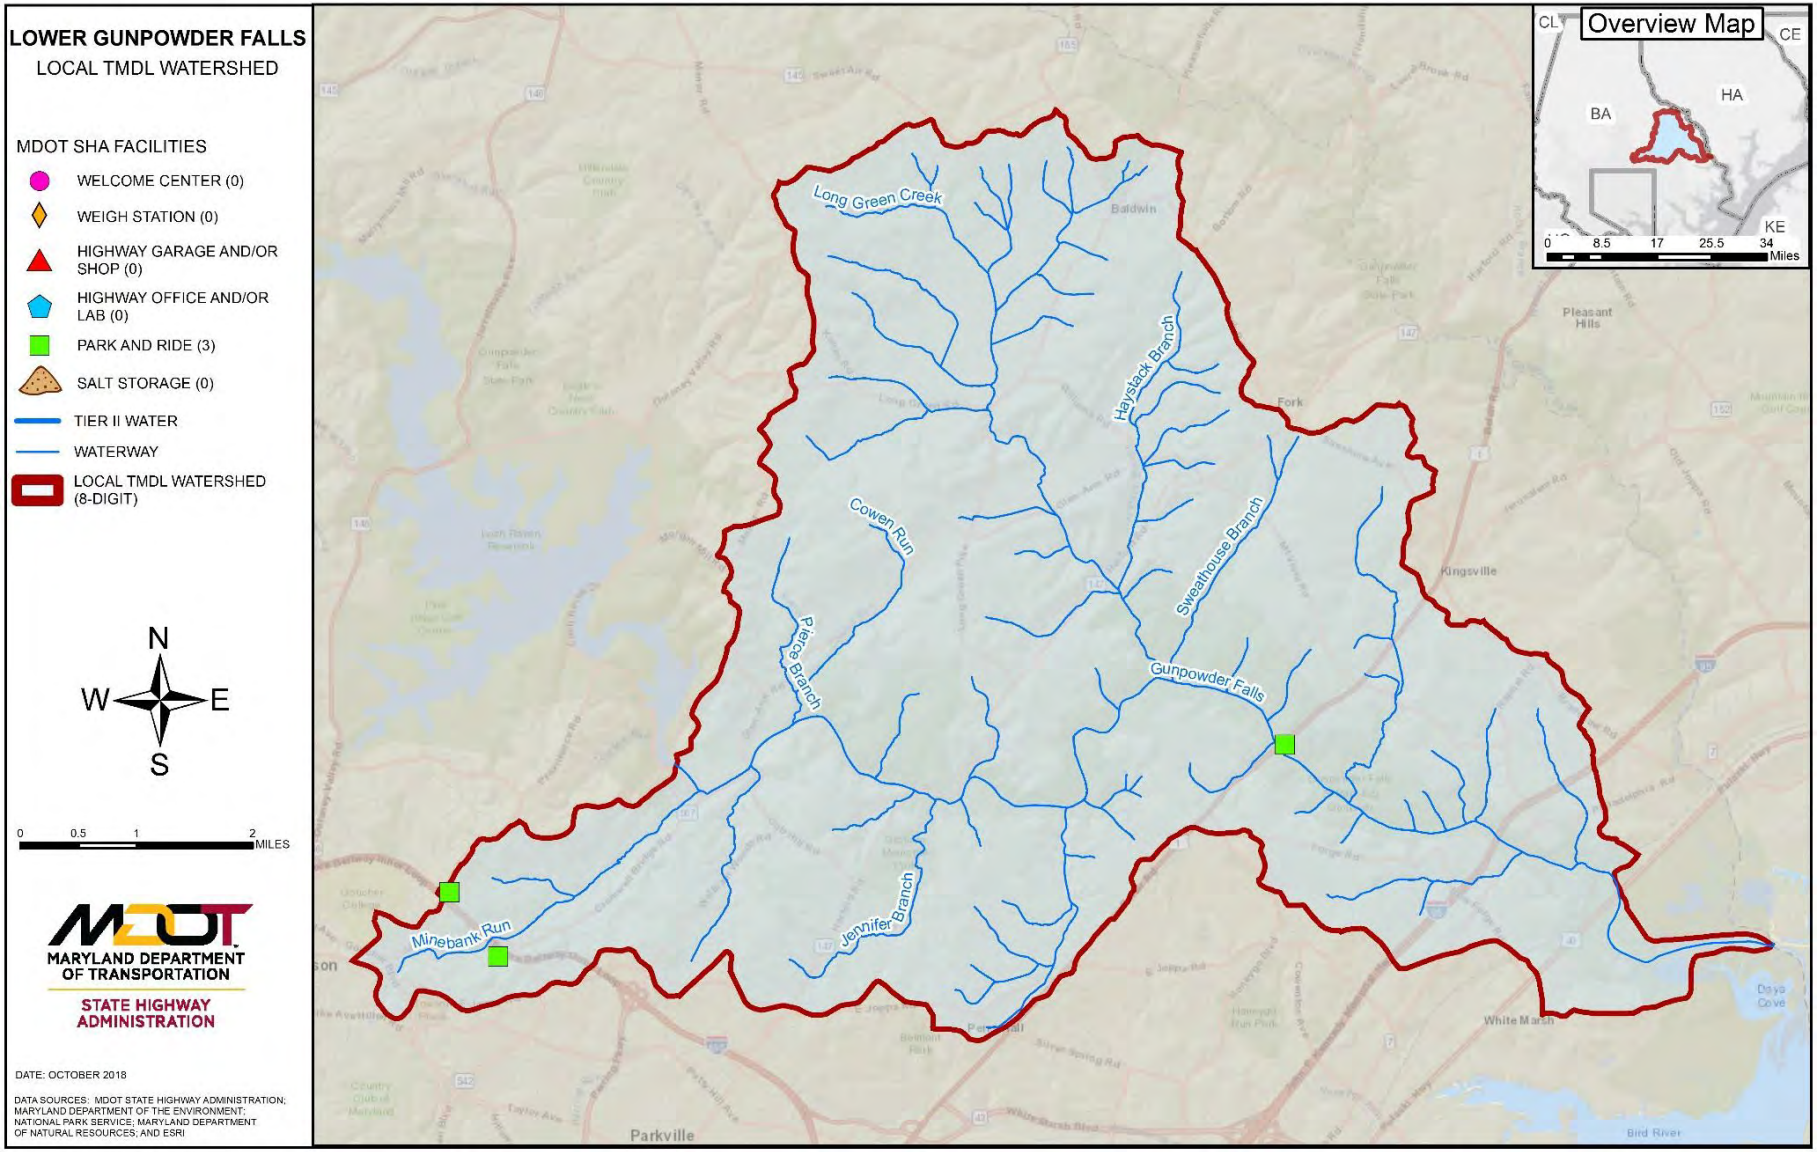


Figure 4-49: Lower Gunpowder Falls Watershed

Q.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan, Section C** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Lower Gunpowder Falls watershed is shown in **Figure 4-50** which illustrates that 29 grid cells have been reviewed, encompassing portions of nine (9) state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 79 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- Four (4) new structural SW controls constructed or under contract.
- 55 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 20 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 93 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 51 sites constructed or under contract.
- Eight (8) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 34 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified eight (8) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- One (1) site constructed or under contract.
- Seven (7) sites deemed not viable for stream restoration.

Grass Swale Rehabilitation

No grass swale rehabilitation sites were identified within this watershed for potential restoration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified five (5) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Five (5) retrofit sites deemed not viable for retrofit and have been removed from consideration.

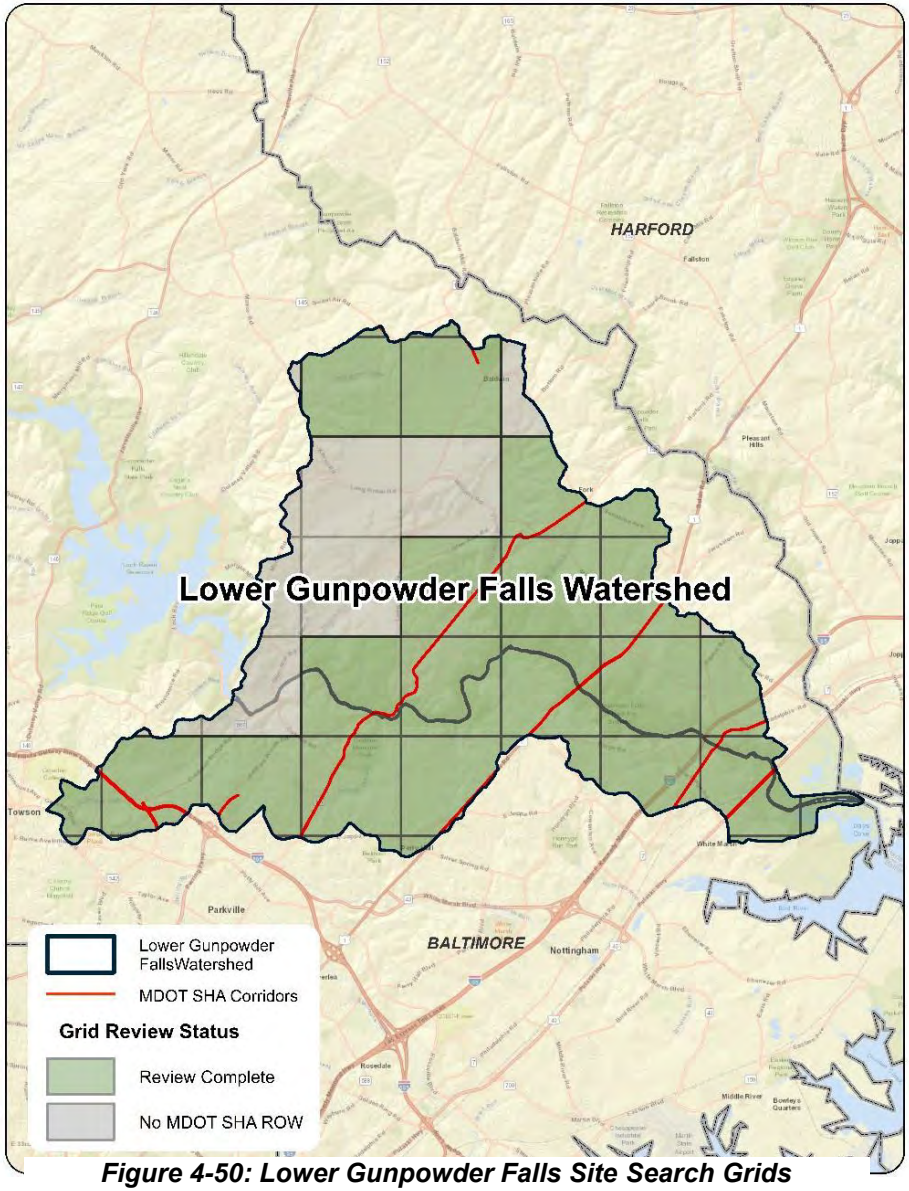


Figure 4-50: Lower Gunpowder Falls Site Search Grids

Q.4. Summary of County Assessment Review

Due to the unique geographic divide that the mainstem Gunpowder Falls creates within the Lower Gunpowder Falls watershed, the Baltimore County Department of Environmental Protection and Sustainability (BA-EPS) has completed two SWAPs for the watershed—one for the rural portion above the mainstem Gunpowder Falls (northern side) and one for the urban portion of the watershed below the mainstem Gunpowder Falls (southern side).

More specifically, according to BA-EPS, there is "very rural countryside to the north and a very urbanized area on the southern side" (BA-EPS, 2017, "Lower Gunpowder Falls," para. 2). The BA-EPS further describes the northern and southern side of the mainstem Gunpowder Falls through the watershed as follows:

> *The land to the north is primarily agricultural in nature and includes the communities of Long Green, Hydes, Glen Arm, Fork, Kingsville and Upper Falls. Land south of the river consists of developed areas such as parts of Towson, Carney, and Parkville, the commercial corridor along Joppa Road, and newer, rapidly developing areas such as Perry Hall. The valley forming the Lower Gunpowder Falls main stem consists of heavily forested lands that are part of the Gunpowder Falls State Park. (BA-EPS, 2017, "Lower Gunpowder Falls," para. 2)*

The following provides a summary of both the rural and urban SWAPS completed for the Lower Gunpowder Falls watershed in 2017 and 2016, respectively. It is important to note that Baltimore County has assigned a letter identifier to all Baltimore County watershed areas with an associated SWAP. Accordingly, Baltimore County has assigned the upper, rural portion of the Lower Gunpowder Falls watershed with the

letter "Q" and the lower, urban portion of the Lower Gunpowder Falls watershed with the letter "N."

BA-EPS SWAP for Lower Gunpowder Falls (Rural) – "Area Q"

Prepared by the Center for Watershed Protection (CWP), KCI Technologies, and Coastal Resources, Inc. for the BA-EPS, the 2017 *Lower Gunpowder Falls (Rural) Small Watershed Action Plan: Final Report* is Baltimore County's SWAP for the rural portion of the Lower Gunpowder Falls watershed (CWP et al., 2017). According to Baltimore County's letter identifier system discussed above, the rural/upper portion of the Lower Gunpowder Falls watershed is hereinafter referred to as "Area Q" and its associated SWAP as the "Area Q SWAP."

The Area Q SWAP provides an assessment of the following six subwatersheds that compose Area Q:

- Cowen Run;
- Long Green Creek;
- Haystack Branch;
- Sweathouse Run;
- Lower Gunpowder Falls–West; and
- Lower Gunpowder Falls–East.

Each of the subwatersheds are located around its corresponding tributary. The Lower Gunpowder Falls–West subwatershed surrounds the upper, western half of the mainstem Gunpowder Falls while the Lower Gunpowder Falls–East subwatershed surrounds the upper, eastern half of the mainstem Gunpowder Falls. All of the subwatersheds drain south towards the mainstem Gunpowder Falls (see **Figure 4-49**).

Water quality within Area Q is largely affected by nitrogen, phosphorus, and sediment inputs. Using ranking criteria to prioritize the six subwatersheds within the rural Lower Gunpowder Falls watershed, Baltimore County numerically ranked the six subwatersheds based on their potential for restoration and need for protection (The final rankings are provided in **Table 4-65**).

Restoration ranks were assigned based on the following eleven criteria:

- Total Nitrogen and Total Phosphorus Loads;
- Biological Indicators;
- Impervious Surfaces;
- Institutional Site Investigation;
- Hotspot Site Investigation;
- Neighborhood Restoration Opportunity/Pollution Severity Indices;
- Neighborhood Lawn Fertilization Reduction/Awareness;
- Stream Buffer Improvement;
- Stream Restoration Potential;
- Septic Systems; and
- Pervious Area Assessment.

A brief description of each restoration ranking criterion and the results of the ranking are as follows (CWP et al., 2017):

Total Nitrogen and Total Phosphorus Loads: Annual total nitrogen and total phosphorous loads (lbs/year) were calculated using the pre-defined land use-based loading rates (lbs/acre/year) provided by the Baltimore County Land Cover Dataset and the CBP. The subwatersheds within Area Q that experience higher rates of nitrogen and phosphorus loading received higher restoration scores and lower protection scores for this criterion. Long Green Creek had the highest nitrogen loading rate and the highest phosphorus loading rate.

Biological Indicators: Both the FIBI and the BIBI were used to score for biological indicators. The data used for these calculations was provided by BA-EPS and the DNR-led Maryland Biological Stream Survey. Restoration scores for subwatersheds were higher when

biological indicators were lower. Long Green Creek was in the highest need of restoration based on this criterion.

Impervious Surfaces: Impervious surfaces cover 9 percent of Area Q; therefore, Area Q is classified as a "sensitive" watershed, just under the "impacted" classification threshold. Sensitive watersheds have less than 10 percent impervious surface and are typified by stable channels, good habitat, and good to high water quality. In contrast, impacted watersheds have between 10 and 25 percent impervious cover and generally show obvious signs of degradation such as channel widening and a decline in stream habitat. Accordingly, impervious surface cover was estimated for each of the six subwatersheds within Area Q. Lower Gunpowder Falls–West had the lowest amount of impervious surface at 6.5 percent, whereas Cowen Run had the highest amount of impervious surface at 11.6 percent. The Area Q SWAP notes that this relatively low impervious cover range of 6.5 to 11.6 percent may, however, be somewhat misleading because the estimates were provided at the subwatershed scale. This would, for example, not account for potential pockets of concentrated development with much higher impervious cover within Area Q. In addition, the Area Q SWAP cites research showing the inability of brook trout to survive in watersheds with impervious cover percentages above 4 percent.

Institutional Site Investigation: Several institutional sites within Area Q were assessed to identify privately managed properties that have restoration potential. Institutional properties have a high potential for public involvement in restoration activities like stormwater retrofitting and tree planting. Scores were assigned based on the total land area of institutional sites with identified restoration actions within a subwatershed. Containing 170 acres of institutional land sites with identified restoration activities, the Lower Gunpowder Falls–East received the highest score under this criterion. The Haystack Branch and Lower Gunpowder Falls–West subwatersheds did not receive a score under this criterion because they have no institutional land available for restoration activities.

Hotspot Site Investigation: According to the Area Q SWAP, a hotspot is a designated site where stormwater has a higher probability of transporting above average pollutant concentrations through runoff. Pollutants that may be present in hotspot areas include nutrients, hydrocarbons, metals, chloride, pesticides, bacteria, and trash. Sites that underwent these investigations are categorized as a "confirmed hotspot," "potential hotspot," or "not a hotspot." With four potential hotspots, Long Green Creek contained the highest number of hotspots, thereby scoring the highest for restoration prioritization. The Lower Gunpowder Falls–East received the second highest restoration score and was the only subwatershed found to have a confirmed hotspot. The Area Q SWAP provides specific hotspot BMP recommendations for these two subwatersheds (see **Table 4-66** below).

Neighborhood Restoration Opportunity/Pollution Severity Indices: Thirty neighborhoods in the various subwatersheds of Area Q were investigated and rated according to a Pollution Severity Index (PSI) and Restoration Opportunity Index (ROI). The Lower Gunpowder Falls–East subwatershed had the most neighborhoods with a high or moderate PSI and ROI score; therefore, it is the most need of restoration based on this criterion.

Neighborhood Lawn Fertilization Reduction/Awareness: Residential lawns within each subwatershed underwent a visual survey to identify properties with high nutrient pollution through fertilizer use. Investigated properties were given a restoration ranking accordingly and are recommended for community engagement to reduce lawn fertilizer. Haystack Branch—the subwatershed with the greatest percentage of high maintenance lawns—received the greatest restoration potential score.

Stream Buffer Improvement: Stream buffer restoration opportunities were identified using GIS to classify the cover within 100-foot stream buffers into three categories: forests, impervious (e.g., roads and buildings), and open pervious (e.g., mowed lawns). Subwatersheds

that contain a large amount of open pervious land within stream buffers are a higher priority for restoration. Long Green Creek contains the highest percentage of open pervious area within its stream buffers. Sweathouse Run received the highest protection score due to its high percentage of forested buffer.

Stream Restoration Potential: Subwatersheds were rated for stream restoration potential based on how many feet of potential stream restoration is present in each subwatershed. Subwatersheds with greater amounts of proposed stream restoration scored higher for potential restoration. Long Green Creek scored highest with a recorded 18,140 feet of proposed stream restoration.

Septic Systems: Septic systems are a potential source of pollution and should be monitored for functionality. The greater the number of septic systems in each subwatershed, the greater the restoration score assigned. There are approximately 2,684 septic systems in Area Q. With 860 septic systems, the Long Green Creek subwatershed scored the highest for potential restoration due to having the highest number of septic systems out of the six subwatersheds.

Pervious Area Assessment: A pervious area assessment was conducted in Area Q that identified parcels of land ideal for large scale tree planting. Tree planting activities can reduce runoff and increase community awareness of watershed management. Area Q has approximately 444 acres of planting opportunity. Subwatersheds were ranked based on the number of acres of tree planting opportunity available. Long Green Creek was ranked the highest priority for restoration as it contained the largest amount of land that would be ideal for tree planting.

In addition to restoration scores, protection scores were also assigned. The protection scores were based on the following five criteria:

- Total Nitrogen and Total Phosphorus Loads;
- Biological Indicators;
- Impervious Surfaces;
- Stream Buffer Improvement; and
- Agricultural Land in Easement.

The protection criteria include several of the same criterion and ranking methods as the restoration criteria. One notable exception is the "Agricultural Land in Easement" criterion:

Agricultural Land in Easement: The agricultural land protection scores were based on the amount of agricultural land not located in conservation easements. Conservation easements provide protection of agricultural lands as well as benefits to the land owners. Lower Gunpowder Falls–East has the highest amount of land located outside conservation easements; therefore, it scored the highest out of the six subwatersheds for protection.

Table 4-65 below provides the overall final ranking of each subwatershed based on the scores it received in each of the aforesaid priority restoration and protection criteria. The numeric scores in **Table 4-65** are provided to convey the degrees at which one subwatershed ranked higher or lower than another; details on the numeric scoring scale used to determine the overall final scores are provided in the Area Q SWAP.

Currently only 2.8 percent of urban land within Area Q is treated by stormwater BMPs. All suggested BMPs for the subwatersheds located in Area Q are shown in **Table 4-66**.

Table 4-65: County Identified Priority Areas for Restoration and Protection within the Lower Gunpowder Falls Watershed - Rural (Area Q)

Subwatershed	Total Restoration Score	Restoration Prioritization Category	Total Protection Score	Protection Prioritization Category
Cowen Run	60	Moderate	62	Moderate
Long Green Creek	88	High	40	Low
Haystack Branch	68	Moderate	58	Moderate
Sweathouse Run	51	Moderate	86	High
Lower Gunpowder Falls–West	33	Low	70	High
Lower Gunpowder Falls–East	74	High	81	High

Source: CWP et al. (2017)

Table 4-66: County Suggested BMPs for Subwatersheds within the Lower Gunpowder Falls Watershed - Rural (Area Q)

Recommended Action	Cowen Run	Long Green Creek	Haystack Branch	Sweathouse Run	Lower Gunpowder Falls–West	Lower Gunpowder Falls–East
Tree Planting	✓	✓	✓	✓	✓	✓
Trash Management	✓			✓		✓
Stream Restoration (channel restoration, bank stabilization)	✓	✓	✓	✓	✓	✓
Stream Buffer Improvement/Reforestation	✓	✓	✓	✓	✓	✓
Storm Drain Marking	✓	✓	✓	✓	✓	✓
Downspout disconnection (rain gardens/barrels)		✓	✓	✓		✓
Stormwater Retrofit (includes wetland/SWM pond creation and conversions)	✓	✓	✓		✓	✓
Outfall Retrofit					✓	✓
Fertilizer Reduction (promote proper lawn care, encourage residents to reduce fertilizer use)	✓	✓	✓	✓		✓
Bayscaping		✓		✓		✓
Lot Canopy Improvement		✓		✓		✓
Hotspot Education		✓				✓
Evaluate Hotspot site by reviewing existing Stormwater Pollution Prevention Plan		✓				✓
Refer Hotspot for Enforcement						✓
Test Hotspot for Illicit Discharge						✓
Hotspot Follow-up Inspection						✓

Source: CWP et al. (2017)

BA-EPS SWAP for Lower Gunpowder Falls (Urban) – "Area N"

On behalf of BA-EPS, Versar, Coastal Resources, and McCormick Taylor completed the *Lower Gunpowder Falls (Urban) Small Watershed Action Plan* in March of 2016 (Versar et al., 2016). This document serves as the official Baltimore County SWAP for the urban portion (below mainstem Gunpowder Falls) of the Lower Gunpowder Falls watershed.

According to the aforementioned Baltimore County letter identifier system, the urban/lower portion of the Lower Gunpowder Falls watershed is hereinafter referred to as "Area N" and its associated SWAP as the "Area N SWAP."

According to the Area N SWAP, impervious land cover comprises 1,753 acres (16.6 percent) of Area N and 9.1 percent of the soils within Area N are considered high runoff potential. Agriculture makes up 7.1 percent of the land use in the watershed, while forest makes up 26.2 percent. Baltimore County estimates that impervious urban land use is responsible for contributing 28,536 lbs of nitrogen; 2,483 lbs of phosphorus; and 3,193,080 lbs of sediment in Area N per year. Stormwater runoff was the primary contributor of nutrient and sediment inputs to Area N.

The Area N SWAP is organized around the analysis of the following seven subwatersheds that compose Area N:

- Minebank Run;
- Jennifer Branch;
- Bean Run;
- Lower Gunpowder Falls–A;
- Lower Gunpowder Falls–B;
- Lower Gunpowder Falls–C; and
- Lower Gunpowder Falls–D.

Each of these subwatersheds are located around its corresponding tributary. The Lower Gunpowder Falls–A, B, C, D surround the mainstem Gunpowder Falls on its southern side in alphabetic order, with the Lower Gunpowder Falls–A on the far western side and the Lower Gunpowder Falls–D being the farthest east. All of the subwatersheds drain north towards the mainstem Gunpowder Falls (see **Figure 4-49**).

Water quality within Area N is largely affected by nitrogen, phosphorus, and sediment inputs. Using ranking criteria to prioritize the seven subwatersheds within the urban Lower Gunpowder Falls watershed, Baltimore County numerically ranked the seven subwatersheds based on their potential for restoration and need for protection.

Restoration and protection ranks were assigned based on the following ten criteria:

- Total Nitrogen and Total Phosphorus Loads;
- Impervious Surfaces;
- Institutional Site Investigation;
- Neighborhood Restoration Opportunity/Pollution Severity Indices;
- Stream Buffer Improvement;
- Stream Restoration Potential;
- Pervious Area Assessment;
- Neighborhood Downspout Disconnection;
- Stormwater Pond Conversions; and
- Illicit Discharge Data.

The ranking criteria for Area N shares several of the same criterion used to rank Area Q discussed above, with the exception of Neighborhood Downspout Disconnection; Stormwater Pond Conversions; and Illicit Discharge Data.

A brief description of each restoration ranking criterion and the results of the ranking are as follows (Versar et al., 2016):

Total Nitrogen and Total Phosphorus Loads: Lower Gunpowder Falls–B had the highest nitrogen loading rate; Lower Gunpowder–D had the highest phosphorus loading rate.

Impervious Surfaces: Lower Gunpowder Falls–B had the highest impervious cover at 21 percent, followed by Minebank Run with 19 percent impervious cover.

Institutional Site Investigation: The Lower Gunpowder Falls–B and Jennifer Branch subwatersheds have the most institutional site restoration opportunities.

Neighborhood Restoration Opportunity/Pollution Severity Indices: Minebank Run and Lower Gunpowder Falls–D contained the most neighborhood area ranked as high priority for restoration.

Stream Buffer Improvement: Lower Gunpowder Falls–C has the highest potential for stream buffer improvement.

Stream Restoration Potential: Stream restoration was recommended in four of the seven subwatersheds, with the Lower Gunpowder Falls–B subwatershed having the most linear feet of stream restoration potential. The three subwatersheds where no stream restoration was recommended were Jennifer Branch, Minebank Run, and Lower Gunpowder Falls–D. This is because Jennifer Branch and Minebank Run have already undergone extensive stream restoration, and there were no identified opportunities in Lower Gunpowder Falls–D.

Pervious Area Assessment: Pervious area assessments were conducted to find sites that were best suited for large-scale tree plantings. Only three subwatersheds contained acreage recommended for reforestation: Jennifer Branch, Lower Gunpowder Falls–B, and Minebank Run. Minebank Run had the most acres recommended for reforestation (13.8 acres).

Neighborhood Downspout Disconnection: Unlike connected downspouts that discharge rooftop runoff directly to the storm drain system or to impervious surfaces, disconnected downspouts allow rooftop runoff to drain to pervious areas such as yards, rain barrels, or rain gardens. Disconnected downspouts allow for slower flow and a reduction in pollution entering streams during storm events. All seven of the subwatersheds contained areas recommended for downspout disconnection.

Stormwater Pond Conversions: The County identified fifteen stormwater management facilities within the watershed that would be good candidates for detention pond conversion to improve water quality treatment. Before the completion of the SWAP, eleven of the fifteen ponds had already been converted, and the remaining four were planned for future conversion. The four planned future conversion projects would take place in Jennifer Branch and Lower Gunpowder Falls–B.

Illicit Discharge Data: Baltimore County tracks illicit discharges via an outfall screening program. Illicit discharges refer to any inputs into the storm sewer system that are not stormwater, or otherwise permitted. Jennifer Branch and Minebank Run were both ranked critical based on this criterion; therefore, illicit discharge in these two subwatersheds should be addressed first.

The subwatersheds were placed into one of four restoration priority categories based on the ranking results: very high, high, medium, and low. The Lower Gunpowder Falls–B subwatershed was ranked as the first priority for restoration, in the Very High prioritization category. The Jennifer Branch, Minebank Run, and Lower Gunpowder Falls–A subwatersheds were ranked second, third, and fourth, respectively, all

in the High prioritization category. The remaining three subwatersheds were in the Low prioritization category: Lower Gunpowder Falls–C was ranked fifth priority, and Bean Run and Lower Gunpowder Falls–D were tied for sixth. Protection priority categories were also assigned. A summary of the final results of the restoration and priority protection rankings can be found in **Table 4-67**. The numeric scores are provided to convey the degrees at which one subwatershed ranked higher or lower than another; details on the numeric scoring scale are provided in the Area N SWAP.

Baltimore County suggested BMPs for Area N are shown in **Table 4-68**.

Table 4-67: County Identified Priority Areas for Restoration and Protection within the Lower Gunpowder Falls Watershed - Urban (Area N)

Subwatershed	Total Restoration Score	Restoration Prioritization Category	Total Protection Score	Protection Prioritization Category
Minebank Run	26	High	26	Medium
Jennifer Branch	29	High	29	Medium
Bean Run	18	Low	18	Very High
Lower Gunpowder Falls–A	25	High	25	Medium
Lower Gunpowder Falls–B	37	Very High	37	Low
Lower Gunpowder Falls–C	19	Low	19	Very High
Lower Gunpowder Falls–D	18	Low	18	Very High

Source: Versar et al. (2016)

Table 4-68: County Suggested BMPs for Subwatersheds within the Lower Gunpowder Falls Watershed - Urban (Area N)

Recommended Action	Minebank Run	Jennifer Branch	Bean Run	Lower Gunpowder Falls–A	Lower Gunpowder Falls–B	Lower Gunpowder Falls–C	Lower Gunpowder Falls–D
Tree Planting	✓	✓	✓	✓	✓	✓	✓
Stormwater Retrofit	✓	✓		✓	✓		
Trash Management	✓	✓		✓	✓		
Stream Buffer Improvement	✓	✓	✓	✓	✓	✓	✓
Remove Impervious Cover	✓	✓		✓	✓		
Storm Drain Marking	✓	✓	✓	✓	✓	✓	✓
Downspout Disconnection (rain gardens/barrels)	✓	✓	✓	✓	✓	✓	✓
Bayscaping	✓	✓	✓	✓	✓	✓	✓
Parking Lot/Alley Retrofit	✓	✓		✓	✓		
Pet Waste Education		✓	✓	✓	✓		
Stream Restoration			✓	✓	✓	✓	

Source: Versar et al. (2016)

Q.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reduction in the Lower Gunpowder Falls watershed are shown in **Table 4-69**. Projected sediment reduction using these practices are shown in **Table 3-2**. Four timeframes are included in the table:

- BMPs implemented before the TMDL baseline. In this case, the baseline is 2009;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

MDOT SHA will accomplish the projected reduction to be achieved as a percent of the baseline load shown in **Table 3-2**

Estimated costs to design, construct, and implement BMPs within Lower Gunpowder Falls watershed total $11,628,000. These projected costs are based on an average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-70** for a summary of estimated BMP costs.

Figure 4-51 is a map of MDOT SHA's restoration practices in the watershed and includes those that are under design or construction. Inlet cleaning is not reflected on this map.

Table 4-69: Lower Gunpowder Falls Sediment BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	37.0	20.8	19.6	N/A	77.4
Tree Planting	acres of tree planting		48.5	3.4	N/A	52.0
Stream Restoration	linear feet		8,765.0	1,043.2	N/A	9,808.2
Outfall Stabilization	linear feet		2.1	400.0	N/A	402.1
Inlet Cleaning[1]	dry tons		3.5			3.5
Load Reductions	TSS EOS lbs/yr.		418,246	492,787	0	
					Total Projected Reduction	492,787	

[1] Inlet cleaning is an annual practice.

Table 4-70: Lower Gunpowder Falls Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$2,293,000	$387,000	$2,680,000
Tree Planting	$1,485,000	$105,000	$1,590,000
Stream Restoration	$5,853,000	$697,000	$6,550,000
Outfall Stabilization	$4,000	$787,000	$791,000
Inlet cleaning	$17,000		$17,000
Total			$11,628,000

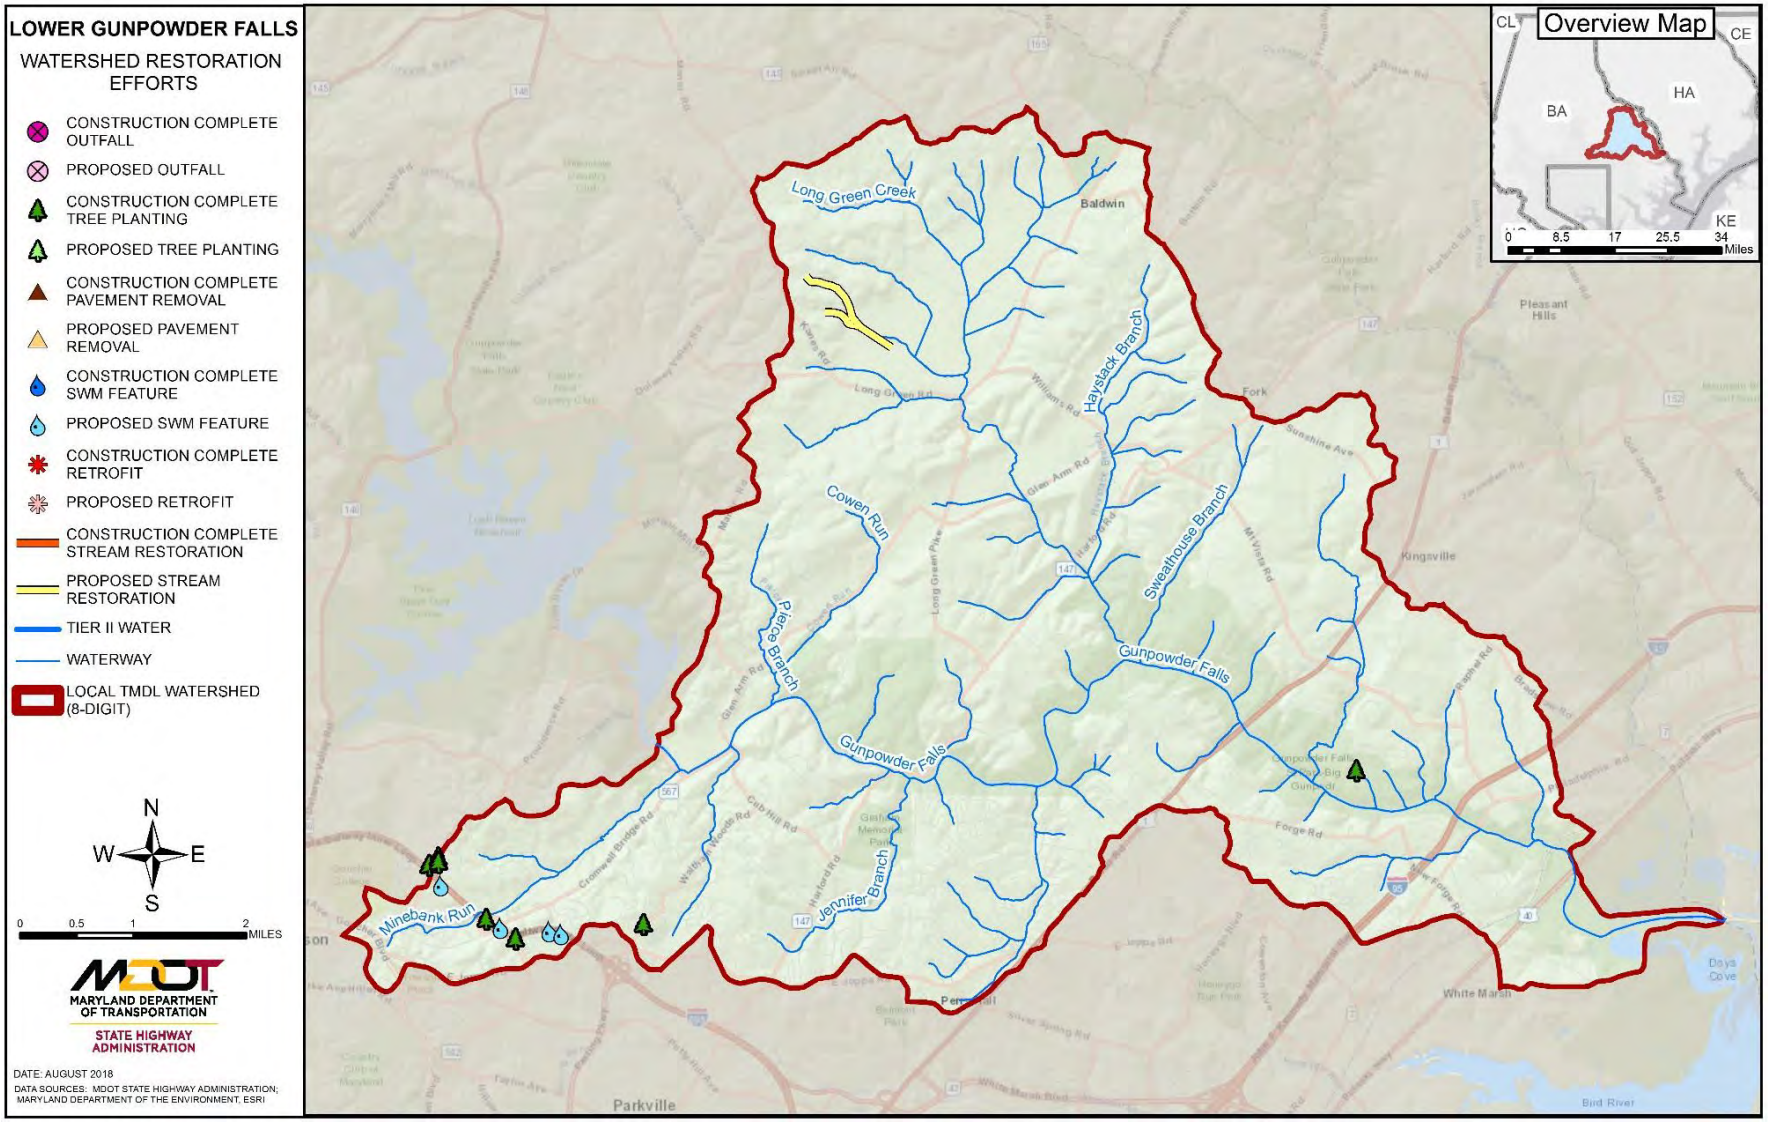


Figure 4-51: MDOT SHA Restoration Strategies within the Lower Gunpowder Falls Watershed

R. LOWER MONOCACY RIVER WATERSHED

R.1. Watershed Description

The Lower Monocacy watershed encompasses 495 square miles primarily within Frederick County as well as small areas of Montgomery and Carroll Counties. The Monocacy River originates in Pennsylvania and flows through Maryland ultimately into the Potomac River. The Lower Monocacy River flows south through Frederick, and ultimately into the Middle Potomac River near the town of Dickerson. Tributary creeks and streams of the Lower Monocacy Watershed include Israel Creek, Carroll Creek, Linganore Creek, Bush Creek, Bennett Creek, and Ballenger Creek. The Lower Monocacy River watershed land use consists of crops (29.4 percent), forest (29.4 percent), residential (17.5 percent), pasture (8.8 percent), commercial (5.2 percent), and water (0.4 percent).

There are 1,224.8 centerline miles of MDOT SHA roadway located within the Lower Monocacy watershed. The associated ROW encompasses 3,562.6 acres, of which 1,886.4 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) highway office or lab, two (2) salt storage facilities, three (3) weigh stations, and seven (7) park and ride facilities. See **Figure 4-52** for a map of the watershed.

R.2. MDOT SHA TMDLs within Lower Monocacy River Watershed

MDOT SHA is included in both the phosphorus (MDE, 2013d) and sediment (MDE, 2009e) TMDLs. Phosphorus is to be reduced by 25.0 percent in Carroll, Frederick, and Montgomery Counties. Sediment is to be reduced by 60.8 percent in Frederick and Montgomery Counties, as shown in **Table 3-2**.

R.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Lower Monocacy River watershed is shown in **Figure 4-53** which illustrates that 123 grid cells have been reviewed, encompassing portions of 23 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 1,345 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 25 new structural SW controls constructed or under contract.
- 737 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 583 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 154 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 130 sites constructed or under contract.

- Six (6) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 118 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 46 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Six (6) additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- 40 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 175 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 82 new structural SW controls constructed or under contract.
- Five (5) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 88 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 23 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of three (3) existing structural SW controls constructed or under contract.
- Nine (9) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 21 retrofit sites deemed not viable for retrofit and have been removed from consideration.

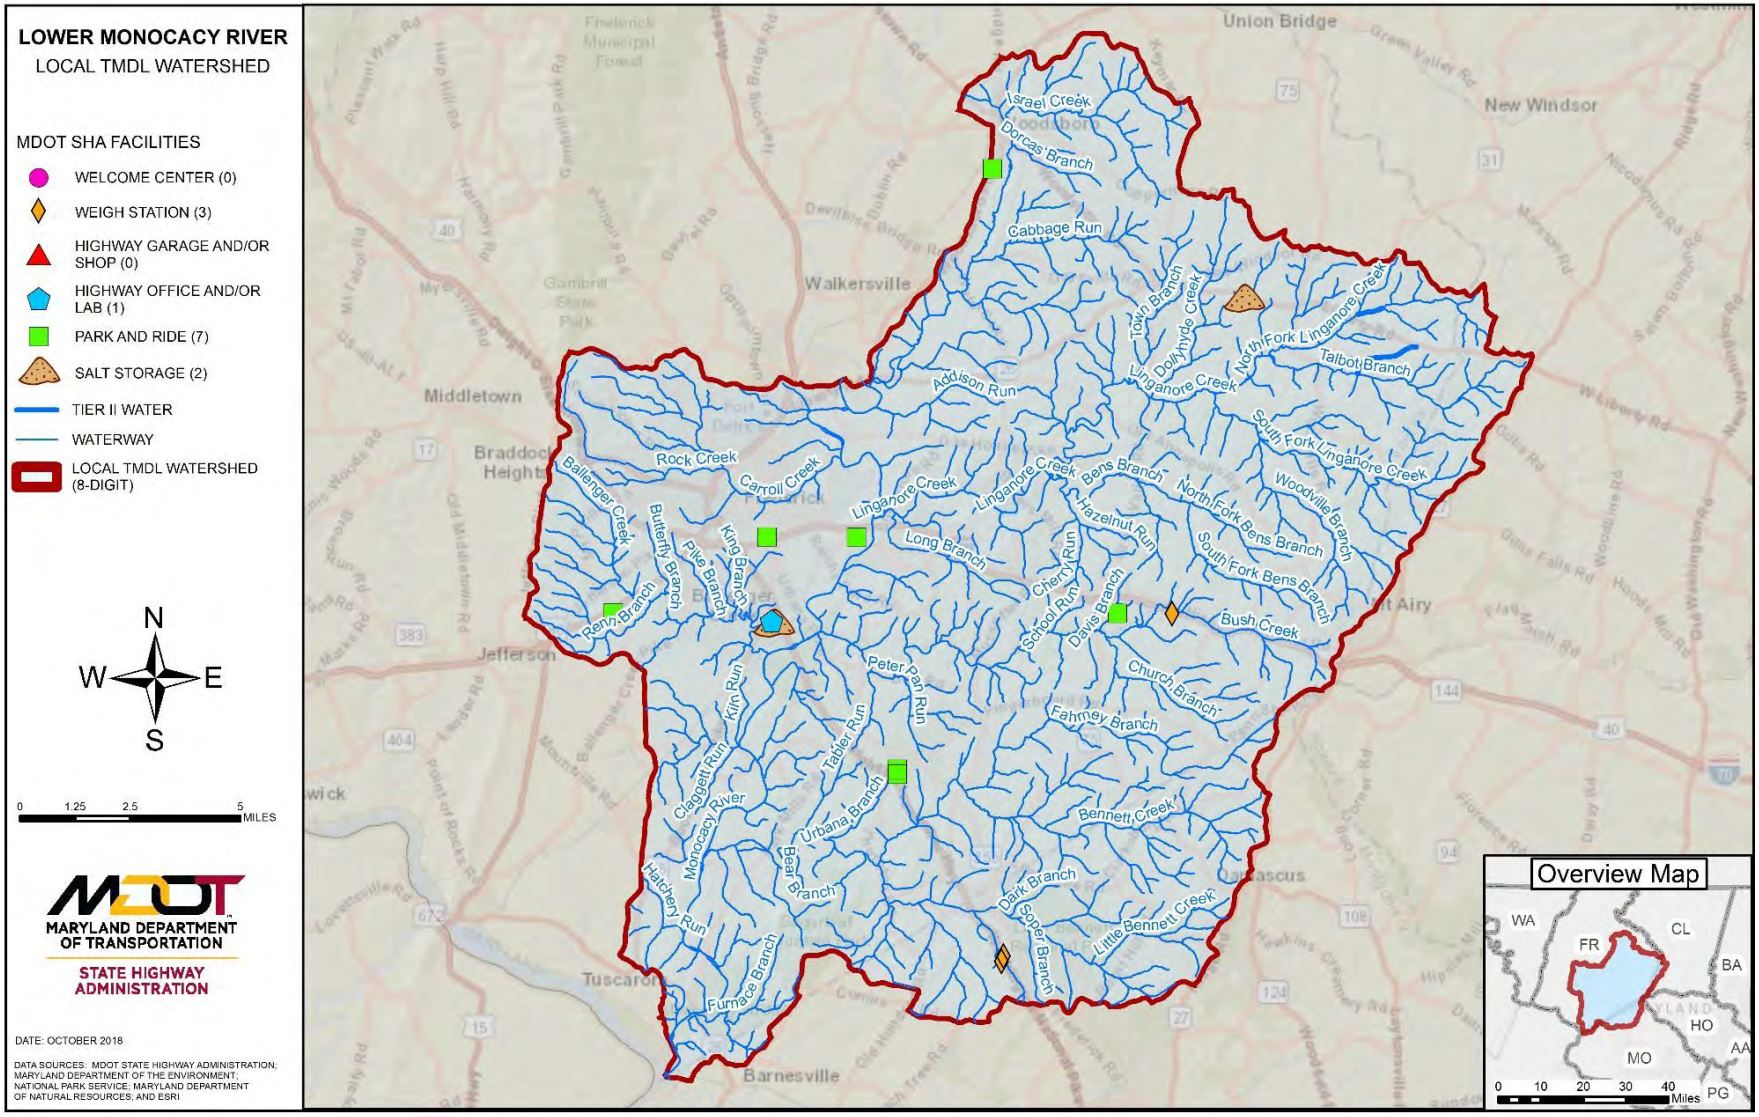


Figure 4-52: Lower Monocacy River Watershed

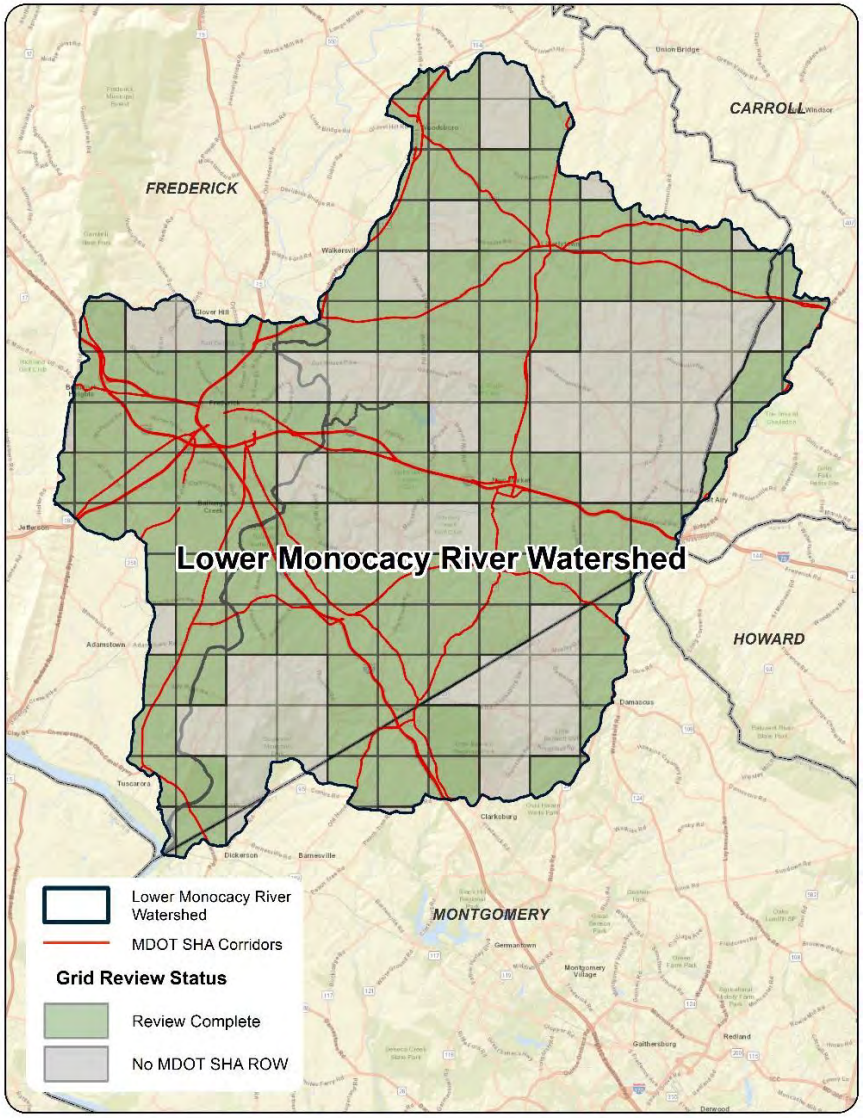


Figure 4-53: Lower Monocacy River Site Search Grids

R.4. Summary of County Assessment Review

Waters within the Lower Monocacy watershed are subject to the following impairments as noted on MDE's 303(d) List:

- *Escherichia coli;*
- Phosphorus (Total);
- Sedimentation/siltation;
- Temperature, water; and
- TSS.

The *Lower Monocacy River Watershed Restoration Action Strategy* (WRAS), prepared by the Frederick County Division of Public Works, was adopted in May 2004 (FR-DPW, 2004). The primary focus of the strategy is the portion of the drainage within Frederick County, which is 87 percent of the total area. The Lower Monocacy River watershed is ranked as a "Category 1 Priority" and "Selected Category 3" watershed in the *Maryland Clean Water Action Plan* (CWAPTW, 1998).

A *Stream Corridor Assessment Survey* (FR-DPW, 2004), to support the WRAS, found 247 potential environmental problem sites following a survey of 75 out of 600 miles. Issues identified included inadequate buffers, erosion, fish barriers, pipe outfalls, channel alterations, trash dumping, and exposed pipes.

An *Assessment of Stormwater Management Retrofit and Stream Restoration Opportunities in Bennett Creek Watershed* was published in 2009 (Tetra Tech, 2009). The assessment identified eleven potential restoration projects. Six of the potential sites are located in Fahrney subwatershed and the others are located in the Bennett Middle, Bennett Upper, Little Bennett, Pleasant, and Urbana subwatersheds.

Restoration approaches proposed across the watershed are primarily county-owned properties and residential properties outside of MDOT SHA ROW. The Bennett Creek Assessment identified three potential stream restoration projects (Tetra Tech, 2009):

- The channel downstream of the Englandtowne SWM pond site is experiencing bank erosion; the upstream channel is also eroding and is contributing to silt deposition within the stormwater pond, thus reducing the effectiveness of the stormwater pond. Stream restoration is proposed upstream and downstream.

- The stream corridor at Kemptown Park is experiencing severe erosion with widening and lateral migration also occurring. It is proposed this stream is restored.

- The stream corridor is located in close proximity to the Persimmon residential area and is experiencing severe erosion, habitat degradation, a fish barrier, and man-made channel alteration. It is recommended the stream corridor is restored.

More recently, the *Frederick County Stream Survey 2016 Countywide Results* found that the average BIBI score for Frederick County streams was "poor." The stream survey also indicated that 18% scored "very poor," 36% scored "poor," 28% scored "fair," and 18% scored "good" (Versar, 2017b). In addition, in July of 2017, Frederick County published the *Lower Monocacy Watershed Assessment*, which provides a comprehensive assessment of the entire Lower Monocacy River watershed within Frederick County (Dewberry, 2017). According to Dewberry (2017), the predominant land uses within the Lower Monocacy River watershed are agricultural (43%), urban (30%), and forest (25%). The urbanized areas within the watershed are found within the cities of Frederick, Mount Airy, New Market, Walkersville, and Woodsboro. The watershed has approximately 658 miles of stream and 1,230 miles of road. Dewberry (2017) identifies several proposed projects that can help achieve load reductions within the watershed. These projects were identified based on Dewberry's review of the watershed's existing stormwater BMPs and projects proposed in previous restoration/retrofit reports as well as the results of windshield surveys of untreated impervious areas within the watershed (Dewberry, 2017).

Montgomery and Carroll Counties have also assessed the Lower Monocacy River watershed portions within Montgomery and Carroll County, respectively. Montgomery County published the *Lower Monocacy Implementation Plan* in 2012 (Biohabitats et al., 2012b) and Carroll County published the *Lower Monocacy River Watershed Characterization Plan* in the Spring of 2016 (CL-BRM, 2016c). Montgomery County identified street sweeping and stream restoration as the most economically efficient practices for meeting sediment load reductions requirements (CL-BRM, 2016c). Carroll County's characterization plan was prepared to provide background water quality conditions in Carroll County's portion of the Lower Monocacy River watershed and to serve as a tool to direct future watershed restoration and protection efforts (CL-BRM, 2016c).

R.5. MDOT SHA Pollutant Reduction Strategies

Lower Monocacy is listed for both phosphorus and sediment with each TMDL having a different baseline year; 2000 for sediment and 2009 for phosphorus. Proposed practices to meet the phosphorus and sediment reduction in the Lower Monocacy River watershed are shown in **Table 4-71 and 4-72**. Projected phosphorus and sediment reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the phosphorus and sediment TMDL baseline. In this case, the phosphorus baseline is 2009 and the sediment baseline are 2000;

- BMPs implemented after the baseline through fiscal year 2020; and

- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL, MDOT SHA will meet 83.3 percent of the MDE 60.8 percent load reduction requirement through implementation of BMPs shown in **Table 4-72.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Lower Monocacy River watershed total $42,853,000. They are based on average cost per impervious acre treated derived from a cost history for each BMP type.

Costs of BMPs used to treat the Lower Monocacy Phosphorus TMDL and Sediment TMDLs are reflected in tables **4-73 and 4-74**, respectively. Because the sediment TMDL is a segmentshed of the Lower Monocacy watershed, only a subset of BMPs implemented in this watershed are used for treatment as opposed to the phosphorus TMDL. The BMPs used to treat the sediment TMDL in this watershed after the baseline year of the phosphorus TMDL (i.e., 2009) are not in addition to the BMPs used to treat the phosphorus TMDLs. The costs to treat the sediment TMDL after 2009 are inherently included in the cost to treat the phosphorus TMDLs in this watershed.

Figure 4-54 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or construction. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-71: Lower Monocacy River Restoration Phosphorus BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	1,295.0	35.8	94.1	N/A	1,424.9
Retrofit	drainage area acres		63.2		N/A	63.2
Impervious Surface Elimination	acres removed		1.6		N/A	1.6
Tree Planting	acres of tree planting	6.9	130.0	59.6	N/A	196.5
Stream Restoration	linear feet		14,097.4	14,038.1	N/A	28,135.5
Outfall Stabilization	linear feet			956.3	N/A	956.3
Inlet Cleaning[1]	dry tons		1.7	4.3	N/A	6.0
Street Sweeping[1]	acres swept		49.7		N/A	49.7
Load Reductions	TP EOS lbs./yr.		1,108	2,253	0	
					Total Projected Reduction	**2,253**

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-72: Lower Monocacy River Restoration Sediment BMP Implementation						
BMP	**Unit**	**Baseline (Before 2000)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	851.6	35.8	94.1	TBD	981.5
Retrofit	drainage area acres		63.2		TBD	63.2
Impervious Surface Elimination	acres removed		1.6		TBD	1.6
Tree Planting	acres of tree planting		134.1	47.9	TBD	182.0
Stream Restoration	linear feet		6,519	8,206.0	TBD	14,725.0
Inlet Cleaning[1]	dry tons		1.6	54	TBD	55.6
Street Sweeping[1]	acres swept		49.3		TBD	49.3
Load Reductions	TP EOS lbs./yr.		384,523	834,913	1,002,040	
				Total Projected Reduction	**1,002,040**	
[1] *Inlet cleaning and street sweeping are annual practices.*						

Table 4-73: Lower Monocacy River Restoration Phosphorus BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$5,371,000	$8,195,000	$13,566,000
Retrofits	$2,250,000		$2,250,000
Impervious Surface Elimination	$460,000		$460,000
Tree Planting	$3,983,000	$1,816,000	$5,799,000
Stream Restoration	$9,416,000	$9,373,000	$18,789,000
Outfall Stabilization		$1,882,000	$1,882,000
Inlet cleaning	$7,000	$25,000	$32,000
Street Sweeping	$75,000		$75,000
Total			$42,853,000

Table 4-74: Lower Monocacy River Restoration Sediment BMP Cost

BMP	2020	2025	Total
New Stormwater	$4,797,000	$8,769,000	$13,566,000
Retrofits	$2,250,000		$2,250,000
Impervious Surface Elimination	$460,000		$460,000
Tree Planting	$4,105,000	$1,464,000	$5,569,000
Stream Restoration	$4,354,000	$5,480,000	$9,834,000
Outfall Stabilization		$1,882,000	$1,882,000
Inlet cleaning	$7,000	$308,000	$315,000
Street Sweeping	$74,000		$75,000
Total			$33,950,000

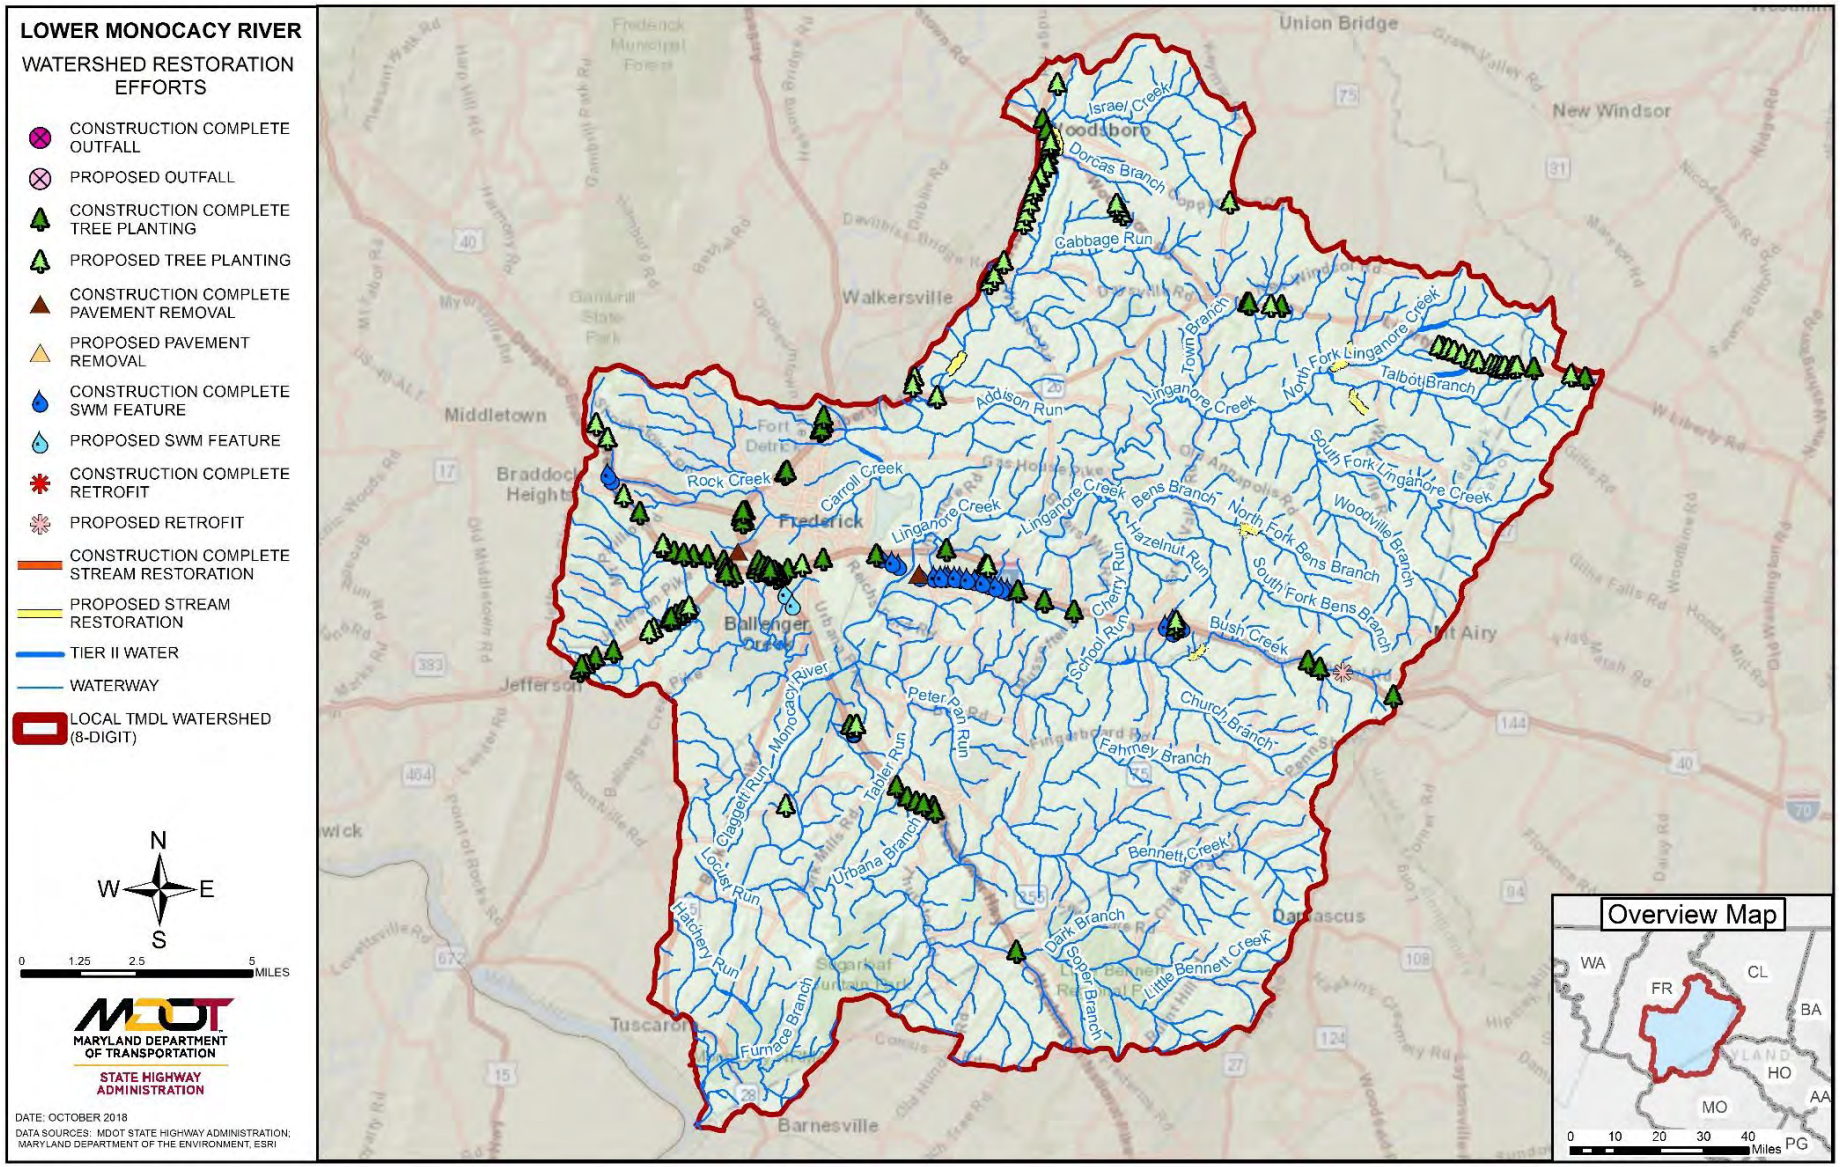


Figure 4-54: MDOT SHA Restoration Strategies within the Lower Monocacy River Watershed

S. PATAPSCO RIVER LOWER NORTH BRANCH WATERSHED

S.1. Watershed Description

The Patapsco River Lower North Branch watershed encompasses 115 square miles across Anne Arundel County, Baltimore County, City of Baltimore, Carroll County, and Howard County. The Patapsco River originates in Carroll County and flows to the Baltimore Harbor and ultimately to the Chesapeake Bay.

There are 1,019.8 centerline miles of MDOT SHA roadway located within the Patapsco River Lower North Branch watershed. The associated ROW encompasses 3,799.2 acres, of which 1,693.7 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) welcome center, one (1) highway office or lab, one (1) highway garage or shop, two (2) salt storage facilities, and two (2) park and ride facilities. See **Figure 4-55** for a map of the watershed.

S.2. MDOT SHA TMDLs within Patapsco River Lower North Branch Watershed

MDOT SHA is included in both bacteria (MDE, 2009f) and sediment (MDE, 2011g) TMDLs. Sediment is to be reduced by 18.0 percent in Anne Arundel, Baltimore and Howard Counties as shown in **Table 3-2**. Bacteria is to be reduced by 14.8 as shown in **Table 3-2.**

S.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Patapsco River Lower North Branch watershed is shown in **Figure 4-56** which illustrates that 77 grid cells have been reviewed, encompassing portions of 35 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 513 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 35 new structural SW controls constructed or under contract.
- 276 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 202 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 271 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 103 sites constructed or under contract.
- 18 additional sites deemed potentially viable for tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 150 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 37 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Eight (8) sites constructed or under contract.
- 12 additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- 17 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 111 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 19 new structural SW controls constructed or under contract.
- 24 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 68 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified six (6) outfalls potential for stabilization. Further analysis of these sites resulted in:

- Five (5) outfall sites constructed or under contract.
- One (1) outfall site deemed potentially viable for outfall stabilization efforts and pending further analysis, may be a candidate for future restoration opportunities.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 33 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of four (4) existing structural SW controls constructed or under contract.
- Seven (7) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 22 retrofit sites deemed not viable for retrofit and have been removed from consideration.

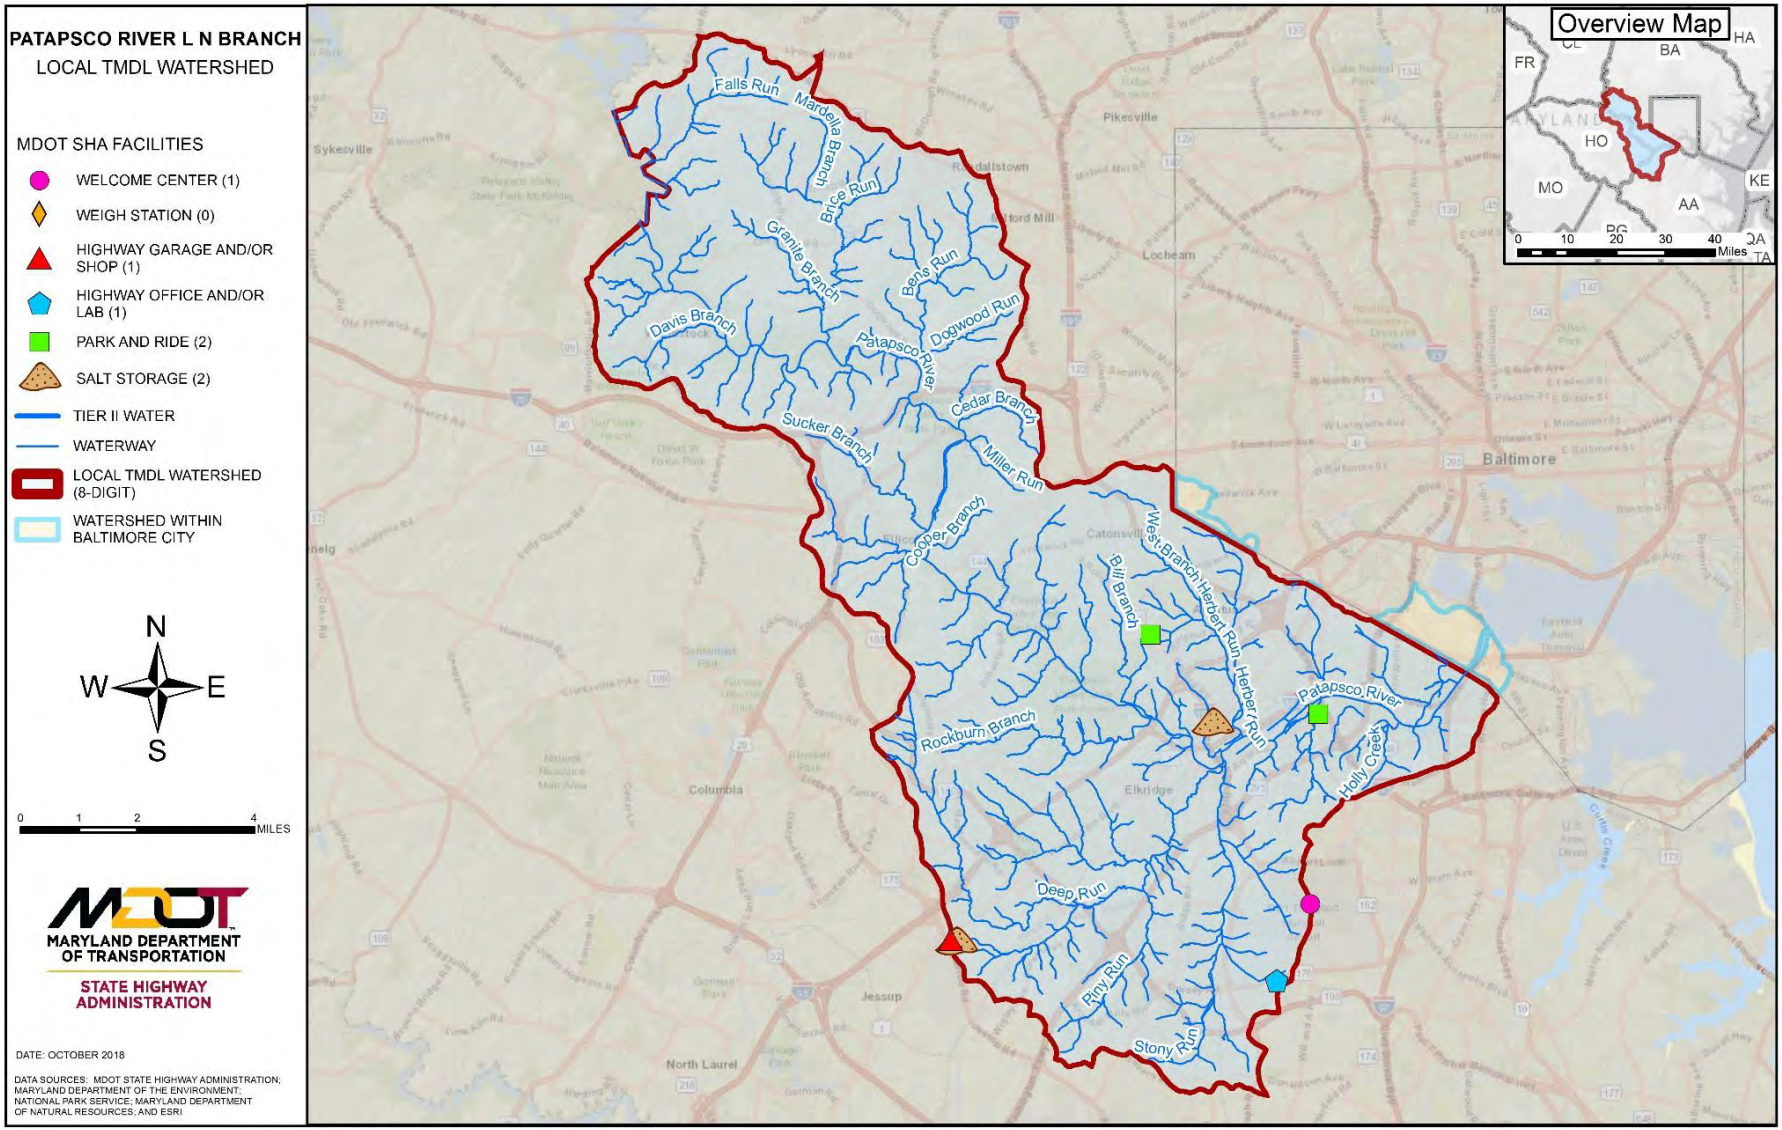


Figure 4-55: Patapsco River Lower North Branch Watershed

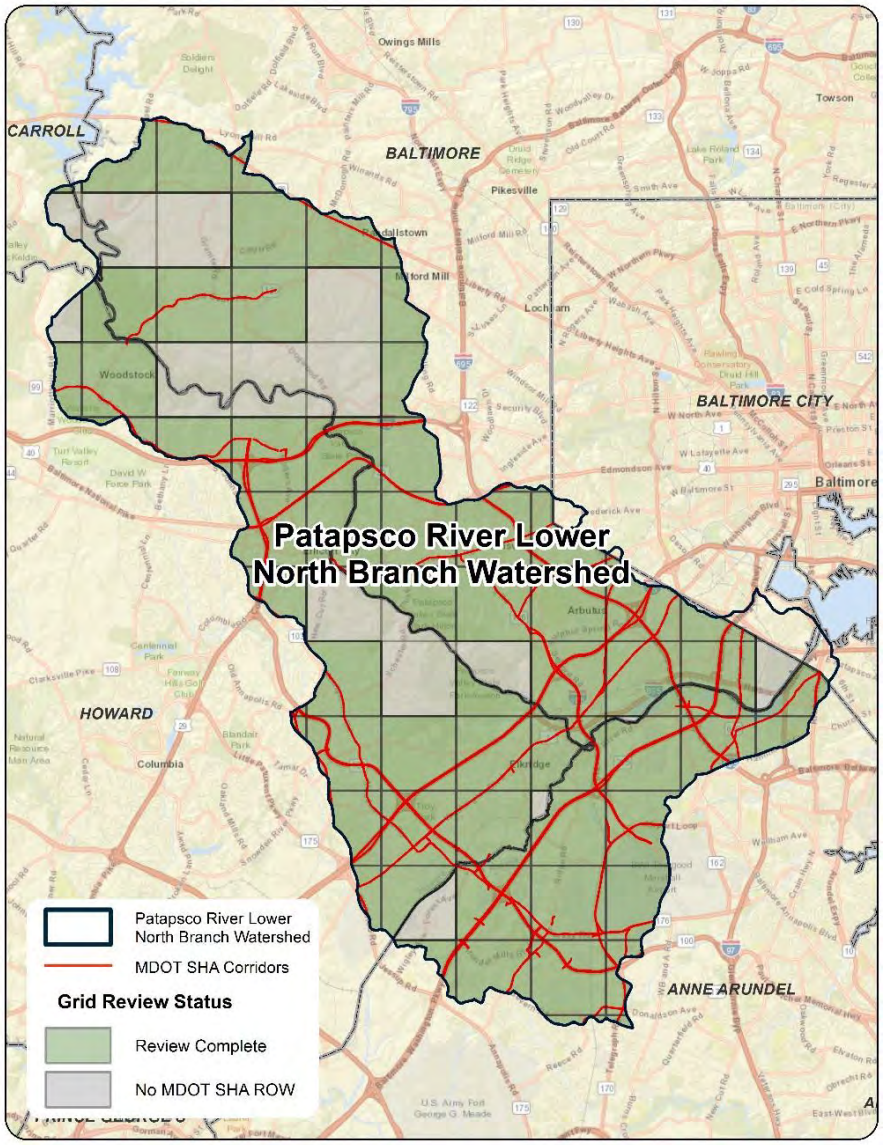


Figure 4-56: Patapsco River Lower North Branch Site Search Grids

S.4. Summary of County Assessment Review

Waters within the Patapsco River Lower North Branch watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- *Escherichia coli;*
- Sulfates; and
- TSS.

This summary reviews findings from Baltimore County's 2012 *Lower Patapsco River Small Watershed Action Plan* (Versar et al., 2012); Anne Arundel County's 2011 *Patapsco Non-Tidal Watershed Assessment Comprehensive Summary Report* (KCI/CH2M Hill, 2011); Carroll County's 2016 *Lower North Branch Patapsco River Watershed Characterization Plan* (CL-BRM, 2016d); and Howard County's 2012 *Tiber-Hudson & Plumtree Branch Stream Corridor Assessment* (S&S Planning and Design, 2012) and 2017 *Patapsco River South Branch and Lower North Branch Watershed Assessment* (KCI, 2017a). These reports discuss specific issues that contribute to overall watershed impairments and identify high priority restoration projects. The Patapsco River Lower North Branch 8-digit watershed currently has completed TMDLs for *E. coli* and sediment. The Patapsco River Lower North Branch also has Category 5 impairment listings (i.e., TMDL required) for sulfates and chlorides.

The Lower Patapsco River watershed, which is the lower portion of the Patapsco River Lower North Branch watershed that is located within Baltimore County, has 41.8% high/very highly erodible soils. Restoration assessments identified seven subwatersheds as "high" or "very high" priority for restoration. Patapsco River-A5, Herbert Run (E. Br.), and Herbert Run (W.Br.) received the highest scores and the prioritization category of "very high." Cooper Branch, Miller Branch, Dogwood Branch, and Cedar Branch received a priority categorization of "high." Surveys identified Soapstone Branch as a potential reference

stream for future restoration projects. Twenty-five existing detention ponds were identified for conversion potential (Versar et al., 2012).

The Patapsco Non-Tidal watershed, which is the lower portion of the Patapsco River Lower North Branch watershed that is located within Anne Arundel County, has 39.7 percent of the soils classified as highly erodible and 44.5 percent classified as potentially highly erodible. There were six subwatersheds that were given Habitat Scores in the "severely degraded" category: Unnamed Tributary (PN4), Patapsco Mainstem (PN5), Stoney Run 3 (PN8), Stoney Run 4 (PN9), Deep Run (PNA), and Deep Run (PNC). The Patapsco Mainstem (PN1) was identified as the subwatershed with the highest priority for restoration based on the Anne Arundel County's subwatershed restoration assessment. Deep Run (PNA) and the Patapsco Mainstem (PN5) were ranked as the highest priority for preservation within the watershed (KCI/CH2M Hill, 2011).

A very small portion (565 acres) of the Patapsco River Lower North Branch watershed is in Carroll County (CL-BRM, 2016d). Carroll County will use the findings from its *Lower North Branch Patapsco River Watershed Characterization Plan* to develop a Watershed Restoration Plan that will define the CL-BRM's goals for addressing environmental impacts within the watershed (CL-BRM, 2016d).

Howard County's *Tiber-Hudson & Plumtree Branch Stream Corridor Assessment* identified areas of concern in the Ellicott City watershed that were highly susceptible to erosion/flooding and recommended BMPs to improve conditions and downstream watershed health. Only the Tiber-Hudson was considered, as Plumtree Branch falls in the Little Patuxent drainage. In the Tiber-Hudson, there were 4 severe and 10 moderate erosion sites, 19 debris blockages, and 7 sites with bank erosion from channelization (S&S Planning and Design, 2012).

Howard County's assessment of the Patapsco River Lower North Branch within Howard County yielded 269 potential projects and 130 concept plans for the top-ranked opportunities (KCI, 2017a). **Table 4-75** shows the breakdown of the 130 concept plans by project type. (The complete set of concept plans is available within Appendix G of document [KCI, 2017a]).

Table 4-75: Number of Projects by Type Developed for Concept Plans in Howard County's Portion of the Patapsco River Lower North Branch Watershed

Project Type	Number of Concept Plans Developed
BMP Conversion	41
New BMP	12
Tree Planting	10
Outfall Stabilization	23
Stream Restoration	44
Total	**130**

Source: KCI (2017a)

S.5. MDOT SHA Pollutant Reduction Strategies

Patapsco River Lower North Branch is listed for both bacteria and sediment with each TMDL having a different baseline year; 2003 for bacteria and 2005 for sediment. Proposed practices to meet the bacteria reduction in the Patapsco River Lower North Branch watershed is shown in **Table 4-76**. Projected bacteria reductions using these practices are shown in **Table 3-2**. Four time frames are included in the table below:

- BMPs implemented before the baseline year. In this case, the bacteria baseline is 2003 and the sediment baseline is 2005;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the bacteria TMDL, MDOT SHA will meet 5.3 percent of the MDE 14.8 percent load reduction requirement through implementation of BMPs shown in **Table 4-76.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Antietam Creek watershed total $34,346,000. They are based on average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-78** for a summary of estimated BMP costs.

Figure 4-57 is a map of the MDOT SHA restoration practices and includes those that are under design or construction. Inlet cleaning and street sweeping are not shown.

Table 4-76: Patapsco River Lower North Branch Restoration Bacteria BMP Implementation

BMP	Unit	Baseline (Before 2003)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	515.8	24.3		TBD	540.1
Retrofit	drainage area acres		31.2		TBD	31.2
Load Reductions	E. coli billion MPN/yr.		1,829	1,829	34,276	
					Total Projected Reduction	**34,276**

Table 4-77: Patapsco River Lower North Branch Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	690.6	62.4	55.5	N/A	808.5
Retrofit	drainage area acres		31.2		N/A	31.2
Impervious Surface Removal	acres removed		0.2		N/A	0.2
Tree Planting	acres of tree planting		92.9	33.2	N/A	126.1
Stream Restoration	linear feet		5,056	17,266.5	N/A	22,322.5
Outfall Stabilization	linear feet		282.3	1,200	N/A	1,482.3
Inlet Cleaning[1]	dry tons		23.6		N/A	23.6
Street Sweeping[1]	acres swept		34.0		N/A	34.0
Load Reductions	TSS EOS lbs./yr.		309,836	1,161,879	0	
					Total Projected Reduction	**1,161,879**

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-78: Patapsco River Lower North Branch Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$7,551,000	$4,016,000	$11,567,000
Retrofits	$863,000		$863,000
Impervious Surface Elimination	$67,000		$67,000
Tree Planting	$2,843,000	$1,014,000	$3,857,000
Stream Restoration	$3,376,000	$11,530,000	$14,906,000
Outfall Stabilization	$556,000	$2,361,000	$2,917,000
Inlet cleaning	$108,000		$108,000
Street Sweeping	$61,000		$61,000
Total			$34,346,000

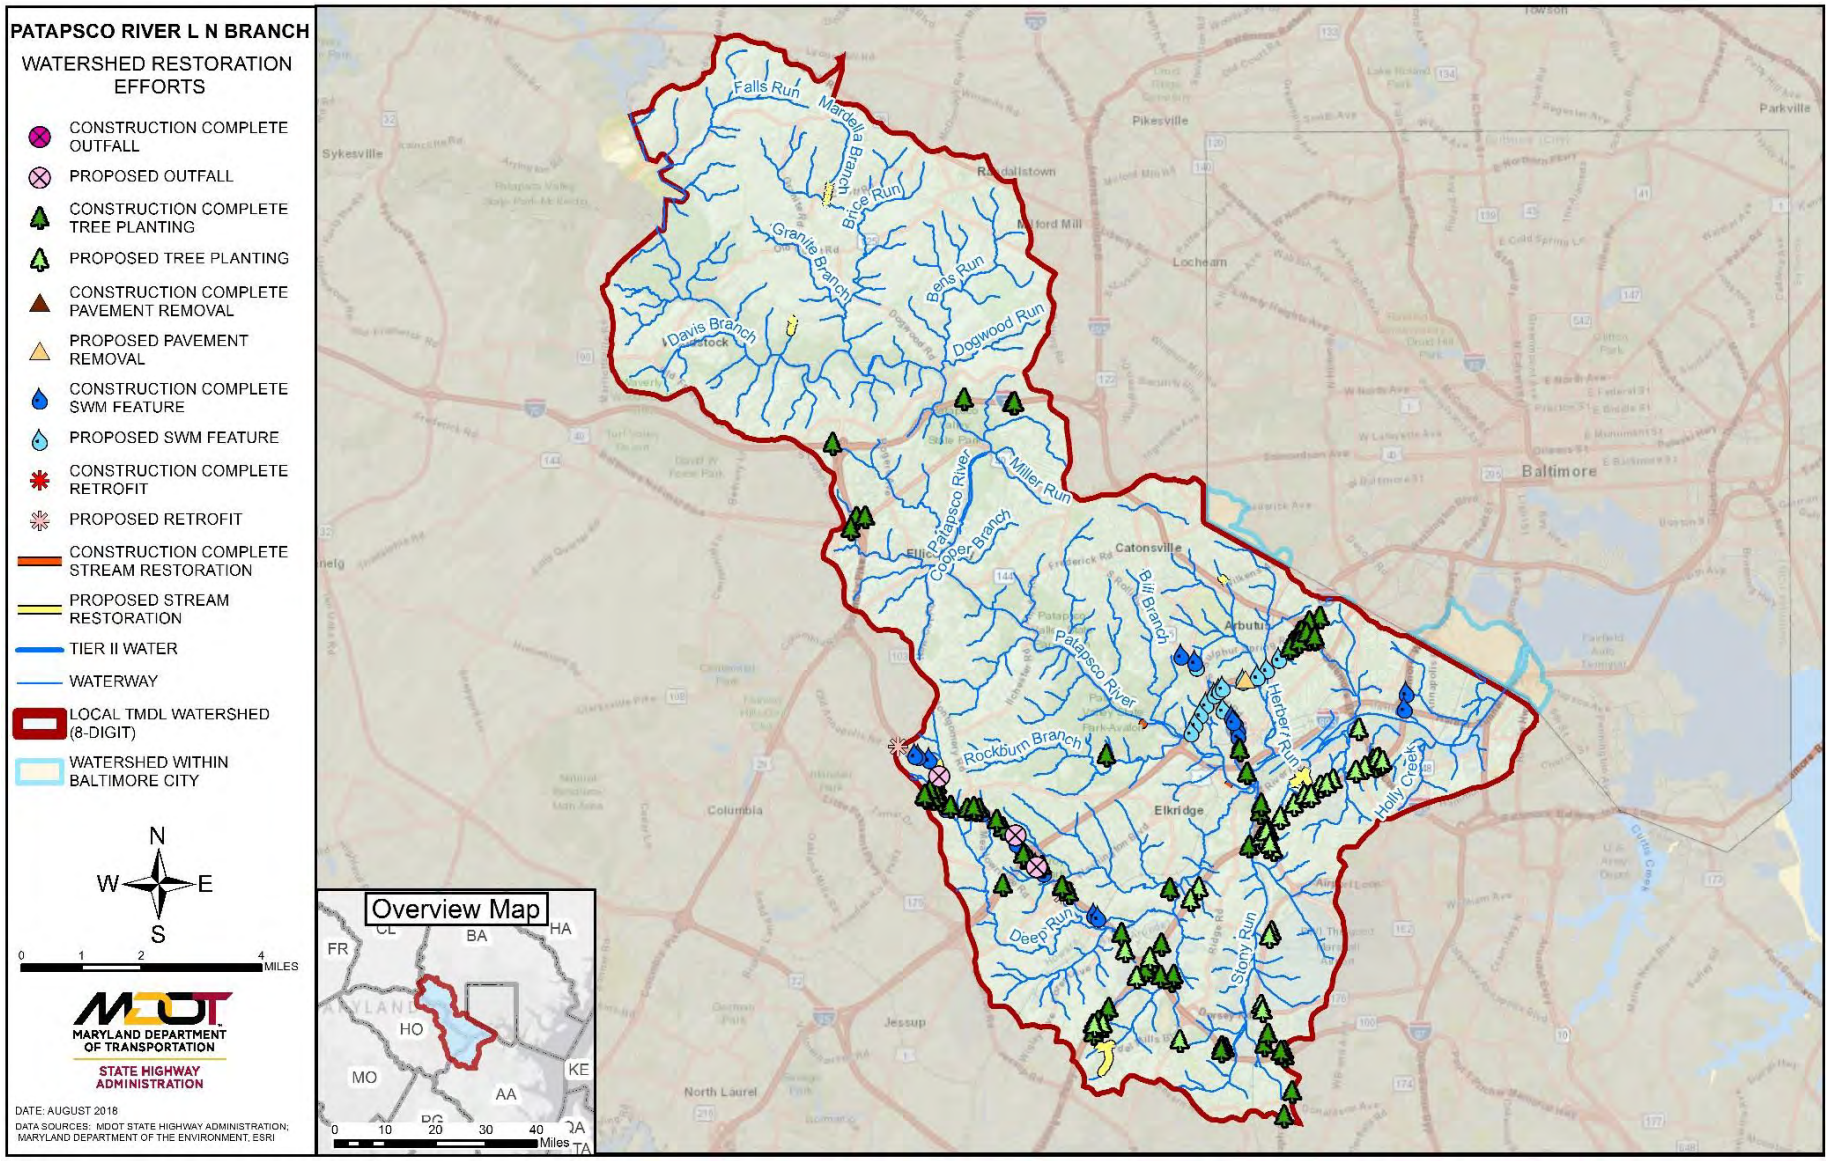


Figure 4-57: MDOT SHA Restoration Strategies within the Patapsco River Lower North Branch Watershed

T. PATUXENT RIVER SEGMENTSHEDS

T.1. Segmentsheds Description

Located in Maryland's Western Shore, the Patuxent River is a tributary of the Chesapeake Bay. The tidal portion of the Patuxent River is approximately 70 kilometers (43 miles) long and consists of three tidal segments: Mesohaline (PAXMH), Oligohaline (PAXOH), and Tidal Fresh (PAXTF). Together, the corresponding PAXMH, PAXOH, and PAXTF segmentsheds drain portions of eight Maryland Counties: Anne Arundel, Calvert, Charles, Frederick, Howard, Montgomery, Prince George's, and St. Mary's. In addition, several 8-digit watersheds are found within these three segmentsheds. PAXMF and PAXOH each contain a portion of the "Patuxent River Lower" 8-digit watershed (MD-02131101). PAXTF includes the following seven 8-digit watersheds: Brighton Dam (MD-02131108), Rocky Gorge Dam (MD-02131107), Middle Patuxent River (MD-02131106), Little Patuxent River (MD-02131105), Patuxent River Upper (MD-02131104), Western Branch (MD-02131103), and the Patuxent River Middle (MD-02131102). The PCB TMDL addressed in this plan (MDE, 2017a) includes the drainage area of the Western Branch Patuxent River Tidal Fresh (WBRTF) segment within the PAXTF boundary.

The designated use of the PAXMH, PAXOH, and PAXTF segments is Use Class II – Support of Estuarine and Marine Aquatic Life and Shellfish Harvesting (MDE, 2017a).

Waters within the PAXMH, PAXOH, and PAXTF segments are subject to the following impairments as noted on MDE's 303(d) List:

- PAXMH
  - Fecal Coliform;
  - Nitrogen (Total);
  - PCB in Fish Tissue;
  - Phosphorous (Total); and
  - TSS.

- PAXOH
  - Fecal Coliform;
  - Nitrogen (Total);
  - PCB in Fish Tissue;
  - Phosphorous (Total); and
  - TSS.

- PAXTF
  - Biochemical Oxygen Demand (BOD)
  - Chlorides;
  - *Escherichia coli*;
  - Fecal Coliform;
  - Mercury in Fish Tissue;
  - Nitrogen (Total);
  - PCB in Fish Tissue;
  - Phosphorus (Total);
  - Sedimentation/siltation;
  - Sulfates;
  - Temperature (water); and
  - TSS.

The PAXMH, PAXOH, and PAXTF segmentshed areas are approximately 182 square miles (116,480 acres), 115 square miles (73,600 acres), and 581 square miles (371,840 acres), respectively, for a total watershed area of 878 square miles (561,920 acres). Each segmentshed contains several small tributaries of the Patuxent River. PAXTF includes three major tributaries as well: the Little Patuxent River, the Middle Patuxent River, and the Western Branch.

There are 18.16 centerline miles of MDOT SHA roadway located within PAXMH. The associated ROW encompasses 203.45 acres, of which 82.53 acres are impervious. MDOT SHA facilities located within the

segmentshed consist of five (5) park and rides and one (1) salt storage facility.

There are 17.38 centerline miles of MDOT SHA roadway located within PAXOH. The associated ROW encompasses 131.66 acres, of which 64.47 acres are impervious. MDOT SHA facilities located within the segmentshed consist of one (1) highway garage or shop, one (1) park and ride, and (1) salt storage facilities.

There are 398.82 centerline miles of MDOT SHA roadway located within PAXTF. The associated ROW encompasses 9775.23 acres, of which 3712.54 acres are impervious. MDOT SHA facilities located within the segmentshed consist of two (2) welcome centers, three (3) weigh stations, five (5) highway garages or shops, 13 park and rides, and seven (7) salt storage facilities.

See **Figure 4-58** for a map of the MDOT SHA facilities located within the PAXMH, PAXOH, and PAXTF segmentsheds.

Figure 4-59 provides a close-up of the MDOT SHA facilities, the county boundaries, and the 8-digit watersheds within the PAXTF. Note that the Patuxent River follows the county boundary line between the counties from the top of the PAXTF downward towards the PAXOH.

T.2. MDOT SHA TMDLs within Patuxent Tidal Fresh Segmentshed

MDOT SHA is included in the PCB TMDL (MDE, 2017a). PCBs for PAXTF are to be reduced by 99.9 percent, as shown in **Table 3-2**. Because MDOT SHA does not have a reduction requirement in the PAXMH and PAXOH segmentsheds, **Section T.2.**, **Section T.3.**, and **Section T.4.** below only pertain to the PAXTF segmentshed.

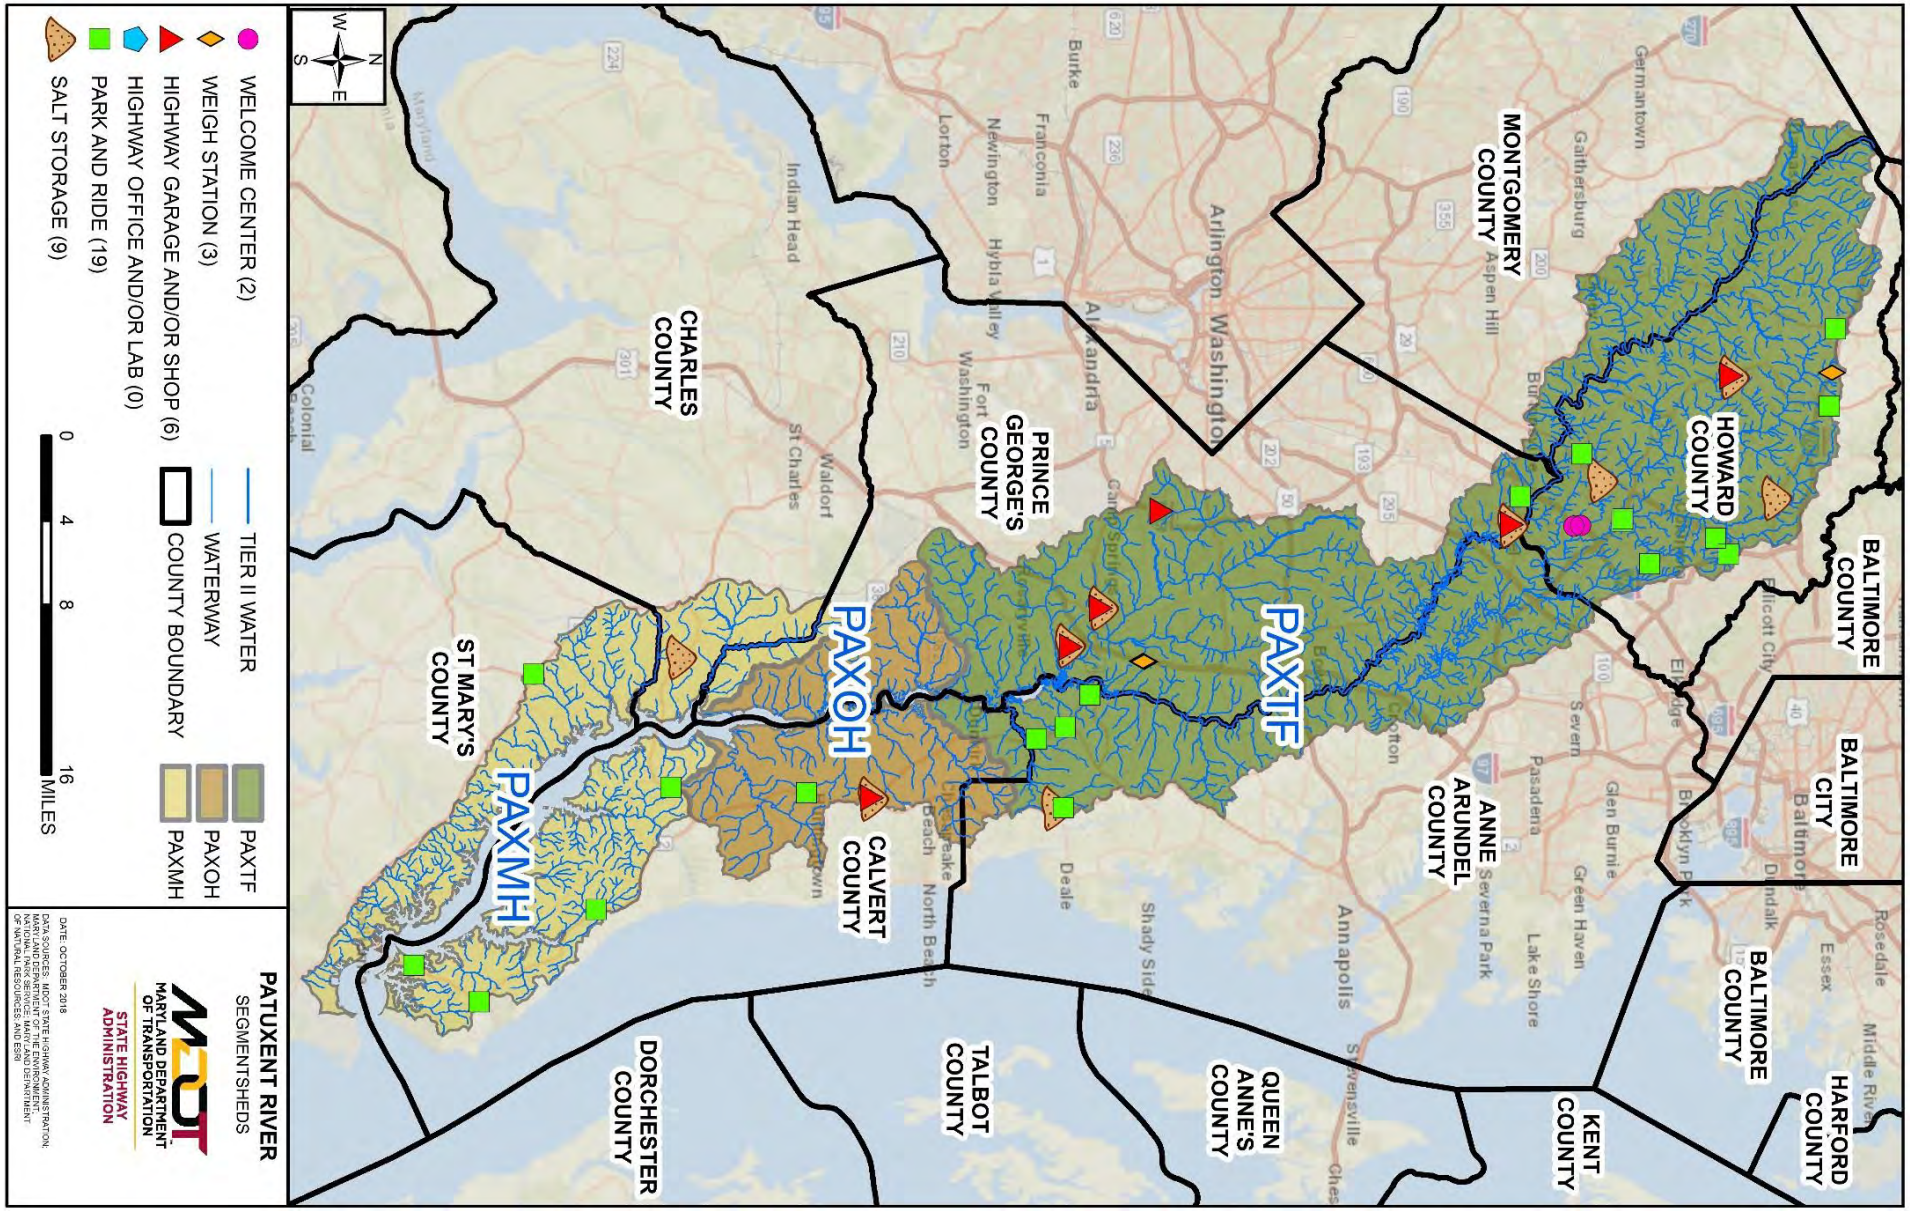


Figure 4-58: PAXMH, PAXOH, and PAXTF Segmentsheds

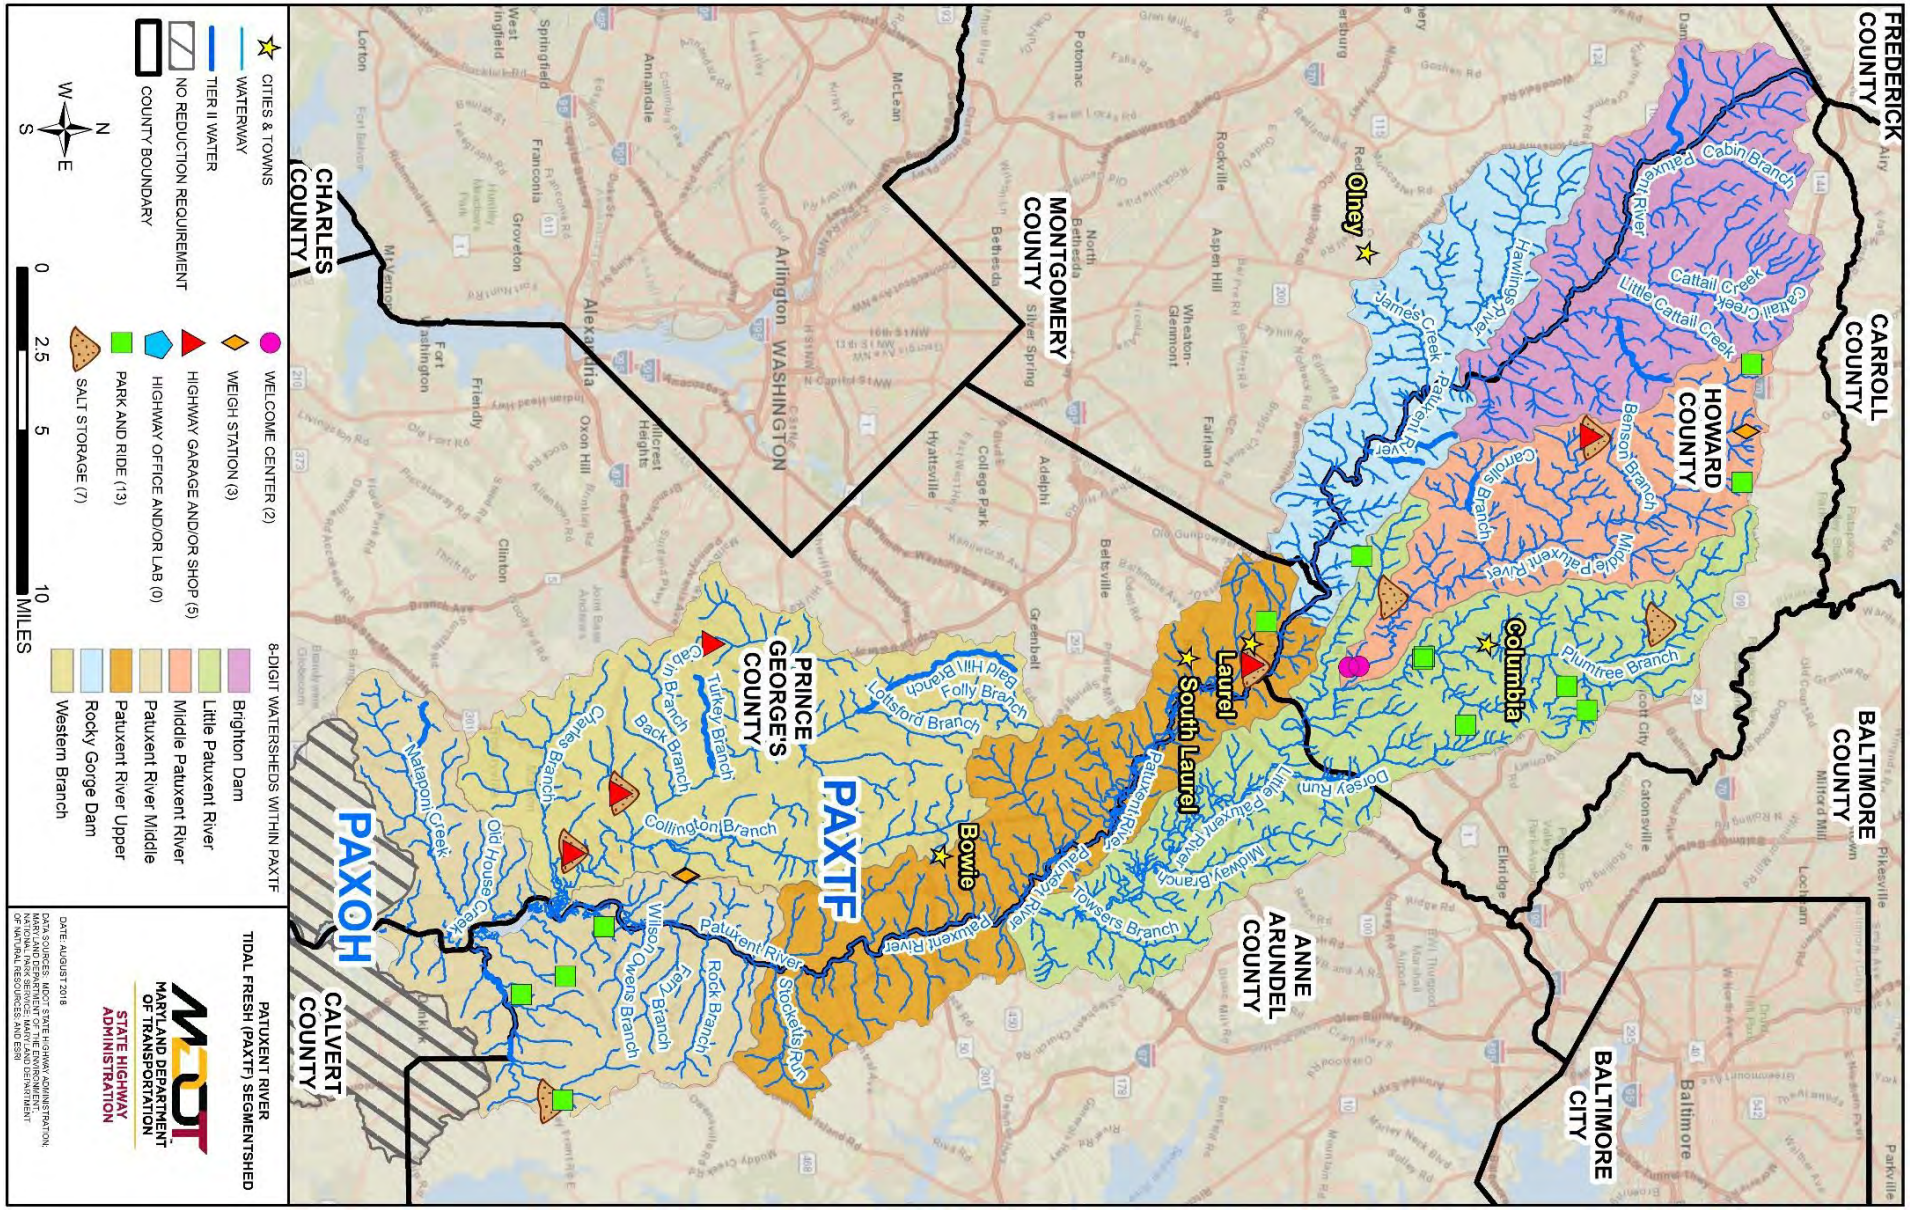


Figure 4-59: PAXTF Segmentshed

T.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Patuxent River Tidal Fresh segmentshed is shown in **Figure 4-60** which illustrates that 257 grid cells have been reviewed, encompassing portions of 76 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 1591 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 83 new structural SW controls constructed or under contract.
- 1010 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 498 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 778 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 224 sites constructed or under contract.
- 99 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 455 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 120 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Nine (9) sites constructed or under contract.
- 16 additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- 95 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 343 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 70 new structural SW controls constructed or under contract.
- 22 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 251 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 656 outfalls potential for stabilization. Further analysis of these sites resulted in:

- 15 outfall sites constructed or under contract.
- 26 outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- 615 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 119 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of 14 existing structural SW controls constructed or under contract.
- 29 retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 76 retrofit sites deemed not viable for retrofit and have been removed from consideration.

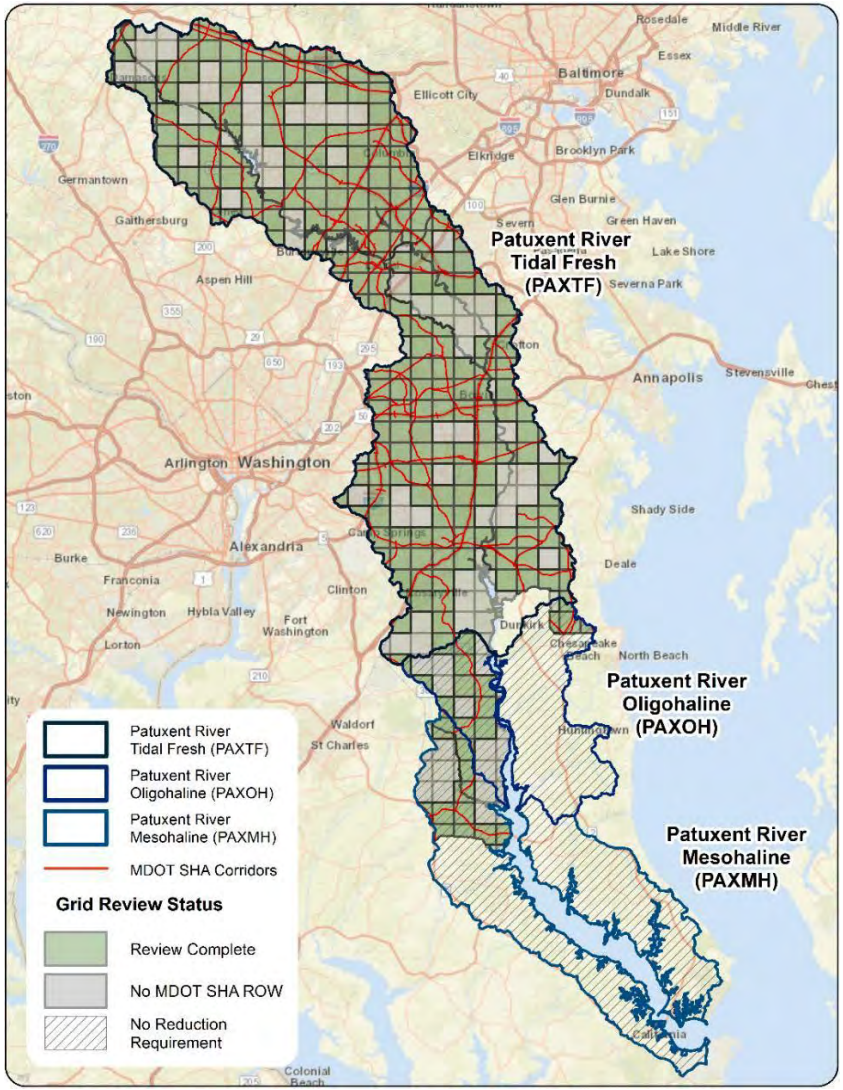


Figure 4-60: PAXMH, PAXOH, and PAXTF Segmentsheds Site Search Grids

T.4. Summary of County Assessment Review

As stated in **Section T.2.** above, MDOT SHA does not have a reduction requirement in the PAXMH and PAXOH segmentsheds; therefore, only the county watershed assessments that cover the PAXTF are summarized below. The following four Maryland counties contain 8-digit watersheds within the PAXTF: Montgomery, Howard, Anne Arundel, and Prince George's. (Note: While the PAXTF segmentshed does drain a very small portion of Frederick County, it is not a large enough area to be included in this section's county assessment summaries. In fact, the PCB TMDL states that "[n]o reduction was applied to the Frederick County portion of the NPDES regulated stormwater baseline load within the PAXTF tidal segment as it only accounts for a relatively small percentage of the total baseline load (0.01%) and is considered insignificant" (MDE, 2017a, p. 41).

Organized by county and their corresponding 8-digit watersheds, the assessments completed by the aforementioned four counties for the areas composing the PAXTF are summarized below. The summaries are best read while referring periodically back to **Figure 4-59**. This is because in addition to providing a close-up of the MDOT SHA facilities in the PAXTF, **Figure 4-59** was also labeled with the relevant cities and roads that serve as points of reference in the summaries.

Montgomery County Assessment

Brighton Dam and Rocky Gorge Dam (Montgomery County)

The 2012 *Patuxent Watershed Implementation Plan (including Pre-Assessment)* (Versar et al., 2012b)—hereinafter referred to as the "Montgomery County Plan"—serves as Montgomery County's assessment of the 8-digit Brighton Dam and Rocky Gorge Dam watershed portions within Montgomery County.

The Montgomery County portion of the Brighton Dam watershed (referred to in the Montgomery County Plan as the "Upper Patuxent River" subwatershed) is a 21-square-mile area located in the northern/northeastern region of the County. Land use within this portion of the watershed consists of rural lands (38 percent), forests (27 percent), and low density residential (23 percent). Streams within Montgomery County's portion of the Brighton Dam watershed are generally of high quality: the streams naturally support a healthy brown trout population with many of the streams serving as reference streams for the County's stream monitoring program (Versar et al., 2012b).

The Montgomery County portion of the Rocky Gorge Dam watershed (referred to in the Montgomery County Plan as the "Hawlings River" and the "Lower Patuxent River" subwatersheds) is a 39-square-mile area located in the northeastern/eastern region of the County. Land use within the Montgomery County portion of the Rocky Gorge Dam consists of medium (25 percent) and low (21 percent) density residential, forests (20 percent), and rural development (17 percent). Streams in the Montgomery County portion of the Rocky Gorge Dam watershed are subject to more impairment than the streams in the Montgomery County portion of the Brighton Dam watershed (Versar et al., 2012b).

The total impervious cover within Montgomery County's portions of Brighton Dam and Rocky Gorge Dam are 312 acres and 1,321 acres, respectively (Versar et al., 2012b). Major impervious elements include roads, parking lots, roofs, sidewalks, and paved courts. Of these various impervious cover types, roads and roofs make up the majority of the impervious surface (note: driveways were not included in the impervious cover calculations) (Versar et al., 2012b).

Currently, there are 173 structural stormwater BMPs in place within Montgomery County's Brighton Dam and Rocky Gorge Dam watersheds (Versar et al., 2012b). The great majority of these existing structural stormwater BMPs occur south of Reddy Branch surrounding the city of Olney (Versar et al., 2012b). The total drainage area treated is 1,298.8 acres, 336.5 of which are impervious acres (Versar et al., 2012b).

Applicable types of restoration practices being considered for future BMPs include new Environmental Site Design (ESD) retrofit practices (rainwater harvesting, upland reforestation, green roofs, etc.); ESD upgrades (retrofit ESD practices within existing publicly owned or privately owned stormwater infrastructure); voluntary ESD implementation (Low Impact Development [LID] practices installed as a result of County education and incentive programs [e.g., rainscape incentives offered in priority neighborhoods]); programmatic and operational practices (e.g., lawn care education); traditional retrofits (e.g., new ponds); credit for BMP maintenance upgrades; and riparian reforestation (Versar et al., 2012b).

Priority status for stormwater BMP retrofit projects are categorized as high, medium, or low priority. Low priority BMP projects include low scoring residential neighborhoods and golf courses. Medium priority projects include land-use types involving commercial/industrial, churches, private schools, apartments and condominiums (multi-family residential), townhouse units, and high and medium scoring residential neighborhood assessment areas. High priority projects are projects that modify existing BMPs that were permitted before 1986 (Versar et al., 2012b).

Current watershed restoration opportunities within the Montgomery County portion of the Brighton Dam watershed include an ESD (low priority) involving the Damascus Library. In the Montgomery County portion of the Rocky Gorge Dam watershed, there are several stream restoration opportunities (low priority), mostly along the Hawlings River and Reddy Branch. In addition, there is one ESD (high priority) opportunity at Longwood Community Center and two ESDs (low priority) opportunities at Ross Boddy Recreation Center near the city of Olney and at the Burtonsville Park and Ride. There are also several retrofit opportunities, including a retrofit (low priority) of the dry pond at the Sandy Spring Meadow community in Olney (Versar et al., 2012b).

Howard County Assessments

Brighton Dam, Rocky Gorge Dam, and Patuxent River Upper (Howard County)

The 2017 *Patuxent River: Brighton Dam, Rocky Gorge Dam, and Patuxent River Upper Watershed Assessment* (KCI, 2017b)—hereinafter referred to as the "2017 Howard County Assessment"—serves as Howard County's assessment of the 8-digit Brighton Dam, Rocky Gorge Dam, and Patuxent River Upper watershed portions within Howard County. The Howard County portion of the Brighton Dam watershed is a 57.7-square-mile area located in northwestern Howard County. The Howard County portion of the Rocky Gorge Dam watershed is a 12.5-square-mile area located in the southwestern region of the County. Lastly, the Howard County portion of the Patuxent River Upper watershed is a small, 2.7-square-mile area located in the southernmost region of the County (KCI, 2017b).

In Howard County, land use within the Brighton Dam, Rocky Gorge Dam, and Patuxent River Upper watersheds varies greatly. Primary land uses in Brighton Dam are split between agricultural, urban, and forest, while the Rocky Gorge Dam and Patuxent River Upper are primarily urban, followed by forest. The "urban" use in all three of these watersheds is predominantly residential. More specifically, land use within the Brighton Dam watershed is as follows: agricultural (37.5 percent), urban (34.5 percent), and forest (26.6 percent). Land use within the Rocky Gorge Dam watershed is urban (47.1 percent), agricultural (14.6 percent), and forest (34.1 percent); land use within the Patuxent River Upper watershed is urban (63.2 percent), agricultural (4.1 percent), and forest (27.7 percent) (KCI, 2017b).

All three watersheds are impaired with various pollutants, with completed TMDLs for *E. coli*, phosphorus, and sediment (KCI, 2017b).

The majority of soils within the Brighton Dam and Rocky Gorge Dam watersheds have moderate infiltration rates, while the Patuxent River

Upper watershed has a much larger proportion of soil groups with higher runoff potential and lower infiltration rates. Accordingly, in regard to the Patuxent River Upper watershed, the 2017 Howard County Assessment states: "[t]he low infiltration rates of these soils means that they are more susceptible to flooding and provide a poor porous medium for stormwater ponds and ESD opportunities, so opportunities should be considered carefully, using local-scale information" (KCI, 2017b, p. 16).

There are many existing BMPs (includes septic practices, tree planting, outfall stabilization, stream restoration, and stormwater structures) in each of watersheds. According to the 2017 Howard County Assessment, Brighton Dam, Rocky Gorge Dam, and Patuxent River Upper have 800, 303, and 134 BMPs, respectively. The corresponding acres that these BMPs treat in Brighton Dam, Rocky Gorge Dam, and Patuxent River Upper are 390.0 acres (0.6 square miles), 108.5 acres (0.2 square miles), and 86.1 acres (0.1 square miles), respectively (KCI, 2017b).

In order to further treat the three watersheds, the 2017 Howard County Assessment examined five types of potential retrofit and restoration opportunities: (1) BMP conversions, (2) new BMPs, (3) tree planting, (4) stream restoration, and (5) outfall stabilization (KCI, 2017b). **Table 4-79** presents the examples provided by Howard County under each category. Both field site selections and desktop analyses were used to identify areas for BMP retrofit or restoration within each watershed.

Of the 123 potential project site recommendations across the three watersheds, 35 project concept plans for the top-ranked projects have been developed. The approved concept plans include 6 BMP conversions, 8 new BMPs, 3 tree plantings, 14 stream restorations, and 4 outfall stabilizations projects.

The concept plans provide the location of the project, current site conditions, implementation information, potential impervious treatment or pollution reduction credits, and a cost estimate. (The complete set of concept plans is available in Appendix G of the 2017 Howard County Assessment [KCI, 2017b]).

Middle Patuxent River (Howard County)

The 2015 *Middle Patuxent River Watershed Assessment* (Versar, 2015b)—hereinafter referred to as the "2015 Howard County Middle Patuxent Assessment"—serves as Howard County's assessment of the 8-digit Middle Patuxent River watershed. Located entirely within Howard County, the Middle Patuxent River watershed is the only other 8-digit watershed besides the Western Branch (entirely in Prince George's County) in the PAXTF that does not cross over into another county or counties.

The Middle Patuxent River watershed is a 58-square-mile area located in central Howard County. Land use within the Middle River Patuxent watershed is as follows: agricultural (33.7 percent), residential (33.1 percent), and forest (26.7 percent) (Versar, 2015b).

Impervious surface cover was used to assess urban impacts to streams within the Middle Patuxent River watershed. According to Howard County's impervious cover data, 9.9 percent of the watershed is impacted by impervious surfaces (Versar, 2015b). A 9.9 percent impervious cover indicates that streams in the watershed are sensitive to becoming degraded. BMPs treat approximately 40 percent of the impervious surfaces in the Middle Patuxent River watershed (Versar, 2015b).

Soil conditions help determine water quantity and quality aspects of streams and rivers. Most soils in the Middle Patuxent River watershed fall into the U.S. Department of Agriculture Group B. Group B soils are loam and silt loam types with moderate infiltration and water transmission rates. Consequently, Group B soils provide good opportunities for stormwater management ponds as well as ESD. The southeastern portion of the watershed; however, features Group D soils.

Group D soils are poorly drained and need careful consideration regarding stormwater management (Versar, 2015b).

Biological monitoring conducted by the DNR Maryland Biological Stream Survey (MBSS) was used to assess stream health in the Middle Patuxent River watershed. The rating categories included Good, Fair, Poor, and Very Poor. The results indicated that 24 percent of the sites assessed were in Good condition, 46 percent were in Fair condition, 19 percent were Poor, and 12 percent were Very Poor. More sites in the Good condition were found in the upper portion of the Middle Patuxent River watershed, while the middle and the lower portion of the watershed had a relatively even distribution of stream conditions (Versar, 2015b). In addition, Howard County also evaluated the watershed's stream habitat condition by using the EPA's RBP. Monitoring results indicated that many of the streams within the Middle Patuxent River watershed are experiencing some level of habitat degradation (Versar, 2015b).

Table 4-79 shows examples of the following five categories of BMPs that Howard County considers to be major strategies towards addressing the County's Bay TMDL and NPDES MS4 permit requirements: (1) BMP conversions, (2) proposed new BMPs, (3) tree planting, (4) stream restoration, and (5) outfall stabilization (Versar, 2015b).

Howard County's overall (applicable across all project types) recommendations for restoration/preservation projects within the Middle Patuxent River watershed were based on the consideration of four pre-developed categories. The first consideration is "permit contribution," i.e., to what degree a project will help meet the County's NPDES MS4 requirements for pollution reduction and impervious surface treatment. The second consideration is "biological uplift," i.e., whether a project will provide additional biological uplift benefits such as the protection of wetlands. The third category—"programmatic benefit"—considers whether a project would have value beyond its primary purpose such as serving as a visible demonstration project or providing public education. The fourth and final category is "feasibility," i.e., the feasibility of project implementation. This includes whether the project site is privately or publicly owned, the accessibility of the site, and whether a repair is already required at the site (would minimize costs by upgrading the facility during the course of other required repairs) (Versar, 2015b).

Out of the 193 potential projects that the County identified and ranked, four-page concept plans were produced for each of the 39 top-ranked opportunities. (The complete set of concept plans is available in Appendix H of the 2015 Howard County Middle Patuxent Assessment [Versar, 2015b]). Overall, of the five recommended project types shown in **Table 4-79**, the 39 concept plans consisted of: 5 BMP conversions, 0 new BMPs, 13 tree plantings, 15 stream restoration projects, and 6 outfall stabilizations (Versar, 2015b).

Little Patuxent River (Howard County)

On behalf of the Howard County Department of Public Works, Versar completed the 2015 *Little Patuxent River Watershed Assessment* (Versar, 2015a)—hereinafter referred to as the "2015 Howard County Little Patuxent Assessment."

In 2014-2015, Howard County's Stormwater Management Division conducted an assessment of the Little Patuxent River watershed within Howard County in order to assess current conditions and recommend watershed restoration opportunities. As a result of the assessment, the project team recommended several opportunities including upgrades to existing stormwater BMPs, new BMPs, tree plantings, stream restoration, and stabilization of stormwater outfalls. Overall, this assessment yielded 760 potential projects and concept plans for 109 of the top-ranked opportunities identified (Versar, 2015a).

The portion of the Little Patuxent River watershed within Howard County drains 59 square miles (37,760 acres). The predominant land use is residential (41.0 percent). This is followed by commercial-industrial-institutional (18.6 percent), which occurs mostly in the southern half of

the watershed. Forested areas (21.1 percent) occur mostly along the watershed's stream corridors and the Little Patuxent River mainstem. The watershed includes 9,043 acres of woods and 190 miles of streams (Versar, 2015c). More residential and commercial development is expected to take place in the future, especially around the planned community of Columbia (Versar, 2015a).

About 25.6 percent of the Little Patuxent River watershed within Howard County contains impervious cover; at this percentage, stream degradation is readily observed. As of 2015, there are 1,746 existing stormwater BMPs treating approximately 47 percent of this impervious area. The impervious cover includes roads, parking lots, driveways, major buildings, bridge decks, sidewalks, pathways, and swimming pools (Versar 2015a). Overall, the majority of the soils located in the watershed have high runoff potential; however, some upper parts (around Hammond Branch, for example) predominantly contain soils that have well to moderately well drained soils.

Stream conditions in Howard County's Little Patuxent River watershed were also assessed. While some sites were in Good condition in the upper parts of the watershed (including the upper reaches of Hammond Branch), most sites in the lower part of the watershed (including Dorsey Run) were in Poor to Very Poor condition (Versar, 2015a). In addition, stream habitat conditions were also evaluated. The results indicated that many streams in the Little Patuxent River watershed have been affected by habitat degradation (Versar, 2015a). This degradation, however, was more prevalent in the heavily developed urban areas. Consequently, conditions are generally better in the more rural parts of the County; however, stream degradation can still occur in the rural areas due to large lot development and nearby agricultural activities (Versar, 2015a).

For future treatment, the following five restoration opportunity types were considered: (1) BMP conversions, (2) proposed new BMPs, (3) tree planting, (4) stream restoration, and (5) outfall stabilization. Candidate project sites were identified that would benefit from these five restoration strategies (Versar, 2015a). **Table 4-79** presents the examples provided by Howard County under each category.

The County utilized and collected GIS data as the first step towards identifying candidate retrofit and restoration sites for further investigation in the field. Initially selected candidate sites were reviewed by Howard County staff to finalize the list of field sites to be visited. Ultimately, 530 sites and 50 stream miles were selected for field investigation, and another 72 sites previously assessed in other studies were scheduled for desktop assessments (Versar, 2015a).

Ranking criteria were developed according to the same four categories described in the previous summary of the 2015 Howard County Middle Patuxent Assessment: permit contribution, biological uplift, programmatic benefit, and feasibility (Versar, 2015a). In addition, a two-part, standardized method was developed for ranking and prioritizing the identified project opportunities. Each project was first ranked against all other projects of the same type. Then, all projects were pooled together and ranked against one another to enable ranking across project type and to determine which projects should be taken to the next design phase (Versar, 2015a).

Out of the 760 potential projects identified, ranking scores were used to select the 109 highest-ranked projects for concept plan development. (The complete set of concept plans is available in Appendix H of the 2015 Howard County Little Patuxent Assessment [Versar, 2015c]). Overall, of the aforementioned five restoration opportunity types, the 109 concept plans consisted of the following: 15 BMP conversions, 10 new BMPs, 19 tree plantings, 45 stream restorations, and 20 outfall stabilizations (Versar, 2015a).

Additional reductions could also be accomplished by activities such as street sweeping; erosion/sediment control; and public outreach efforts such as watershed trash cleanup campaigns, conservation landscaping, and pet waste education. Over the next several years, the County may

add these types of activities as needed to meet TMDL goals (Versar, 2015a).

Table 4-79: Howard County Suggested BMPs within the Howard County Portions of the PAXTF
BMP Conversions
• Extended detention wet ponds/wetlands, shallow wetlands • Bioretention • Non-bioretention filtering practices • Infiltration practices • Swales • Addition of pre-treatment or post-treatment BMPs within existing dry or wet pond boundaries • New BMP retrofits outside of existing dry or wet pond boundaries but which would drain into an existing pond or capture and treat stormwater just outside of the existing pond (e.g., step pool conveyance)
New BMPs
• Extended detention wet ponds/wetlands, shallow wetlands • Bioretention • Non-bioretention filtering practices • Infiltration practices • Swales • Green roofs • Replacement of impervious cover with pervious pavement • Impervious cover removal • Rain barrels • Rain gardens • Rooftop disconnection
Tree Planting
• Reforestation of stream buffers • Reforestation of upland areas
Stream Restoration (restoring degraded stream channels for erosion control and enhanced nutrient processing)
Outfall Stabilization
• Rip Rap stabilization • Step Pool Conveyance (SPSC)/Regenerative Stormwater Conveyance (RSC) stabilization • Installing a drop structure or other stabilization of the outfall channel
Sources: KCI (2017b); Versar (2015a); and Versar (2015b)

Anne Arundel County Assessments

Little Patuxent River (Anne Arundel County)

In 2016, the Anne Arundel County Department of Public Works completed the *Little Patuxent Watershed Assessment Comprehensive Summary Report* (LimnoTech & Versar, 2016)—hereinafter referred to as the "2016 Report." For assessment purposes, the Little Patuxent River watershed was broken up into 21 subwatersheds. Each subwatershed was given a name to match the geographic area (stream or landmark) and assigned a number if there were multiple subwatersheds related to that geographic area (e.g., Dorsey Run 1, Dorsey Run 2, etc.) as well as a three-digit code beginning with "LP" for Lower Patuxent. Ten of the subwatersheds codes were given numbers: LP0 – LP9; the rest were given letters: LPA – LPK. For simplicity, the names, not codes, of the 21 subwatersheds are referenced in this summary.

There are a variety of jurisdictions in the watershed, including Fort Meade, the Patuxent Research Refuge, and the Maryland Sunrise Farm (formerly the U.S. Naval Academy Dairy Farm). In addition to the Little Patuxent River, major streams in Anne Arundel County's portion of the Little Patuxent River watershed include Dorsey Run, Rogue Harbor Branch, and Towsers Branch. Several major roads also traverse the watershed: MD 32, I-95, I-295 (Baltimore-Washington Parkway), MD 175 (Jessup Road), Piney Orchard Parkway, MD 3, MD 198, MD 50, MD 301 and MD 424. The watershed also contains the Crofton County (or Golf) Club in its southernmost portion.

The watershed has many sensitive environmental features such as wetlands and greenways. The majority of wetlands are located along the Little Patuxent River. With the exception of Fort Meade, greenways are located throughout the watershed. Forest (approximately 45.9 percent) makes up the biggest portion of land cover in the watershed. The largest land ownership types are "Natural Lands within County jurisdiction," the U.S. Department of Defense (Fort Meade), and the U.S. Fish and Wildlife Service (Patuxent Research Refuge). Of the property owned by the County, the private high density residential and County roads/facilities constitute the largest impervious areas. According to the 2016 Report, MDOT SHA owns about 387.9 acres in Anne Arundel County's portion of the Little Patuxent River watershed. Of the 387.9 acres, 159.5 acres are impervious (41 percent).

The fastest development in the watershed occurred in the Crofton Golf subwatershed from 1960 through 1979. In the 2000-2015 time period, the "Towsers Branch 3" subwatershed experienced the highest rate of new development (Towsers Branch is located in the most southern portion of the watershed near MD 3.)

Approximately 38 percent (majority) of the soils in the Little Patuxent watershed are classified as hydrologic soil Group C. Group C soils have a moderately high runoff potential when thoroughly wet and water transmission through the soil is somewhat restricted. The most common (47 percent) soil erodibility class present in the Little Patuxent River watershed is "potentially highly erodible land" (LimnoTech & Versar, 2016).

Based on the calculated Maryland Physical Habitat Index (MPHI) score, each stream reach was assigned a condition category of Severely Degraded, Degraded, Partially Degraded, or Minimally Degraded. Standard MPHI category breakpoints used by the DNR are as follows:

- 0 to 50.9 – Severely Degraded
- 51.0 to 65.9 – Degraded
- 66.0 to 80.9 – Partially Degraded
- 81.0 to 100 – Minimally Degraded

The 2016 Report states that the average stream-weighted MPHI score for the Little Patuxent River watershed is 79.3, which corresponds to the "Partially Degraded" condition. Riparian buffer impacts and erosion had the highest total cumulative impact score of all the inventoried features.

Riparian buffer impacts were mostly due to encroachment from residential lawns (LimnoTech & Versar, 2016).

The County has also selected several different types of restoration strategies. The County's selection criteria for restoration projects includes the cost effectiveness relative to the quantity of pollutant removed, maintenance needs, life expectancy, and public acceptance of the proposed project (LimnoTech & Versar, 2016).

The County's strategy is broken down into three primary categories:

- **Core Strategies** – Generally large capital improvement projects that represent the bulk of the load reductions and capital expenditures. Goals include obtaining compliance with WQSs and restoring stream stability, connectivity with floodplains, biological health.
- **Core Tier II Strategies** – Generally smaller scale capital projects or programmatic strategies collectively intended to close the County's gap on achieving its final 2025 required nutrient load reductions.
- **Potential Load Reductions Outside of the Core Strategy WIP Areas** – Credits that may be achieved from installation of stormwater management practices on private property as a result of potential future implementation of a County stormwater utility fee and associated credit program (LimnoTech & Versar, 2016).

The following represent the Core Strategies that will be employed in the Little Patuxent River watershed:

- Outfall Retrofits;
- Stormwater Pond Retrofits;
- Stream Restoration; and
- Programmed Projects (Programmed environmental restoration projects to be implemented by the County, including outfall retrofits, stream restorations, and BMP retrofits.)

The following represent the Core Tier II Strategies that will be employed in the Little Patuxent River watershed:

- Street Sweeping;
- Inlet Cleaning;
- Public Land Reforestation; and
- Stormwater to the MEP (This strategy includes retrofitting existing impervious surfaces to the MEP with stormwater management practices, including but not limited to green roofs, permeable pavement, bioretention, and downspout disconnection. The 2016 Report states that these retrofits will be limited to County-owned properties including the County's Board of Education and Recreation and Park facilities (LimnoTech & Versar, 2016).

For the third category strategy, "Potential Load Reductions Outside of the Core Strategy WIP Areas," the County assumes that these credits are limited to areas outside of existing areas covered by the Core Strategies and Core Tier II Strategies. Therefore, the following two broad types of restoration activities were considered in this category (LimnoTech & Versar, 2016):

- Private Commercial/Industrial Stormwater Management (credit accounts for stormwater management retrofits to private commercial and industrial properties)
- Private Residential Stormwater Management (credit accounts for retrofitting rooftops in high density residential areas with practices such as rain water harvesting or rain gardens)

Patuxent River Upper (Anne Arundel County)

On behalf of the Anne Arundel County Department of Public Works, LimnoTech completed the *Upper Patuxent River Watershed Overall Summary Recommendation Report* in September of 2008 (LimnoTech, 2008)—hereinafter referred to as the "Recommendation Report." The Recommendation Report explains that Anne Arundel County's portion

of the Patuxent River Upper watershed is divided into 19 subwatersheds, named UP1 – UP9 and UPA – UPJ. The watershed was also split into northern and southern sections near where MD 3 intersects the watershed. The northern section contained UP1 – UP7; the southern section consisted of UP8, UP9, and UPA – UPJ.

According to the Recommendation Report, the entire portion of the Patuxent River Upper watershed within Anne Arundel County drains 22,500 acres, with impervious land cover comprising approximately 14 percent of the watershed as a whole. Land use, however, was assessed separately for the northern and southern sections of the watershed. In the northern section, the predominant land use was forest (76 percent), followed by residential (7 percent). Only 1 percent of the northern section is used for agriculture. In the southern section, the predominant land use was also forest (43 percent), followed by residential (22 percent). Agriculture was the third most common land use, making up 19 percent of the southern section.

The Recommendation Report used three methods to assess restoration and preservation potential within the watershed: a stream restoration assessment, a subwatershed restoration assessment, and a subwatershed preservation assessment. As part of these assessments, chemical and physical data were collected, and various GIS layers were updated.

The assessed stream reaches were placed into one of four categories: Good, Fair, Poor, and Very Poor. The stream reaches in the Patuxent River Upper watershed were predominantly Good to Fair on the rating scale. The full results of the stream restoration assessment are provided in the Recommendation Report (see “Table 2” on p. 7 of LimnoTech [2008]).

The subwatershed restoration assessment was intended to identify subwatersheds where conditions warranted restoration activities on a large scale, such as BMP retrofitting. Likewise, the subwatershed preservation assessment was intended to identify subwatersheds where conditions warranted consideration for preservation activities.

The subwatersheds were placed into one of four categories based on the results of the restoration and preservation assessments: Good, Fair, Poor, and Very Poor. For the subwatershed restoration assessment, subwatersheds UP2 (in northern section near the city of Laurel) and UPB (in southern section directly below MD 50/MD 301) were both rated Very Poor and were therefore the highest priority for restoration. For the subwatershed preservation assessment, subwatersheds UP1, UP6, and UP7 (UP1 and UP6 are in the northern section near the city of South Laurel; UP7 is the southernmost subwatershed in the northern section, extending down to where the northern section becomes the southern section near MD 3) were rated as Good and were therefore the best candidates for preservation. The full list of restoration and preservation rankings results can be found in the Recommendation Report (see “Table 4” and “Table 6” on p. 9 and p. 10, respectively, of LimnoTech [2008]).

Known impairments of the County’s portion of the Patuxent River Upper watershed include nutrients and sediments. Therefore, the Recommendation Report also conducted water quality modeling to better understand the potential for future water quality improvements. Existing and future development scenarios were modeled that included assumptions for impervious cover, stormwater management, and septic loading. For each scenario, BMP pollutant removal efficiencies and event mean concentration (EMC) values for the different land cover types were used to predict pollutant loading for a set of water quality parameters. These parameters included total nitrogen, total phosphorus, nitrates, fecal coliform, TSS, and metals. Loading determinations were made for the typical TMDL categories (urban, agricultural, and other) and were calculated separately with and without BMPs or ESD retrofits.

Two existing conditions scenarios were modeled: with fully maintained BMPs, and with failed urban BMPs. Eighteen different future condition

scenarios were also modeled. Examples of conditions used in the future models included with or without various BMP implementation and maintenance, septic upgrades, implementation of the Sewer Master Plan, and varying levels of ESD retrofits, to name a few.

For some subwatersheds and water quality parameters, all current and future development scenarios met County loading goals. For other subwatersheds and water quality parameters, none of the scenarios met loading goals. The Recommendation Report generally concluded that ESD retrofits in County right-of-ways and select private lands provide the best opportunity for pollutant reduction.

Patuxent River Middle (Anne Arundel County)

In June 2018, KCI and Coastal Resources completed the *Herring Bay, Middle Patuxent, and Lower Patuxent Watershed Assessment Comprehensive Summary Report* (KCI & Coastal Resources, 2018) (hereinafter referred to as the "2018 Report"). The 2018 Report serves as Anne Arundel County's assessment of the 8-digit Patuxent River Middle watershed portion within Anne Arundel County (referred to as the "Middle Patuxent" watershed in the 2018 Report).

For the 2018 Report, the Anne Arundel County portion of the Patuxent River Middle watershed, which is located in the southern portion of the County, was divided into 33 subwatersheds. Each subwatershed was given a name to match the surrounding geographic area (stream or landmark) and assigned a number if there were multiple subwatersheds related to that geographic area (e.g., Rock Branch 1, Rock Branch 2, etc.) as well as a three-digit code beginning with "MP" for Middle Patuxent. Ten of the subwatersheds were given numbers: MP0 – MP9; the rest were given letters: MPA, MPB, MPD – W, and MPZ. While not discussed in this summary, MPC, MPX, and MPY are three subwatersheds that are in the Patuxent River Lower watershed that were in grouped in with the Patuxent River Middle watershed for analysis and reporting in the 2018 Report. For simplicity, the names, not codes, of the 33 subwatersheds are used in this summary.

The Anne Arundel County portion of the Patuxent River Middle watershed is approximately 29,820 acres in area in the southern portion of the County. The watershed includes several named streams including Rock Branch, Wilson Owens Branch, Lyons Creek, Cabin Branch, Galloway Creek, and the middle branch of the Patuxent River.

In the Patuxent River Middle, the fastest development occurred in the Galloway Creek subwatershed between 1920 and 1999. Development is expected to continue to occur. The majority of future residential development will likely take place in and around the Wilson Owens Branch and Galloway Creek subwatersheds.

Impairments in the Patuxent River Middle watershed include nitrogen, phosphorus, TSS, and most recently, PCBs addressed by the PCB TMDL (MDE, 2017a).

The stormwater BMPs in the Patuxent River Middle watershed are typically owned by private land owners, the County, or other State agencies, such as the MDOT SHA. While the majority of BMPs in the watershed are privately owned, the MDOT SHA-owned BMPs account for about half of the managed drainage areas within the Patuxent River Middle watershed within Anne Arundel County (KCI & Coastal Resources, 2018). Examples of privately owned BMPs include small bioretention cells and ESD facilities such as rain gardens and downspout disconnection.

Four types of assessments were conducted for the Patuxent River Middle watershed in Anne Arundel County: stream restoration, subwatershed restoration, subwatershed preservation, and parcel scale. All four types of assessments utilized a prioritization rating scale of High, Medium High, Medium, or Low.

Results of the stream restoration showed that when compared with all of the major watersheds in Anne Arundel County, the Patuxent River Middle watershed has relatively few stream reaches rated High for restoration, with most of the reaches falling in the Medium and Low category. The "Lyons Creek 10" subwatershed had the most stream reaches in the High category with four reaches rated as High priority for restoration.

The subwatershed restoration assessment used a suite of indicator ratings that were weighed and combined to obtain a single restoration rating for each subwatershed. The indicators were grouped into one of seven categories: stream ecology, 303(d) list, septics, BMPs, H&H, water quality, and landscape. In the Patuxent River Middle watershed, only 4 subwatersheds out of the 33 subwatersheds received a rating of High for restoration priority: "Galloway Creek," "Wilson Owens Branch 2," "Lyons Creek 7," and "Lyons Creek 8."

The subwatershed preservation assessment also used a suite of indicator ratings that were weighed and combined to obtain a single preservation rating for each subwatershed. The indicators were grouped into one of five categories: stream ecology, future departure of water quality conditions, soils, landscape, and aquatic living resources. Ten subwatersheds out of the 33 subwatersheds (30 percent) were rated High priority for preservation: "Ferry Branch 1," "Galloway Creek," "Cabin Branch 1," "Two Run Branch 2," "Pindell Branch," "Lyons Creek 2," "Lyons Creek 9," "Cabin Branch 2," "Two Run Branch 1," and "Wilson Owens Branch 4." The 2018 Report further noted that two "Tier II High Quality Waters" stream segments exist in the "Cabin Branch 1" and the "Lyons Creek 10" subwatersheds.

As stated above, the "Cabin Branch 1" subwatershed received a preservation ranking of High. The nearby "Lyons Creek 10" subwatershed received a preservation ranking of Medium High. These two ratings coupled with the fact that several adjacent subwatersheds draining to the reaches in the "Cabin Branch 1" and "Lyons Creek 10" subwatersheds also rated High for preservation makes "…this an important area for implementing preservation measures" (KCI & Coastal Resources, 2018, p. 90).

Lastly, a parcel scale assessment was conducted. The 2018 Report noted that this additional assessment was completed due to the fact that the general land use conditions in the southern portions of Anne Arundel County differ from the rest of the County in that the southern areas are less developed and contain more agricultural and forest cover. Consequently, the amount of impervious surface area in the southern portions of the County is "considerably less" than in other parts of the County (KCI & Coastal Resources, 2018, p. 91). (Impervious surface accounts for only 4.8 percent of the total area in the Patuxent River Middle watershed.) Based on this information, the County has recognized that preservation is critical in the Patuxent River Middle watershed. Therefore, the County supplemented its subwatershed preservation assessment with three separate but related prioritization models that identified areas at the parcel level as good candidates for (1) preservation, (2) tree planting and/or riparian buffer restoration, and (3) impervious treatment (removal and conversion to pervious). At the parcel level, there were too many sites identified to provide a meaningful summary. Accordingly, the 2018 Report provides a visual summary of the identified good candidate sites for these actions in the form of several large maps (see Map 4.4 for the good candidate sites for preservation, Map 4.5 for the good candidate sites for reforestation, and Map 4.6 for the good candidate sites for impervious treatment in the 2018 Report).

Prince George's County Assessments

Rocky Gorge Dam and Patuxent River Upper (Prince George's County)

In 2015, Prince George's County Department of the Environment published the *Restoration Plan for the Upper Patuxent River and Rocky*

Gorge Reservoir Watersheds in Prince George's County (Tetra Tech, 2015c) (hereinafter referred to as the "2015 Restoration Plan").

There is a very small portion (approximately 530 acres or 0.83 square miles) of the Rocky Gorge Dam (referred to as the "Rocky Gorge Reservoir" watershed in the 2015 Restoration Plan) within Prince George's County. Prince George's portion of the Rocky Gorge Dam watershed is impaired with phosphorus associated with both upstream point and non-point sources. Almost all of the watershed contains hydrologic Group B soils. Land use in Prince George's portion of the Rocky Gorge Dam consists of mostly forest (more than 51 percent), followed by urban (less than 23 percent) and agricultural (more than 18 percent). Approximately 6.1 percent of the land in Prince George's part of the Rocky Gorge Dam watershed is impervious (Tetra Tech, 2015c).

Prince George's portion of the Patuxent River Upper watershed (referred to as the "Upper Patuxent River" watershed in the 2015 Restoration Plan) is approximately 31,881 acres (49.8 square miles) and includes several municipalities such as the cities of Laurel, South Laurel, and Bowie. It also includes a large area of the Patuxent Research Refuge owned and operated by the U.S. Fish and Wildlife Service. Streams in the portion of the watershed surrounding the city of Bowie are impaired with fecal coliform bacteria (Tetra Tech, 2015c). Sediment is listed as an impairment throughout the entire watershed (both the Rocky Gorge Dam and Patuxent River Upper). Almost half of the Patuxent River Upper watershed contains hydrologic Group B soils, while a combination of Group C and Group D soils make up the remainder of the watershed. Land use in Prince George's portion of the Patuxent River Upper watershed is mostly urban (about 51 percent, largely residential land); however, there is significant forested land (more than 38 percent) among the non-urban portions of the watershed. Approximately 18 percent of the land in Prince George's part of the Patuxent River Upper watershed is impervious (Tetra Tech, 2015c).

For the 2015 Restoration Plan, Prince George's portion of the Patuxent River Upper watershed was divided into 38 subwatersheds, named as PX-1 through PX-38. With the exception of PX-38, which is near the southern portion of the watershed, the subwatersheds start out with PX-37 near the northern most part of the watershed and progress in numerical order down the length of the watershed until PX-1 is reached at the southernmost tip.

An evaluation of each subwatershed in the Patuxent River Upper watershed was performed to aid in the selection of BMPs in the areas with the highest required pollutant load reductions. The County prioritized the subwatersheds by ranking the necessary total load reduction for each TMDL parameter and then averaging the individual ranks to obtain an overall rank for the subwatershed. According to the 2015 Restoration Plan, "Although not included in this restoration plan, PCBs are included in the subwatershed ranking" (Tetra Tech, 2015c, p. 63). Therefore, the TMDL parameters included in the ranking were total nitrogen (TN), total phosphorus (TP), TSS, BOD, fecal coliform bacteria, and PCBs. These six TMDL parameters are also noted as the "contaminants of most concern in the County" (Tetra Tech, 2015c, p. 107).

The highest ranked watersheds tended to be in areas with the largest amount of impervious cover. Subwatersheds PX-28, PX-30, and PX-34 were among the highly ranked watersheds. These subwatersheds encompass the cities of Laurel and South Laurel in the upper portion of the Patuxent River Upper watershed. Subwatersheds PX-12, PX-13, PX-14, and PX-17 were also highly ranked, with PX-13 emerging as the highest ranked subwatershed overall. These subwatersheds encompass the city of Glenn Dale and portions of the city of Bowie. The County noted that "[t]hese areas are dominated by commercial and residential areas with some minor institutional areas that could be used for BMP implementation in the future." (Tetra Tech, 2015c, p. 63) No ranking was completed for the Rocky Gorge Dam portion; however, its entire drainage area was included in the County's modeling calculations (Tetra Tech, 2015c).

Western Branch and WBRTF (Prince George's County)

The Western Branch, which includes the WBRTF segmentshed within its boundary, is located solely within Prince George's County. As of July 2018, a watershed restoration plan for the Western Branch is not available online at Prince George's Watershed Restoration Planning Site (http://pgcdoe.net/pgcountyfactsheet/Factsheet/Default). However, Prince George's County has prepared several Watershed Existing Condition Reports, including one from 2014 that covers the Western Branch and is summarized below. These reports were the initial step in the restoration plan development process for the watersheds in the County that have EPA-approved TMDLs. The reports characterize the watersheds, provide a review of existing reports and data, and present some additional data and spatial analyses.

In December 2014, Prince George's County Department of the Environment published the *Watershed Existing Condition Report for the Upper Patuxent River, Western Branch, and Rocky Gorge Reservoir Watershed* (Tetra Tech, 2014a)—hereinafter referred to as the "Watershed Existing Condition Report."

The Watershed Existing Condition Report stated that TSS issues in the Western Branch can be attributed to agricultural and urban land uses and stream bank erosion from increased stormwater sources. Located solely within Prince George's County, the Western Branch also has a problem with BOD, which can be an indicator of organic pollution. Lower DO in streams near discharges from WWTPs, agriculture feed lots, and septic systems is also a problem.

In the Western Branch, the land use is primarily forest and agriculture, which show areas of higher nutrient loads (Tetra Tech, 2014a). Stormwater ponds, which usually treat residential and non-urban areas, are the most implemented BMP in the Western Branch watershed. While this practice treats larger areas, they are less efficient than other practices at removing pollution.

Infiltration practices are the second most implemented stormwater control in the Western Branch; they treat smaller areas but remove pollution with greater efficiency. The oil and grit separators are known for treating more area but have lower removal efficiencies than infiltration practices. Existing BMPs in the Western Branch include bioretention, grass swales, infiltration, oil/grit separators, and ponds (Tetra Tech, 2014a).

There were two sites mentioned in the Watershed Existing Condition Report regarding benthic invertebrates and BIBI sampling within the Western Branch watershed; these sites are (Tetra Tech, 2014a):

- Southwest Branch – a total of 7 streams were sampled: 6 first order and 1 second order. One was rated Very Poor, three were rated Poor, and the remaining were rated as Fair.

- Collington Branch – a total of 12 streams were sampled. One was rated Very Poor, three were rated Poor, seven were rated as Fair, and one was rated as Good.

Prince George's County has also engaged in street sweeping, public outreach to promote environmental awareness, green initiatives, and community involvement in protecting natural resources. Past public outreaches conducted include distributing educational brochures on stormwater pollution, the "Can the Grease" program to decrease SSOs, and implementing recycling programs (Tetra Tech, 2014a).

Patuxent River Middle (Prince George's County)

As of July 2018, a watershed restoration plan is not available online at Prince George's Watershed Restoration Planning Site (http://pgcdoe.net/pgcountyfactsheet/Factsheet/Default) that covers the Patuxent River Middle watershed portion within Prince George's County. A Watershed Existing Condition Report covering the Patuxent River

Middle portion within Prince George's County is also currently not available on the site.

T.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet PCB reduction in the Patuxent Tidal Fresh segmentshed are shown in **Table 4-80**. Projected PCB reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs implemented before the TMDL baseline. In this case, the baseline is 2010;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025,
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the PCB TMDL, MDOT SHA will meet 3.9 percent of the MDE 99.9 percent load reduction requirement through implementation of BMPs shown in **Table 4-80**. MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in Part III Section E.

Estimated costs to design, construct, and implement BMPs within the Patuxent Tidal Fresh segmentshed watershed total $33,205,000. These projected costs are based on an average cost per impervious acre treated derived from a cost history for each BMP type. Please see **Table 4-81** for a BMP strategy cost breakdown.

Figure 4-61 is a map of MDOT SHA's restoration practices in the PAXTF segmentshed, including those that are under design or construction. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-80: PAXTF PCB BMP Implementation

BMP	Unit	Baseline (Before 2010)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	3,669.5	185.8	228.4	TBD	4,083.7
Retrofit	drainage area acres		119.7		TBD	119.7
Impervious Surface Elimination	acres removed		0.5		TBD	0.5
Inlet Cleaning[1]	tons		20.7	42.9	TBD	63.6
Street Sweeping[1]	acres swept		177.8		TBD	177.8
Load Reductions	PCB g/yr.		0.14	0.20	5.09	
					Total Projected Reduction	**5.09**	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-81: PAXTF Restoration BMP Cost

BMP	20202020	2025	Total
New Stormwater	$16,741,000	$10,720,000	$27,461,000
Retrofits	$5,091,000		$5,091,000
Impervious Surface Elimination	$146,000		$146,000
Inlet cleaning	$81,000	$245,000	$326,000
Street Sweeping	$181,000		$181,000
Total			$33,205,000

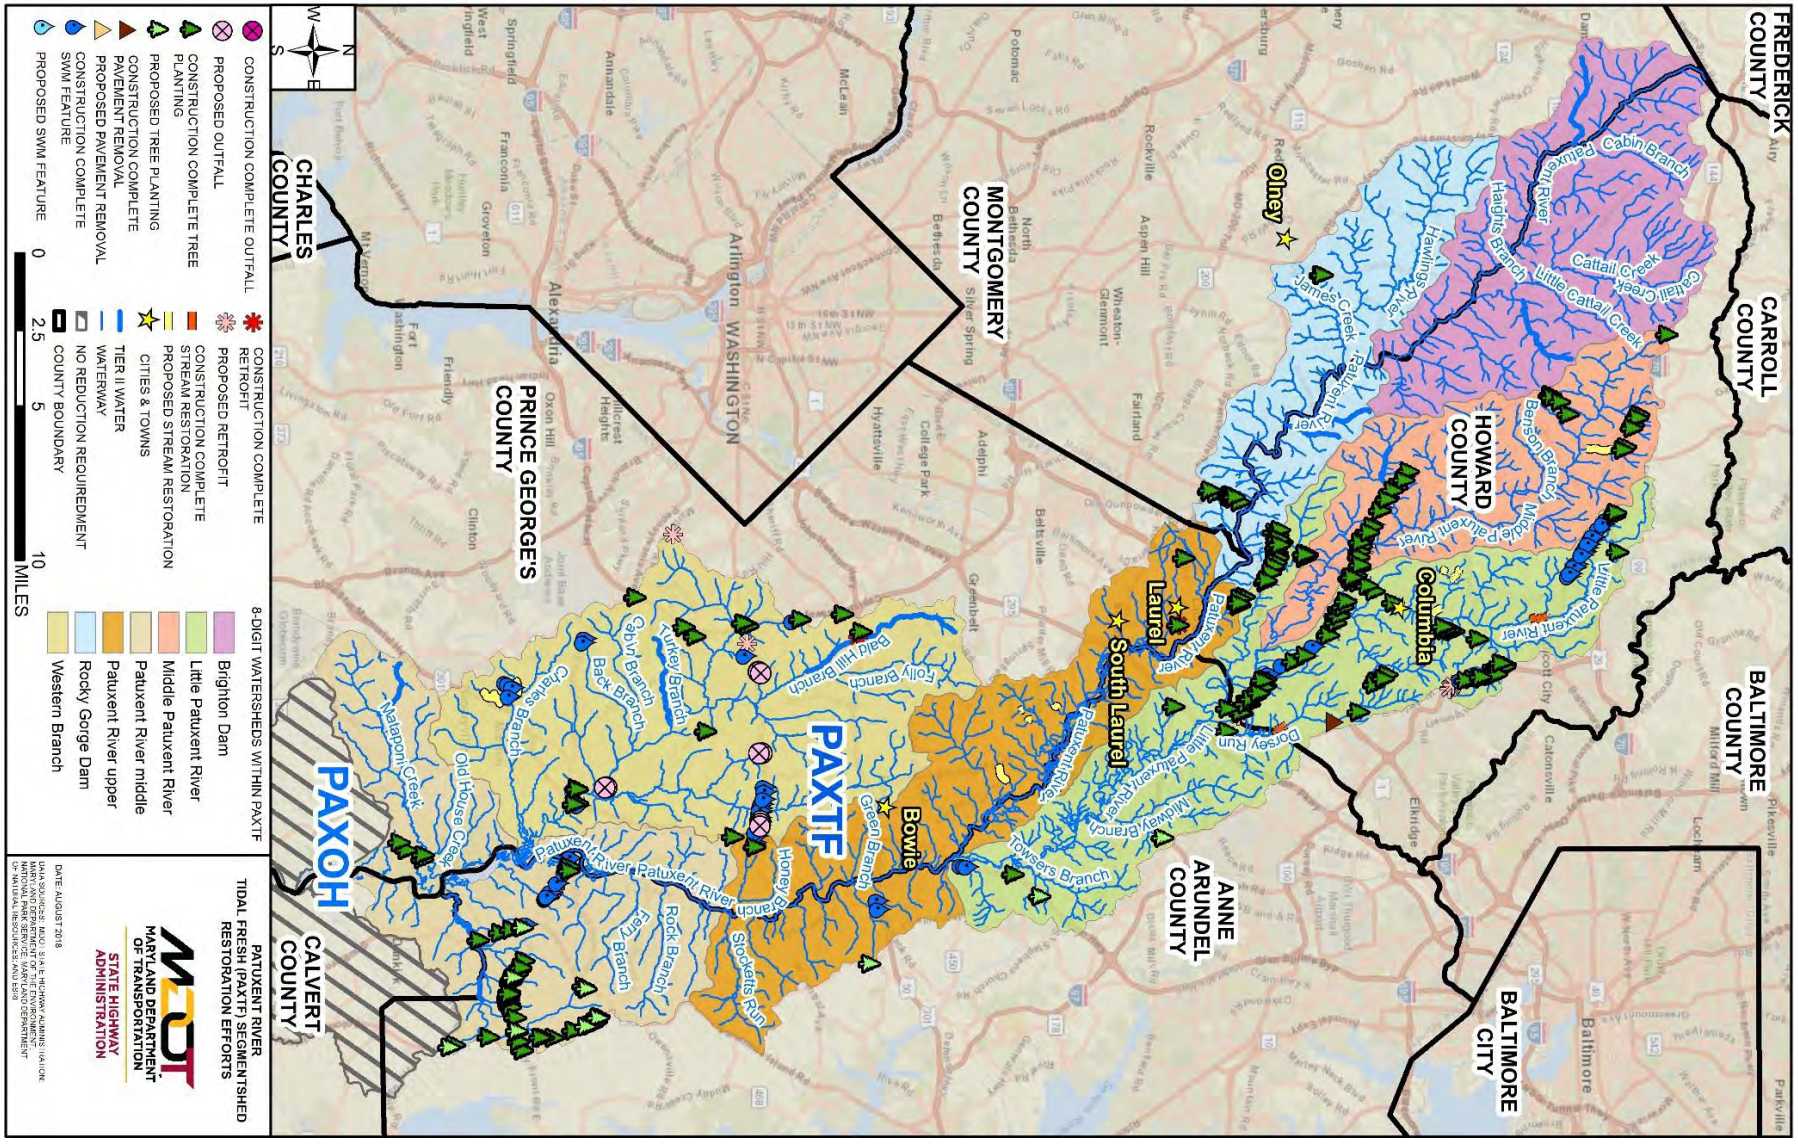


Figure 4-61: MDOT SHA Programmed Restoration Strategies within the PAXTF Segmentshed

U. PATUXENT RIVER UPPER WATERSHED

U.1. Watershed Description

The Patuxent River Upper watershed encompasses 88 square miles within west Anne Arundel and northeast Prince George's Counties, in addition to small areas in Montgomery and Howard Counties. The Patuxent River Upper begins in Howard County to the north and flows south ultimately draining to the Chesapeake Bay.

There are 556.5 centerline miles of MDOT SHA roadway located within the Patuxent River Upper watershed. The associated ROW encompasses 1,801.9 acres, of which 784.5 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) highway garage or shop, one (1) salt storage facility, and one (1) park and ride facility. See **Figure 4-62** for a map of the watershed.

U.2. MDOT SHA TMDLs within Patuxent River Upper Watershed

MDOT SHA is included in both bacteria (MDE, 2011h) and sediment (MDE, 2011i) TMDLs. Sediment is to be reduced by 11.4 percent in Anne Arundel, Prince George's and Howard Counties. Bacteria is to be reduced by 45.3 percent, as shown in **Table 3-3**.

U.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Patuxent River Upper watershed is shown in **Figure 4-63** which illustrates that 58 grid cells have been reviewed, encompassing portions of 19 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 289 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- Seven (7) new structural SW controls constructed or under contract.
- 180 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 102 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 59 locations as potential tree planting locations. Further analysis of these locations resulted in:

- Nine (9) sites constructed or under contract.
- Eight (8) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 42 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 31 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Two (2) sites constructed or under contract.
- One (1) additional site deemed potentially viable for stream restoration and pending further analysis may be a candidate for future restoration opportunities.
- 28 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 74 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Five (5) new structural SW controls constructed or under contract.
- Seven (7) additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 62 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 19 outfalls potential for stabilization. Further analysis of these sites resulted in:

- 19 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 18 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of two (2) existing structural SW controls constructed or under contract.
- Two (2) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 14 retrofit sites deemed not viable for retrofit and have been removed from consideration.

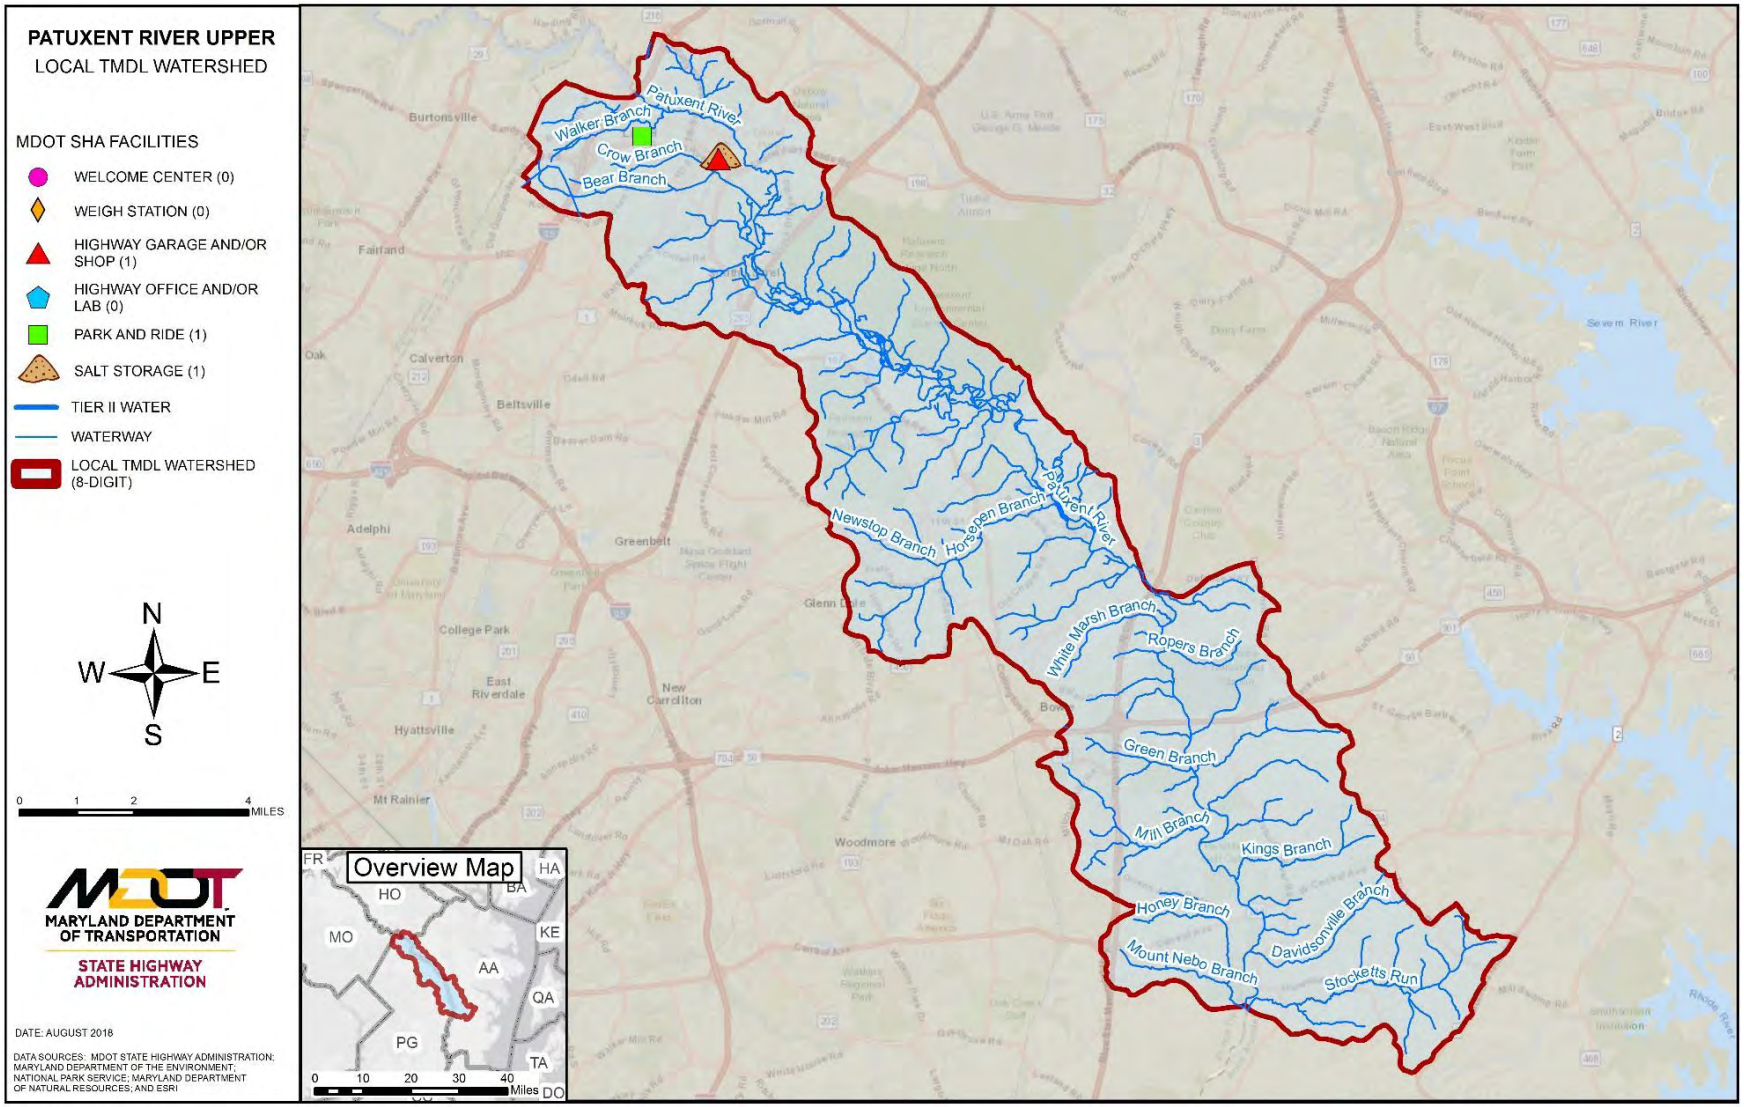


Figure 4-62: Patuxent River Upper Watershed

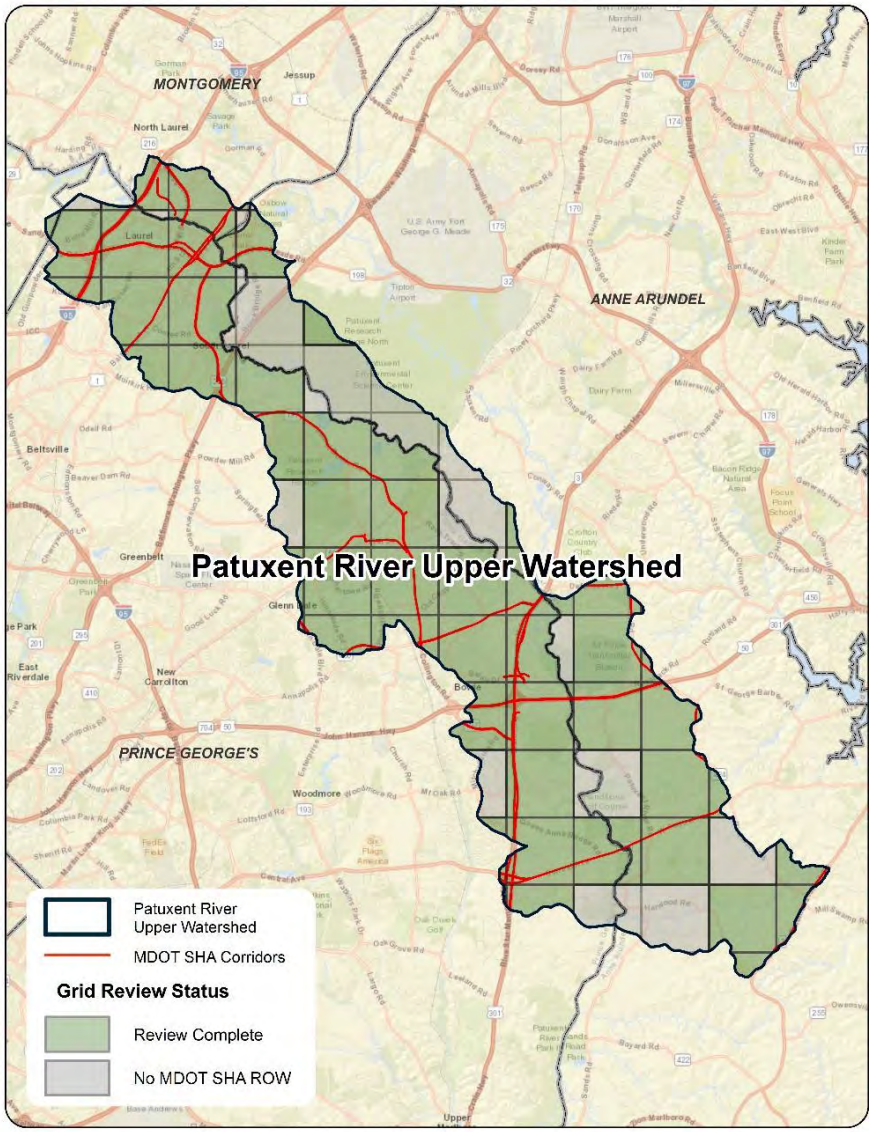


Figure 4-63: Patuxent River Upper Site Search Grids

U.4. Summary of County Assessment Review

Waters within the Patuxent River Upper watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- *Escherichia coli*;
- Mercury in Fish Tissue;
- Sulfates; and
- TSS.

Prince George's County Department of the Environment prepared the *Watershed Existing Condition Report for the Upper Patuxent River, Western Branch, and Rocky Gorge Reservoir Watersheds* in 2014 (Tetra Tech, 2014a) and the *Restoration Plan for the Upper Patuxent River and Rocky Gorge Reservoir Watersheds in Prince George's County* in 2015 (Tetra Tech, 2015c). The phosphorus in Rocky Gorge Reservoir, which is approximately 55 square miles in size, can be associated with non-point sources and urban runoff. In the Patuxent River Upper watershed, the problem with fecal coliform bacteria is attributed to wildlife and domestic animals, land surfaces, humans via septic and sewer systems, regulated stormwater, and SSO.

Total suspended solid issues in the watershed can be attributed to agricultural and urban land uses and stream bank erosion from increased stormwater sources. Western Branch has a problem with BOD, which can be an indicator of organic pollution. There is also a problem with lower DO (with streams near discharges from WWTPs and stormwater runoff, agriculture feed lots, septic systems and natural debris. Within the Patuxent River Upper watershed, Laurel and Bowie have the largest volumes of runoff, which are generated due to higher percent of impervious cover. In the lower portions of the Patuxent River Upper and Western Branch, the land use is primarily forest and agriculture, which shows areas of higher nutrient loads (Tetra Tech, 2014a).

An evaluation of each subwatershed in the Patuxent River Upper watershed was performed to aid in the selection of BMPs in the areas with the highest required pollutant loading reductions. The County prioritized the subwatersheds by ranking the necessary total load reduction for each TMDL parameter and then averaging the individual ranks to obtain an overall rank for the subwatershed. The highest ranked watersheds tended to be in areas with the largest amount of impervious cover. Subwatersheds PX-28, PX30, and PX-34 are among the highly ranked watersheds. These subwatersheds encompass the cities of Laurel and South Laurel in the upper portion of the Patuxent River Upper watershed. Subwatersheds PX-12, PX-13, PX-14, and PX-17 are also highly ranked, with PX-13 emerging as the highest ranked subwatershed as a whole. These subwatersheds encompass the city of Glenn Dale and portions of the city of Bowie. These areas are dominated by commercial and residential areas with some minor institutional areas that could be used for BMP implementation in the future (Tetra Tech, 2015c).

Stormwater ponds are the most implemented BMP, which usually treat residential and non-urban areas. While this practice treats larger areas, they are less efficient than other practices at removing pollution. Infiltration practices are the second most implemented stormwater control; they treat smaller areas but remove pollution with greater efficiency. The oil and grit separators are known for treating more area, but have lower removal efficiencies than infiltration practices. The Patuxent River Upper watershed currently has no bio-retention, infiltration, oil/grit separators, and ponds in use. The Western Branch has bio-retention, grass swales, infiltration, oil/grit separators and ponds (Tetra Tech, 2014a).

There were three sites mentioned in the watershed assessment report regarding benthic invertebrate and BIBI sampling within the Patuxent River Upper and Western Branch watersheds; these sites are (Tetra Tech, 2014a):

- Horsepen Branch – in 2013, four sites were sampled, three yielding a “poor” score, and one receiving a “fair” rating. The estimated number of biologically degraded stream miles increased from 33 percent to 75 percent.

- Southwest Branch – a total of 7 streams were sampled – 6 first order and one second order. One was rated “very poor,” three “poor,” and the remaining as “fair.” The number of biologically degraded stream miles decreased from 100 percent to 57 percent.

- Collington Branch - a total of 12 streams were sampled. One was rated “very poor,” three sites “poor,” seven as “fair,” and one as “good.” The stream miles classified as biologically impaired went from 58 percent to 33 percent.

As a whole, structural and nonstructural BMPs that have been implemented by Prince George’s County include permit compliance, TMDL WLAs, and flood mitigation. Prince George’s County has also engaged in street sweeping, public outreach to promote environmental awareness, green initiatives and community involvement in protecting natural resources. Past public outreaches conducted include educational brochures on stormwater pollution awareness, outreach in schools, and the “Can the Grease” program to decrease SSOs and recycling programs (Tetra Tech, 2014a).

U.5. MDOT SHA Pollutant Reduction Strategies

Patuxent River Upper is listed for both bacteria and sediment with each TMDL having a different baseline year; 2009 for bacteria and 2005 for sediment. Proposed practices to meet the bacteria and sediment reductions in the Patuxent River Upper watershed are shown in **Table 4-82 and 4-83**, respectively. Four time frames are included in the table below:

- BMPs built before the TMDL baseline. In this case, the bacteria baseline is 2009 and the sediment baseline is 2005;

- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the bacteria TMDL, MDOT SHA will meet .4 percent of the MDE 45.3 percent load reduction requirement through implementation of BMPs shown in **Table 4-82.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Patuxent River Upper watershed total $14,186,000. They are based on average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-84** for a summary of estimated BMP costs.

Figure 4-64 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design or construction. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-82: Patuxent River Upper Restoration Bacteria BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	190.3	1.3		TBD	191.6
Load Reductions	E. coli billion MPN/yr.		45.0	45	11,869	
Total Projected Reduction					**11,869**	

Table 4-83: Patuxent River Upper Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	493.9	46.1	37.2	N/A	577.2
Retrofit	drainage area acres		1.2		N/A	1.2
Impervious Surface Elimination	acres removed		0.1		N/A	0.1
Tree Planting	acres of tree planting		8.9	7.3	N/A	16.2
Stream Restoration	linear feet		2000.0	6,186.3	N/A	8186.3
Outfall Stabilization	linear feet		3.2	885.2	N/A	888.4
Inlet Cleaning[1]	dry tons		4.6		N/A	4.6
Street Sweeping[1]	acres swept		27.3		N/A	27.3
Load Reductions	TSS EOS lbs./yr.		100,163	366,589	0	
					Total Projected Reduction	**366,589**

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-84: Patuxent River Upper Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$3,375,000	$3,009,000	$6,384,000
Retrofits	$28,000		$28,000
Impervious Surface Elimination	$23,000		$23,000
Tree Planting	$273,000	$222,000	$495,000
Stream Restoration	$1,336,000	$4,131,000	$5,467,000
Outfall Stabilization		$1,748,000	$1,748,000
Inlet cleaning	$17,000		$17,000
Street Sweeping	$24,000		$24,000
Total			$14,186,000

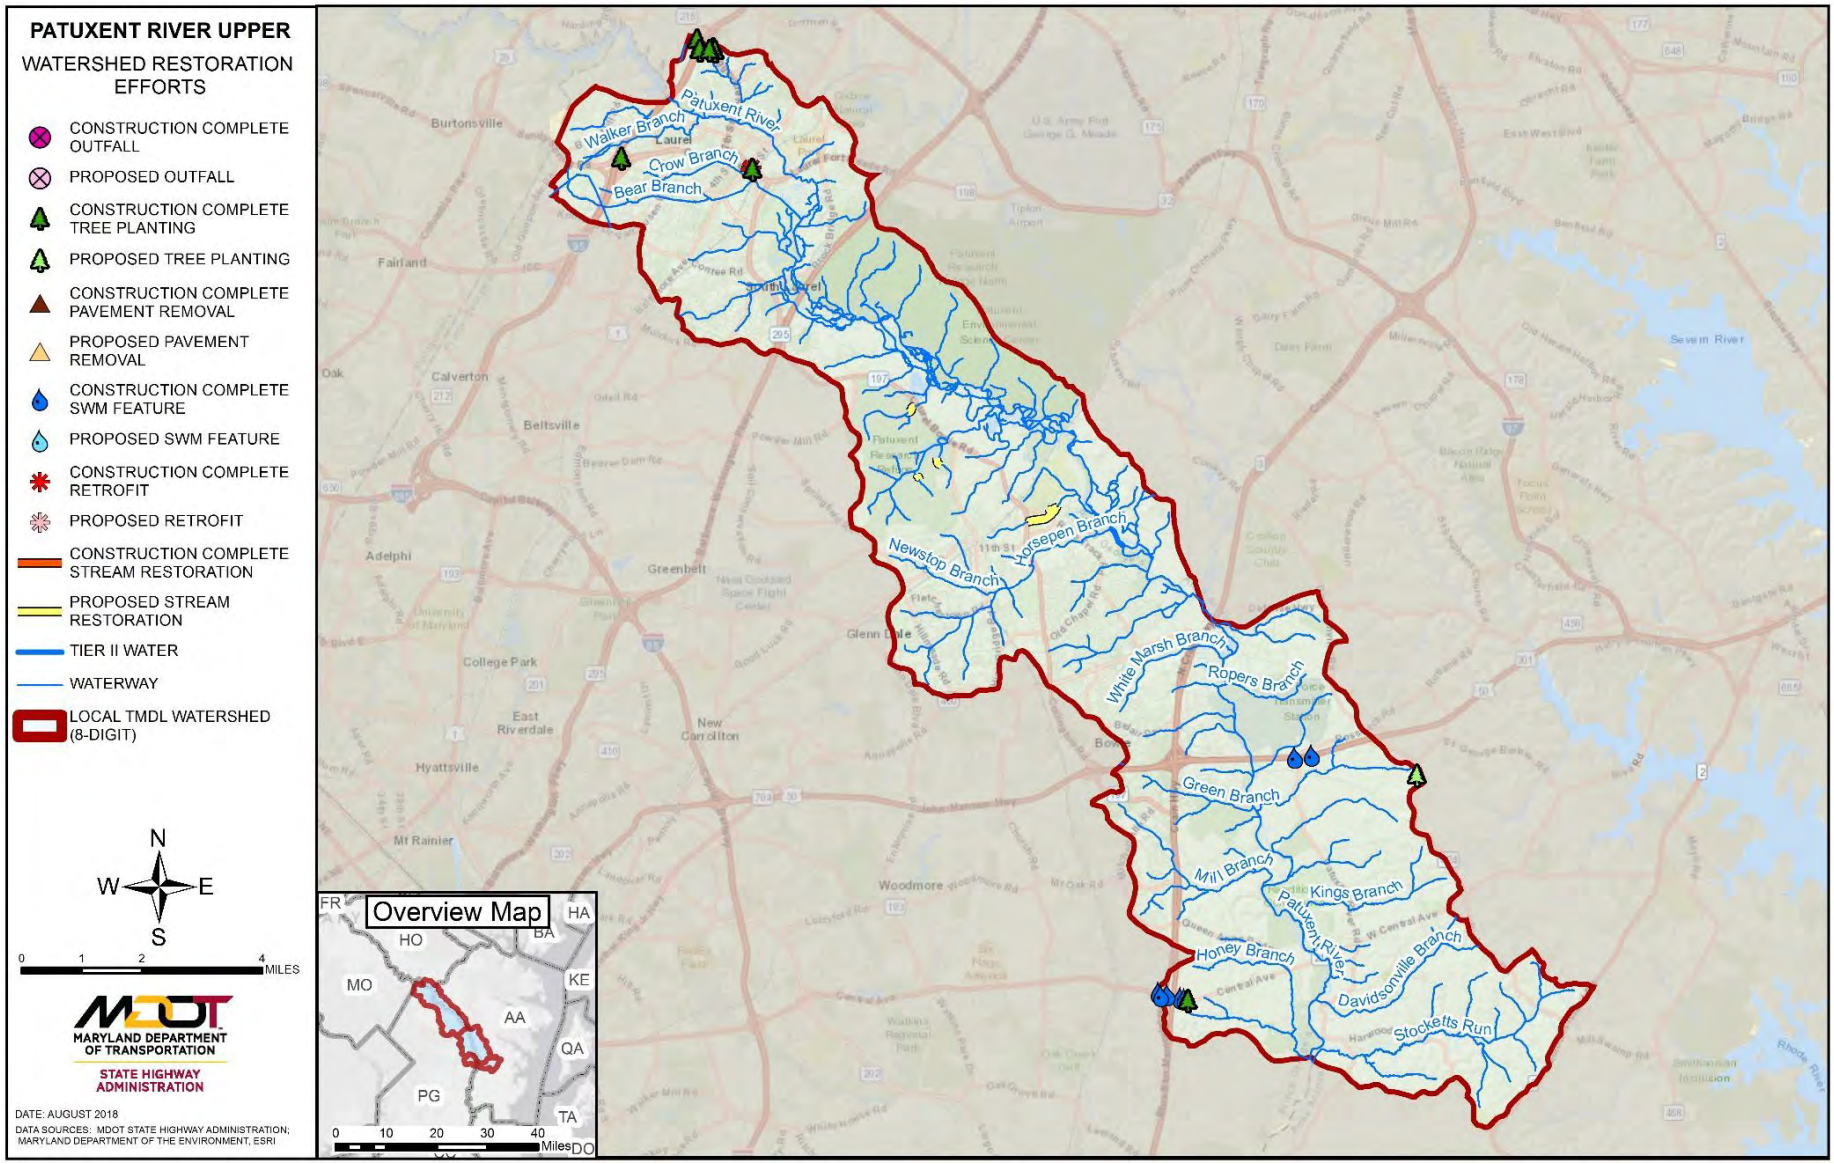


Figure 4-64: MDOT SHA Restoration Strategies within the Patuxent River Upper Watershed

V. POTOMAC RIVER MONTGOMERY COUNTY WATERSHED

V.1. Watershed Description

The Potomac River Montgomery County watershed includes the stretch of the mainstem Potomac River that flows 39 miles through Montgomery County, Maryland from the Frederick County border down to Washington, D.C. The watershed is predominantly located in Montgomery County (140.0 square miles), but small portions also extend into Frederick County (0.7 square miles) and Washington, D.C. (2.1 square miles). Tributary creeks and streams of the Potomac River Montgomery County watershed include Broad Run, Cabin Branch, Greenbrier Branch, Horsepen Branch, Little Falls Branch, Little Monocacy River, Muddy Branch, Piney Branch, Rock Run, Sandy Branch, and Watts Branch.

There are 760.6 centerline miles of MDOT SHA roadway located within the Potomac River Montgomery County watershed. The associated ROW encompasses 1,282.4 acres, of which 1,203.1 acres are impervious. There are no MDOT SHA facilities located within the Potomac River Montgomery County watershed. See **Figure 4-65** for a map of the watershed.

V.2. MDOT SHA TMDLs within Potomac River Montgomery County Watershed

MDOT SHA is included in the sediment TMDL (MDE, 2012e) and has a reduction requirement of 36.2 percent within Montgomery County, as shown in **Table 3-2**.

V.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Potomac River Montgomery County watershed is shown in **Figure 4-66** which illustrates that 51 grid cells have been reviewed, encompassing portions of 19 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 160 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- Six (6) new structural SW controls constructed or under contract.
- 76 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 78 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 58 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 23 sites constructed or under contract.

- 12 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 23 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 18 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- One (1) site constructed or under contract.
- One (1) additional site deemed potentially viable for stream restoration and pending further analysis may be a candidate for future restoration opportunities.
- 16 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 13 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- 13 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 21 outfalls potential for stabilization. Further analysis of these sites resulted in:

- Three (3) outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- 18 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

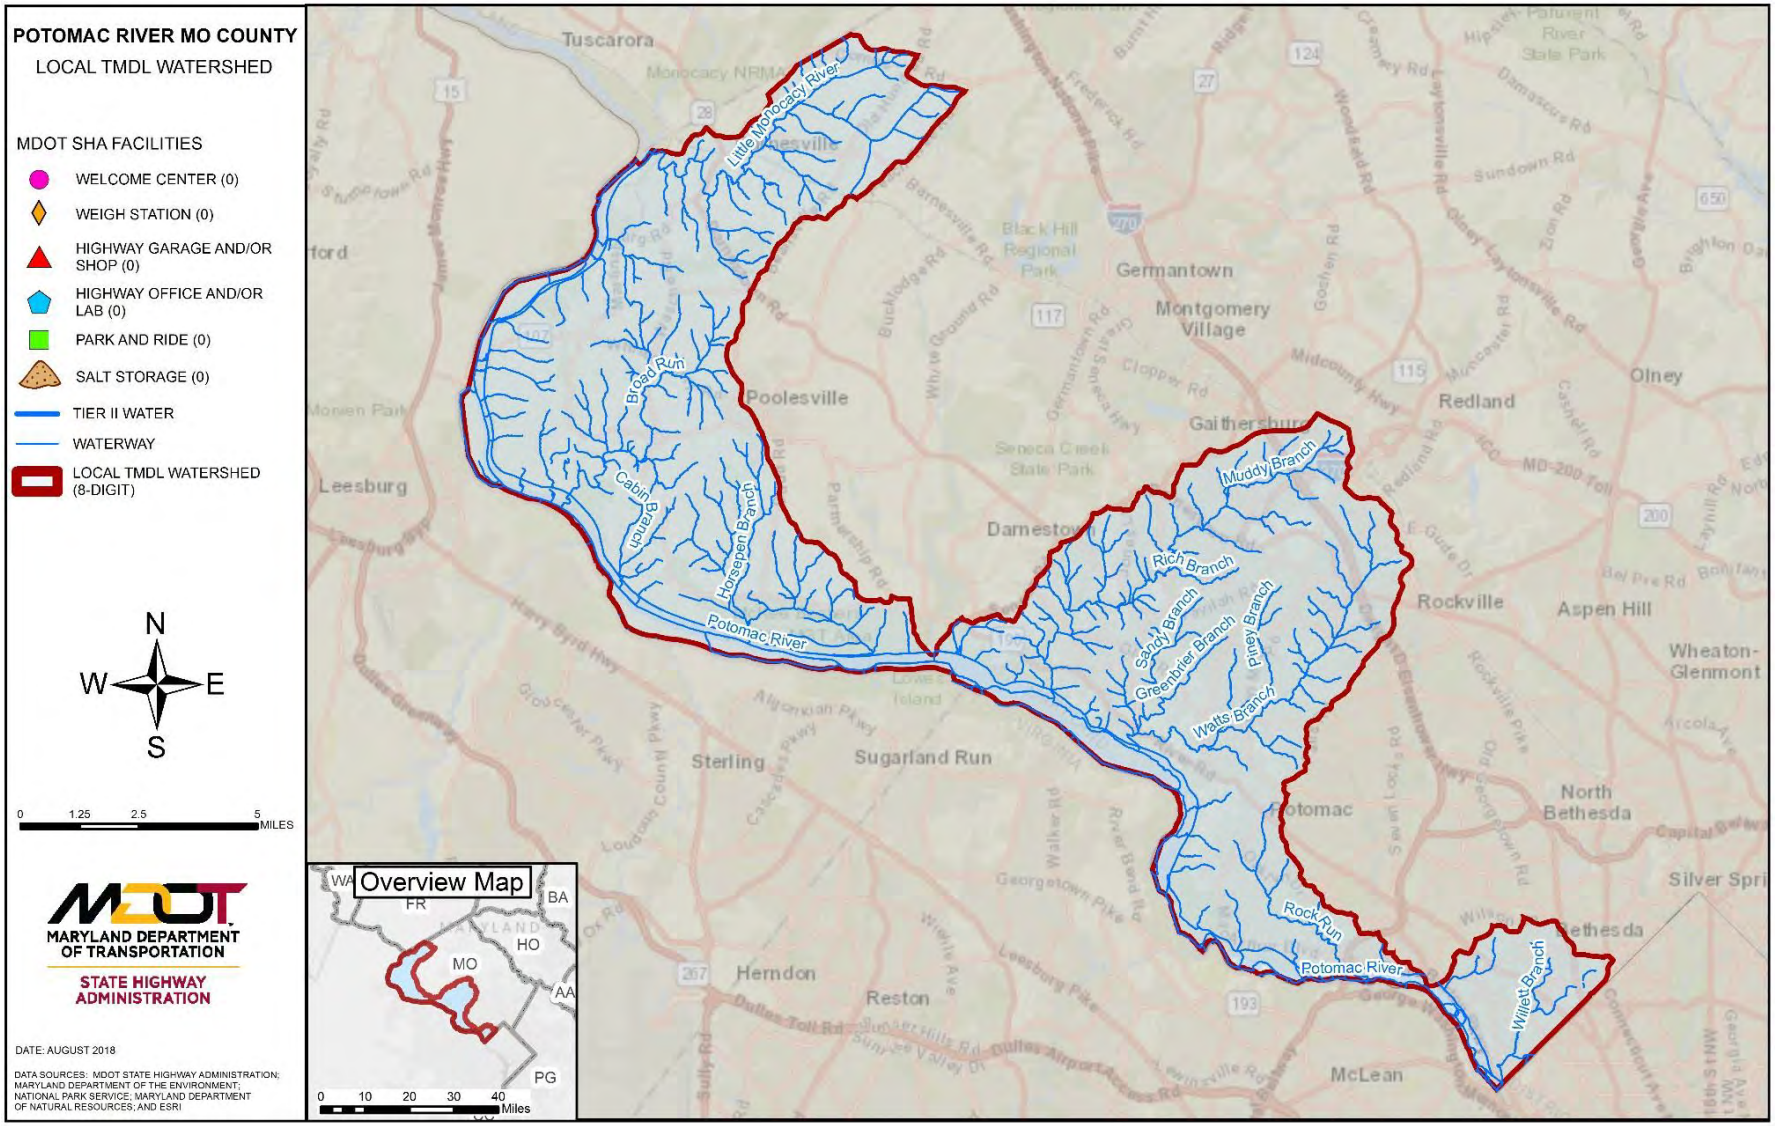


Figure 4-65: Potomac River Montgomery County Watershed

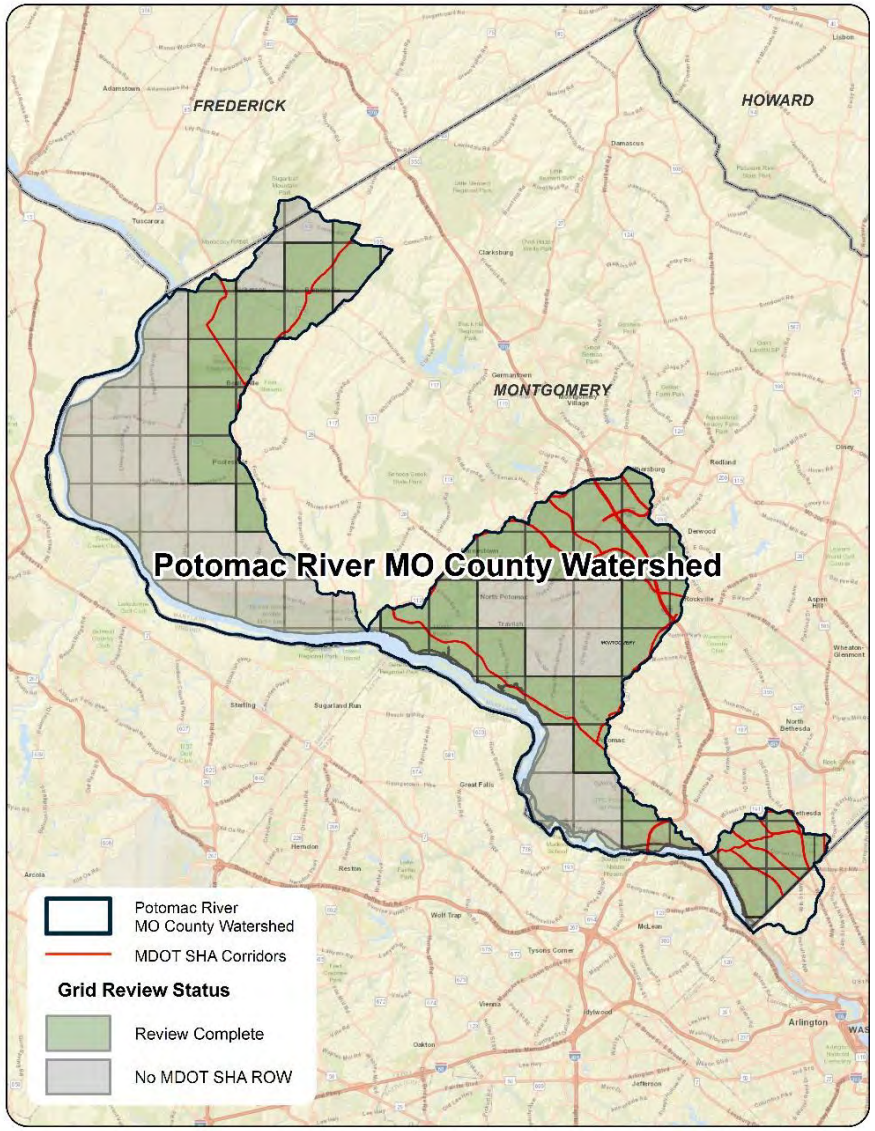


Figure 4-66: Potomac River Montgomery County Site Search Grids

V.4. Summary of County Assessment Review

Waters within the Potomac River Montgomery County watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- PCB in Fish Tissue;
- pH, High;
- Sulfates; and
- TSS.

In 2011 and 2012, Montgomery County Department of Environmental Protection (MO-DEP) published the *Muddy Branch and Watts Branch Subwatersheds Implementation Plan* (Horsley Witten Group, Inc. [HWG], 2012a), the *Upper Potomac Direct Watershed Pre-Assessment* Report (Versar et al., 2011a), and the *Lower Potomac Direct Watershed Pre-Assessment Report* (Versar et al., 2011b). MO-DEP also published the *Watts Branch Watershed Restoration Study* (AMT, Inc. and Biohabitats, 2003). In addition, the City of Gaithersburg published the *Muddy Branch Watershed Study* (URS, 2014b).

The Potomac River Montgomery County watershed comprises primarily urban land use, covering approximately 42 percent of the watershed (7 percent of which is impervious). Forested land comprises approximately 38 percent and agricultural land comprises approximately 20 percent. Within the Muddy Branch and the Watts Branch subwatersheds, the majority of the stream resource conditions were assessed as "fair" (75 percent) and 25 percent were assessed as "good" (HWG, 2014a). Within the Lower Potomac, the majority of stream resource conditions were assessed as "fair" or "poor," with only one site in the Rock Run subwatershed rated "good" (Versar et al., 2011b). Within the Upper Potomac, the majority of stream resource conditions were assessed as "good" or "fair" with only one site in the Broad Run watershed rated as "poor" (Versar et al., 2011a).

The *Upper* and *Lower Potomac Direct Pre-Assessment Reports* identified priorities for stormwater BMP retrofits. These include areas treated by pre-1986 permitted SWM facilities as high priority. Medium and lower priority sites did not include any MDOT SHA ROW, and focused on county-owned and privately-owned sites (Versar et al., 2011a and b).

The *Muddy Branch Watershed Study* identified four proposed stream restoration projects (URS, 2014b):

- M2 Stream Reach: Future Park City, experiencing widespread bank erosion, debris jams, sediment deposition and poor aquatic habitat. Proposed measures include grade control, rock toe protection, root wads, and a deflector.
- T3.1 Stream Reach: Quince Orchard Park, experiencing active lateral headcuts, poor aquatic habitat, and lateral channel migration. Proposed measures include grade control and rock toe protection.
- T4.1 Stream Reach: Brighton Village, experiencing widespread bank erosion, unstable banks, falling trees. Proposed measures include grade control and rock toe protection.
- T5.2a Stream Reach: I-370 Outfall, experiencing unstable banks and streambed, and poor aquatic habitat.

The Frederick County Office of Sustainability and Environmental Resources (OSER) “Publications and Resources” webpage does not currently (as of September 2018) include a watershed assessment for the very small portion of the Potomac River Montgomery County watershed in Frederick County (FR-OSER, 2018).

V.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reductions in the Potomac River Montgomery County watershed are shown in **Table 4-85**. Projected sediment reduction using these practices are shown in **Table 3-2**. Four timeframes are included in the table:

- BMPs built before the TMDL baseline. In this case, the baseline is 2005;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL, MDOT SHA will meet 48.5 percent of the MDE 36.2 percent load reduction requirement through implementation of BMPs shown in **Table 4-85.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within Potomac River Montgomery County watershed total $5,584,000. These projected costs are based on an average cost per impervious acre treated derived from a cost history for each BMP type. Please see **Table 4-86** for a BMP strategy cost breakdown.

Figure 4-67 shows a map of MDOT SHA’s restoration practices in the watershed and include those that are under design or constructed. Inlet cleaning and street sweeping is not reflected on this map.

Table 4-85: Potomac River Montgomery County Restoration Sediment BMP Implementation						
BMP	**Unit**	**Baseline (Before 2005)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	624.9	16	15.1	TBD	656.0
Tree Planting	acres of tree planting		55.3		TBD	55.3
Stream Restoration	linear feet	201.0	1,855.2		TBD	2056.2
Outfall Stabilization	linear feet			400.0	TBD	400.0
Inlet Cleaning[1]	dry tons		18.2	59.1	TBD	77.3
Street Sweeping[1]			34.9		TBD	34.9
Load Reductions	TSS EOS lbs/yr.		48,320	155,573	320,708	
				Total Projected Reduction	320,708	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-86: Potomac River Montgomery County Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$463,000	$971,000	$1,434,000
Tree Planting	$1,611,000	$81,000	$1,692,000
Stream Restoration		$1,239,000	$1,239,000
Outfall Stabilization		$787,000	$787,000
Inlet cleaning	$77,000	$338,000	$415,000
Street Sweeping	$17,000		$17,000
Total			$5,584,000

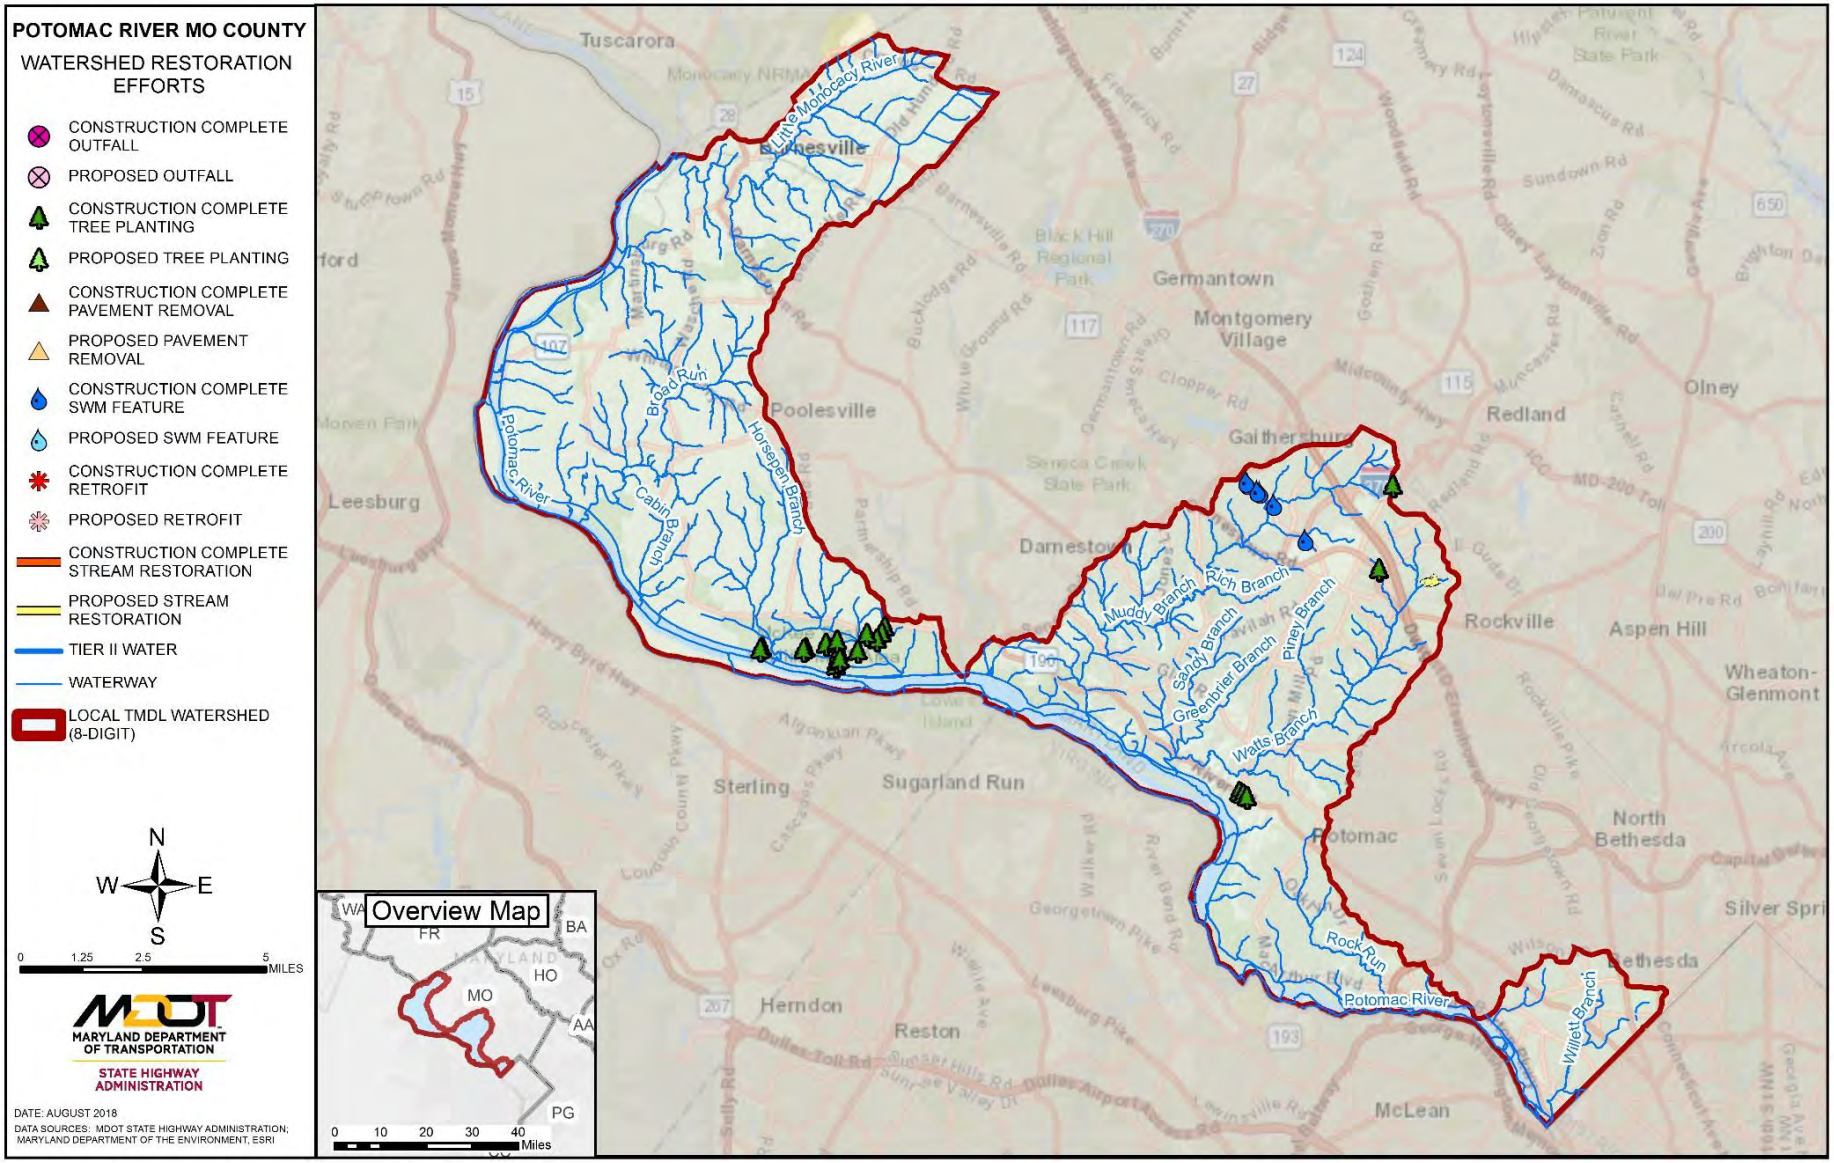


Figure 4-67: MDOT SHA Restoration Strategies within the Potomac River Montgomery County Watershed

W. POTOMAC RIVER UPPER TIDAL WATERSHED

W.1. Watershed Description

The Potomac River Upper Tidal watershed (Maryland 8-digit Basin Code: 02140201) encompasses approximately 56.6 square miles within Prince George's and Charles Counties, Maryland. The majority of the watershed is located in Prince George's County; a relatively small piece of the watershed is located in the northwestern tip of Charles County. Tributary creeks and streams of the Potomac River Upper Tidal watershed includes the mainstem Potomac River, Henson Creek, Carey Branch, and Hunters Mill Branch. The watershed drains directly into the Potomac River, which ultimately drains to the Chesapeake Bay.

The designated use of the Potomac River Upper Tidal watershed is Use Class II – Support of Estuarine and Marine Aquatic Life and Shellfish Harvesting (Haywood & Buchanan, 2007).

Waters within the Potomac River Upper Tidal watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Nitrogen (Total);
- PCB in Fish Tissue; and
- Phosphorus (Total).

There are 68.1 centerline miles of MDOT SHA roadway located within the Potomac River Upper Tidal watershed. The associated ROW encompasses 1178.4 acres, of which 512.9 acres are impervious. There are no MDOT SHA facilities located within the Potomac River Upper Tidal watershed. See **Figure 4-68** for a map of the watershed.

W.2. MDOT SHA TMDLs within Potomac River Upper Tidal Watershed

MDOT SHA is included in the PCB TMDL (Haywood & Buchanan, 2007). PCBs for the Potomac River Upper Tidal are to be reduced by 92.1 percent, as shown in **Table 3-2**.

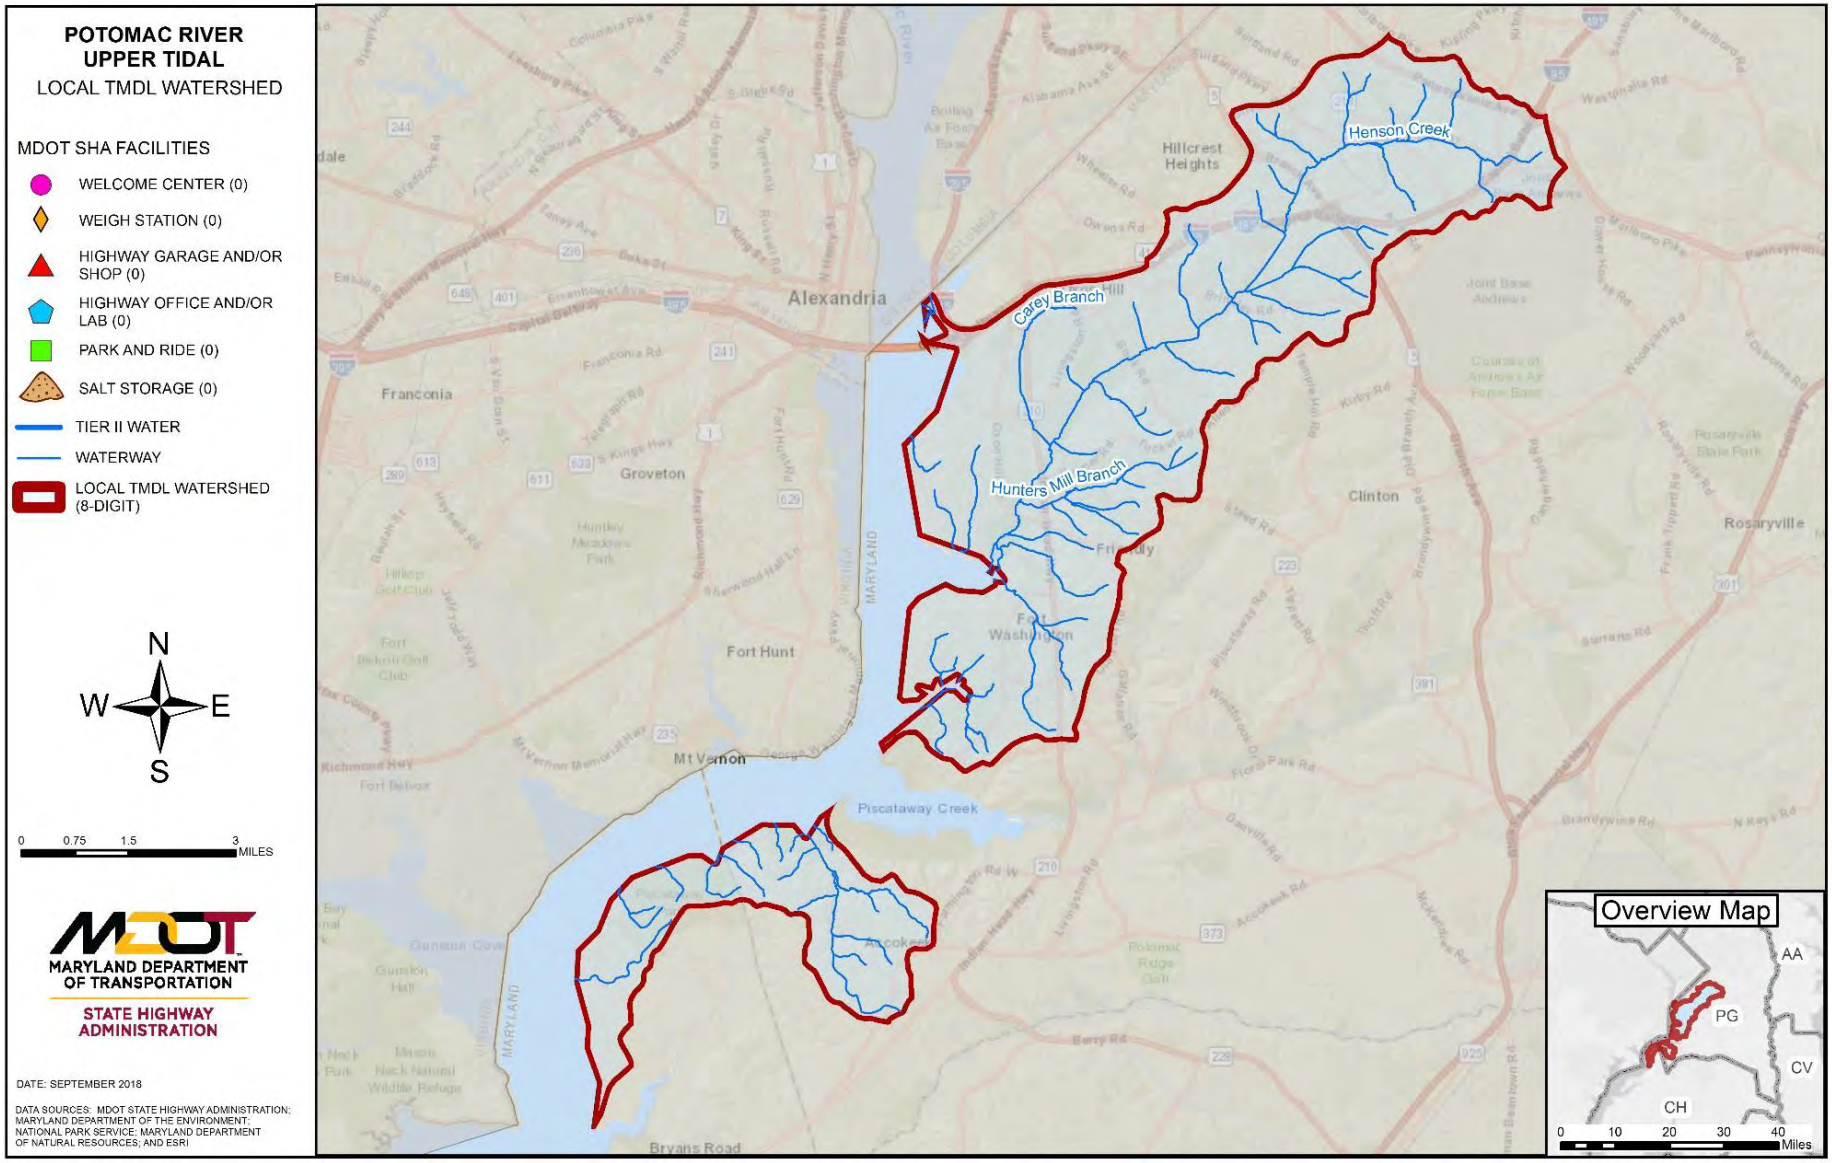


Figure 4-68: Potomac River Upper Tidal Watershed

W.3. Summary of County Assessment Review

As of September 2018, a restoration plan is not available on Prince George's Watershed Restoration Planning Site (http://pgcdoe.net/pgcountyfactsheet/Factsheet/Default) solely for the portion of the Potomac River Upper Tidal watershed in Prince George's County. In late 2014, however, Prince George's County published the *Watershed Existing Condition Report for the Potomac River Watershed*. (Tetra Tech, 2014b). This report is the initial step in the restoration plan development process for the watersheds in the County that have EPA-approved TMDLs. Key points from this report are summarized below.

Land use in the Prince George's County portion of the Potomac River Upper Tidal watershed is primarily urban (62%, of which 72% is residential) and forest (31%). A small percentage is used for agriculture (3%). Impervious area consists of roads (29%), buildings (27%), and parking lots (21%); the biological integrity values of the watershed ranges from poor to very poor in areas of impervious cover, to good in open areas with pervious cover (Tetra Tech, 2014b).

The County performed a BSID of the watershed in 2014 that identified many stressors on the watershed such as the application of road salts during winter, on-site septic systems, SW discharges, and the repeated additions of acidic material (i.e., atmospheric deposition) (Tetra Tech, 2014b).

According to Tetra Tech (2014b), PCBs in the Potomac River Upper Tidal watershed are generally from runoff and stormwater flow occurring at legacy-polluted sites and possibly from the illegal/improper dumping and/or disposal of PCB-containing products.

In addition, Prince George's County completed the *Restoration Plan for PCB-Impacted Waterbodies in Prince George's County*, which includes the County's portion of the Potomac River Upper Tidal watershed (Tetra Tech, 2015a). This plan reported that PCB concentrations in the watershed are linked to TSS and that current recreational fish consumption advisories suggest limiting the consumption of a number of fish species caught in the Potomac River due to PCBs.

PCBs sources within the Prince George's County of the watershed are hotspots from legacy contamination and are highly associated with soils and sediment. A reduction in sediment loads entering the watershed is expected to result in lower PCB concentrations over time. Programmatic Initiatives include public education regarding the handling and proper disposal of PCB light ballasts, PCB-containing equipment in industrial facilities, and PCBs in caulk and sealants used in renovation and repairs (Tetra Tech, 2015a).

The County will also use an adaptive management approach. Adaptive management is important in addressing PCBS because sources of contamination are generally unknown in number and size. The adaptive management approach involves identifying hot spots and conducting subsequent source tracking to hone in on the contributing PCB contamination sources. Adaptive management allows for adjustments of actions to increase effectiveness and for adopting new, more effective strategies. The County will also work with MDE to identify additional methods for PCB reductions (Tetra Tech, 2015a).

As previously stated, while most of the Potomac River Upper Tidal watershed is in Prince George's County, a small piece of the watershed is located in the northwestern tip of Charles County. Accordingly, in February 2018, Charles County published the *Upper, Middle, and Lower Potomac Watershed Assessment* (KCI, 2018). The

following information pertains only to the document's discussion of the "Upper" section of the Potomac watersheds within Charles County, an area which corresponds to Charles County's portion of the Potomac River Upper Tidal watershed.

The Potomac River Upper Tidal watershed in Charles County is 5,615 acres, with forested lands making up much of the land use due to the presence of Piscataway National Park (KCI, 2018). Three types of assessments/surveys were used to identify the present conditions in the Charles County portion of the Potomac River Upper Tidal watershed: 1) an upland assessment (included a neighborhood source assessment [NSA] and a hotspot site investigation [HSI]), 2) a nutrient synoptic survey (included water quality sampling and stream discharge measurement), and 3) an SCA (KCI, 2018).

The upland assessment was used to identify sources of pollution located outside of waterways. An NSA was conducted at one neighborhood/subdivision site—identified as "PU-NSA-1"—in the Potomac River Upper Tidal watershed and an "opportunity index" was assigned based on the area's restoration potential. The opportunity index takes into consideration potential point source pollution locations as well as impervious surface percentages. The PU-NSA-1 site received a moderate restoration potential due to moderate pollution severity. Rain gardens, rain barrels, and conservation landscaping are recommended BMPs for the PU-NSA-1 site. An HSI was also conducted that identified locations within the watershed that have a higher probability of transporting stormwater with an above average pollutant concentration. Potential hotspot areas were identified via desktop GIS efforts as well as aerial imagery. Areas considered for HSI were urbanized areas associated with business, commercial, or industrial land use and identified as having inadequate stormwater management. No areas within the Potomac River Upper Tidal watershed were considered hotspots or potential hotspots as a result of the HSI (KCI, 2018).

The nutrient synoptic survey included water quality sampling conducted across the watershed in locations that would accurately portray the watershed as a whole. Methods such as upstream and downstream sampling were used to show how specific infrastructure impacted waterways in critical areas. Stream discharge measurements were also taken at each of the water quality monitoring locations. Quality and quantity profiling of streams allowed for specific BMP recommendations at specific locations. These recommendations typically involved outfall restoration. Results of the water quality sampling showed low nitrogen (<1.5 mg/L) and nitrate (<0.01kg/ha/day) loads. Total phosphorus loads occurring in the Potomac River Upper Tidal watershed were also low at all test locations. If water quality deterioration was to occur in the future, the recommended BMP solution would be specific to the type and source of the pollution (KCI, 2018).

Lastly, a SCA was conducted to assess critical stream sections for several possible impairments including erosion, channel alteration, and exposed outfall pipes. Both a desktop review and a field assessment were utilized for the SCA. Potential reforestation sites were searched for during the SCA assessment as well. As a result, one potential tree planting project site was identified in the Charles's County portion of the Potomac River Upper Tidal watershed. The site—identified as "PU_TP_1"—is 3.3 acres located on private property. If completed, the PU_TP_1 project is expected to result in a TSS load reduction of 268.5 pounds per year (KCI, 2018).

W.4. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Potomac River Upper watershed is shown in **Figure 4-69** which illustrates that 21 grid cells have been reviewed, encompassing portions of 13 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 74 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 63 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 11 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 57 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 21 sites constructed or under contract.
- 10 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 26 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified six (6) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Two (2) additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- Four (4) sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

No grass swale rehabilitation sites were identified within this watershed for potential restoration.

Outfall Stabilization

Preliminary evaluation identified 180 outfalls potential for stabilization. Further analysis of these sites resulted in:

- Three (3) outfall site constructed or under contract
- 17 outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- 160 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified one (1) existing structural SW controls as potential retrofits. Further analysis of this location resulted in:

- One (1) retrofit site deemed potentially viable for retrofit and pending further analysis may be a candidate for future restoration opportunities.

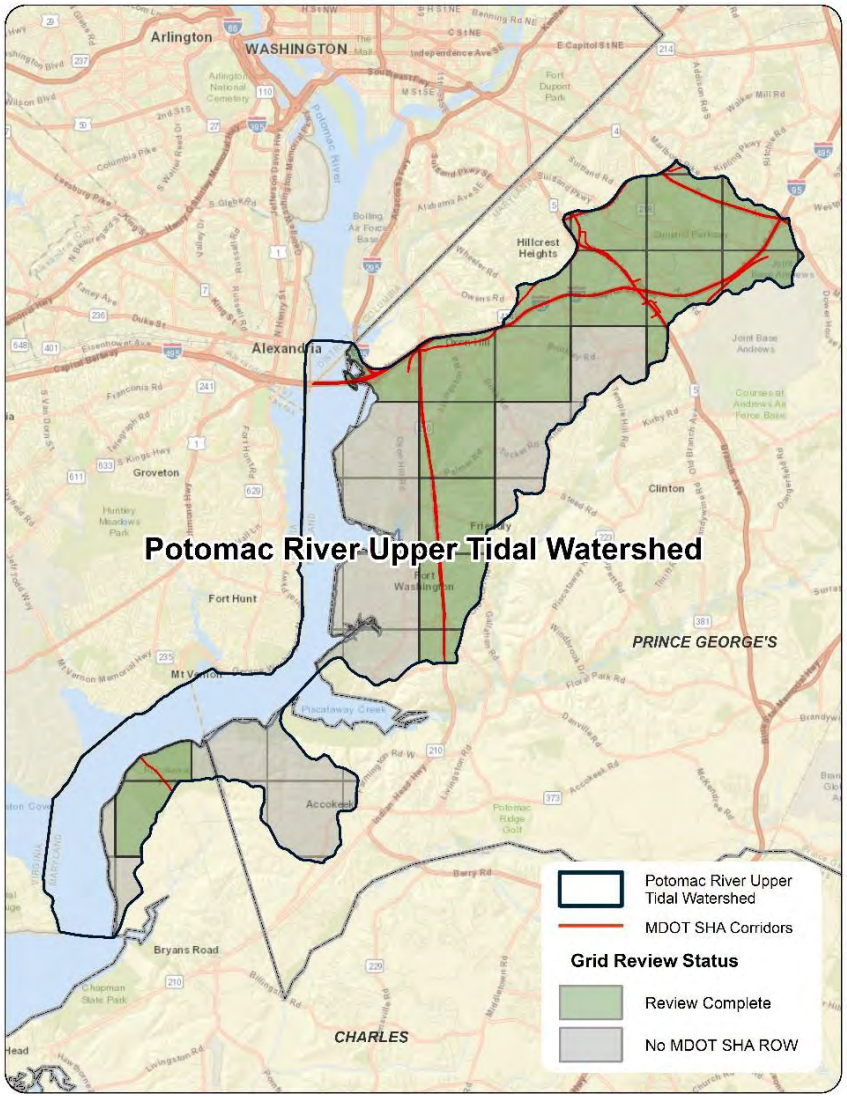


Figure 4-69: Potomac River Upper Tidal Site Search Grids

W.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet PCB reduction in the Potomac River Upper Tidal watershed are shown in **Table 4-87**. Projected PCB reductions using these practices are described in **Part III, Coordinated TMDL Implementation Plan** and are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the TMDL baseline. In this case, the baseline is 2010;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the PCB TMDL, MDOT SHA will meet 5.4 percent of the MDE 92.1 percent load reduction requirement through implementation of BMPs shown in **Table 4-87.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Potomac River Upper Tidal Fresh watershed total $1,324,000. These projected costs are based on an average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-88** for a summary of estimated BMP costs.

Figure 4-70 is a map of MDOT SHA's restoration practices in the Potomac River Upper Tidal watershed, including those that are under design or construction. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-87: Potomac River Upper Tidal PCB BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	250.3	4.8	11.0	TBD	266.1
Inlet Cleaning[1]	dry tons		5.3	32.4	TBD	37.7
Street Sweeping[1]	acres swept		30.1		TBD	30.1
Load Reductions	PCB g/yr.		0.06	0.06	1.14	
				Total Projected Reduction	**1.14**	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-88: Potomac River Upper Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$234,000	$866,000	$1,100,000
Inlet cleaning	$24,000	$185,000	$209,000
Street Sweeping	$15,000		$15,000
Total			$1,324,000

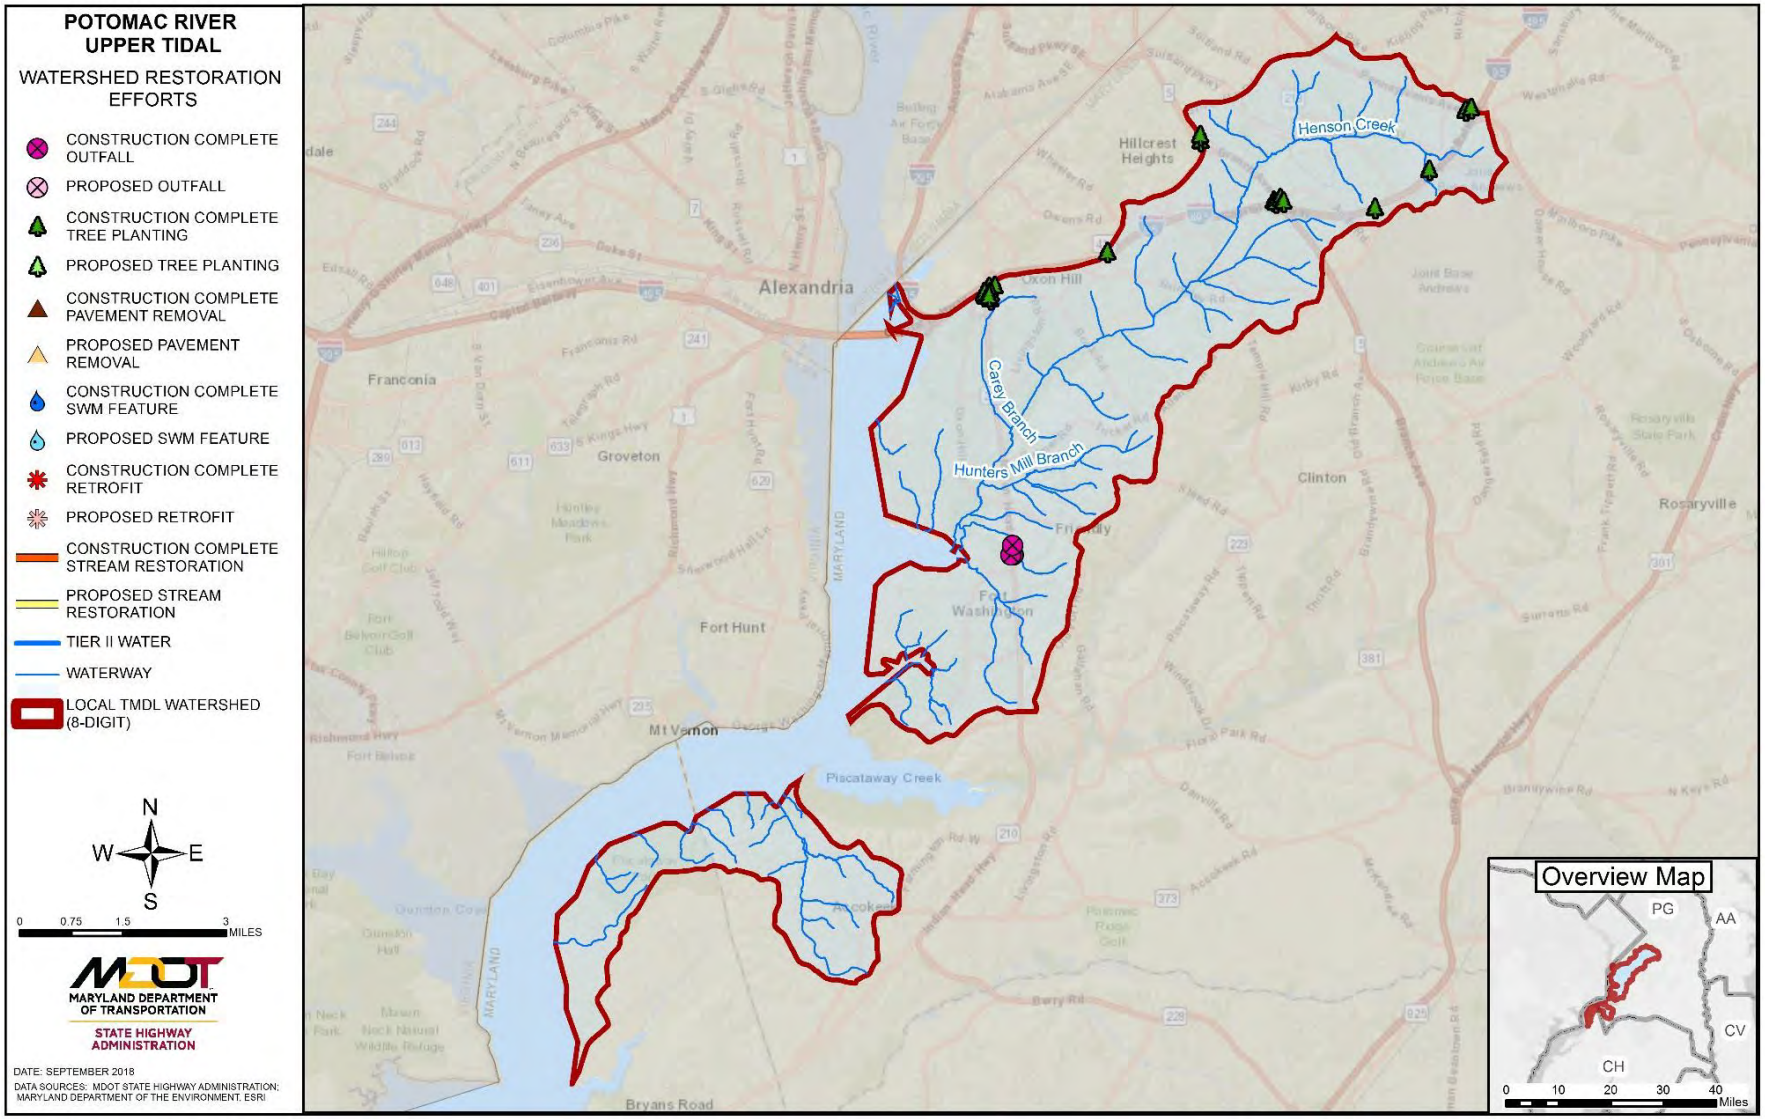


Figure 4-70: MDOT SHA Programmed Restoration Strategies within the Potomac River Upper Tidal Watershed

X. ROCK CREEK WATERSHED

X.1. Watershed Description

The Rock Creek watershed encompasses 61 square miles within Montgomery County, Maryland and Washington, D.C. Rock Creek headwaters are located in the Laytonsville area from which the river flows south to Washington, D.C, where it empties into the Potomac River. Tributary creeks and streams of the Rock Creek Watershed include Alexandra Aqueduct, Crabbs Creek, Mill Creek, and North Branch Rock Creek. The Rock Creek watershed in Maryland comprises primarily of residential land use, covering approximately 65 percent of the watershed. Municipal/institutional land comprises approximately ten percent, and roadway comprises approximately eight percent. Approximately six percent is identified as forest, open water, or bare ground.

There are 801.0 centerline miles of MDOT SHA roadway located within the Rock Creek watershed. The associated ROW encompasses 1,358.1 acres, of which 832.8 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) salt storage facility, and one (1) highway garage or shop. See **Figure 4-71** for a map of the watershed.

X.2. MDOT SHA TMDLs within Rock Creek Watershed

MDOT SHA is included in both phosphorus (MDE, 2013e) and sediment (MDE, 2011j) TMDLs. Phosphorus is to be reduced by 32 percent and sediment is to be reduced by 37.9 percent, as shown in **Table 3-2**.

X.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Rock Creek watershed is shown in **Figure 4-72** which illustrates that 45 grid cells have been reviewed, encompassing portions of 25 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 173 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 74 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 99 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 17 locations as potential tree planting locations. Further analysis of these locations resulted in:

- Five (5) sites constructed or under contract.
- One (1) additional site deemed potentially viable for tree planting and pending further analysis, may be a candidate for future restoration opportunities.

- 11 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 12 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Three (3) sites constructed or under contract.
- Nine (9) sites deemed not viable for stream restoration.

Grass Swale Rehabilitation

Preliminary evaluation identified nine (9) sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Four (4) new structural SW controls constructed or under contract.
- One (1) additional site deemed potentially viable for new structural SW control and pending further analysis, may be a candidate for future restoration opportunities.
- Four (4) sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 41 outfalls potential for stabilization. Further analysis of these sites resulted in:

- One (1) outfall site constructed or under contract.
- 40 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 12 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of three (3) existing structural SW controls constructed or under contract.
- Nine (9) retrofit sites deemed not viable for retrofit and have been removed from consideration.

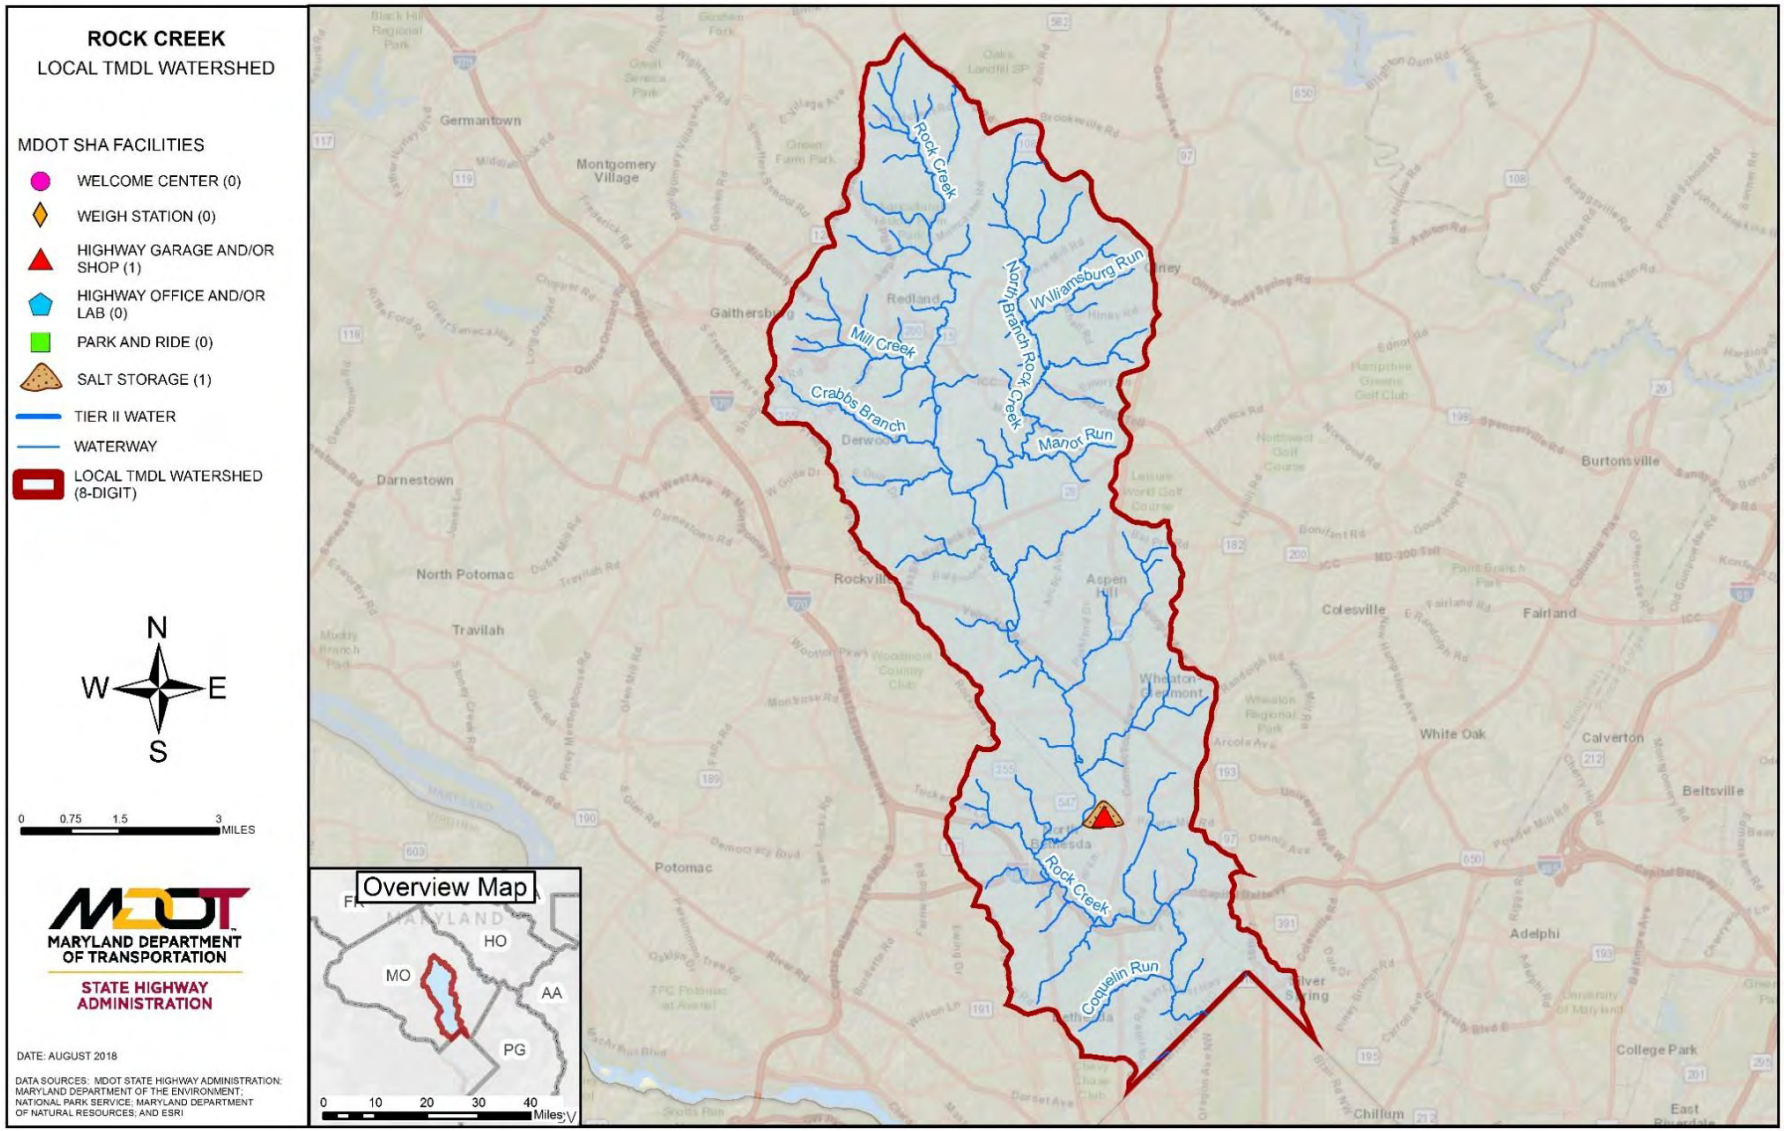


Figure 4-71: Rock Creek Watershed

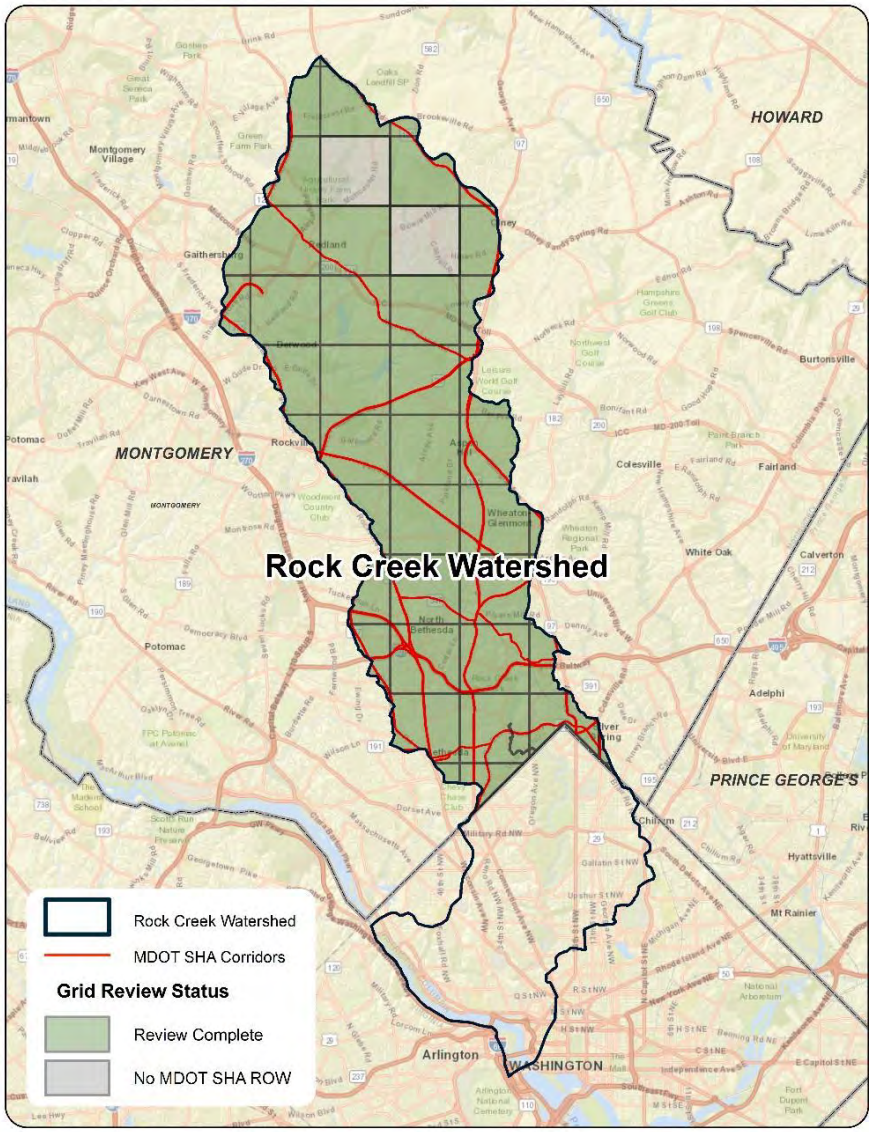


Figure 4-72: Rock Creek Site Search Grids

X.4. Summary of County Assessment Review

Waters within the Rock Creek watershed are subject to the following impairments as noted on MDE's 303(d) List:

- *Enterococcus*;
- Phosphorus (Total);
- Temperature, water; and
- TSS.

The *Rock Creek Implementation Plan* (Biohabitats et al., 2012c), prepared by the Montgomery County Department of Environmental Protection, was adopted in January 2012. This document provides a comprehensive plan for watershed restoration targeting bacteria reduction (with a TMDL), sediment and nutrient reduction (with a TMDL), runoff management and impervious cover treatment, and trash management. The majority of the stream resource conditions in Rock Creek were assessed as "fair" (53 percent), 18 percent were assessed as "good," and 22 percent as "poor." The remaining 2 percent were assessed as "excellent" (Biohabitats et al., 2012c).

Montgomery County's BMPs proposed within Rock Creek watershed are estimated to result in 52 percent load reductions for total nitrogen, 53 percent for total phosphorus, and 49 percent for TSS. An approximate 55 percent reduction of trash over baseline conditions is also anticipated (Biohabitats et al., 2012c). Preferred BMPs include ESD property retrofits, new structural SWM facilities, retrofitting underperforming SWM facilities, and stream restoration projects (Biohabitats et al., 2012c). Projects sites for ESD, pond retrofits, and new stormwater ponds have been identified and are focused on county-owned properties and priority neighborhood areas, which do not include MDOT SHA ROW.

X.5. MDOT SHA Pollutant Reduction Strategies

Rock Creek is listed for both phosphorus and sediment with each TMDL having a different baseline year, 2009 for phosphorus and 2005 for sediment. Proposed practices to meet the phosphorus and sediment reduction in the Rock Creek watershed are shown in **Table 4-89 and 4-90.** Projected phosphorus and sediment reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the phosphorus and sediment TMDL baseline. In this case, the phosphorus baseline is 2009 and the sediment baseline is 2005;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

MDOT SHA will accomplish the percent reduction presented in **Table 3-2**. Estimated costs to design, construct, and implement BMPs within the Rock Creek watershed total $14,663,000. These projected costs are based on an average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-91** for a BMP strategy cost breakdown.

Figure 4-73 is a map of the MDOT SHA restoration practices and includes those that are under design and construction. Inlet cleaning and street sweeping are not shown.

Table 4-89: Rock Creek Restoration Phosphorus BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	141.0	6.2	7.5	N/A	154.7
Retrofit	drainage area acres		29.4		N/A	29.4
Tree Planting	acres of tree planting		8.0	1.3	N/A	9.3
Stream Restoration	linear feet		13,764.0	398.0	N/A	14,162.0
Outfall Stabilization	linear feet			600.0		600.0
Inlet Cleaning[1]	dry tons		29.7			29.7
Street Sweeping[1]	acres swept		29.5			29.5
Load Reductions	TP EOS lbs./yr.		992	1,077	0	
					Total Projected Reduction	1,077	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-90: Rock Creek Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	118.2	6.2	7.5	N/A	131.9
Retrofit	drainage area acres		29.4		N/A	29.4
Tree Planting	acres of tree planting		8.0	1.3	N/A	9.3
Stream Restoration	linear feet		13,764.0	398.0	N/A	14,162.0
Outfall Stabilization	linear feet			600.0	N/A	600.0
Inlet Cleaning[1]	dry tons		29.7		N/A	29.7
Street Sweeping[1]	acres swept		29.5		N/A	29.5
Load Reductions	TP EOS lbs./yr.		661,381	721,308	0	
				Total Projected Reduction	721,308	

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-91: Rock Creek Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$166,000	$2,238,000	$2,404,000
Retrofits	$1,187,000		$1,187,000
Tree Planting	$245,000	$40,000	$285,000
Stream Restoration	$9,191,000	$266,000	$9,457,000
Outfall Stabilization		$1,181,000	$1,181,000
Inlet cleaning	$136,000		$136,000
Street Sweeping	$13,000		$13,000
Total			$14,663,000

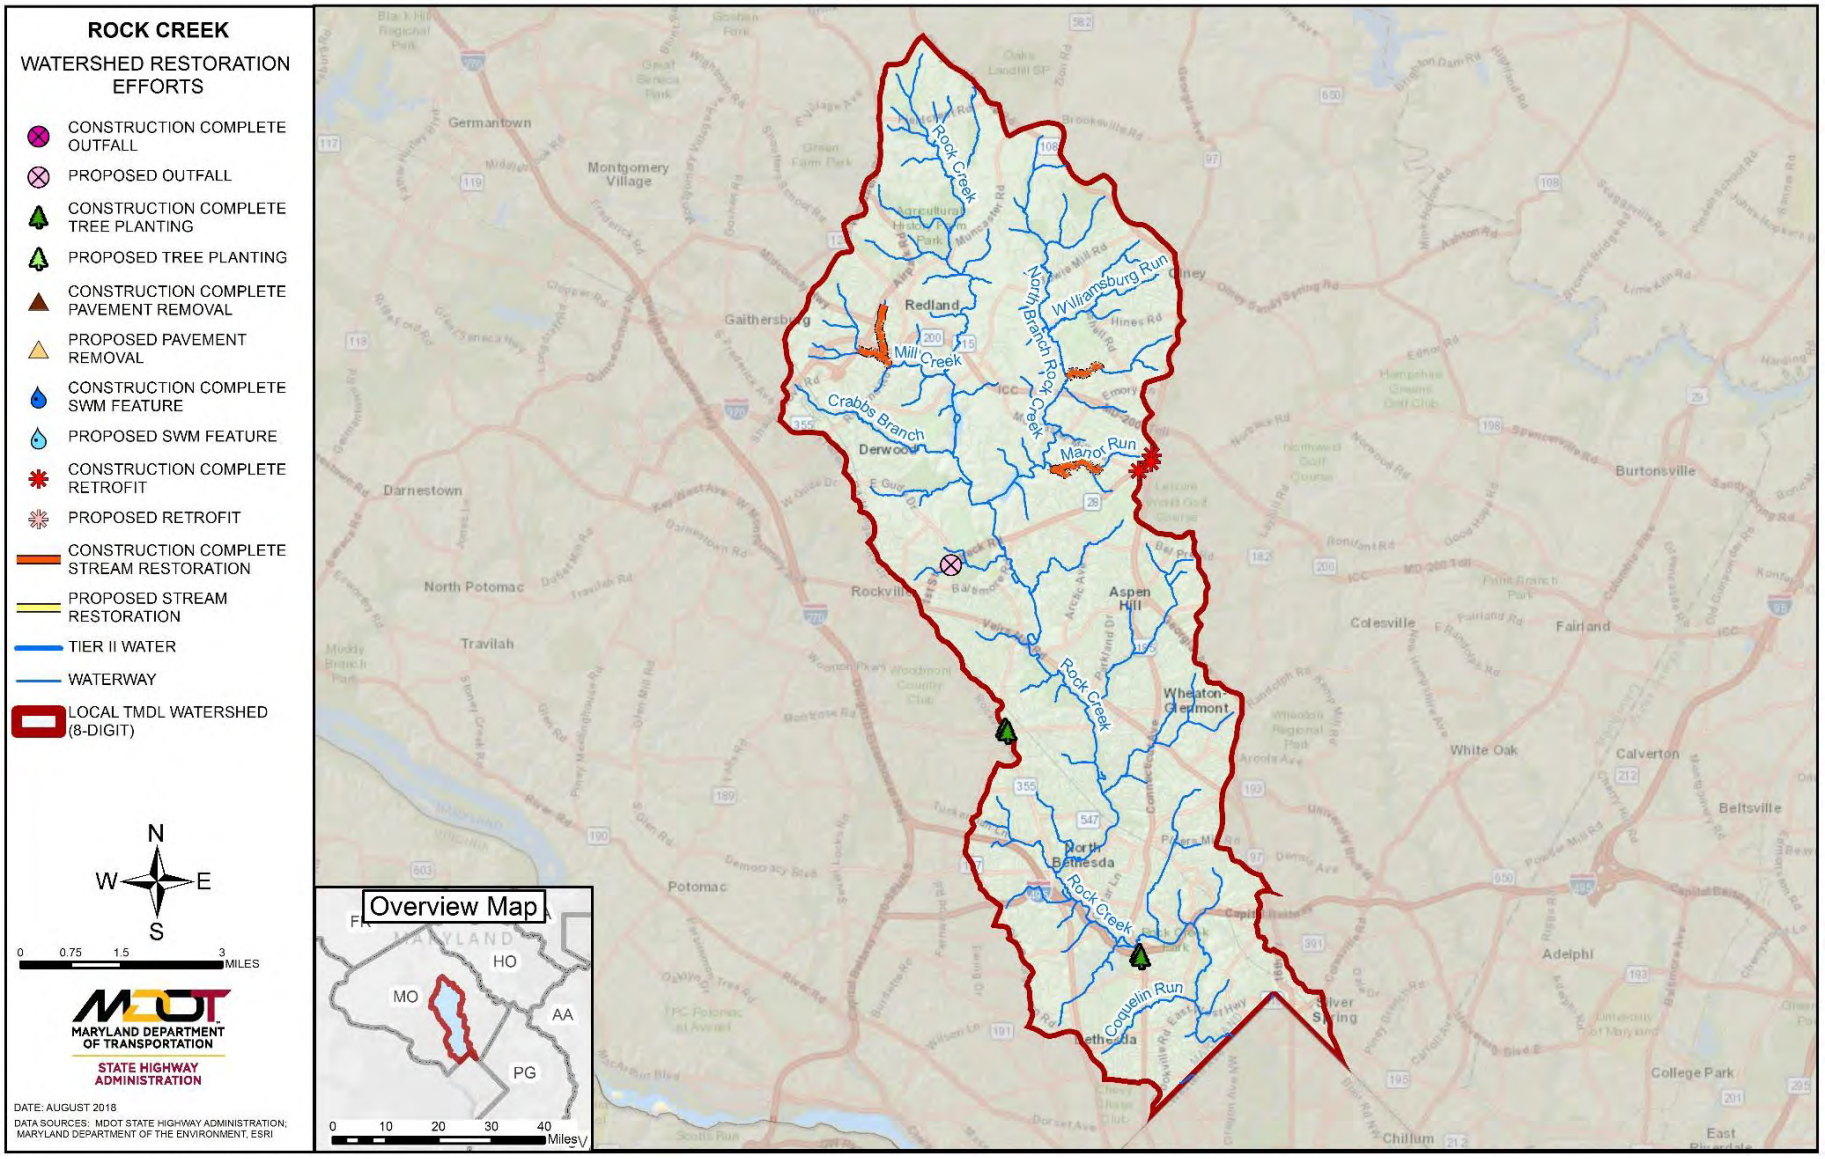


Figure 4-73: MDOT SHA Restoration Strategies within the Rock Creek Watershed

Y. SENECA CREEK WATERSHED

Y.1. Watershed Description

The Seneca Creek watershed encompasses 129 square miles located solely within Montgomery County. Seneca Creek begins in the northwestern portion of the County, near Damascus. Seneca Creek flows about 27 miles south, passing through the City of Gaithersburg, before joining the Potomac River. Tributary creeks and streams of the Seneca Creek watershed include Bucklodge Branch, Cabin Branch, Goshen Branch, Gunners Branch, Long Draught Branch, Magruder Branch, North Creek, Tenmile Creek, Whetstone Run, and Wildcat Branch.

There are 676.2 centerline miles of MDOT SHA roadway located within the Seneca Creek watershed. The associated ROW encompasses approximately 1,504.9 acres, of which 1,182.9 acres are impervious. MDOT SHA facilities located within the watershed consist of two (2) salt storage facilities, two (2) park and ride facilities, and one (1) highway garage or shop. See **Figure 4-74** for a map of the watershed.

Y.2. MDOT SHA TMDLs within Seneca Creek Watershed

MDOT SHA is included in the sediment (TSS) TMDL (MDE, 2011k) and has a reduction requirement of 44.9 percent, as shown in **Table 3-2**.

Y.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Seneca Creek watershed is shown in **Figure 4-75** which illustrates that 65 grid cells have been reviewed, encompassing portions of 14 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 445 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- Seven (7) new structural SW controls constructed or under contract.
- 195 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 243 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 144 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 30 sites constructed or under contract.
- 17 additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 97 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 18 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Two (2) sites constructed or under contract.
- Two (2) additional sites deemed potentially viable for stream restoration and pending further analysis may be candidates for future restoration opportunities.
- 14 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 23 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- One (1) additional site deemed potentially viable for new structural SW control and pending further analysis, may be a candidate for future restoration opportunities.
- 22 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

Preliminary evaluation identified 10 outfalls potential for stabilization. Further analysis of these sites resulted in:

- Three (3) outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- Seven (7) outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 25 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of two (2) existing structural SW controls constructed or under contract.
- Three (3) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 20 retrofit sites deemed not viable for retrofit and have been removed from consideration.

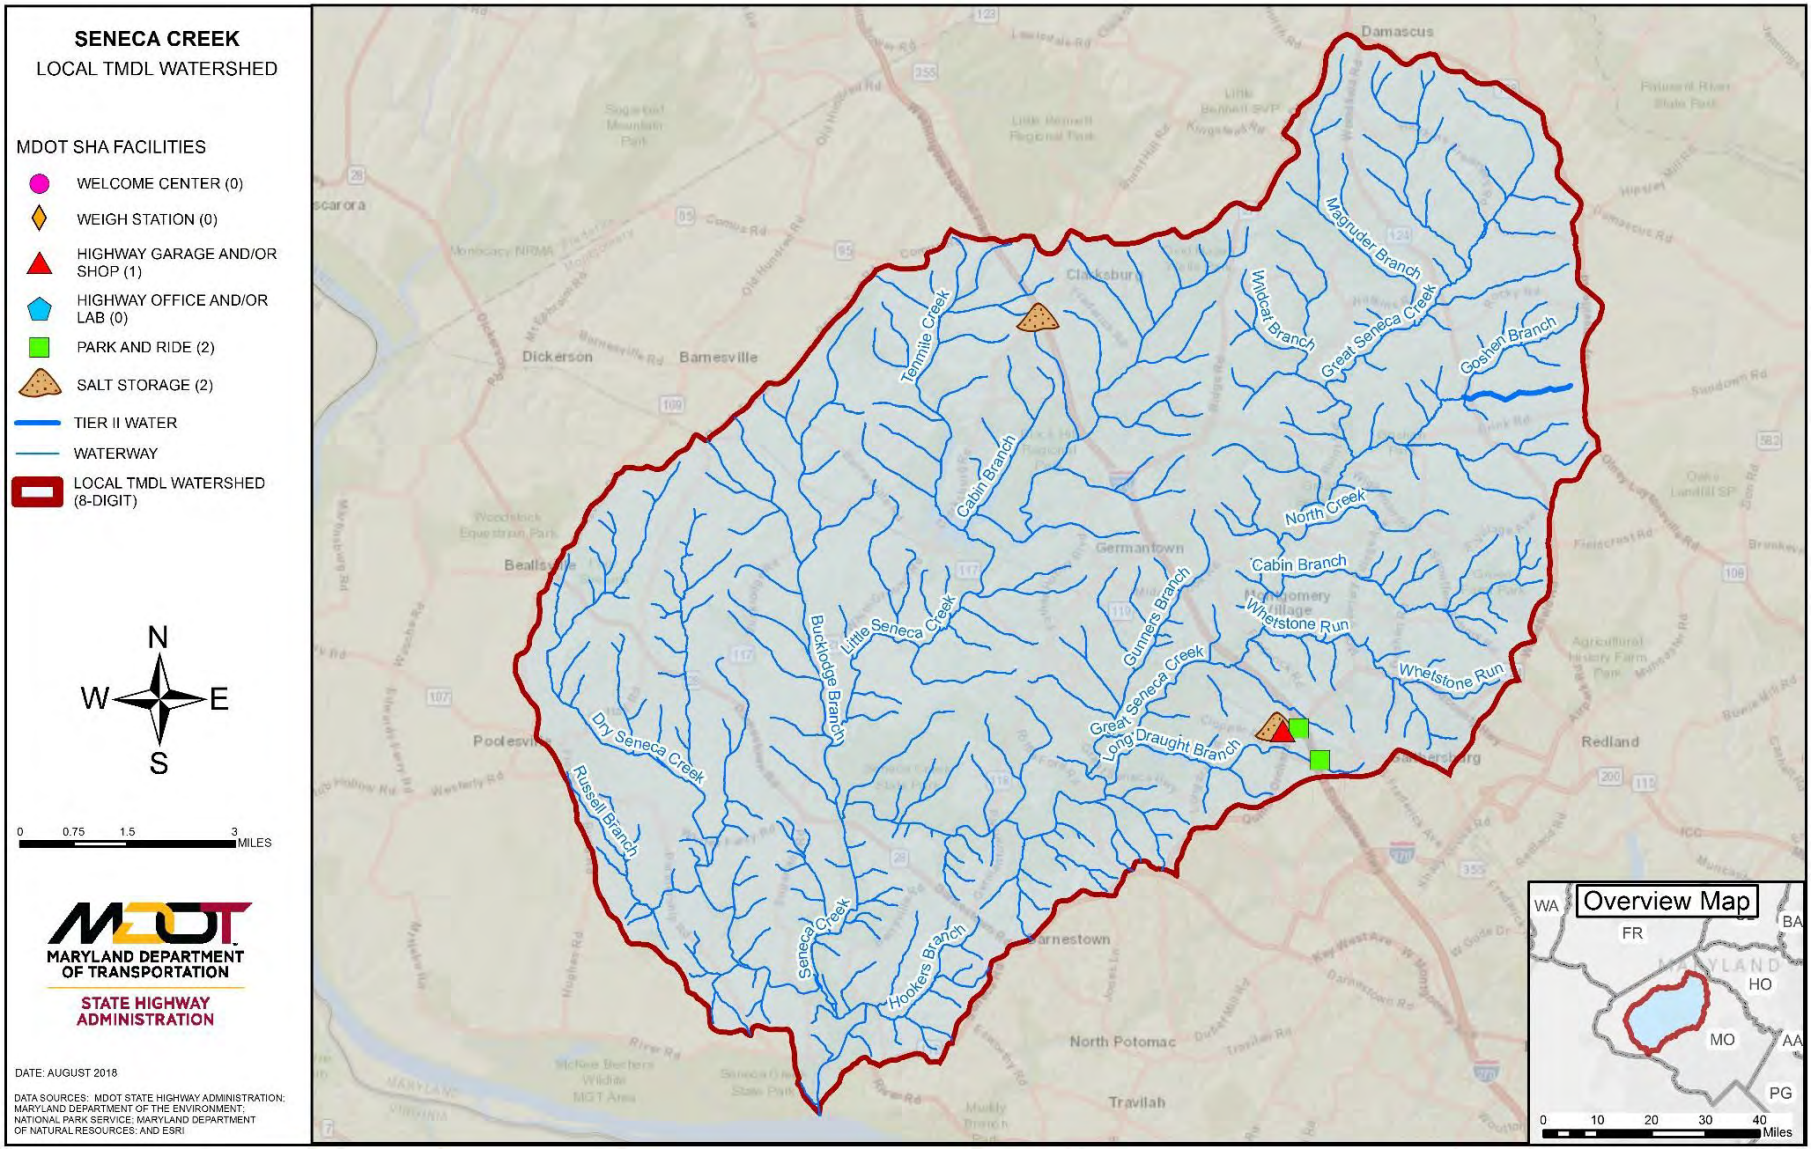


Figure 4-74: Seneca Creek Watershed

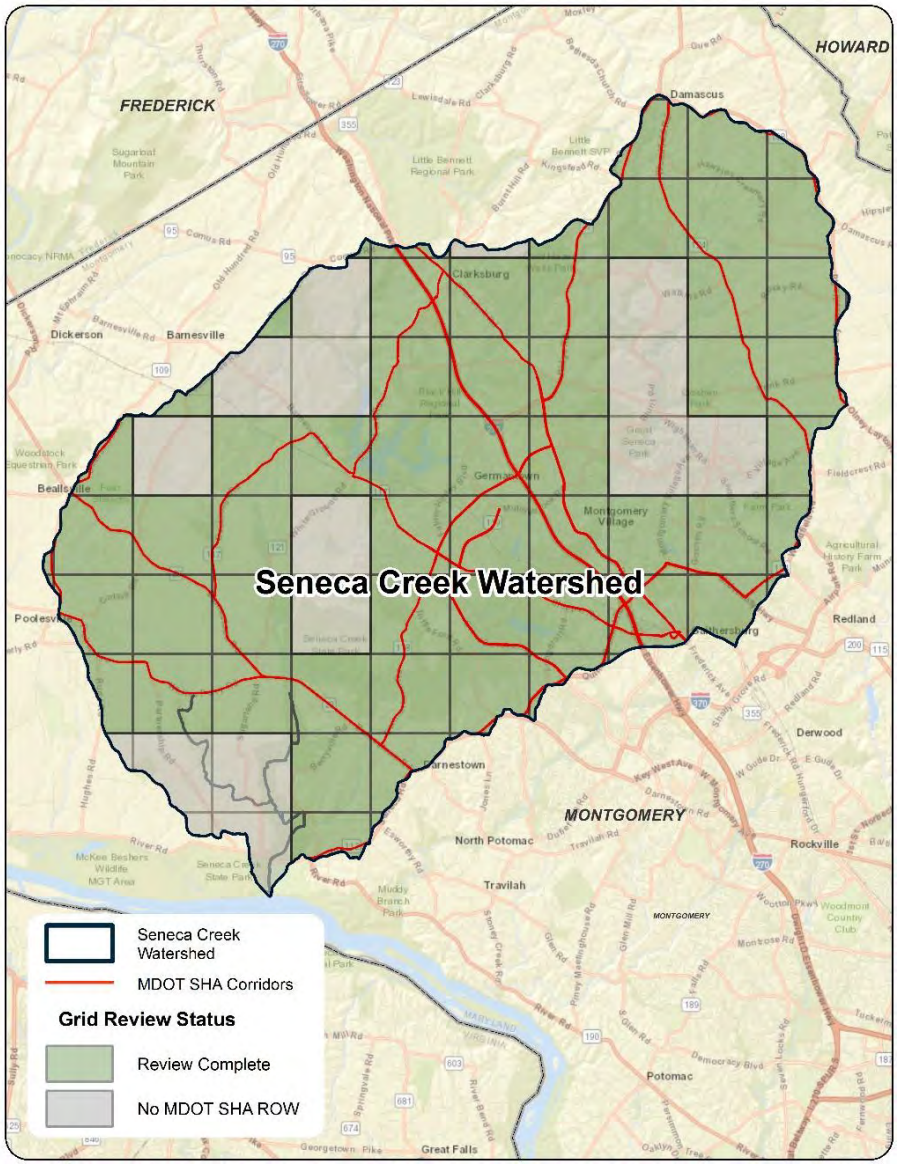


Figure 4-75: Seneca Creek Site Search Grids

Y.4. Summary of County Assessment Review

Waters within the Seneca Creek Watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- Phosphorus (Total);
- Sedimentation/siltation;
- Temperature, water; and
- TSS.

The Montgomery County Department of Environmental Protection (MO-DEP) has published the *Dry Seneca Creek & Little Seneca Creek Pre-Assessment Report* (Versar et al., 2011c) and the *Great Seneca Subwatershed Implementation Plan* (HWG et al., 2012b). MO-DEP also published the *Great Seneca Creek Watershed Study* in 1999 (MO-DEP, 1999). The City of Gaithersburg published the *Middle Great Seneca Watershed Study* in 2013 (URS, 2013) and the *Lower Great Seneca Creek Watershed Study* in 2014 (URS, 2014c).

The Seneca Creek watershed is mostly comprised of urban, forest, agriculture, and pasture land uses. Urban land covers approximately 38.5 percent of the watershed (7.5 percent of which is impervious), forested land is approximately 37.3 percent, agricultural is approximately 20.7 percent, and pasture is 3.5 percent (Versar et al., 2011c).

Within the Upper Great Seneca, the majority of the streams were rated as "good" (48 percent) or "fair" (41 percent), with 11 percent not assessed. The highest quality streams were found in the Upper and Lower Great Seneca watersheds, with poorer streams, primarily rated as "fair," found in the Middle Great Seneca watershed due to higher levels of development surrounding Gaithersburg. Stream conditions within the Dry Seneca Creek and Little Seneca Creek subwatersheds were rated as "excellent" to "poor," with most streams being rated as "good" (HWG, 2012b).

The *Dry Seneca Creek & Little Seneca Creek Pre-Assessment Report* (Versar et al., 2011c) identified priorities for stormwater BMP retrofits as the areas treated by pre-1986 permitted SWM facilities. Using ESD, SWM retrofits, and new SWM ponds are the preferred BMP types for these areas. Medium and lower priority sites did not include any MDOT SHA ROW, and focused on county-owned and privately-owned sites.
The *Middle Great Seneca Creek Watershed Study* identified five proposed stream restoration projects (URS, 2013):

- Stream Reach GST-1 on Whetstone Run, experiencing meandering, downcutting, over-widening, lack of vegetation and poor aquatic habitat. Proposed measures include grade control, bank protection, and channel realignment.
- Stream Reach GST-2a on Watkins Mill Run, experiencing erosion, limited riparian zone, and lack of vegetation. Proposed measures include grade control, and bank protection.
- Stream Reach GST-2b on Watkins Mill Run, experiencing channelization, steep banks, invasive species, and incision. Proposed measures include flow diversion and bed and bank stabilization.
- Stream Reach 2012-1a on the unnamed tributary, experiencing channelization, poor aquatic habitat, and bank erosion. Proposed measures include flow diversion and bed and bank stabilization.
- Stream Reach 2012-1b on the unnamed tributary, experiencing incision, trash, lack of vegetation, downcutting, and bank erosion. Proposed measures include step pool storm conveyance, grade control, and bank regrading.

The *Lower Great Seneca Creek Watershed Study* (URS, 2014c) identified two proposed stream restoration projects:

- Rabbit East #4 Stream Reach, experiencing steep banks, bank erosion, and incised channels. Proposed measures include grade control, bank protection, and channel realignment.
- Solitaire North Stream Reach, experiencing steep banks, bank erosion, and incised channels. Proposed measures comprise bed and bank stabilization.

Y.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reduction in the Seneca Creek watershed are shown in **Table 4-92**. Projected sediment reduction using these practices are shown in **Table 3-2**. Four timeframes are included in the table:

- BMPs built before the TMDL baseline. In this case, the baseline is 2005;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL, MDOT SHA will meet 71.6 percent of the MDE 44.9 percent load reduction requirement through implementation of BMPs shown in **Table 4-92**. MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E**.

Estimated costs to design, construct, and implement BMPs within the Seneca Creek watershed total $10,117,000. These projected costs are based on an average cost per impervious acre treated derived from a cost history for each BMP type. Please see **Table 4-93** for a BMP strategy cost breakdown.

Figure 4-76 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design and constructed. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-92: Seneca Creek Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2005)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	684.9	16.8	15.7	TBD	717.4
Retrofit	drainage area acres		32.5		TBD	32.5
Tree Planting	acres of tree planting		29.2	2.8	TBD	31.9
Stream Restoration	linear feet		6,623.0	837.9	TBD	7,460.9
Outfall Stabilization	linear feet			400.0	TBD	400.0
Inlet Cleaning[1]	dry tons		15.2	58.1	TBD	73.3
Street Sweeping[1]			20.6		TBD	20.6
Load Reductions	TSS EOS lbs/yr.		363,663	426,812	596,434	
					Total Projected Reduction	596,434

[1] *Inlet cleaning and street sweeping are annual practices.*

Table 4-93: Seneca Creek Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$1032,000	$447,000	$1,479,000
Retrofits	$1,490,000		$1,490,000
Tree Planting	$892,000	$84,000	$976,00
Stream Restoration	$4,423,000	$560,000	$4,983,000
Outfall Stabilization		$787,000	$787,000
Inlet cleaning	$60,000	$332,000	$392,000
Street Sweeping	$10,000		$10,000
Total			$10,117,000

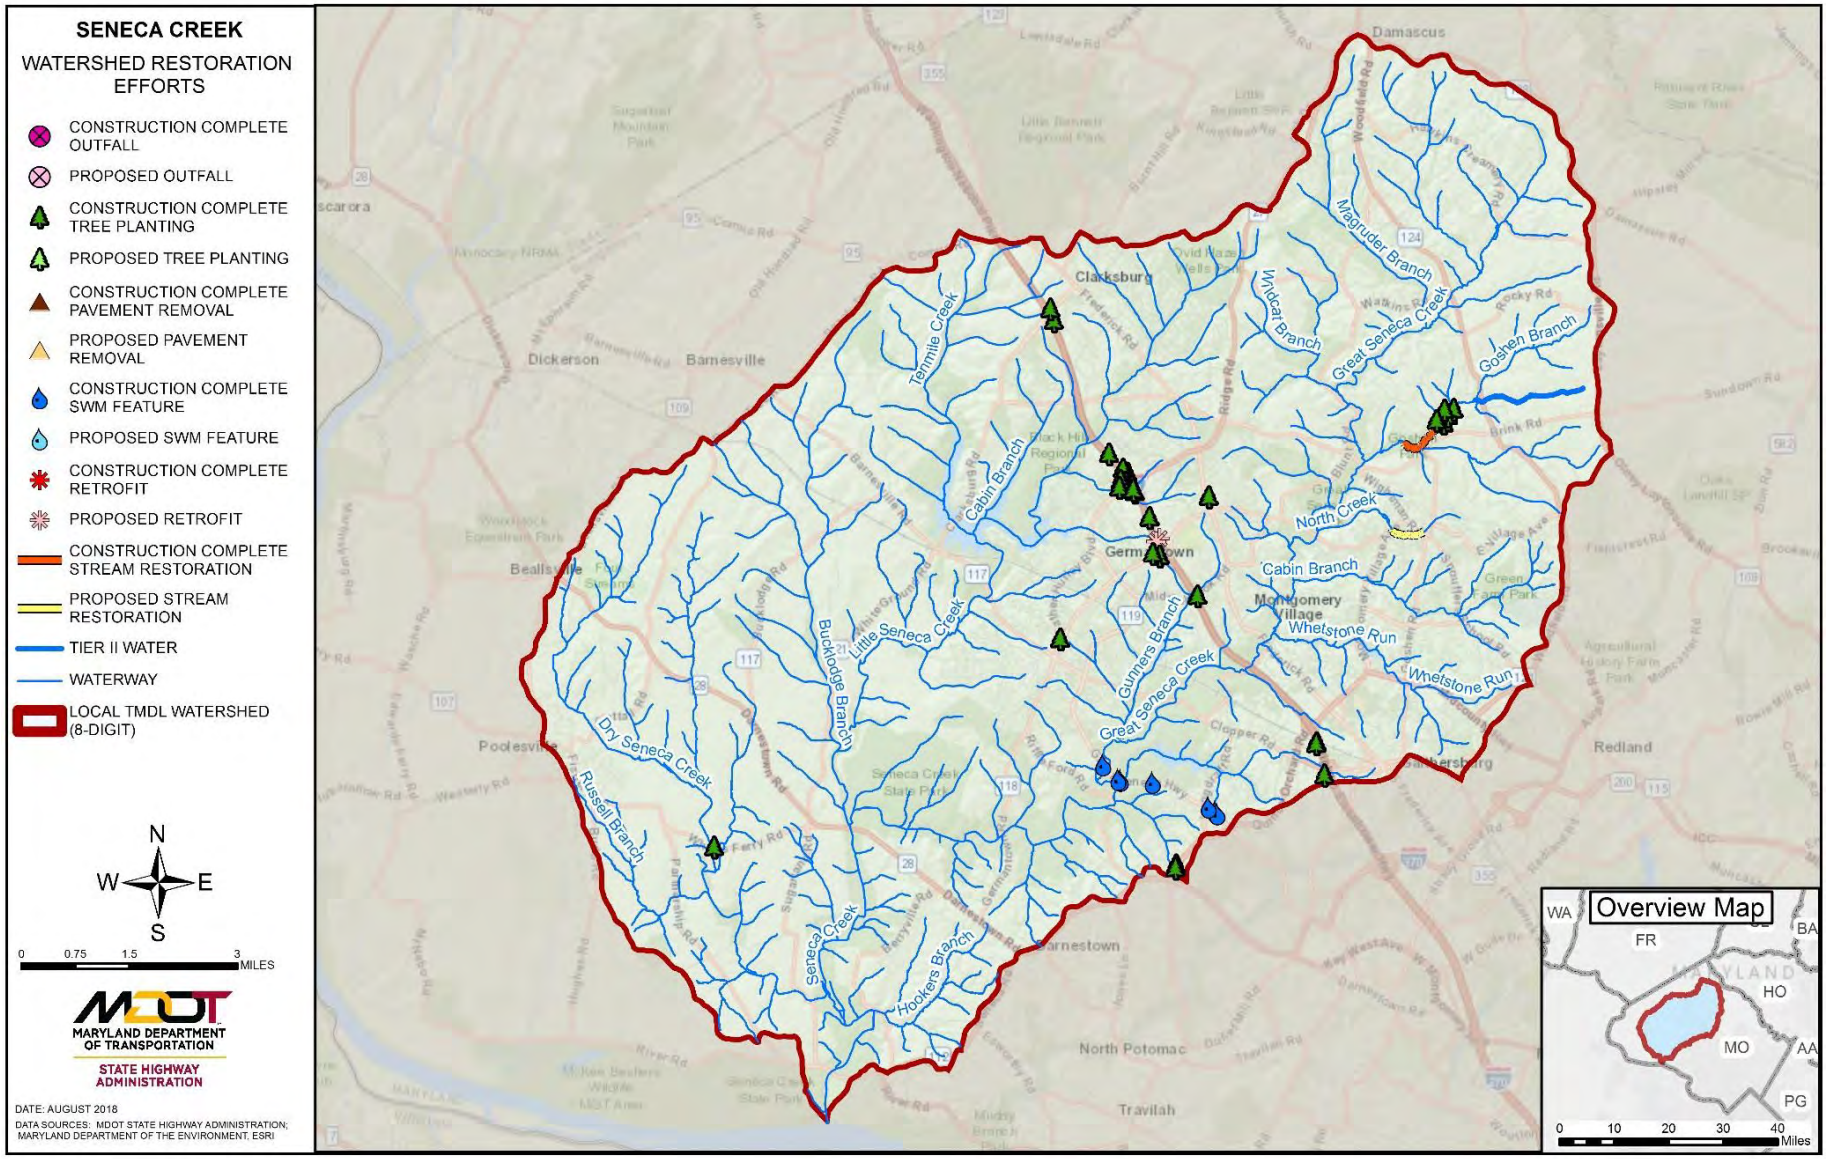


Figure 4-76: MDOT SHA Restoration Strategies within the Seneca Creek Watershed

Z. SOUTH RIVER WATERSHED

Z.1. Watershed Description

Located entirely within central Anne Arundel County, the South River watershed (Maryland 8-digit Basin Code: 02131003) drains to the South River, which discharges to the Chesapeake Bay. The South River watershed is approximately 56.6 square miles (36,200 acres), not including water/wetlands; approximately 300 acres of the watershed is covered by water. There are no "high quality," or Tier II, stream segments within the South River watershed. The entire South River watershed is within the Coastal plain geologic province of Maryland. The total population in the South River watershed is approximately 75,800 (MDE, 2017c).

The designated use of the non-tidal portion of the South River is Use Class I – Water Contact Recreation and Protection of Nontidal Warmwater Aquatic Life (MDE, 2017c).

Waters within the South River watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Chlorides;
- Fecal Coliform;
- Nitrogen (Total);
- PCB in Fish Tissue;
- Phosphorus (Total); and
- TSS.

There are 76 centerline miles of MDOT SHA roadway located within the South River watershed. The associated ROW encompasses 1,291 acres, of which 433 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) highway office or lab, two (2) park and rides, and one (1) salt storage facility.

See **Figure 4-77** for a map of MDOT SHA facilities within the South River watershed.

Z.2. MDOT SHA TMDLs within South River Watershed

MDOT SHA is included in the sediment TMDL (MDE, 2017c), with a reduction requirement of 28 percent, as shown in **Table 3-2**. This TMDL only applies to the non-tidal portion of the South River watershed. There are no other pollutants with TMDLs and MDOT SHA WLAs for the non-tidal portion of this watershed. There is a PCB TMDL for the mesohaline portion of the South River watershed.

Z.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan, Section C** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the South River watershed is shown in **Figure 4-78** which illustrates that 47 grid cells have been reviewed, encompassing portions of 14 state route corridors. Results of the visual inventory categorized by BMP type follow.

Structural SW Controls

Preliminary evaluation identified 164 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 19 new structural SW controls constructed or under contract.

- 118 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 27 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 47 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 27 sites constructed or under contract.
- 20 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 12 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Three (3) sites constructed or under contract.
- Nine (9) sites deemed not viable for stream restoration.

Grass Swale Rehabilitation

No grass swale rehabilitation sites were identified in this watershed for restoration.

Outfall Stabilization

Preliminary evaluation identified 91 outfalls along 2 State roadway corridors as potential for stabilization. Further analysis of these sites resulted in:

- 13 outfall sites deemed potentially viable for outfall stabilization efforts and pending further analysis, may be candidates for future restoration opportunities.
- 78 outfall sites deemed not viable for outfall stabilization and have been removed from consideration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified 20 existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of seven (7) existing structural SW controls constructed or under contract.
- Three (3) retrofit sites deemed potentially viable for retrofit and pending further analysis may be candidates for future restoration opportunities.
- 10 retrofit sites deemed not viable for retrofit and have been removed from consideration.

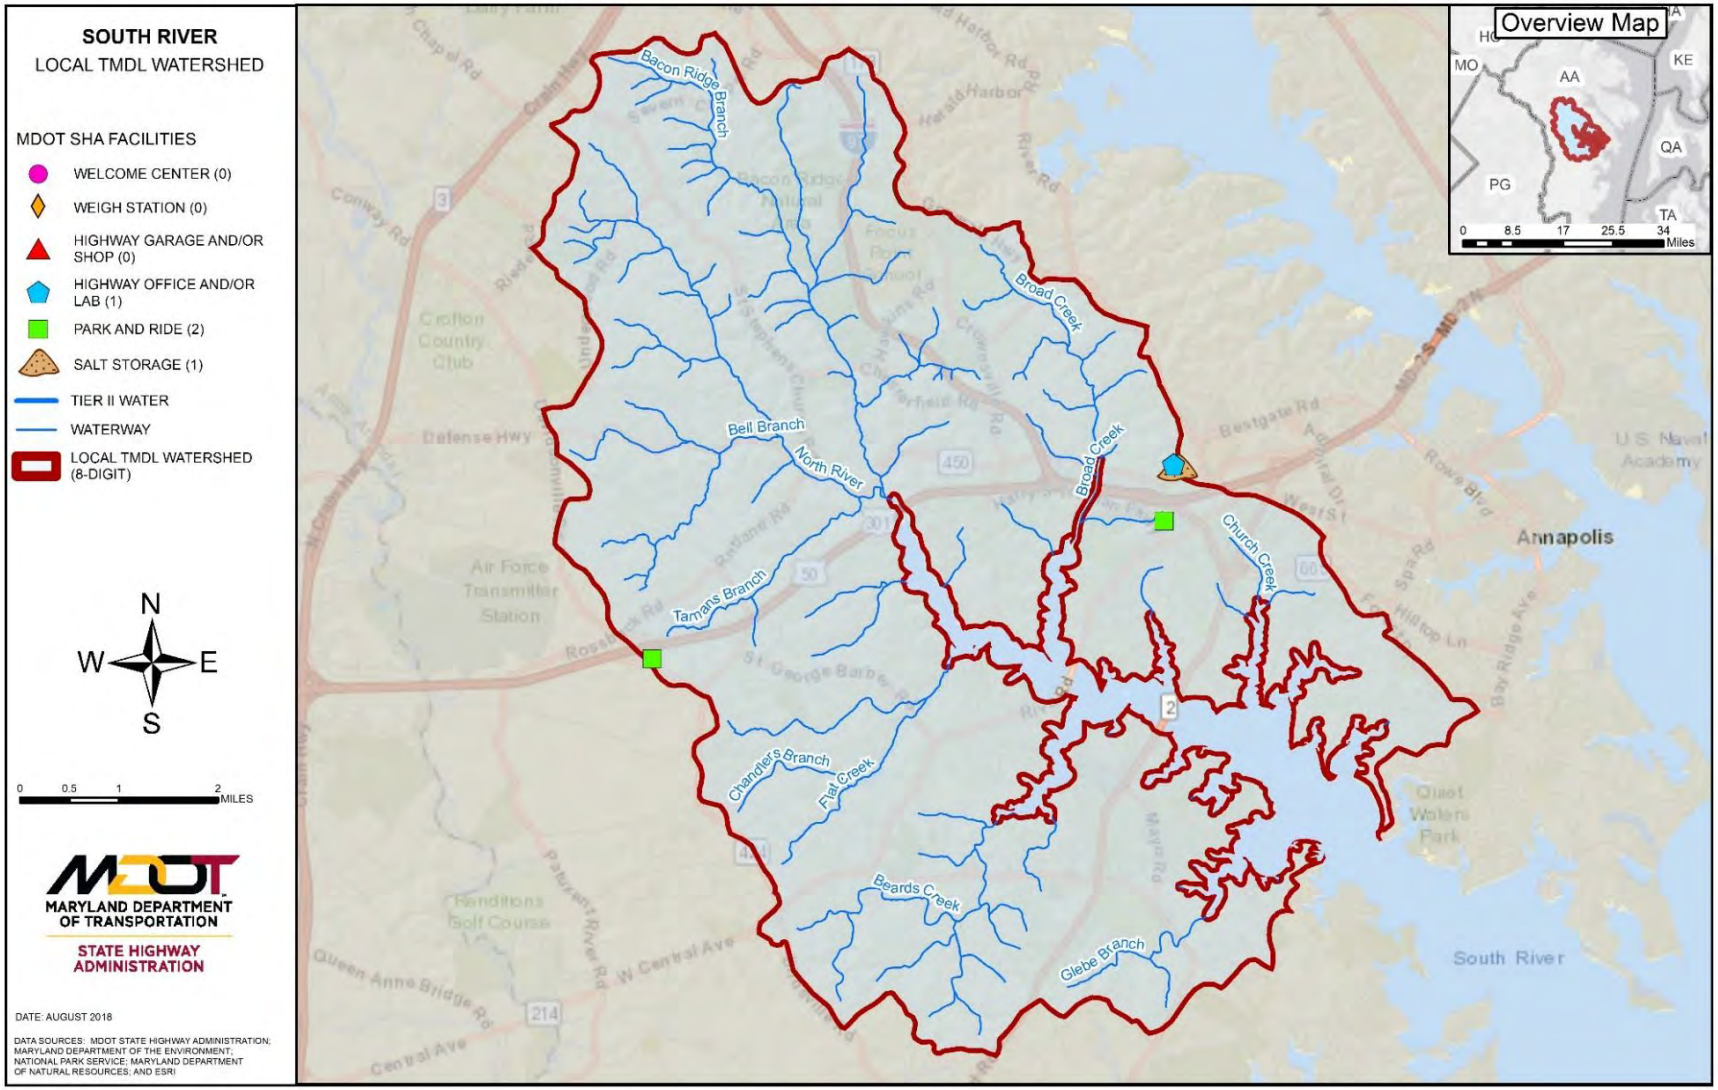


Figure 4-77: South River Watershed

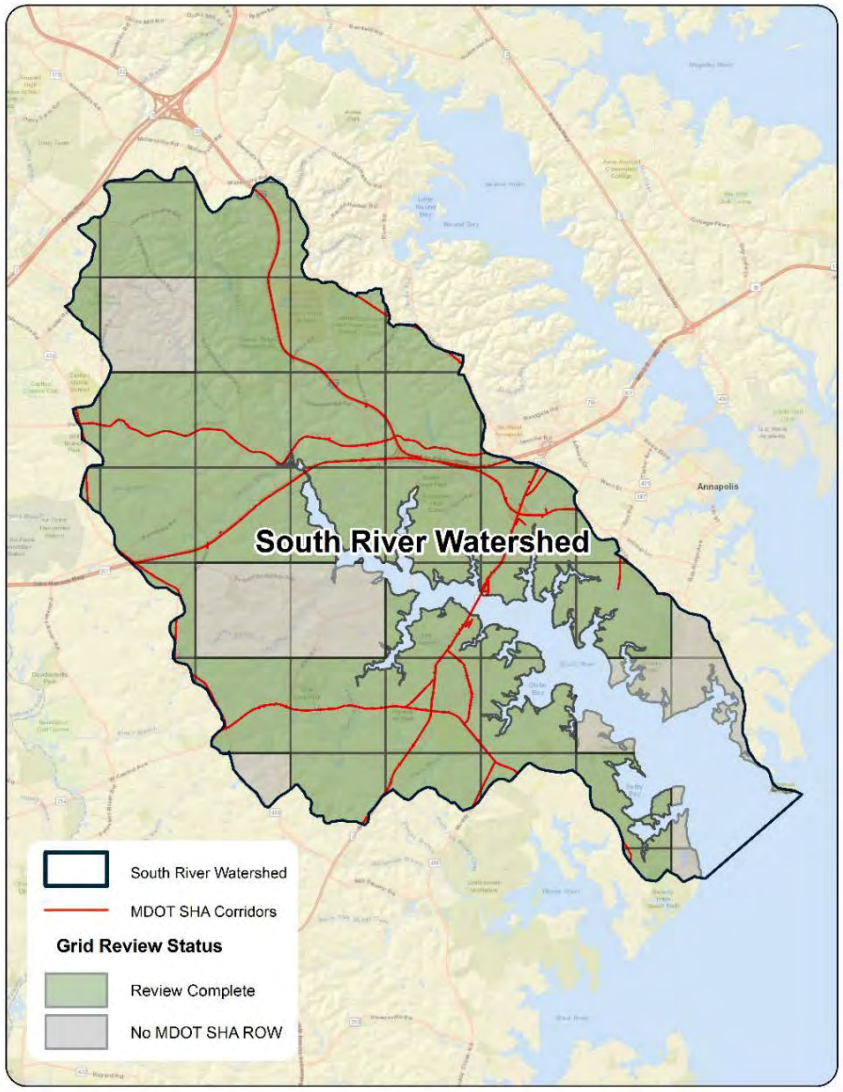


Figure 4-78: South River Site Search Grids

Z.4. Summary of County Assessment Review

On behalf of the Anne Arundel County Department of Public Works, CH2MHILL and KCI Technologies completed the *South River Watershed Study Summary Report* in November of 2008 (CH2MHILL and KCI, 2008) (hereinafter referred to as the "Watershed Study"). The Watershed Study elaborated on the findings from the 2006 Anne Arundel County-sponsored stream assessment of the South River watershed, which was completed as part of the County's Watershed Management Master Plan for the South River. Approximately 246 miles of streams were studied in the 2006 stream assessment; data collected from the assessment provided the County with information on the current conditions (or baseline condition) of the South River watershed (CH2MHILL and KCI, 2008).

In order to provide greater detail and specificity in the analysis and reporting, the South River watershed was divided into 59 subwatersheds in the Watershed Study. For ease of presentation, however, the 59 subwatersheds were grouped into three clusters: Headwaters, North Shore, and South Shore.

The Headwaters cluster of subwatersheds lies almost entirely above U.S. Route 301 (US 301) and includes 151.4 miles of streams with three major streams: North River, Bacon Ridge Branch, and Tarnans Branch. The Headwaters cluster area also includes the majority of the watershed surrounding Broad Creek to the north of US 301. The cluster is approximately 16,200 acres, of which 9 percent is impervious. Residential and transportation areas make up most of the impervious surface in the Headwaters cluster; approximately half of the impervious area is residential, and a quarter is transportation, which is due to the cluster being bisected by several major road corridors such as Interstate 97 and MD Route 450. The Headwaters cluster area is less populated than either the North Shore or South Shore clusters. While the Headwaters cluster has several residential and agricultural areas, "most notably in this cluster are the large tracts of contiguous forested land" (CH2MHILL and KCI, 2008, Appendix A, p.1).

The North Shore cluster of subwatersheds lies below US 301 to the north of South River and includes a portion of the city of Annapolis. Major streams include Broad Creek and Church Creek. The North Shore cluster is approximately 6,900 acres, of which 27 percent is impervious. It includes 21.3 miles of streams, with at least half of the subwatersheds containing streams that are completely influenced by tides. The North Shore cluster area is highly populated and is dominated by residential and commercial development. While this cluster also has a large percentage of forested land, it is much more fragmented than in the Headwaters cluster (CH2MHILL and KCI, 2008).

The South Shore cluster lies below US 301 to the south of South River. Major streams include Flat Creek and Beards Creek. The South Shore cluster is approximately 13,000 acres, of which 15 percent is impervious. It includes 69.8 miles of streams. Like the North Shore cluster, the South Shore cluster is also highly populated. The South Shore cluster includes a number of small parks and a small regional airport. There is a high residential concentration in the South Shore cluster subwatersheds that are directly adjacent to the South River. Several of the subwatersheds in this cluster are bisected by a significant utility corridor. The rest of the South Shore cluster area contains a significant amount of contiguous forested land (CH2MHILL and KCI, 2008).

Pollutant loading from the South River watershed was modeled for total nitrogen, total phosphorous, TSS, and fecal coliform. Specifically, for sediment (i.e., the pollutant of the subject TMDL [MDE, 2017c]), existing conditions showed that the areas with the highest TSS load from runoff (tons/yr) were in the North Shore cluster in the subwatersheds immediately surrounding Broad Creek and Church Creek as well as in the South Shore cluster in the subwatersheds immediately surrounding Glebe Creek (CH2MHILL and KCI, 2008).

Currently, Anne Arundel County is managing its stormwater runoff in the South River watershed through both urban stormwater management facilities and agricultural BMPs. In regard to the agricultural BMPs, the Watershed Study states that the significant acreage of agricultural land in the South River watershed prompted the County to carefully consider how to evaluate runoff quality and BMP effectiveness in these areas of the watershed. Therefore, the County collected and organized data on agricultural practices/BMPs (e.g., conservation tillage, cover crop, nutrient management; manure storage, etc.) in the watershed as an input to the County's watershed management process.

In addition to the stream assessment, information on land use, stormwater BMPs, and pollutant-loading models were compiled in a prioritization model that ranked and prioritized the watershed. This prioritization effort included prioritization within all three clusters for stream reach restoration; subwatershed restoration; and subwatershed preservation. The Watershed Study provides numerous color-coded maps that show the specific results (exact locations and ratings) of all prioritizations within each cluster. Broad-based conclusions can be drawn from these maps as well. For example, the preservation maps in particular show that the Headwaters cluster overwhelming contains the most subwatersheds ranked as high priority for preservation, which can be attributed to the fact that the Headwaters cluster has a limited amount of development along with large contiguous tracts of forest cover (CH2MHILL and KCI, 2008).

The modeling results for the South River watershed showed that the following four types of practices will provide the biggest impact towards reducing pollutant loadings from urban sources in the future: 1) implementation of enhanced stormwater retrofits, 2) expansion of stream buffers by 300 feet in unsewered areas, 3) preservation of greenways, and 4) implementation of regenerative conveyance BMPs (Watershed Study provides a figure that shows potential locations for regenerative conveyance). While the modeling results show the biggest impact if these BMP types are implemented fully across the watershed, the Watershed Study noted that other types of BMPs might be more appropriate for or have a bigger impact on the loading of an individual subwatershed. Other factors such as the results of cost benefit analyses will impact the County's final decision on which scenario to implement in an individual subwatershed (CH2MHILL and KCI, 2008).

Z.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reduction in the South River watershed are shown in **Table 4-94**. Projected sediment reduction using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the TMDL baseline. In this case, the baseline is 2009;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

MDOT SHA will accomplish the projected reduction to be achieved as a percent of the baseline load presented in **Table 3-2**.

Estimated costs to design, construct, and implement BMPs within the South River watershed total $31,062,000. These projected costs are based on an average cost per impervious acre treated derived from cost history for each BMP type. See **Table 4-95** for a summary of estimated BMP costs.

Table 4-94: South River Restoration Sediment BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs	Total BMPs		
			2020	2025	Future	Total
New Stormwater	drainage area acres	424.6	34.0	37.2	N/A	495.8
Retrofit	drainage area acres		95.1		N/A	95.1
Impervious Surface Elimination	acres removed		0.1		N/A	0.1
Tree Planting	acres of tree planting	0.6	7.0	10.4	N/A	18.0
Stream Restoration	linear feet		23,356.0	1,981.9	N/A	25,337.9
Outfall Stabilization	linear feet			400.0	N/A	400.0
Inlet Cleaning[1]	dry tons		2.9		N/A	2.9
Street Sweeping[1]	acres swept		48.8		N/A	48.8
Load Reductions	TSS EOS lbs/yr.		1,004,800	1,059,947	0	
				Total Projected Reduction	1,059,947	

[1] *Inlet cleaning and street sweeping are annual practices.*

Figure 4-79 is a map of MDOT SHA's restoration practices in the watershed and includes those that are under design and construction. Inlet cleaning and street sweeping are not reflected on this map.

Table 4-95: South River Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$4,124,000	$2,939,000	$7,063,000
Retrofits	$5,665,000		$5,665,000
Impervious Surface Elimination	$39,000		$39,000
Tree Planting	$213,000	$319,000	$532,000
Stream Restoration	$15,597,000	$1,324,000	$16,921,000
Outfall Stabilization		$787,000	$787,000
Inlet cleaning	$8,000		$8,000
Street Sweeping	$47,000		$47,000
Total			$31,062,000

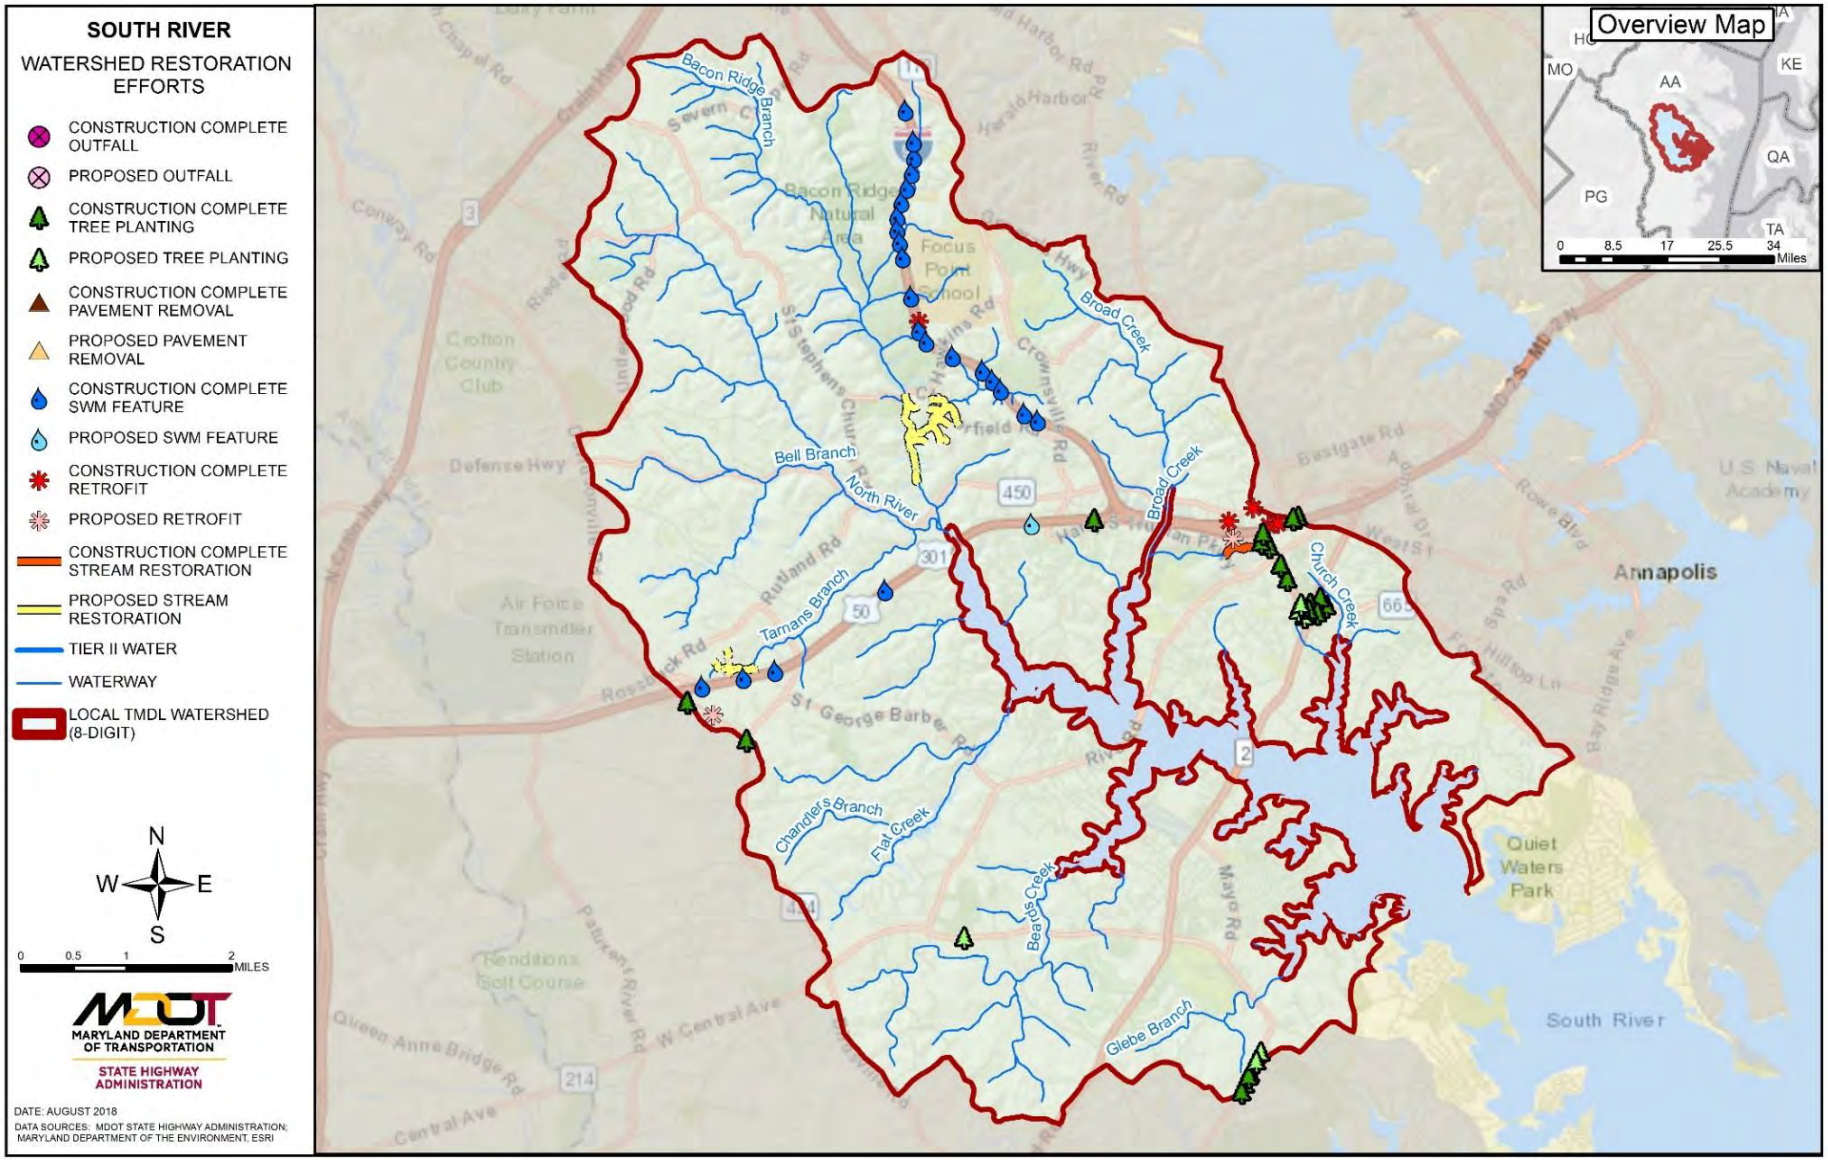


Figure 4-79: MDOT SHA Programmed Restoration Strategies within the South River Watershed

AA. SWAN CREEK WATERSHED

AA.1. Watershed Description

The Swan Creek watershed encompasses 26 square miles solely within Harford County, and is comprised of both non-tidal and tidal waters. The watershed drains into Swan Creek, which is located approximately four miles south of where the Susquehanna River drains into the Chesapeake Bay. The lower portion of Swan Creek is a small, shallow tidal embayment that drains into the Chesapeake Bay. While predominantly situated within Maryland's Piedmont geologic province, the lower portion of the Swan Creek watershed extends slightly into the Coastal Plain province. Major tributary creeks and streams of the Swan Creek watershed include Gasheys Creek, Swan Creek, and Carsins Run.

There are 29 centerline miles of MDOT SHA roadway located within the Swan Creek watershed. The associated ROW encompasses 252 acres, of which 142 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) park and ride facility. See **Figure 4-80** for a map of MDOT SHA facilities within the Swan Creek watershed.

AA.2. MDOT SHA TMDLs within Swan Creek Watershed

MDOT SHA is included in the sediment TMDL (MDE, 2016e) and has a reduction requirement of 13 percent within Harford County, as shown in **Table 3-2**. This TMDL only applies to the non-tidal portion of the Swan Creek watershed.

AA.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan, Section C** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Swan Creek watershed is shown in **Figure 4-81** which illustrates that 19 grid cells have been reviewed, encompassing portions of nine (9) state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 194 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 26 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 168 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 19 locations as potential tree planting locations. Further analysis of these locations resulted in:

- Nine (9) sites constructed or under contract.
- Three (3) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.

- Seven (7) sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified two (2) sites as potential stream restoration locations. Further analysis of these locations resulted in:

- Two (2) sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 21 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Five (5) new structural SW controls constructed or under contract.
- 16 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified five (5) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- One (1) retrofit site deemed potentially viable for retrofit and pending further analysis may be a candidate for future restoration opportunities.
- Four (4) retrofit sites deemed not viable for retrofit and have been removed from consideration.

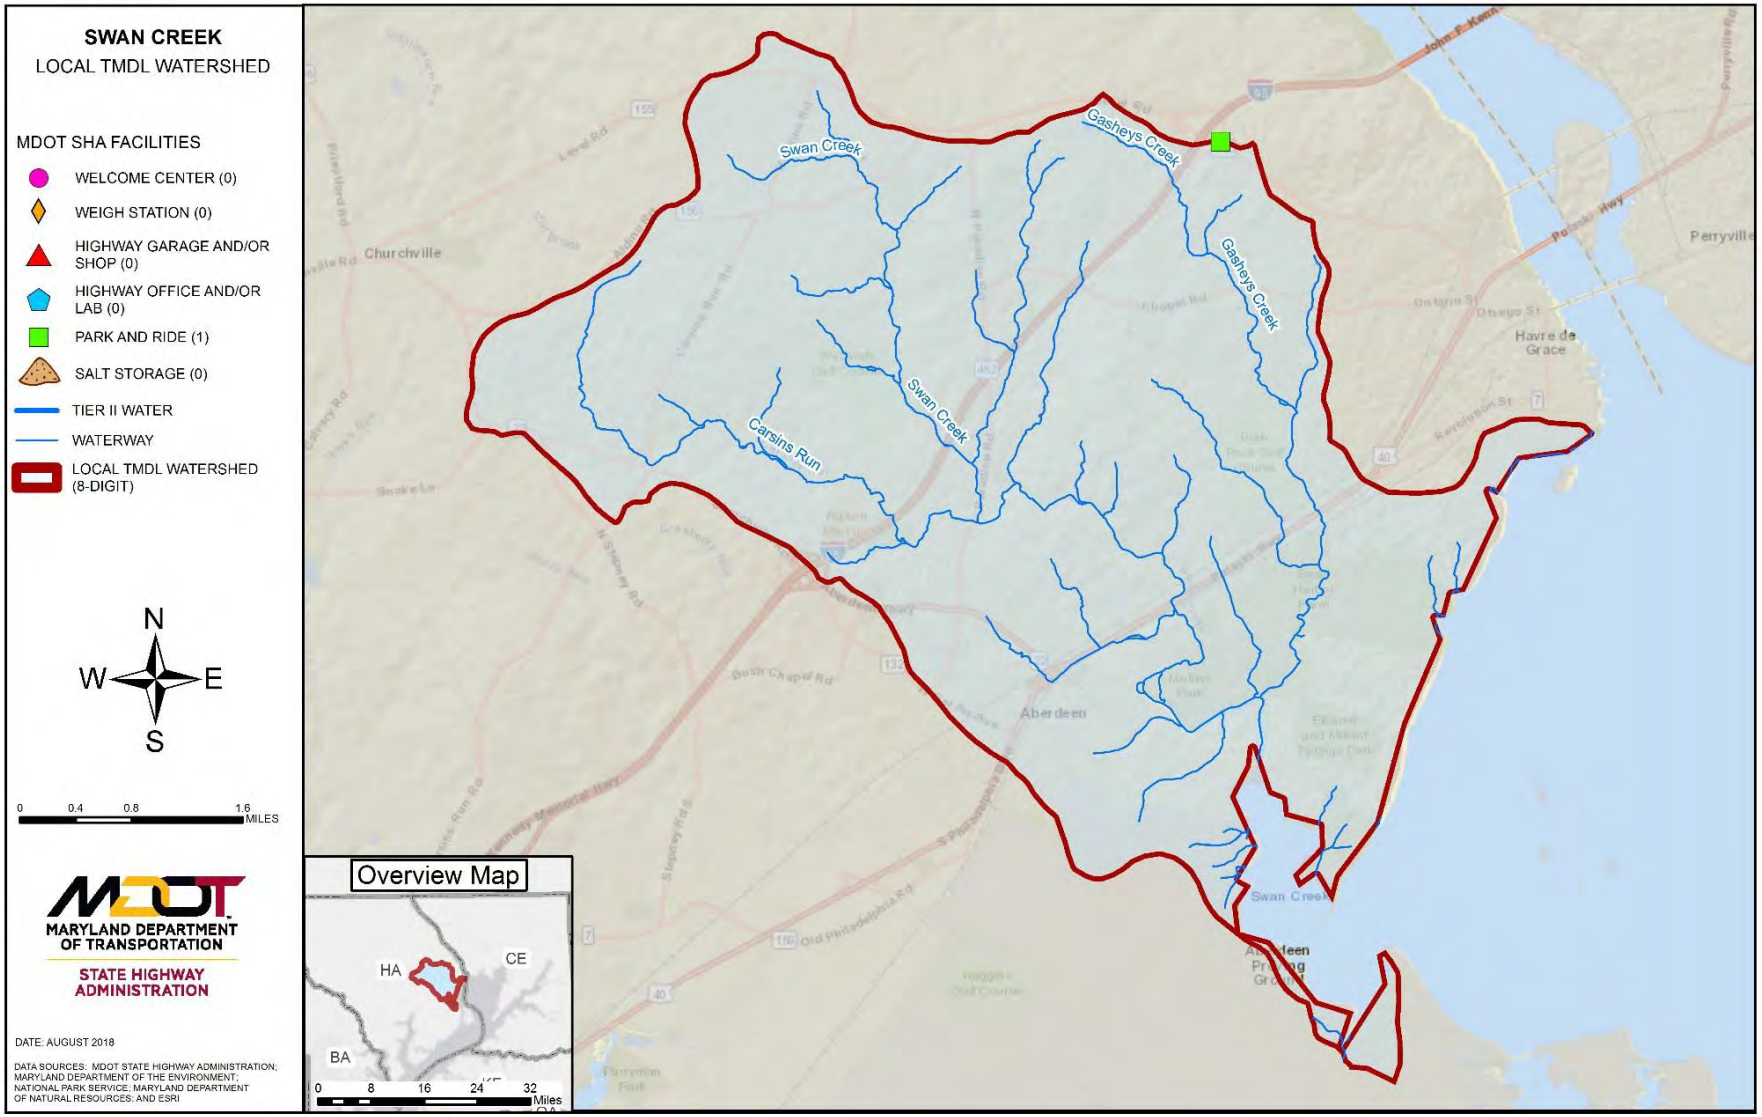


Figure 4-80: Swan Creek Watershed

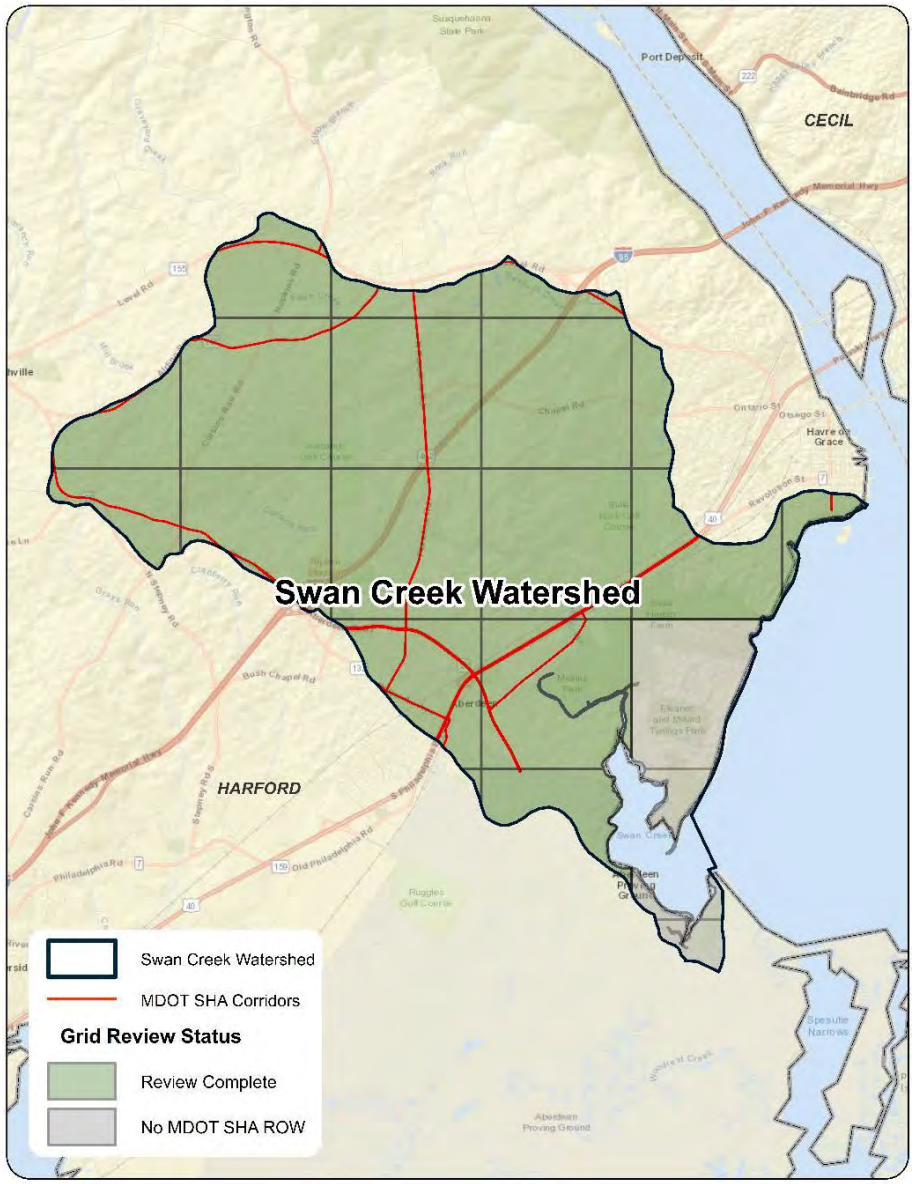


Figure 4-81: Swan Creek Site Search Grids

AA.4. Summary of County Assessment Review

The designated use of the non-tidal portion of Swan Creek (8-digit Basin Code: 02130706) is Use I – Water Contact Recreation and Protection of Aquatic Life (MDE, 2016e). Waters within the Swan Creek watershed are subject to the following impairments as noted on MDE's 303(d) List:

- Nitrogen (Total);
- Phosphorus (Total); and
- TSS.

Prepared by the DNR in partnership with Harford County, the 2002 *Bush River Watershed Characterization* (hereinafter referred to as the "Characterization Report") serves as Harford County's assessment of the Swan Creek watershed (DNR, 2002a). The Characterization Report was created to support Harford County's WRAS for its Bush River Project Area. While the Swan Creek watershed does not directly drain into the Bush River, it is included within the larger Bush River Basin (6-digit Basin Code: 021307) along with the Bynum Run, Atkisson Reservoir, Lower Winters Run, and Bush River watersheds. Accordingly, the Swan Creek watershed, although not specifically included within Harford County's Bush River WRAS initiative, was assessed in the Characterization Report to allow comparison of watersheds across the entire Bush River Basin (DNR, 2002a).

On the outset, the Characterization Report cites the 1998 *Maryland Clean Water Action Plan* (CWAPTW, 1998), which identified the Swan Creek watershed as a "Category 1 Priority" (highest State priority for restoration) based on indicators of water quality, landscape, and living resources that were developed for all watersheds in Maryland. The Characterization Report discussed problems within the Swan Creek watershed based on these three indicators.

First, with respect to water quality, the Swan Creek watershed was shown to be transporting large amounts of nitrogen and phosphorus to

the Chesapeake Bay when compared to other Maryland watersheds that drain into the Bay. Water quality was also being affected by high soil erodibility and an insufficiency of riparian buffers around streams in the watershed. More specifically, the Swan Creek watershed was found to have an average soil erodibility factor (K) of 0.33, suggesting that control of soil erosion is particularly important; a K value greater than 0.275 was considered a likely factor for water quality problems. Approximately 28 percent of streams in the watershed lacked a riparian buffer.

The landscape indicator included the percent of impervious surface. Impervious surfaces were found to cover 14.2 percent of the Swan Creek watershed; this percentage indicated that average watershed conditions measured by impervious coverage in the Swan Creek watershed are worse than the statewide benchmark. The Characterization Report also indicated that a quarter of the Swan Creek watershed was listed as a "Priority Funding Area" under Maryland's Smart Growth program, where State funding for infrastructure may be available to support development and redevelopment. Further development in the Swan Creek watershed is expected to increase impervious surface coverage.

The living resources indicator focused on the importance of habitat for sensitive species and fish movement within the Swan Creek watershed. The Characterization Report indicated that 44 acres of Wetlands of Special State Concern (WSSC) were located in the Swan Creek watershed. WSSC are wetlands identified as having sensitive species habitat in or near the wetland. Both the Swan and Gasheys Creek streams as well the Chesapeake Bay shore area are within the vicinity of the 44 acres. Likewise, the Oakington Road and Swan Harbor Farm Park communities are also within the vicinity of the Swan Creek watershed's 44 acres of WSSC. Gasheys Creek is of particular importance as it was declared critical habitat for the federally endangered Maryland darter (*Etheostoma sellare*) in 1984. The Characterization Report also discusses how blockages in the watershed's streams can interfere with or prevent some fish species from moving upstream to otherwise viable habitat. The structural components of lakes, farm ponds, or drainage ditches can cause blockages (DNR, 2002a).

The DNR Fish Passage Program identified fish blockages at seven sampling stations in the Swan Creek watershed (See **Table 4-96**). Mitigation or removal of blockages to fish movement is recommended as many fish species need the ability to move between stream segments to maintain healthy, resilient populations (DNR, 2002a).

Overall, Harford County and DNR suggested several BMPs for the Bush River Basin in the Characterization Report; however, no recommendations specific to the Swan Creek watershed were made except for the aforementioned fish blockage removal opportunities listed in **Table 4-96**. General recommendations included incorporating "Green Infrastructure" (areas of natural vegetation and habitat that have statewide or regional importance as defined by criteria developed by DNR) and the habitat needs of sensitive forest interior dwelling species into local land use planning and management; encouraging the use of agricultural BMPs and conservation programs; and conducting stream buffer and wetland restorations (DNR, 2002a).

Table 4-96: County Identified Fish Blockages / Removal Opportunities in the Swan Creek Watershed

Station	Stream	Name/Location
CW010	Gasheys Creek	0.2 mile below Chapel Road
CW011	Gasheys Creek	Chapel Road
CW030	Swan Creek	0.1 mile above Rt. 40
CW031	Swan Creek	100 ft. above Oak Street
CW032	Swan Creek	130 yards above Oak St
CW063	Unnamed Tributary to Gasheys Creek	0.33 mile below Chapel Rd
CW064	Unnamed Tributary to Gasheys Creek	Chapel Road

Source: DNR (2002a)

AA.5. MDOT SHA Pollutant Reduction Strategies

Proposed practices to meet sediment reduction in the South River watershed are shown in **Table 4-97**. Projected sediment reduction using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the TMDL baseline. In this case, the baseline is 2009;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

MDOT SHA will accomplish the projected reduction to be achieved as a percent of the baseline load presented in **Table 3-2**.

Estimated costs to design, construct, and implement BMPs within the Swan Creek watershed total $1,693,000. These projected costs are based on an average cost per impervious acre treated derived from a cost history for each BMP type. See **Table 4-98** for a summary of estimated BMP costs .

Figure 4-82 shows a map of MDOT SHA's restoration practices in the watershed and includes those that are under design and construction. Inlet cleaning is not reflected on this map.

Table 4-97: Swan Creek Restoration Sediment BMP Implementation						
BMP	**Unit**	**Baseline (Before 2009)**	**Restoration BMPs**			**Total BMPs**
			2020	**2025**	**Future**	
New Stormwater	drainage area acres	29.9	0.8	5.5	N/A	6.3
Tree Planting	acres of tree planting		9.0	1.0	N/A	10.0
Stream Restoration	linear feet			295.2	N/A	295.2
Outfall Stabilization	linear feet			369.0	N/A	369.0
Inlet Cleaning[1]	dry tons		11.9			11.9
Load Reductions	TSS EOS lbs./yr.		5,400	36,118	0	
				Total Projected Reduction	36,118	
[1] *Inlet cleaning is an annual practice.*						

Table 4-98: Swan Creek Restoration BMP Cost			
BMP	**2020**	**2025**	**Total**
New Stormwater	$180,000	$219,000	$399,000
Tree Planting	$276,000	$30,000	$306,000
Stream Restoration		$197,000	$197,000
Outfall Stabilization		$726,000	$726,000
Inlet cleaning	$65,000		$64,000
Total			$1,693,000

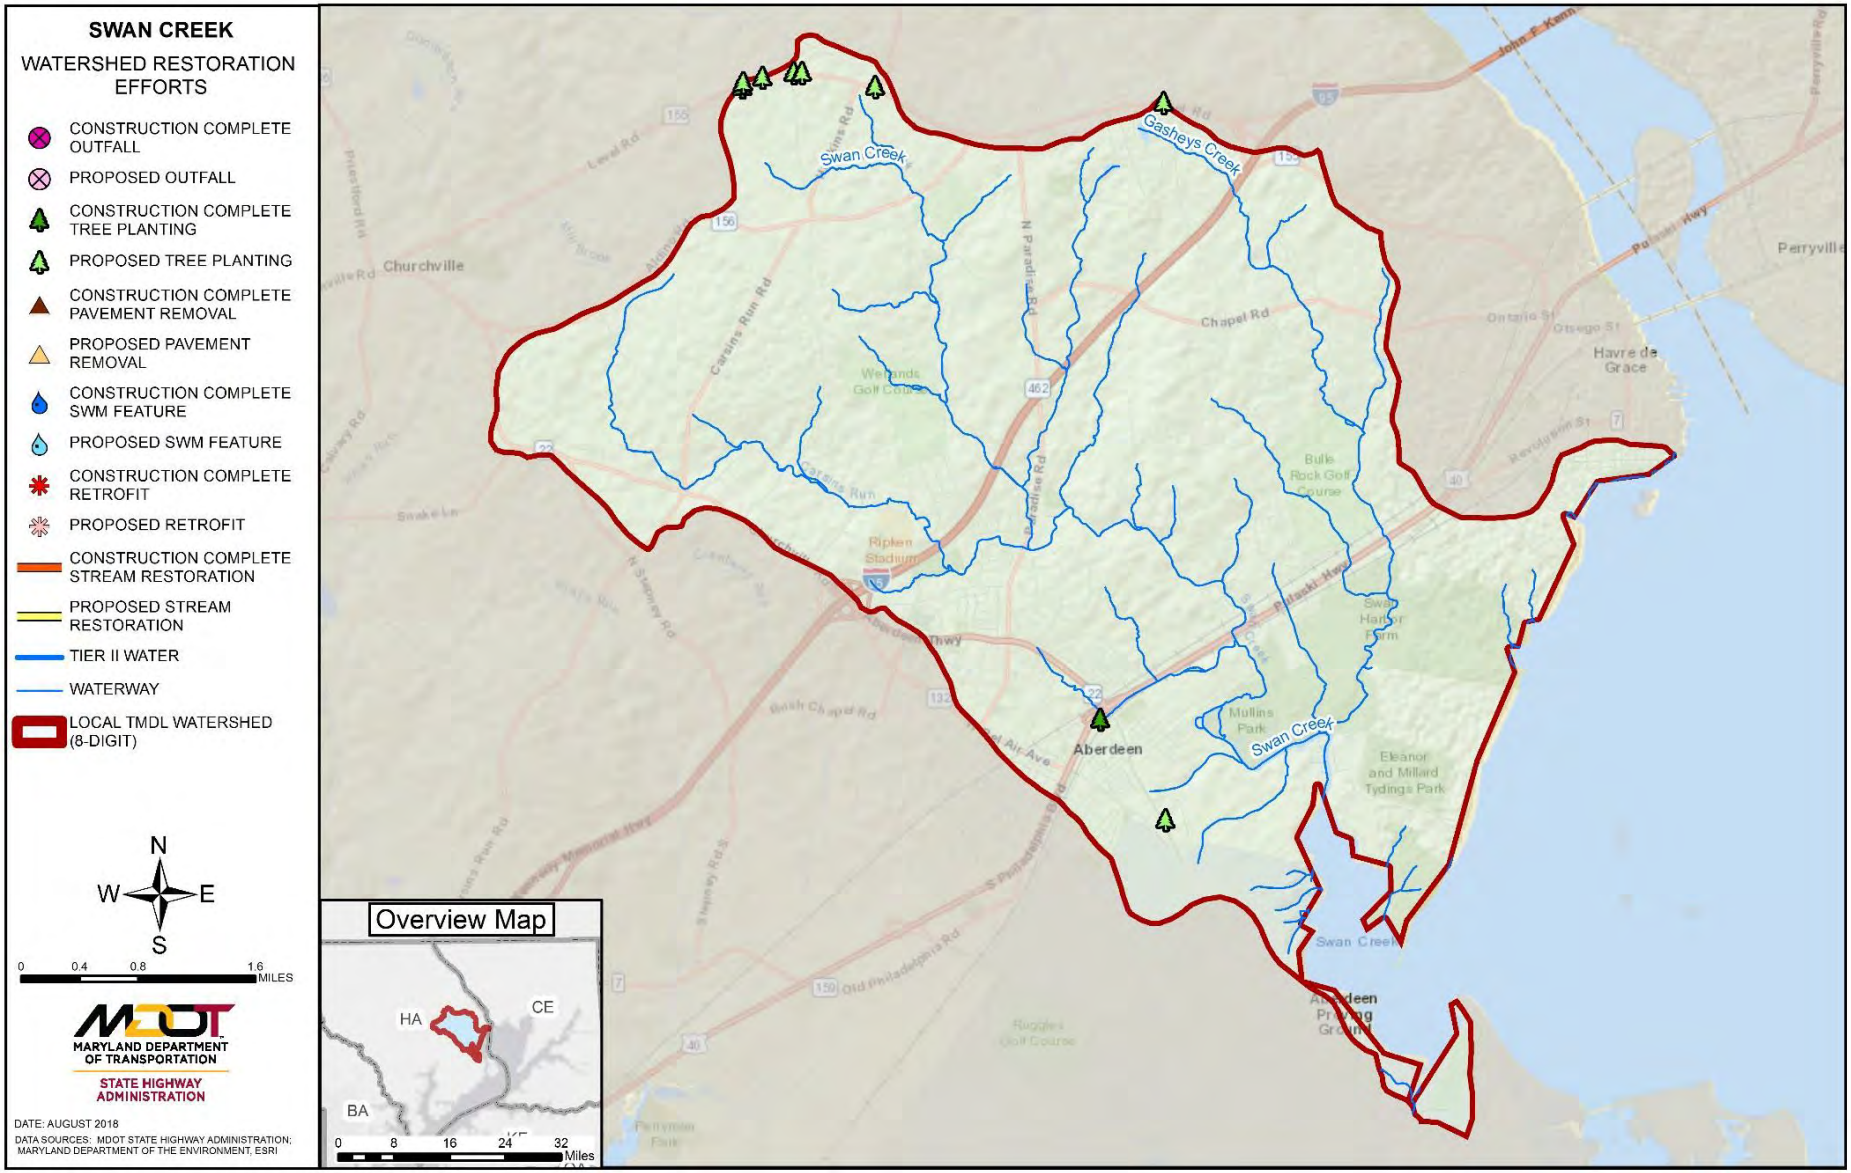


Figure 4-82: MDOT SHA Restoration Strategies within the Swan Creek Watershed

AB. UPPER MONOCACY RIVER WATERSHED

AB.1. Watershed Description

The Upper Monocacy River originates in Pennsylvania and flows through Maryland ultimately into the Potomac River. The watershed encompasses approximately 274 square miles within the state of Pennsylvania and approximately 724 square miles in both Frederick and Carroll Counties, Maryland. In Frederick County, it is divided into six subwatersheds: Fishing Creek, Glade Creek, Hunting Creek, Owens Creek, Toms Creek, and Tuscarora Creek.

There are 665.1 centerline miles of MDOT SHA roadway located within the Upper Monocacy River watershed. The associated ROW encompasses 1,219.9 acres, of which 630.5 acres are impervious. MDOT SHA facilities located within the watershed consist of one (1) highway garage or shop, one (1) welcome center, and two (2) salt storage facilities. See **Figure 4-83** for a map of the watershed.

AB.2. MDOT SHA TMDLs within Upper Monocacy River Watershed

TMDLs requiring reduction by MDOT SHA include phosphorus (MDE, 2013f) and sediment (MDE, 2009g). Phosphorus is to be reduced by 3.0 percent and sediment is to be reduced by 49 percent as shown in **Table 3-2**.

AB.3. MDOT SHA Visual Inventory of ROW

The MS4 Permit requires MDOT SHA to perform visual assessments. **Part III, Coordinated TMDL Implementation Plan,** describes the MDOT SHA visual assessment process. For each BMP type, implementation teams have performed preliminary evaluations for each grid and/or major state route corridor within the watershed as part of desktop and field evaluations. The grid-system used for the Upper Monocacy River watershed is shown in **Figure 4-84** which illustrates that 84 grid cells have been reviewed, encompassing portions of 13 state route corridors. Results of the visual inventory categorized by BMP type follow:

Structural SW Controls

Preliminary evaluation identified 966 locations as potential new structural SW control locations. Further analysis of these locations resulted in:

- 36 new structural SW controls constructed or under contract.
- 675 additional sites deemed potentially viable for new structural SW controls and pending further analysis, may be candidates for future restoration opportunities.
- 255 sites deemed not viable for structural SW controls and have been removed from consideration.

Tree Planting

Preliminary evaluation identified 208 locations as potential tree planting locations. Further analysis of these locations resulted in:

- 84 sites constructed or under contract.

- Seven (7) additional sites deemed potentially viable tree planting and pending further analysis, may be candidates for future restoration opportunities.
- 117 sites deemed not viable for tree planting and have been removed from consideration.

Stream Restoration

Preliminary evaluation identified 10 sites as potential stream restoration locations. Further analysis of these locations resulted in:

- 10 sites deemed not viable for stream restoration and have been removed from consideration.

Grass Swale Rehabilitation

Preliminary evaluation identified 40 sites as potential grass swale rehabilitation. Further analysis of these locations resulted in:

- Seven (7) new structural SW controls constructed or under contract.
- 33 sites deemed not viable for structural SW controls and have been removed from consideration.

Outfall Stabilization

No outfall stabilization sites were identified within this watershed for potential restoration.

Retrofit of Existing Structural SW Controls

Preliminary evaluation identified six (6) existing structural SW controls as potential retrofits. Further analysis of these locations resulted in:

- Retrofit of one (1) existing structural SW controls constructed or under contract.
- Five (5) retrofit sites deemed not viable for retrofit and have been removed from consideration.

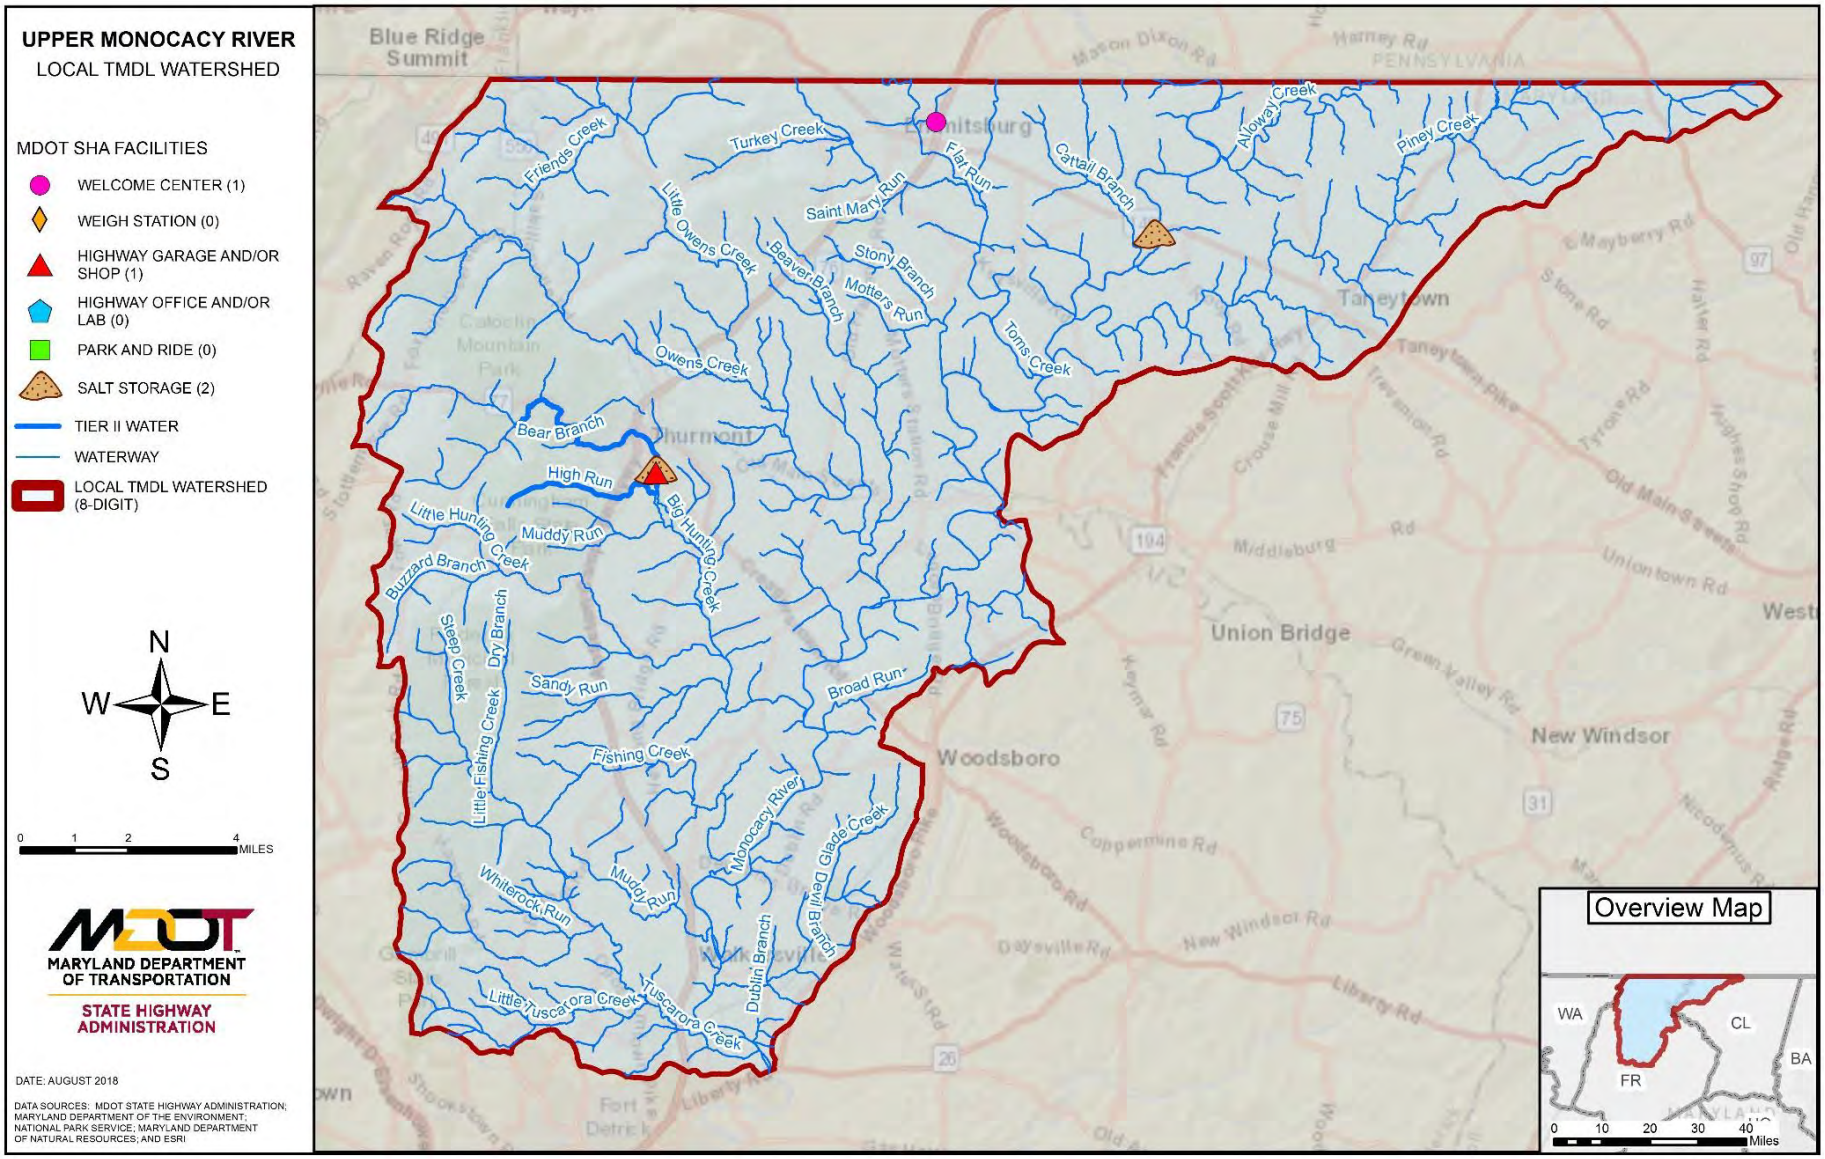


Figure 4-83: Upper Monocacy River Watershed

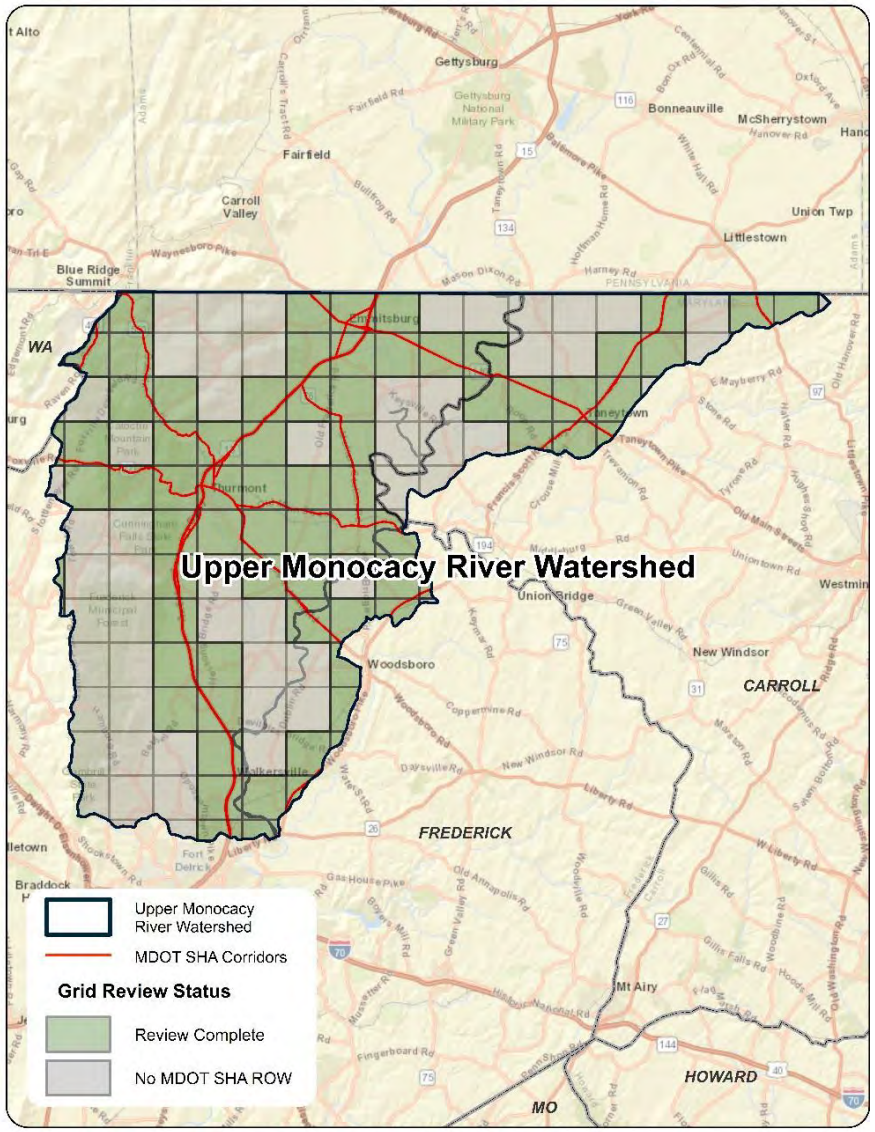


Figure 4-84: Upper Monocacy River Site Search Grids

AB.4. Summary of County Assessment Review

Waters within the Upper Monocacy River watershed are subject to the following impairments as noted on MDE's 303(d) List:

- *Escherichia coli*;
- Phosphorus (Total);
- Temperature, water; and
- TSS.

The Upper Monocacy River watershed is ranked in the *Maryland Clean Water Action Plan* (CWAPTW, 1998) as a "Category 1 Priority," a watershed not meeting clean water and other natural resource goals and therefore needing restoration, and a "Selected Category 3," a pristine or sensitive watershed most in need of protection. The Frederick County Division of Public Works completed a *Watershed Restoration Action Strategy* (WRAS) for the Upper Monocacy River watershed within Frederick County in 2005 (FR-DPW, 2005). According to the WRAS, impervious land cover comprises 3.7 percent of the watershed, and 25 percent of the soils are considered highly erodible.

For the purposes of planning, Frederick County has selected the following generalized restoration strategies to aid in meeting restoration goals within the Upper Monocacy River watershed:

- Restore riparian corridors;
- Improve impaired streams;
- Identify and preserve pristine areas;
- Protect and expand existing green infrastructure and riparian corridors; and
- Protect water quality and habitat through appropriate zoning.

The DNR conducted a SCA in Frederick County and identified 226 sites with varying degrees of severity in terms of channel alteration,

erosion (120,153 linear feet), exposed pipes, fish passage barriers, inadequate buffers, and pipe outfalls. Sites were prioritized based on the greatest need and potential for restoration. The sites with the most severe problems are listed below in **Table 4-99.**

Detailed information on site locations and less severe sites can be found in the 2004 *Upper Monocacy River Stream Corridor Assessment Survey* (DNR, 2004). According to this survey, the following potential stream restoration sites were identified within the Upper Monocacy River watershed with a severity rating of two (severe) or one (very severe).

Table 4-99: Upper Monocacy River Stream Corridor Assessment Survey Restoration Site Recommendations

Subwatershed	Reach ID	Length (ft.)	Impact(s)
Glade Creek	2719205	107	Downcutting
Glade Creek	2819202	69	Downcutting
Glade Creek	2821402	10247	Downcutting
Hunting Creek	1914103	409	Widening
Owens Creek/Beaver Branch	1621201	1980	Downcutting
Toms Creek	2208201	570	Downcutting
Tuscarora Creek	0510302	12464	Widening
Fishing Creek	1510104	--	Total fish blockage (dam)
Fishing Creek	1510106	--	Total fish blockage (dam)
Fishing Creek	1512312	--	Total fish blockage (channelized)
Hunting Creek	1813301	--	Total fish blockage (channelized)
Hunting Creek	1813302	--	Total fish blockage
Owens Creek/Beaver Branch	2419103	--	Total fish blockage (road crossing)
Toms Creek	1924301	--	Total fish blockage
			(channelized)
Toms Creek	2307303	--	Total fish blockage (road crossing)

Source: DNR (2004)

The Frederick County Office of Sustainability and Environmental Resources also conducted SCAs from 2008 – 2011 (Round 1) and again from 2013 – 2016 (Round 2) that include the Fishing Creek, Glade Creek, Hunting Creek, Owens Creek, Toms Creek, and Tuscarora Creek subwatersheds of the Upper Monocacy River watershed (Versar, 2012; Versar, 2017a). Information on water quality, erosion, physical habitat, and BIBI scores for several sites within the Upper Monocacy River watershed can be found in the SCA reports; however, detailed location information is not provided.

Lastly, in 2017, Frederick County completed and published the *Upper Monocacy River Watershed Assessment Frederick County, Maryland* (EA, 2017). This document expanded upon and continued the efforts described in the previously issued 2005 WRAS (FR-DPW, 2005). The EA (2017) document provides water quality conditions and a listing of completed restoration projects as well as new project opportunities in order of priority within the Upper Monocacy River watershed's six subwatersheds: Toms Creek, Owens Creek, Hunting Creek, Fishing Creek, Tuscarora Creek, and Glade Creek.

For the portion of the Upper Monocacy River watershed in Carroll County, the Carroll County Bureau of Resource Management released the *Upper Monocacy River Watershed Characterization Plan* in the spring of 2016 (CL-BRM, 2016e). According to this plan, the current impairments within Carroll County's portion of the Upper Monocacy River watershed are bacteria, phosphorus, and sediment (CL-BRM, 2016e). The Upper Monocacy River watershed in Carroll County is

mostly rural with mixed urban uses accounting for less than three percent of the total land use; agriculture is the dominant land use (approximately 69 percent) (CL-BRM, 2016e). Within the watershed, the Piney Creek (0255) subwatershed has the highest percentage (7.55 percent) of total impervious area for the entire watershed (Piney Creek [0255] subwatershed drains a large portion of the city of Taneytown) (CL-BRM, 2016e).

AB.5. MDOT SHA Pollutant Reduction Strategies

Upper Monocacy is listed for both phosphorus and sediment with each TMDL having a different baseline year; 2009 for phosphorus and 2000 for sediment. Proposed practices to meet the phosphorus and sediment reduction in the Upper Monocacy River watershed are shown in **Table 4-100 and 4-101**. Projected phosphorus and sediment reductions using these practices are shown in **Table 3-2**. Four timeframes are included in the table below:

- BMPs built before the phosphorus and sediment TMDL baseline. In this case, the phosphorus baseline is 2009 and the sediment baseline is 2000;
- BMPs implemented after the baseline through fiscal year 2020; and
- BMPs implemented after fiscal year 2020 through fiscal year 2025; and
- Future BMPs to be implemented after fiscal year 2025.

Although MDOT SHA will accomplish the projected reduction, our current modeling only looks forward to 2025, which may not achieve 100 percent of the required reduction. For example, under the sediment TMDL, MDOT SHA will meet 83.8 percent of the MDE 49 percent load reduction requirement through implementation of BMPs shown in **Table 4-101.** MDOT SHA will work to increase expected reductions for all pollutant TMDLs through strategies identified in **Part III Section E.**

Estimated costs to design, construct, and implement BMPs within the Upper Monocacy River watershed total $21,126,000. These projected costs are based on an average cost per impervious acre treated derived from cost history for each BMP type. See **Table 4-102** for a BMP strategy cost breakdown.

Figure 4-85 shows a map of MDOT SHA's restoration practices in the watershed and include those that are under design and construction. Inlet cleaning is not reflected on this map.

Table 4-100: Upper Monocacy River Restoration Phosphorus BMP Implementation

BMP	Unit	Baseline (Before 2009)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	193.6	70.4	86.9	N/A	350.9
Retrofit	drainage area acres		15.6		N/A	15.6
Impervious Surface Elimination	acres removed		0.7		N/A	0.7
Tree Planting	acres of tree planting	0.2	55.8	40.4	N/A	96.4
Stream Restoration	linear feet			4,633.6	N/A	4,633.6
Outfall Stabilization	linear feet			800.0	N/A	800.00
Inlet Cleaning[1]	tons		0.2	18.6	N/A	18.8
Load Reductions	TP EOS lbs./yr.		131	613	0	
				Total Projected Reduction	**613**	

[1] *Inlet cleaning is an annual practice.*

Table 4-101: Upper Monocacy River Restoration Sediment BMP Implementation

BMP[1]	Unit	Baseline (Before 2000)	Restoration BMPs			Total BMPs
			2020	2025	Future	
New Stormwater	drainage area acres	179.8	70.4	86.9	TBD	337.1
Retrofit	drainage area acres		15.6		TBD	15.6
Impervious Surface Elimination	acres removed		0.7		TBD	0.7
Tree Planting	acres of tree planting		56.0	40.4	TBD	96.4
Stream Restoration	linear feet			4,633.6	TBD	4,633.6
Outfall Stabilization	linear feet			800.0	TBD	800.00
Inlet Cleaning[1]	tons		0.2	18.6	TBD	18.8
Load Reductions	TSS lbs./yr.		65,776	346,081	412,831	
				Total Projected Reduction	**412,831**	

[1] *Inlet cleaning is an annual practice.*

Table 4-102: Upper Monocacy River Restoration BMP Cost

BMP	2020	2025	Total
New Stormwater	$6,845,000	$5,718,000	$12,563,000
Retrofits	$647,000		$647,000
Tree Planting	$192,000		$192,000
Stream Restoration	$1,714,000	$1,235,000	$2,949,000
Outfall Stabilization		$3,094,000	$3,094,000
Inlet cleaning		$1,574,040	$1,574,000
Street Sweeping	$1,000	$106,000	$107,000
Total			$21,126,000

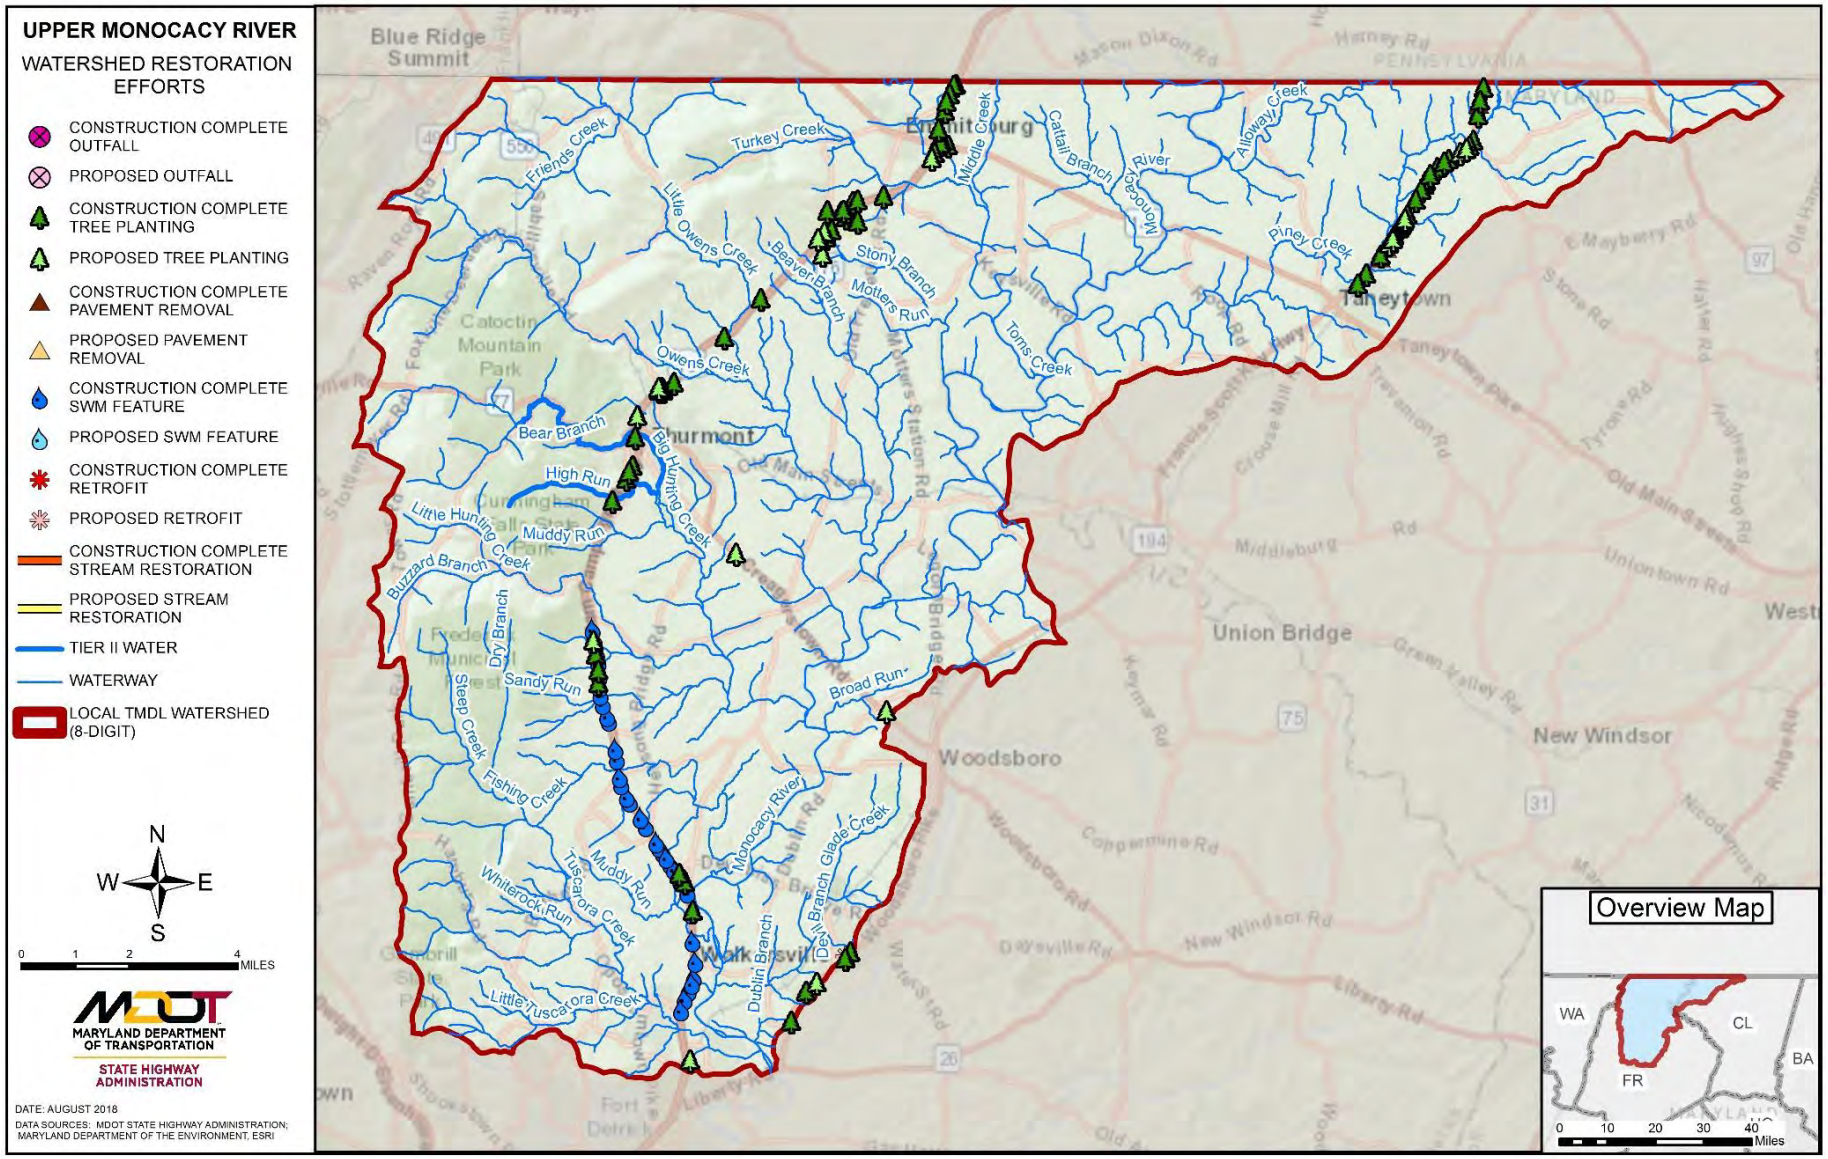


Figure 4-85: MDOT SHA Restoration Strategies within the Upper Monocacy River Watershed

MARYLAND DEPARTMENT OF TRANSPORTATION

STATE HIGHWAY ADMINISTRATION

Abbreviations







ABBREVIATIONS

AA	Anne Arundel (County)
AA-DPW	Anne Arundel County, Department of Public Works
AAH	Adopt-A-Highway
AASHTO	American Association of State Highway and Transportation Officials
ac	Acre
AFB	Air Force Base
Alt	Alternative
AMT, Inc.	A. Morton Thomas and Associates, Inc.
ATV	All-terrain vehicle
BA	Baltimore (County)
BA-DEPRM	Baltimore County, Department of Environmental Protection and Resource Management
BA-EPS	Baltimore County, Department of Environmental Protection and Sustainability
BARC	Beltsville Agriculture Research Center
BASMAA	Bay Area Stormwater Management Agencies Association
Bay	Chesapeake Bay
BBO	Beaverdam Run, Baisman Run, and Oregon Branch Subwatersheds of the Loch Raven Reservoir Watershed
BIBI	Benthic Index of Biotic Integrity
BMP	Best Management Practice
BOD	Biochemical Oxygen Demand
BSID	Biological Stressor Identification
BST	Bacterial Source Tracking
CAFO	Concentrated Animal Feeding Operation
CBP	Chesapeake Bay Program
CBP WM	Chesapeake Bay Program Watershed Model
CH	Charles (County)
CH-DPGM	Charles County, Department of Planning & Growth
CFR	Code of Federal Regulations
CL	Carroll (County)
CL-BRM	Carroll County, Bureau of Resource Management
CRP	Community Reforestation Program
CSN	Chesapeake Stormwater Network
CSO	Combined Sewer Overflow
CTP	Consolidated Transportation Program
CWA	Clean Water Act
CWAPTW	Clean Water Action Plan Technical Workgroup
CWP	Center for Watershed Protection
DC	District of Columbia
DD	Direct Drainage
DO	Dissolved Oxygen
DMCF	Dredged Material Containment Facilities
DNR	Maryland Department of Natural Resources
DRMO	Defense Reutilization and Marketing Office
ECD	Environmental Compliance Division (MDOT SHA)
E. coli	*Escherichia coli*
EMC	Event Mean Concentration
EOS	Edge of Stream
EPA	United States Environmental Protection Agency
ESC	Erosion and Sediment Control
ESD	Environmental Site Design
FHWA	Federal Highway Administration

FIB	Fecal Indicator Bacteria
FIBI	Fish Index of Biotic Integrity
FMD	Facility Maintenance Division (MDOT SHA)
FR	Frederick (County)
FR-DPW	Frederick County, Division of Public Works
FR-OSER	Frederick County, Office of Sustainability and Environmental Resources
FY	Fiscal Year
GIS	Geographic Information System
HA	Harford (County)
HA-DPW	Harford County, Department of Public Works
HO	Howard (County)
HWG	Horsley Witten Group, Inc.
ICPRB	Interstate Commission on the Potomac River Basin
IDDE	Illicit Discharge Detection and Elimination
IR	Integrated Report
ISWBMPDB	International Stormwater BMP Database
LA	Load Allocations
lbs	Pounds (weight)
LF	Linear Feet
LID	Low Impact Development
LN	Lower North
LNB	Lower North Branch
LRE	Loch Raven East subwatershed
LJF	Lower Jones Falls (Watershed)
MAA	Maryland Aviation Administration
MD	Maryland
MDA	Maryland Department of Agriculture
MDE	Maryland Department of the Environment
MDOT SHA	Maryland Department of Transportation State Highway Administration
MDP	Maryland Department of Planning
MEP	Maximum Extent Practicable
MEPA	Maryland Environmental Policy Act
MET	Maryland Environmental Trust
MGF	Middle Gwynns Falls (Watershed)
MO	Montgomery (County)
MO-DEP	Montgomery County, Department of Environmental Protection
MOS	Margin of Safety
MS4	Municipal Separate Storm Sewer System
MSU	Morgan State University
MUTCD	Manual on Uniform Traffic Control Devices
NEPA	National Environmental Policy Act
NJF	Northeastern Jones Falls (Watershed)
NPDES	National Pollutant Discharge Elimination System
OC	Office of Communications (MDOT SHA)
OED	Office of Environmental Design (MDOT SHA)
OOM	Office of Maintenance (MDOT SHA)
PACD	Pennsylvania Association of Conservation Districts
PATMH	Patapsco River Mesohaline
PAXMH	Patuxent River Mesohaline
PAXOH	Patuxent River Oligohaline
PAXTF	Patuxent River Tidal Fresh
PB	Parsons Brinckerhoff
PCB	Polychlorinated Biphenyl

P_E	Rainfall Target Used To Size ESD Practices
PERC	Perchloroethylene
PG	Prince George's (County)
PG-DoE	Prince George's County, Department of the Environment
RBP	Rapid Bioassessment Protocol
RGP	Regional General Permit
ROW	Rights-Of-Way
SAH	Sponsor-A-Highway
SB	Spring Branch subwatershed
SCA	Stream Corridor Assessment
SFEI	San Francisco Estuary Institute
SGW	Submerged Gravel Wetlands
SSO	Sanitary Sewer Overflow
SW	Stormwater
SWAP	Small Watershed Action Plan
SWM	Stormwater Management
SW-WLA	Stormwater Wasteload Allocation
TBD	To Be Determined
TBR	Tidal Back River (Watershed)
TCW	Toxic Contaminants Workgroup
TMDL	Total Maximum Daily Load
TN	Total Nitrogen
TP	Total Phosphorus
tPCB	Total Polychlorinated Biphenyl
TSS	Total Suspended Solids
UBR	Upper Back River (Watershed)
UGF	Upper Gwynns Falls (Watershed)
UJF	Upper Jones Falls (Watershed)
US	United States
USACE	United States Army Corps of Engineers
USDA-NRCS	United States Department of Agriculture, Natural Resources Conservation Service
USFWS	United States Fish and Wildlife Service
USGS	United States Geological Survey
USWG	Urban Stormwater Work Group
WA	Washington (County)
WA-DPW	Washington County, Division of Public Works
WAMP	Watershed Management Plan
WCSCD	Washington County Soil Conservation District
WIP	Watershed Implementation Plan
WLA	Wasteload Allocation
WPD	Water Programs Division (MDOT SHA)
WQSs	Water Quality Standards
WQv	Water Quality Volume
WQGIT	Water Quality Goal Implementation Team
WRAS	Watershed Restoration Action Strategy
WSSC	Wetlands of Special State Concern
WTM	Watershed Treatment Model
WTWG	Watershed Technical Work Group
WWTP	Waste Water Treatment Plant
Year	Year
12-SW	Maryland General Permit for Discharges from Stormwater Associated with Industrial Activities

MARYLAND DEPARTMENT OF TRANSPORTATION

STATE HIGHWAY ADMINISTRATION

References







REFERENCES

AMT, Inc. (A. Morton Thomas and Associates, Inc.). 2011. *Upper Gwynns Falls Small Watershed Action Plan* prepared for Baltimore County, Department of Environmental Protection and Sustainability. Retrieved from http://www.baltimorecountymd.gov/Agencies/environment/watersheds/gwynnsmain.html

AMT, Inc. & Biohabitats. 2003. *Watts Branch Watershed Restoration Study*, Task 1 Report, March 2003 prepared for Montgomery County Department of Environmental Protection. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Lower%20Potomac%20Direct/Watts-Branch-stream-restoration-study-03.pdf

BA-DEPRM (Baltimore County, Department of Environmental Protection and Resource Management). 2008a. *Upper Back River Small Watershed Action Plan*. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/swapupperbackrivervol1.pdf

BA-DEPRM. 2008b. *Spring Branch Subwatershed - Small Watershed Action Plan* (Addendum to the Water Quality Management Plan for Loch Raven Watershed). Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/swapspringbranchvol%201.pdf

BA-EPS (Baltimore County, Department of Environmental Protection and Sustainability). 2012. *Northeastern Jones Falls Small Watershed Action Plan* (SWAP). Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/swapnejonesfallsvol1130605.pdf

BA-EPS. 2016. *Baltimore County TMDL Implementation Plan: Trash and Debris in the Middle Branch and Northwest Branch Portions of the Patapsco River Mesohaline Tidal Chesapeake Bay Segment*. Final July 2016. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/tmdls/trashtmdl.pdf

BA-EPS. 2017. Lower Gunpowder Falls. Retrieved from https://www.baltimorecountymd.gov/Agencies/environment/watersheds/lowergpmain.html

BASMAA (Bay Area Stormwater Management Agencies Association). 2012. Trash Load Reduction Tracking Method, Assessing The Progress of San Francisco Bay Area MS4s Towards Stormwater Trash Load Reduction Goals. Technical Report (Version 1.0). Prepared by EOA, Inc. February 1, 2012. Retrieved from http://www.scvurppp-w2k.com/pdfs/1112/TL_ReductionTracking_Method_020112.pdf

Biohabitats, Versar, Horsley Witten Group, Capuco Consulting Services, Chesapeake Stormwater Network, & RESOLVE. 2012a. *Anacostia Watershed Implementation Plan*. Retrieved from www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Anacostia/AnacostiaRiverWIP_FINAL.pdf

Biohabitats, Versar, Horsley Witten Group, Capuco Consulting Services, Chesapeake Stormwater Network, & RESOLVE. 2012b. *Lower Monocacy Implementation Plan* prepared for Montgomery County, Department of Environmental Protection. January 2012. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Lower-Monocacy-implementation-plan-12.pdf

Biohabitats, Versar, Horsley Witten Group, Capuco Consulting Services, Chesapeake Stormwater Network, & RESOLVE. 2012c. *Rock Creek Implementation Plan* prepared for Montgomery County, Department of Environmental Protection. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Rock-creek-watershed-implementation-plan-11.pdf

Caraco, D. 2013. *Watershed Treatment Model (WTM) 2013 User's Guide*. Center for Watershed Protection, Ellicott City, MD. Retrieved from https://owl.cwp.org/?mdocs-file=5540

CBP (Chesapeake Bay Program). 2015. *Toxic Contaminants Policy and Prevention Outcome: Management Strategy.* 2015-2025. Vol 1. Retrieved

from
https://www.chesapeakebay.net/channel_files/24193/3e_toxics_policypreventi
on_6-25-15_ff_formatted.pdf

CH2MHILL & KCI Technologies, Inc. (KCI). 2008. *South River Watershed Study Summary Report* prepared for Anne Arundel County. November 2008. Retrieved from http://dev.aacounty.org/departments/public-works/wprp/forms-and-publications/South%20River%20Summary%20Report.pdf

Clary, J., Jones, J., Urbonas, B., Quigley, M., Strecker, E., & Wagner, T. 2008. Can Stormwater BMPs Remove Bacteria? New Findings from the International Stormwater BMP Database. *Stormwater Magazine,* May/June 2008. Retrieved from http://www.uwtrshd.com/assets/can-stormwater-bmps-remove-bacteria.pdf

CL-BRM (Carroll County, Bureau of Resource Management). 2012. *Liberty Reservoir Watershed Stream Corridor Assessment*. Retrieved from http://ccgovernment.carr.org/ccg/resmgmt/doc/Liberty/Liberty%20SCA.pdf?x=1466803710079

CL-BRM. 2015. *Liberty Reservoir Watershed Characterization Plan*. Retrieved from http://ccgovernment.carr.org/ccg/resmgmt/Liberty/Character.aspx

CL-BRM. 2016a. *Double Pipe Creek Watershed Characterization Plan*. Spring 2016. Retrieved from http://ccgovernment.carr.org/ccg/resmgmt/DoublePipeCreek/Character.aspx

CL-BRM. 2016b. *Loch Raven Reservoir Watershed Characterization Pla*n. Spring 2016. Retrieved from http://ccgovernment.carr.org/ccg/resmgmt/LochRaven/Character.aspx

CL-BRM. 2016c. *Lower Monocacy River Watershed Characterization Plan*. Spring 2016. Retrieved from http://ccgovernment.carr.org/ccg/resmgmt/LochRaven/Character.aspx

CL-BRM. 2016d. *Lower North Branch Patapsco River Watershed Characterization Plan*. Spring 2016. Retrieved from http://ccgovernment.carr.org/ccg/resmgmt/NorthBranch/Character.aspx

CL-BRM. 2016e. *Upper Monocacy River Watershed Characterization Plan*. Spring 2016. Retrieved from http://ccgovernment.carr.org/ccg/resmgmt/UpperMonocacy/Character.aspx

Clemson Cooperative Extension. 2015. *Managing Waterfowl in Stormwater Ponds*. Retrieved from https://www.clemson.edu/extension/water/stormwater-ponds/problem-solving/nuisance-wildlife/waterfowl/index.html

CWAPTW (Clean Water Action Plan Technical Workgroup). 1998. *Maryland Clean Water Action Plan: Final 1998 Report on Unified Watershed Assessment, Watershed Prioritization and Plans for Restoration Action Strategies*. Retrieved from http://msa.maryland.gov/megafile/msa/speccol/sc5300/sc5339/000113/000000/000385/unrestricted/20040775e.pdf

CWP (Center for Watershed Protection). 2003. *Bush River Watershed Management Plan* prepared for Harford County, Department of Public Works. April 2003. Retrieved from http://dnr.maryland.gov/waters/Documents/WRAS/br_strategy.pdf

CWP. 2008a. *Deriving Reliable Pollutant Removal Rates for Municipal Street Sweeping and Storm Drain Cleanout Programs in the Chesapeake Bay Basin,* CWP, Ellicott City, MD. Retrieved from https://www.epa.gov/sites/production/files/2015-11/documents/cbstreetsweeping.pdf

CWP. 2008b. *Lower Jones Falls Watershed Small Watershed Action Plan* (SWAP) prepared for Baltimore County, Department of Environmental Protection and Resource Management and the U.S. Environmental Protection Agency, Region III. October 15, 2008. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/swaplowerjonesfalls.pdf

CWP, KCI, & Coastal Resources, Inc. (Coastal Resources). 2011. *Beaverdam Run, Baisman Run, and Oregon Branch SWAP: Final Report.* Vols. 1 and 2 prepared for Baltimore County, Department of Environmental Protection and Sustainability. November 2011. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/swapareaivolume1.pdf

CWP, KCI, & Coastal Resources. 2014. *Loch Raven East Small Watershed Action Plan: Final Report* Vols. 1 and 2 prepared for Baltimore County, Department of Environmental Protection and Sustainability. February 2014. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/2014/lochraveneastswapvol1.pdf

CWP, KCI, & Coastal Resources. 2015. *Upper Jones Falls SWAP* prepared for Baltimore County Department of Environmental Protection and Sustainability. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/2015/AreaG/areagswapfulldoc1.pdf

CWP, KCI, & Coastal Resources. 2017. *Lower Gunpowder Falls (Rural) Small Watershed Action Plan: Final Report*. Vols. 1 and 2 prepared for Baltimore County, Department of Environmental Protection and Sustainability. Retrieved from https://www.baltimorecountymd.gov/Agencies/environment/watersheds/lowergpmain.html

Dewberry. 2017. *Lower Monocacy Watershed Assessment* prepared for Frederick County, Office of Sustainability and Environmental Resources. July 2017. Retrieved from https://www.frederickcountymd.gov/DocumentCenter/View/300361/Lower-Monocacy-Watershed-Assessment_Part-1?bidId=

DNR (Maryland Department of Natural Resources). 2002a. *Bush River Watershed Characterization*. Annapolis, MD. Retrieved from http://dnr.maryland.gov/waters/Documents/WRAS/br_char.pdf

DNR. 2002b. *Liberty Reservoir Watershed Characterization*. Retrieved from http://msa.maryland.gov/megafile/msa/speccol/sc5300/sc5339/000113/002000/002374/unrestricted/20063378e.pdf

DNR. 2004. *Upper Monocacy Stream Corridor Assessment*. Baltimore, MD: DNR, Watershed Assessment and Targeting Division, Watershed Services. Retrieved from https://dnr.maryland.gov/waters/Documents/WRAS/umon_sca.pdf

EA. 2015. Final *Implementation Plan for the Anacostia River Watershed Trash Total Maximum Daily Load in Prince George's County* prepared for the Prince George's County, Department of the Environment. Largo, MD. March 2015. Retrieved from http://pgcdoe.net/pgcountyfactsheet/Areas/Factsheet/Documents/Plans/Final_AnacTrash_Plan_.pdf

EA. 2017. *Upper Monocacy River Watershed Assessment Frederick County, Maryland* prepared for Frederick County, Division of Public Works. May 5, 2017. EA Project No. 6279402. Retrieved from https://www.frederickcountymd.gov/DocumentCenter/View/300340/Upper-Monocacy-Watershed-Assessment?bidId=

EPA (Environmental Protection Agency). 2010. *Chesapeake Bay Total Maximum Daily Load for Nitrogen, Phosphorus and Sediment*. US EPA, Chesapeake Bay Program Office, Annapolis, MD. December 29, 2010. Retrieved from https://www.epa.gov/chesapeake-bay-tmdl/chesapeake-bay-tmdl-document

EPA. 2016. Watershed Academy Web. Watershed Change Modules: Growth and Water Resources. Retrieved from https://cfpub.epa.gov/watertrain/

FR-DPW (Frederick County, Division of Public Works). 2004. *Lower Monocacy River Watershed Restoration Action Strategy*. Final Report. Retrieved from http://dnr.maryland.gov/waters/Documents/WRAS/lmon_strategy.pdf

FR-DPW. 2005. *Upper Monocacy River Watershed Restoration Action Strategy*. Retrieved from http://msa.maryland.gov/megafile/msa/speccol/sc5300/sc5339/000113/002000/002377/unrestricted/20063545e.pdf

FR-OSER (Frederick County, Office of Sustainability and Environmental Resources). 2018. Publications and Resources [webpage]; Watershed Studies. Retrieved from https://www.frederickcountymd.gov/7595/Publications-and-Resources

Gilbreath, A., Yee, D., & McKee, L. 2012. *Concentrations and Loads of Trace Contaminants in a Small Urban Tributary, San Francisco Bay, California*. A Technical Report of the Sources Pathways and Loading Work Group of the

Regional Monitoring Program for Water Quality: Contribution No. 650. San Francisco Estuary Institute, Richmond, California. Retrieved from https://www.sfei.org/sites/default/files/Z4LA_Final_2012May15.pdf

HA-DPW (Harford County, Department of Public Works). 2016. Harford County Maryland, Loch Raven Reservoir Total Maximum Daily Load (TMDL) for Bacteria, Mercury, Nutrients, and Sediment. March 1, 2016. Retrieved from https://www.harfordcountymd.gov/DocumentCenter/View/5844/Loch-Raven-TMDL-Restoration-Plan-2016-03-01?bidId=

HA-DPW. 2017. *Bush River Watershed Total Maximum Daily Load (TMDL) Restoration Plan for PCBs*. August 2017. Retrieved from https://www.harfordcountymd.gov/DocumentCenter/View/9440/Bush-River-Watershed-TMDL-Restoration-Plan-for-PCBs-2017-08-02?bidId=

Haywood, H. C., & Buchanan, C. 2007. Total maximum daily loads of poly*chlorinated biphenyls (PCBs) for tidal portions of the Potomac and Anacostia rivers in the District of Columbia, Maryland, and Virginia*. Interstate Commission on the Potomac River Basin. ICPRB Report 07-7. Rockville, MD. October 2007. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/tmdl_final_potomac_pcbs.aspx

Hoos, A. B., Robinson, J. A., Aycock, R. A., Knight, R. R., & Woodside, M. D. 2000. *Sources, Instream Transport, and Trends of Nitrogen, Phosphorus, and Sediment in the Lower Tennessee River Basin, 1980-96*. U.S. Geological Survey, Water-Resources Investigations Report 99-4139. Nashville, Tennessee. Retrieved from https://pubs.usgs.gov/wri/wri994139/txt2.pdf

HWG (Horsley Witten Group, Inc). 2012a. *Muddy Branch and Watts Branch Subwatersheds Implementation Plan* prepared for the Montgomery County Department of Environmental Protection. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Muddy-Branch-Watts-Branch-Subwatersheds-Implementation-Plan-12.pdf

HWG. 2012b. *Great Seneca Subwatershed Implementation Plan* prepared for the Montgomery County Department of Environmental Protection. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Great-Seneca-subwatershed-implementation-plan-12.pdf

KCI Technologies, Inc. (KCI). 2017a. *Patapsco River South Branch and Lower North Branch Watershed Assessment* prepared for Howard County, Department of Public Works. January 2017. Retrieved from https://www.howardcountymd.gov/LinkClick.aspx?fileticket=YNYQlarhnb0%3d&portalid=0

KCI. 2017b. *Patuxent River: Brighton Dam, Rocky Gorge Dam, and Patuxent River Upper Watershed Assessment* prepared for Howard County, Department of Public Works. Retrieved from https://www.howardcountymd.gov/LinkClick.aspx?fileticket=Z05pT5qkEJU%3d&portalid=0

KCI. 2018. *Upper,* M*iddle, and Lower Potomac River Watershed Assessment* prepared for Charles County, Department of Planning and Growth Management. February 2018. Retrieved from http://www.charlescountymd.gov/sites/default/files/pgm/planning/watershed/potomac_river_watershed_assessment.pdf

KCI & CH2M HILL. 2011. *Patapsco Non-Tidal Watershed Assessment Comprehensive Summary Report* prepared for Anne Arundel County. August 2011 Final Report. Retrieved from http://dev.aacounty.org/departments/public-works/wprp/forms-and-publications/PNT_Report.pdf

KCI & Coastal Resources. 2018. Herring Bay, Middle Patuxent, and Lower Patux*ent Watershed Assessment Comprehensive Summary Report* prepared for Anne Arundel County, Department of Public Works. June 2018 Final Report. Retrieved from https://www.aacounty.org/departments/public-works/wprp/herring-bay-middle-patuxent/index.html

Lazarick, L. 2013. 'Scoop the Poop Day in Maryland,' O'Malley declares, *MarylandReporter.com*, 27 August 2013. Retrieved from http://marylandreporter.com/2013/08/27/scoop-the-poop-day-in-maryland-omalley-declares/#

Leisenring, M., Clary, J., & Hobson, P. 2014. *International Stormwater Best Management Practices (BMP) Database Pollutant Category Statistical Summary Report: Solids, Bacteria, Nutrients, and Metals*. Retrieved from

http://www.bmpdatabase.org/Docs/2014%20Water%20Quality%20Analysis%20Addendum/BMP%20Database%20Categorical_StatisticalSummaryReport_December2014.pdf

LimnoTech. 2008. *Upper Patuxent River Watershed Overall Summary Recommendation Report* prepared for Anne Arundel County, Department of Public Works. Retrieved from https://www.aacounty.org/departments/public-works/wprp/forms-and-publications/Upper%20Patuxent%20Summary%20Report.pdf

LimnoTech & Versar. 2012. *Patapsco Tidal and Bodkin Creek Watershed Assessment Comprehensive Summary Report* prepared for Anne Arundel County, Department of Public Works. Retrieved from http://dev.aacounty.org/departments/public-works/wprp/forms-and-publications/PTB_Summary_Report_Final_Main.pdf

LimnoTech & Versar. 2016. *Little Patuxent Watershed Assessment Comprehensive Summary Report* prepared for Anne Arundel County, Department of Public Works. Retrieved from http://www.aacounty.org/AACoOIT/WPRP/Little%20Patuxent%20Watershed%20Assessment%20Report%20with%20Appendices_FINAL%202.pdf

MAST (Maryland Assessment Scenario Tool). 2016. MASTSource_Data_3_31_2016.xlsx. Retrieved from http://www.mastonline.org/Documentation.aspx. Retrieved March 31, 2016.

MDA (Maryland Department of Agriculture) & MDE (Maryland Department of the Environment). 2016. Draft *Maryland Trading and Offset Policy and Guidance Manual Chesapeake Bay Watershed.* Retrieved from http://www.mde.state.md.us/programs/water/pages/wqtac.aspx

MDOT SHA (Maryland Department of Transportation State Highway Administration). 2016. *MDOT SHA Existing Water Quality Grass Swale Identification Protocol*. Prepared by AECOM. Retrieved from https://www.roads.maryland.gov/OED/SHA-Existing-Water-Quality-Grass-Swale-Identification-Protocol-and-Appendices.pdf

MDOT SHA. 2018. *MDOT SHA Restoration Modeling Protocol*. Retrieved from https://www.roads.maryland.gov/Index.aspx?pageid=336

MDE (Maryland Department of the Environment). 2006. *Prioritizing Sites for Wetland Restoration, Mitigation, and Preservation in Maryland*. Version: May 2006. Baltimore, MD: Maryland Department of the Environment, Wetlands and Waterways Program. Retrieved from http://www.mde.state.md.us/programs/Water/WetlandsandWaterways/AboutWetlands/Documents/www.mde.state.md.us/assets/document/wetlandswaterways/Title.pdf

MDE. 2008a. Revised Final *Total Maximum Daily Load of Sediment in the Antietam Creek Watershed, Washington County, Maryland*. Retrieved from http://mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/Antietam_Sed_TMDL_011609_Final.pdf

MDE. 2008b. Final *Total Maximum Daily Load of Sediment in the Conococheague Creek Watershed, Washington County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/Conoco_Sed_TMDL_011609_Final.pdf

MDE. 2009a. *2000 Maryland Stormwater Design Manual*, Volumes I & II (Original publication in October 2000, Revised May 2009). Retrieved from https://mde.maryland.gov/programs/water/stormwatermanagementprogram/pages/stormwater_design.aspx

MDE. 2009b. Revised Final *Total Maximum Daily Load of Sediment in the Catoctin Watershed, Frederick County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/Catoctin_Sed_TMDL_20090918_final_revised.pdf

MDE. 2009c. Final *Total Maximum Daily Load of Sediment in the Double Pipe Creek Watershed, Frederick and Carroll Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/Double_Pipe_Sed_TMDL_091208_final.pdf

MDE. 2009d. Final *Total Maximum Daily Loads of Fecal Bacteria for Loch Raven Reservoir Watershed in Baltimore, Carroll and Harford Counties,*

Maryland. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/Loch_Raven_Bacteria_TMDL_Final.pdf

MDE. 2009e. Final *Total Maximum Daily Load of Sediment in the Lower Monocacy River Watershed, Frederick, Carroll, and Montgomery Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/Lower-Monocacy/TSS/Lower_Monoc_Sed_TMDL.pdf

MDE. 2009f. Final *Total Maximum Daily Loads of Fecal Bacteria for the Patapsco River Lower North Branch Basin in Anne Arundel, Baltimore, Carroll, and Howard Counties, and Baltimore City Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/Patapsco_LNB_Bacteria_TMDL_Final.pdf

MDE. 2009g. Final *Total Maximum Daily Load of Sediment in the Upper Monocacy River Watershed, Frederick and Carroll Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/Upper-Monocacy/TSS/Upper_Monoc_Sed_TMDL_final.pdf

MDE. 2010a. *Total Maximum Daily Loads of Trash for the Anacostia River Watershed, Montgomery and Prince George's Counties, Maryland and the District of Columbia* Retrieved from: https://doee.dc.gov/sites/default/files/dc/sites/ddoe/publication/attachments/Final_Anacostia_Trash_TMDL.pdf

MDE. 2010b. Final *Total Maximum Daily Load of Sediment in the Gwynns Falls Watershed, Baltimore City and Baltimore County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/Gwynns_Sed_TMDL_072610_Final.pdf

MDE. 2011a. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in the Northeast and Northwest Branches of the Nontidal Anacostia River, Montgomery and Prince George's County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/NEB_NWB_PCB_TMDL_20110930_Final.pdf

MDE. 2011b. Final *Total Maximum Daily Loads of Bacteria for Impaired Recreational Areas in Marley Creek and Furnace Creek of Baltimore Harbor Basin in Anne Arundel County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/TMDL_Marley_Furnace_070910_final.pdf

MDE. 2011c. Final *Total Maximum Daily Load of Sediment in the Bynum Run Watershed, Harford County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/Bynum_Sed_TMDL_093011_Final.pdf

MDE. 2011d. Final *Total Maximum Daily Load of Sediment in the Cabin John Creek Watershed, Montgomery County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/www.mde.state.md.us/assets/document/CabJohn_Sed_TMDL_093011_Final.pdf

MDE. 2011e. Final *Total Maximum Daily Load of Sediment in the Jones Falls Watershed, Baltimore City and Baltimore County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_Jones_Falls_Sediment.aspx

MDE. 2011f. Final *Total Maximum Daily Load of Sediment in the Little Patuxent River Watershed, Howard and Anne Arundel Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_LittlePAX_Sediment.aspx

MDE. 2011g. Final *Total Maximum Daily Load of Sediment in the Patapsco River Lower North Branch Watershed, Baltimore City and Baltimore, Howard, Carroll and Anne Arundel Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_PatapscoLNB_Sediment.aspx

MDE. 2011h. Final *Total Maximum Daily Loads of Fecal Bacteria for the Patuxent River Upper Basin in Anne Arundel and Prince George's Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_final_Patuxent_River_Upper_bacteria.aspx

MDE. 2011i. *Final Total Maximum Daily Load of Sediment in the Patuxent River Upper Watershed, Anne Arundel, Howard and Prince George's Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_PaxUpper_Sediment.aspx

MDE. 2011j. Final *Total Maximum Daily Load of Sediment in the Rock Creek Watershed, Montgomery County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_final_Rock_Creek_sed.aspx

MDE. 2011k. Final *Total Maximum Daily Load of Sediment in the Seneca Creek Watershed, Montgomery County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_Seneca_Creek_sed.aspx

MDE. 2012a. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in Back River Oligohaline Tidal Chesapeake Bay Segment, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_BackRiver_PCBs.aspx

MDE. 2012b. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in Baltimore Harbor, Curtis Creek/Bay, and Bear Creek Portions of Patapsco River Mesohaline Tidal Chesapeake Bay Segment, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_BaltHarbor_PCBs.aspx

MDE. 2012c. *Final Watershed Report for Biological Impairment of the Catoctin Creek Watershed in Frederick County, Maryland Biological Stressor Identification Analysis Results and Interpretation*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/Documents/BSID_Reports/Catoctin_Creek_BSID_Report_final.pdf

MDE. 2012d. Final *Watershed Report for Biological Impairment of the Liberty Reservoir Watershed in Baltimore and Carroll Counties, Maryland, Biological Stressor Identification Analysis Results and Interpretation*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/Documents/BSID_Reports/LibertyRes_BSID_25Jan2012_final.pdf

MDE. 2012e. Final *Total Maximum Daily Load of Sediment* in the Potomac River Montgomery County Watershed, Montgomery and Frederick Counties, Maryland. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_PotomacMOCnty_Sediment.aspx

MDE. 2013a. Final *Total Maximum Daily Load of Phosphorus in the Antietam Creek Watershed, Washington County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_final_Antietam_Creek_Nutrient.aspx

MDE. 2013b. Final *Total Maximum Daily Load of Phosphorus in the Catoctin Creek Watershed, Frederick County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_final_Catoctin_Creek_nutrient.aspx

MDE. 2013c. Final *Total Maximum Daily Load of Phosphorus in the Double Pipe Creek Watershed, Frederick and Carroll Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/tmdl_final_double_pipe_creek_phosphorus.aspx

MDE. 2013d. Final *Total Maximum Daily Load of Phosphorus in the Lower Monocacy River Watershed, Frederick, Carroll, and Montgomery Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/Lower-Monocacy/Nutrients/Lower_Monocacy_River_Nut_TMDL_8-30-2012_fa.pdf

MDE. 2013e. Final *Total Maximum Daily Load of Phosphorus in the Rock Creek Watershed, Montgomery County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_final_Rock_Creek_Nutrient.aspx

MDE. 2013f. Final *Total Maximum Daily Load of Phosphorus in the Upper Monocacy River Watershed, Frederick and Carroll Counties, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/tmdl_final_upper_monocacy_river_phosphorus.aspx

MDE. 2014a. General Permit for Discharges from Stormwater Associated with Industrial Activities. Discharge Permit No. 12-SW; NPDES Permit No. MDR0000. Effective Date: January 1, 2014; Expiration Date: December 31, 2018. Retrieved from https://mde.maryland.gov/programs/Permits/WaterManagementPermits/Documents/GDP%20Stormwater/12_SW_CompleteFinalPermit.pdf

MDE. 2014b. *Accounting for Stormwater Wasteload Allocations and Impervious Acres Treated: Guidance for National Pollutant Discharge Elimination System Stormwater Permits*. August 2014. Retrieved from http://www.mde.state.md.us/programs/Water/StormwaterManagementProgram/Documents/NPDES%20MS4%20Guidance%20August%2018%202014.pdf

MDE. 2014c. *Guidance for Developing Stormwater Wasteload Allocation Implementation Plans for Nutrient, and Sediment Total Maximum Daily Loads*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/DataCenter/Documents/Nutrient%20Sediment%20Implementation%20Plan%20Guidance_final_111814.pdf

MDE. 2014d. *Guidance for Developing Stormwater Wasteload Allocation Implementation Plans for Trash/Debris Total Maximum Daily Loads*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/DataCenter/Documents/Trash%20Implementation%20Plan%20Guidance_052014.pdf

MDE. 2014e. *Guidance for Developing a Stormwater Wasteload Allocation Implementation Plan for Bacteria Total Maximum Daily Loads*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/DataCenter/Documents/Bacteria%20Implementation%20Plan%20Guidance_051414_clean.pdf

MDE. 2014f. Comment Response Document regarding the Final *Total Maximum Daily Load of Polychlorinated Biphenyls in Lake Roland of Jones Falls Watershed in Baltimore County and Baltimore City, Maryland*. Retrieved from http://mde.maryland.gov/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/tmdl_final_lake_roland_pcb.aspx

MDE. 2015a. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in the Magothy River Mesohaline Chesapeake Bay Tidal Segment, Anne Arundel County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/tmdl_final_magothy_river_pcb.aspx

MDE. 2015b. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in South River Mesohaline Chesapeake Bay Segment, Anne Arundel County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/South-River/PCBs/South_River_PCB_TMDL_fa.pdf

MDE. 2015c. Final *Total Maximum Daily Loads of Trash and Debris for Middle Branch and Northwest Branch Portions of Patapsco River Mesohaline Tidal Chesapeake Bay Segment, Baltimore City and County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_final_BaltimoreHarbor_trash.aspx

MDE. 2016a. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in the Severn River, Mesohaline Chesapeake Bay Tidal Segment, Anne Arundel County, Maryland.* Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/Severn-River/PCBs/Severn_River_PCB_TMDL_fa.pdf

MDE. 2016b. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in the West River and Rhode River, Mesohaline Segments, Anne Arundel County, Maryland*. Retrieved from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Documents/West-River/PCBs/West_River_PCB_TMDL_fa.pdf

MDE. 2016c. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in the Gunpowder River and Bird River Subsegments of the Gunpowder River Oligohaline Segment, Baltimore County and Harford County, Maryland*. Retrieved from

http://mde.maryland.gov/programs/water/TMDL/ApprovedFinalTMDLs/Pages/tmdl_final_gunpowder_bird_pcb.aspx

MDE. 2016d. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in the Bush River Oligohaline Segment, Harford County, Maryland*. Retrieved from http://mde.maryland.gov/programs/water/TMDL/ApprovedFinalTMDLs/Pages/tmdl_final_bush_river_pcb.aspx

MDE. 2016e. Final *Total Maximum Daily Load of Sediment in the Swan Creek Watershed, Harford County, Maryland*. Retrieved from http://mde.maryland.gov/programs/water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_SwanCreek_sediment.aspx

MDE. 2017a. Final *Total Maximum Daily Load of Polychlorinated Biphenyls in the Patuxent River Mesohaline, Oligohaline and Tidal Fresh Chesapeake Bay Segments. Retrieved* from http://mde.maryland.gov/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/tmdl_final_patuxent_pcb.aspx

MDE. 2017b. Final *Total Maximum Daily Load of Sediment in the Lower Gunpowder Falls Watershed, Baltimore County, Maryland*. Retrieved from http://mde.maryland.gov/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_LowerGunpowder_sediment.aspx

MDE. 2017c. Final *Total Maximum Daily Load of Sediment in the Non-tidal South River Watershed, Anne Arundel County, Maryland. Retrieved* from http://www.mde.state.md.us/programs/Water/TMDL/ApprovedFinalTMDLs/Pages/TMDL_Final_SouthRiver_sediment.aspx

MDE. 2018. *Maryland's Draft 2018 Integrated Report of Surface Water Quality*. Retrieved from https://mde.maryland.gov/programs/Water/TMDL/Integrated303dReports/Pages/2018IR.aspx

MDP (Maryland Department of Planning). 2010. Maryland Department of Planning 2010 Land Use/Land Cover Update, Maryland Department of Planning Land Use/Land Cover Classification Definitions. Retrieved from https://planning.maryland.gov/Documents/OurProducts/landuse/AppendixA_LandUseCategories.pdf

MO-DEP (Montgomery County, Department of Environmental Protection). 1999. *Great Seneca Watershed Study*. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Seneca%20Creek/Great-Seneca-Creek-watershed-study-99.pdf

MSU (Morgan State University) & CWP (Center for Watershed Protection). 2018. *Inlet Cleaning Pollutant Characterization Study for TMDL Compliance* prepared for the Maryland Department of Transportation State Highway Administration. June 2018.

PACD (Pennsylvania Association of Conservation Districts). 2009. *Stream Bank Fencing and Stream Crossings: We All Live Downstream*. Retrieved from https://pacd.org/wp-content/uploads/2009/09/StreambankFencing1.pdf

PB (Parsons Brinckerhoff). 2010. *Tidal Back River Small Watershed Action Plan (SWAP)* prepared for Baltimore County, Department of Environmental Protection and Resource Management. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/tbrswapvol1.pdf

PB. 2012. *Bear Creek/Old Road Bay Small Watershed Action Plan* prepared for Baltimore County, Department of Environmental Protection and Sustainability. December 2012. Retrieved from https://www.baltimorecountymd.gov/Agencies/environment/watersheds/bhmain.html

PB. 2013. *Middle Gwynns Falls SWAP* prepared for Baltimore County, Department of Environmental Protection and Sustainability. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/2013/swapmgfareacvol131113.pdf

PB. 2015a. *Liberty Reservoir Small Watershed Action Plan*. Vols. I and II prepared for Baltimore County, Department of Environmental Protection and Sustainability. March 2015. Retrieved from https://www.baltimorecountymd.gov/Agencies/environment/watersheds/libmain.html

PB. 2015b. *Loch Raven North SWAP* prepared for Baltimore County, Department of Environmental Protection and Sustainability. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/2016/lochravennorth/lrnswapvol1complete.pdf

S&S Planning and Design. 2012. *Tiber-Hudson and Plumtree Branch Stream Corridor Assessment* prepared for the Howard County Department of Public Works - Bureau of Environmental Services - Stormwater Management Division by S&S Planning and Design, LLC. Cumberland, MD. Retrieved from https://www.howardcountymd.gov/LinkClick.aspx?fileticket=yHQ87JE3FGk%3D&portalid=0

SFEI (San Francisco Estuary Institute). 2010. *A BMP Tool Box for Reducing Polychlorinated Biphenyls (PCBs) and Mercury (Hg) in Municipal Stormwater*. Retrieved from http://www.nemallc.com/Resources/Documents/BMP%20Performance/pcb%20and%20hg%20bmp%20toolbox%202010.pdf

Schueler, T. 2000. Microbes in Urban Watersheds: Concentrations, Sources, & Pathways. *Watershed Protection Techniques, 3*(1), 554-565. Retrieved from http://www.myxyz.org/phmurphy/dog/Article17Microbes.pdf

Schueler, T. 2011. *Nutrient Accounting Methods to Document Local Stormwater Reduction in the Chesapeake Bay Watershed*. CSN Technical Bulletin No. 9. Chesapeake Stormwater Network, Ellicott City, MD. Retrieved from http://chesapeakestormwater.net/wp-content/uploads/downloads/2012/03/TB-9-Nutrient-Accounting-FINAL-DRAFT.pdf

Schueler, T. R. 1987. *Controlling Urban Runoff: A Practical Manual for Planning and Designing Urban BMPs*. Washington, DC: Metropolitan Washington Council of Governments.

Schueler, T., & Youngk, A. 2015. *Potential Benefits of Nutrient and Sediment Practices to Reduce Toxic Contaminants in the Chesapeake Bay Watershed. Part 1: Removal of Urban Toxic Contaminants*. Final Report. Chesapeake Stormwater Network, Ellicott City, MD. Retrieved from https://cbtrust.org/wp-content/uploads/FY14-Potential-Benefits-of-Nutrient-and-Sediment-Practices- to-Reduce-Toxic-Contaminants-in-CBW.pdf

Tetra Tech. 2009. An Assessment of Stormwater Management Retrofit and Stream Restoration Opportunities in Bennett Creek Watershed, Frederick County, Maryland. Retrieved from https://frederickcountymd.gov/DocumentCenter/View/294567/BennettCreekRetrofit_Final_20090511

Tetra Tech. 2014a. *Watershed Existing Condition Report for the Upper Patuxent River, Western Branch, and Rocky Gorge Reservoir Watersheds* prepared for Prince George's County, Department of the Environment. Retrieved from http://pgcdoe.net/pgcountyfactsheet/Areas/Factsheet/Documents/Reports/WECR_Patuxent_20141231.pdf

Tetra Tech. 2014b. *Watershed Existing Condition Report for the Potomac River Watershed* prepared for Prince George's County, Department of the Environment. December 31, 2014. Retrieved from http://pgcdoe.net/pgcountyfactsheet/Areas/Factsheet/Documents/Reports/WECR_Potomac_20141231.pdf

Tetra Tech. 2015a. *Restoration Plan for PCB-Impacted Water Bodies in Prince George's County* prepared for Prince George's County, Department of the Environment, Stormwater Management Division. December 30, 2015. Retrieved from http://pgcdoe.net/pgcountyfactsheet/Areas/Factsheet/Documents/Plans/PCB%20Restoration%20Plan%2020151228-combined.pdf

Tetra Tech. 2015b. *Restoration Plan for the Anacostia River Watershed in Prince George's County* prepared for Prince George's County, Department of the Environment, Stormwater Management Division. December 30, 2015. Retrieved from http://pgcdoe.net/pgcountyfactsheet/Areas/Factsheet/Documents/Plans/Restoration%20Plan%20Anacostia%2020151228-combined.pdf

Tetra Tech. 2015c. *Restoration Plan for the Upper Patuxent River and Rocky Gorge Reservoir Watersheds in Prince George's County* prepared for the Prince George's County, Department of Environment, Stormwater Management Division. December 30, 2015. Retrieved from http://pgcdoe.net/pgcountyfactsheet/Areas/Factsheet/Documents/Plans/Restoration%20Plan%20Upper%20Patuxent%2020151228-combined.pdf

WA-DPW (Washington County, Division of Public Works). 2014. 2013 NPDES MS4 Annual Report. April 30, 2014. Retrieved from https://www.washco-md.net/wp-content/uploads/2018/03/swm_2013_NPDES_AnnualReport.pdf

WCSCD (Washington County Soil Conservation District), Board of County Commissioners of Washington County, Antietam Creek Watershed Alliance, Canaan Valley Institute, & MDE. 2012. *Antietam Creek Watershed Restoration Plan.* Retrieved from http://www.mde.state.md.us/programs/Water/319NonPointSource/Pages/AntietamCreekWRP.aspx

WSP. 2017. *Loch Raven West Small Watershed Action Plan* prepared for Baltimore County, Department of Environmental Protection and Sustainability. July 2017. Retrieved from https://www.baltimorecountymd.gov/Agencies/environment/watersheds/lrmain.html

USGS (United States Geological Survey). 2016. The USGS Water Science School: What is a watershed? Retrieved from http://water.usgs.gov/edu/watershed.html

URS. 2013. *Middle Great Seneca Creek Watershed Study* prepared for City of Gaithersburg. Retrieved from http://www.gaithersburgmd.gov/~/media/city/documents/services/environmental/middle_great_seneca_watershed_study.pdf

URS. 2014a. *Small Watershed Action Plan for Declaration Run and Riverside Watersheds* prepared for Harford County Department of Public Works. Retrieved from http://www.harfordcountymd.gov/ArchiveCenter/ViewFile/Item/332

URS. 2014b. *Muddy Branch Watershed Study* prepared for the City of Gaithersburg. Retrieved from http://www.gaithersburgmd.gov/~/media/city/documents/services/environmental/muddy_branch_watershed_study.pdf

URS. 2014c. *Lower Great Seneca Watershed Study* prepared for City of Gaithersburg. Retrieved from http://www.gaithersburgmd.gov/~/media/city/documents/services/environmental/Final_LGSCW_Study.pdf

URS. 2016. *Bynum Run Watershed Total Maximum Daily Load Restoration Plan for Sediment* prepared for Harford County, Department of Public Works. March 2016. Retrieved from https://www.harfordcountymd.gov/DocumentCenter/View/5845/Bynum-Run-TMDL-Restoration-Plan-2016-03-01?bidId=

Vaughn, C. 2012. The Scoop on Poop: Pet Waste a Major Polluter of MD Waterways, *Capital News Service*, 25 October 2012. Retrieved from http://cnsmaryland.org/2012/10/25/the-scoop-on-poop-pet-waste-a-major-polluter-of-md-waterways/

Versar. 2012. *Frederick County Stream Survey 2008-2011 Countywide Results* prepared for Frederick County, Community Development Division. October 2012. Retrieved from https://www.frederickcountymd.gov/DocumentCenter/View/291410/FCSS_200 8-2011-County-Wide-Results?bidId=

Versar. 2015a. *Little Patuxent River Watershed Assessment* prepared for Howard County, Department of Public Works. Retried from https://www.howardcountymd.gov/LinkClick.aspx?fileticket=nVCaaYAeEc4%3d&portalid=0

Versar. 2015b. *Middle Patuxent River Watershed Assessment* prepared for Howard County, Department of Public Works. Retrieved from https://www.howardcountymd.gov/LinkClick.aspx?fileticket=PO5dWmgWwWw%3d&portalid=0

Versar. 2017a. *Frederick County Stream Survey: 2013-2016 Four Year Report* prepared for Frederick County, Office of Sustainability and Environmental Resources. December 2017. Retrieved from https://www.frederickcountymd.gov/DocumentCenter/View/304884/FINAL-Frederick-County-Stream-Survey-2013-2016-Countywide-Results

Versar. 2017b. *Frederick County Stream Survey 2016 Countywide Results* prepared for Frederick County, Office of Sustainability and Environmental Resources. May 2017. Retrieved from https://www.frederickcountymd.gov/DocumentCenter/View/298120/FCSS-2016-Countywide-Stream-Survey-Results?bidId=

Versar, Biohabitats, Inc., Horsley Witten Group, Capuco Consulting Services, Chesapeake Stormwater Network, & RESOLVE. 2011a. *Upper Potomac Direct Pre-Assessment Report* prepared for Montgomery County, Department of Environmental Protection. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Upper-Potomac-Direct-Pre-Assessment-Report-11.pdf

Versar, Biohabitats, Inc., Horsley Witten Group, Capuco Consulting Services, Chesapeake Stormwater Network, & RESOLVE. 2011b. *Lower Potomac Direct Pre-Assessment Report* prepared for Montgomery County, Department of Environmental Protection. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Lower-Potomac-Direct-Pre-Assessment-Report-11.pdf

Versar, Biohabitats, Inc., Horsley Witten Group, Capuco Consulting Services, Chesapeake Stormwater Network, & RESOLVE. 2011c. *Dry Seneca Creek & Little Seneca Creek Pre-Assessment Report* prepared for Montgomery County Department of Environmental Protection. May 2011. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Seneca%20Creek/Dry-Seneca-Creek-and-Little-Seneca-Creek-watershed-pre-assessment-report-11.pdf

Versar, Biohabitats, Inc., Horsley Witten Group, Capuco Consulting Services, Chesapeake Stormwater Network, & RESOLVE. 2012a. *Cabin John Creek Implementation Plan* prepared for Montgomery County, Department of Environmental Protection. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/Cabin-John-Creek-implementation-Plan-12.pdf

Versar, Biohabitats, Inc., Horsley Witten Group, Capuco Consulting Services, Chesapeake Stormwater Network, & RESOLVE. 2012b. *Patuxent Watershed Implementation Plan (including Pre-Assessment)* prepared for Montgomery County, Department of Environmental Protection. Retrieved from https://www.montgomerycountymd.gov/DEP/Resources/Files/ReportsandPublications/Water/Watershed%20studies/PatuxentWIP_FINAL.pdf

Versar, Coastal Resources, & McCormick Taylor. 2012. *Lower Patapsco River Small Watershed Action Plan*. Final Report. Vols. 1 and 2 prepared for the Baltimore County, Department of Environmental Protection and Sustainability. Retrieved from http://resources.baltimorecountymd.gov/Documents/Environment/Watersheds/lowerpatapscoswapvol1opt.pdf

Versar, Coastal Resources, & McCormick Taylor. 2014. *Bird River Small Watershed Action Plan*. Vols. 1 and 2 prepared for the Baltimore County, Department of Environmental Protection and Sustainability. Retrieved from http://www.baltimorecountymd.gov/Agencies/environment/watersheds/birdmain.html

Versar, Coastal Resources, & McCormick Taylor. 2016. *Lower Gunpowder Falls (Urban) Small Watershed Action Plan*. Vols. 1 and 2 prepared for Baltimore County Department of Environmental Protection and Sustainability. Retrieved from https://www.baltimorecountymd.gov/Agencies/environment/watersheds/lowergpmain.html